

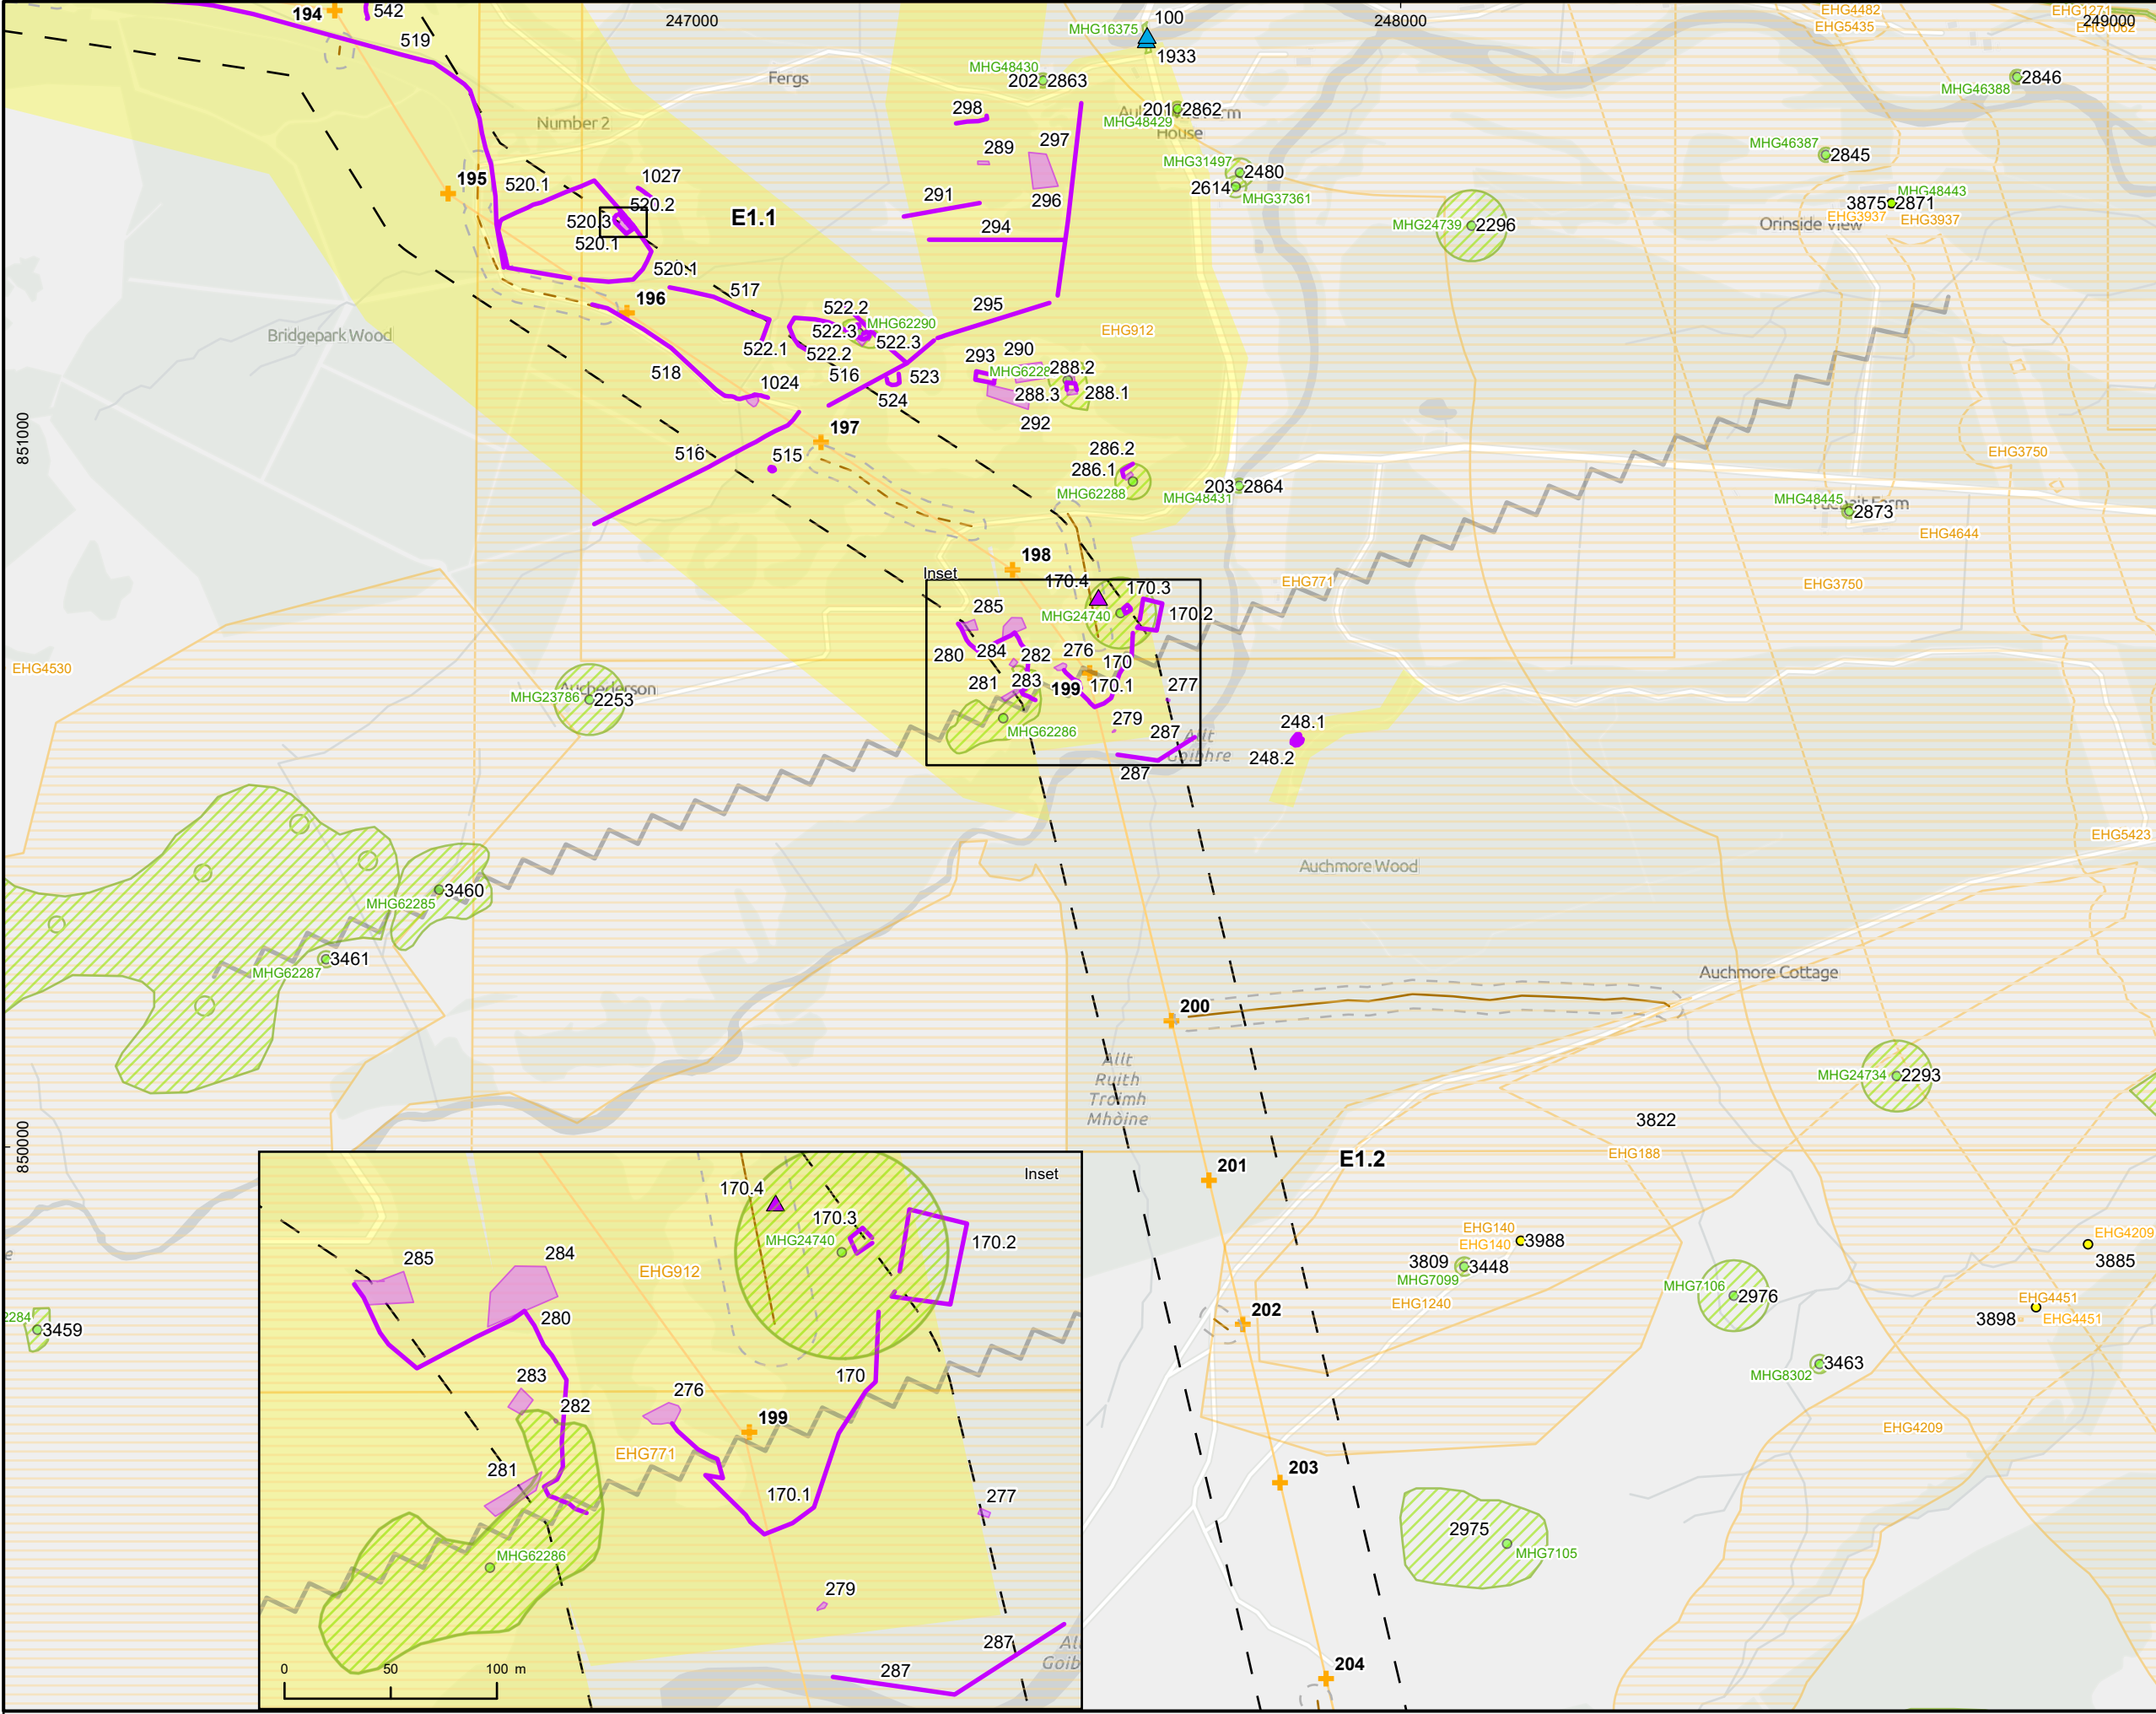


Figure3.99

Proposed Alignment with Walkover Survey Corridors and Heritage Assets

Legend

Listed Building - Category B

Walkover Survey Asset - Point

Walkover Survey Asset - Line

Walkover Survey Asset - Polygon

HER Monument - Point

HER Event - Point

HER Asset - Polygon

HER Event - Polygon

Section Division

- 200m-wide Alignment Survey Corridor

- 40m-wide Access Track Survey Corridor

South Tower Location

Proposed Temporary Access Track - South

Proposed Permanent Access Track - South

South 2C Alignment (centre line)

Walkover Survey Extent

FOR

ERM
6th Floor
102 West Port
Edinburgh
EH3 9DN

Drawn/checked:

SW/SO

DWG no:

01/27571/WO/2/01

AOC Project No.:

27571

AOC Archaeology Group

SYSTEM

Coordinate System: British National Grid
Projection: Transverse Mercator
Datum: OSGB 1936

SCALE

1:9,000 @ A3

SCALE

0 100 200 300 400 m

© Contains OS Open Data and Crown Copyright and Database Rights 2024

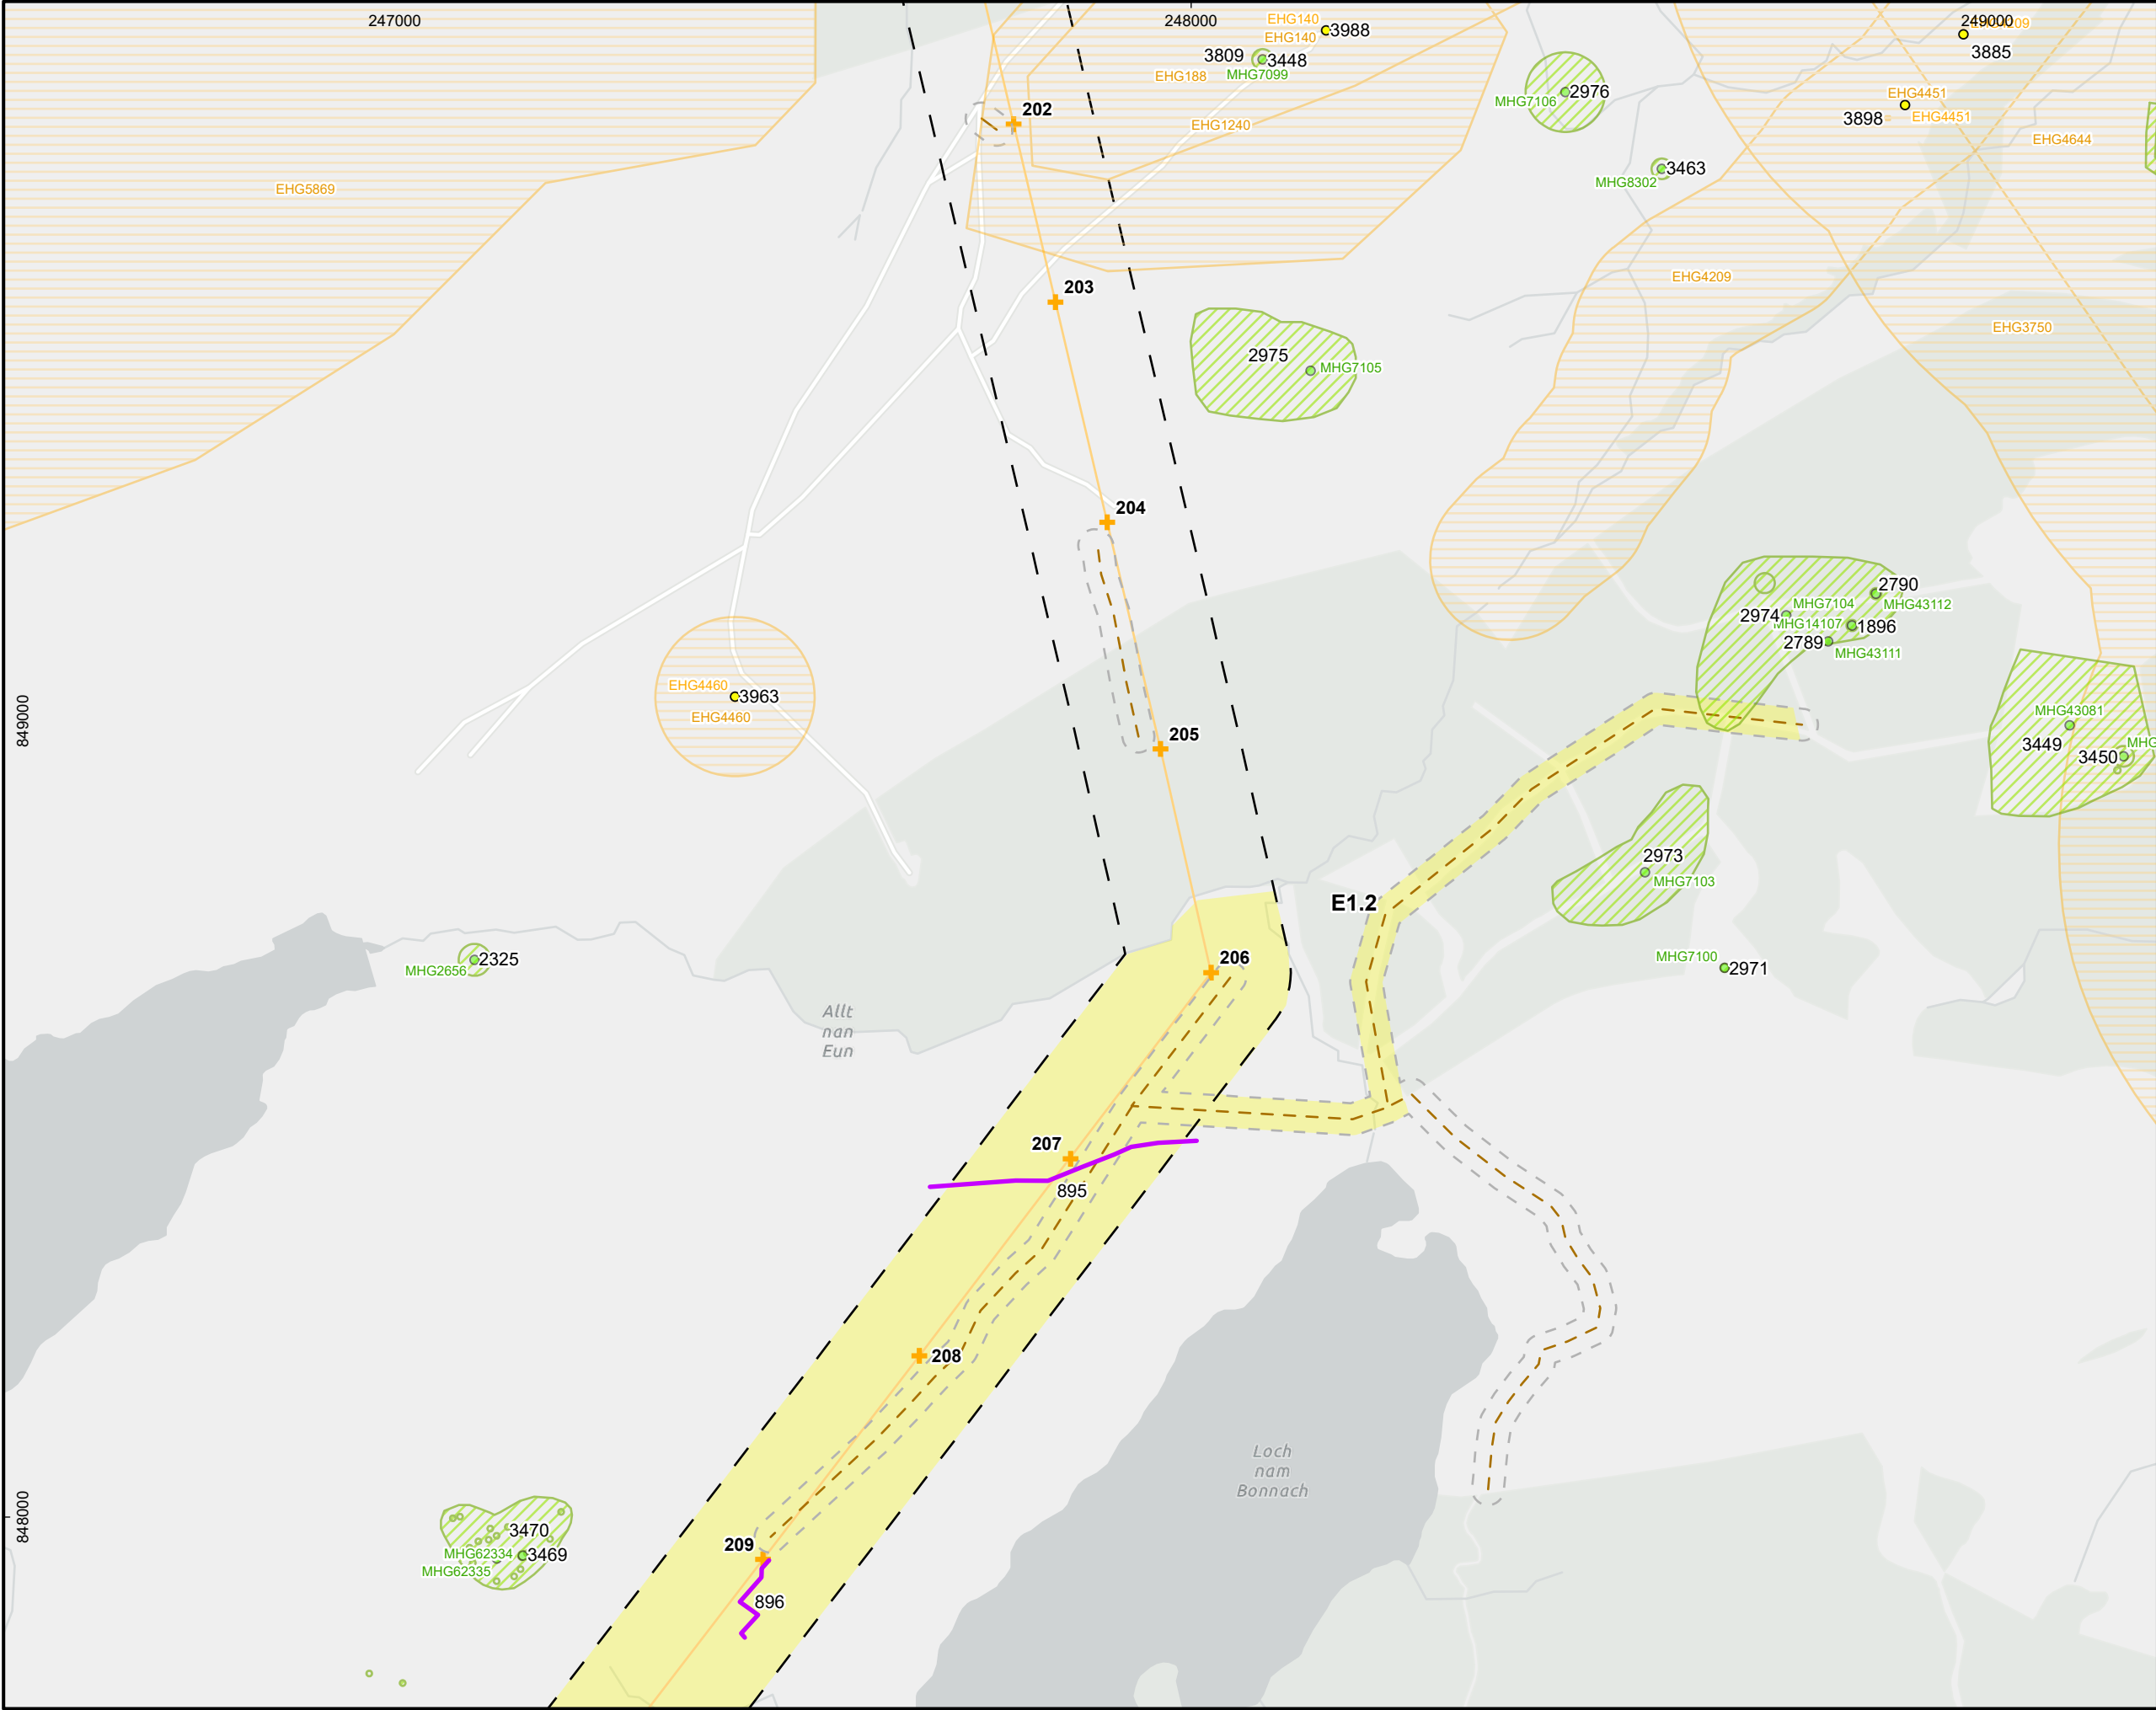


Figure3.100

Proposed Alignment with Walkover Survey Corridors and Heritage Assets

Legend

Walkover Survey Asset - Line

HER Monument - Point

HER Event - Point

HER Asset - Polygon

HER Event - Polygon

- 200m-wide Alignment Survey Corridor

- 40m-wide Access Track Survey Corridor

South Tower Location

Proposed Temporary Access Track - South

Proposed Permanent Access Track - South

South 2C Alignment (centre line)

Walkover Survey Extent

FOR

ERM
6th Floor
102 West Port
Edinburgh
EH3 9DN

Drawn/checked:

SW/SO

DWG no:

01/27571/WO/2/01

AOC Project No.:

27571

SYSTEM


Coordinate System: British National Grid
Projection: Transverse Mercator
Datum: OSGB 1936

SCALE


1:8,000 @ A3

SCALE

© Contains OS Open Data and Crown Copyright and Database Rights 2024



Proposed Alignment with Walkover Survey Corridors and Heritage Assets

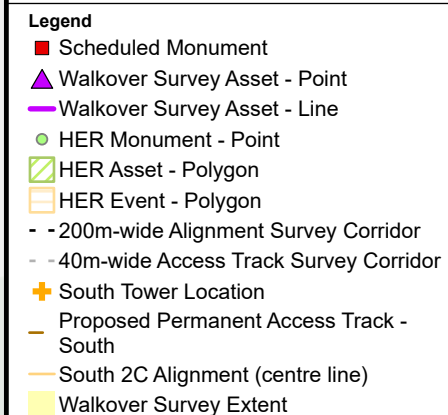

FOR
ERM
6th Floor
102 West Port
Edinburgh
EH3 9DN

Drawn/checked:	SW/SO

DWG no:	01/27571/WO/2/01


AOC Project No.:	27571




SYSTEM

Coordinate System: British National Grid
Projection: Transverse Mercator
Datum: OSGB 1936

SCALE 1:9,000 @ A3



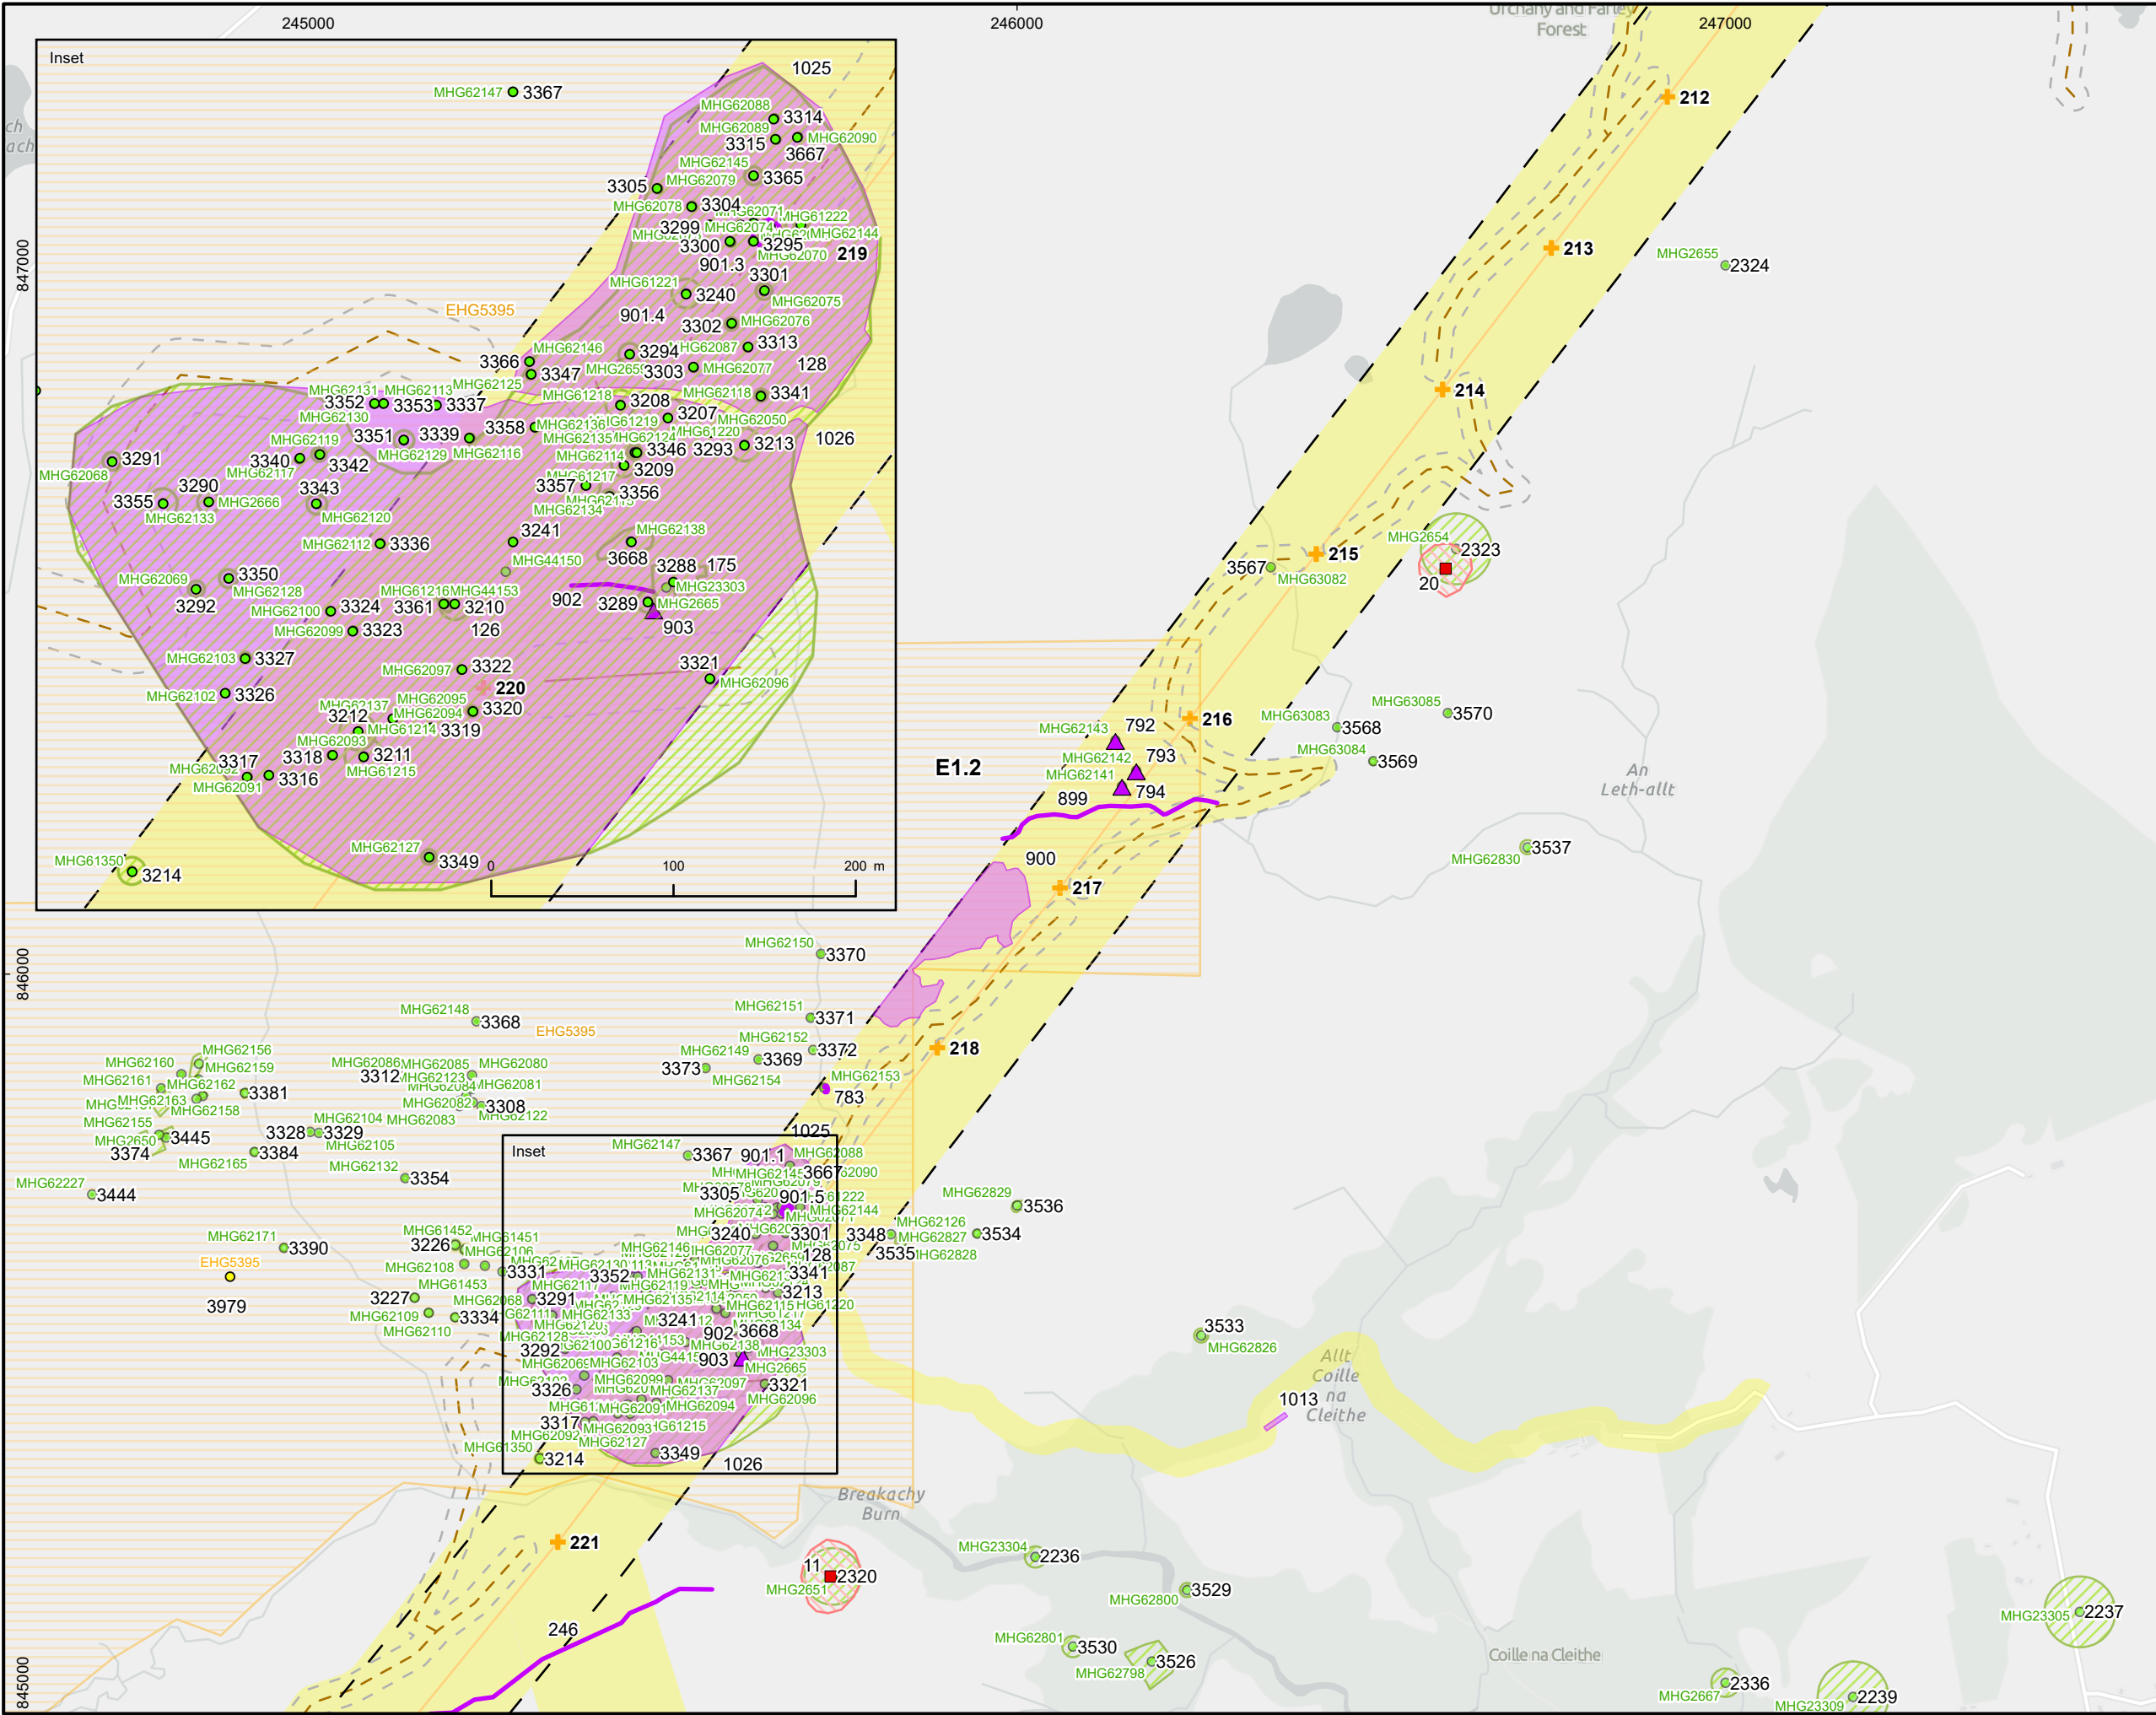

Figure

3.102

Proposed Alignment with Walkover Survey Corridors and Heritage Assets

Legend

Scheduled Monument

Walkover Survey Asset - Point

Walkover Survey Asset - Line

Walkover Survey Asset - Polygon

HER Monument - Point

HER Event - Point

HER Asset - Polygon

HER Event - Polygon

- -200m-wide Alignment Survey Corridor

- -40m-wide Access Track Survey Corridor

South Tower Location

Proposed Temporary Access Track - South

Proposed Permanent Access Track - South

South 2C Alignment (centre line)

Walkover Survey Extent

FOR
ERM
6th Floor
102 West Port
Edinburgh
EH3 9DN

Drawn/checked:

SW/SO

DWG no:

01/27571/WO/2/01

AOC Project No.:

27571

SYSTEM

Coordinate System: British National Grid
Projection: Transverse Mercator
Datum: OSGB 1936

SCALE

1:9,000 @ A3

SCALE


0

100

200

300

400 m

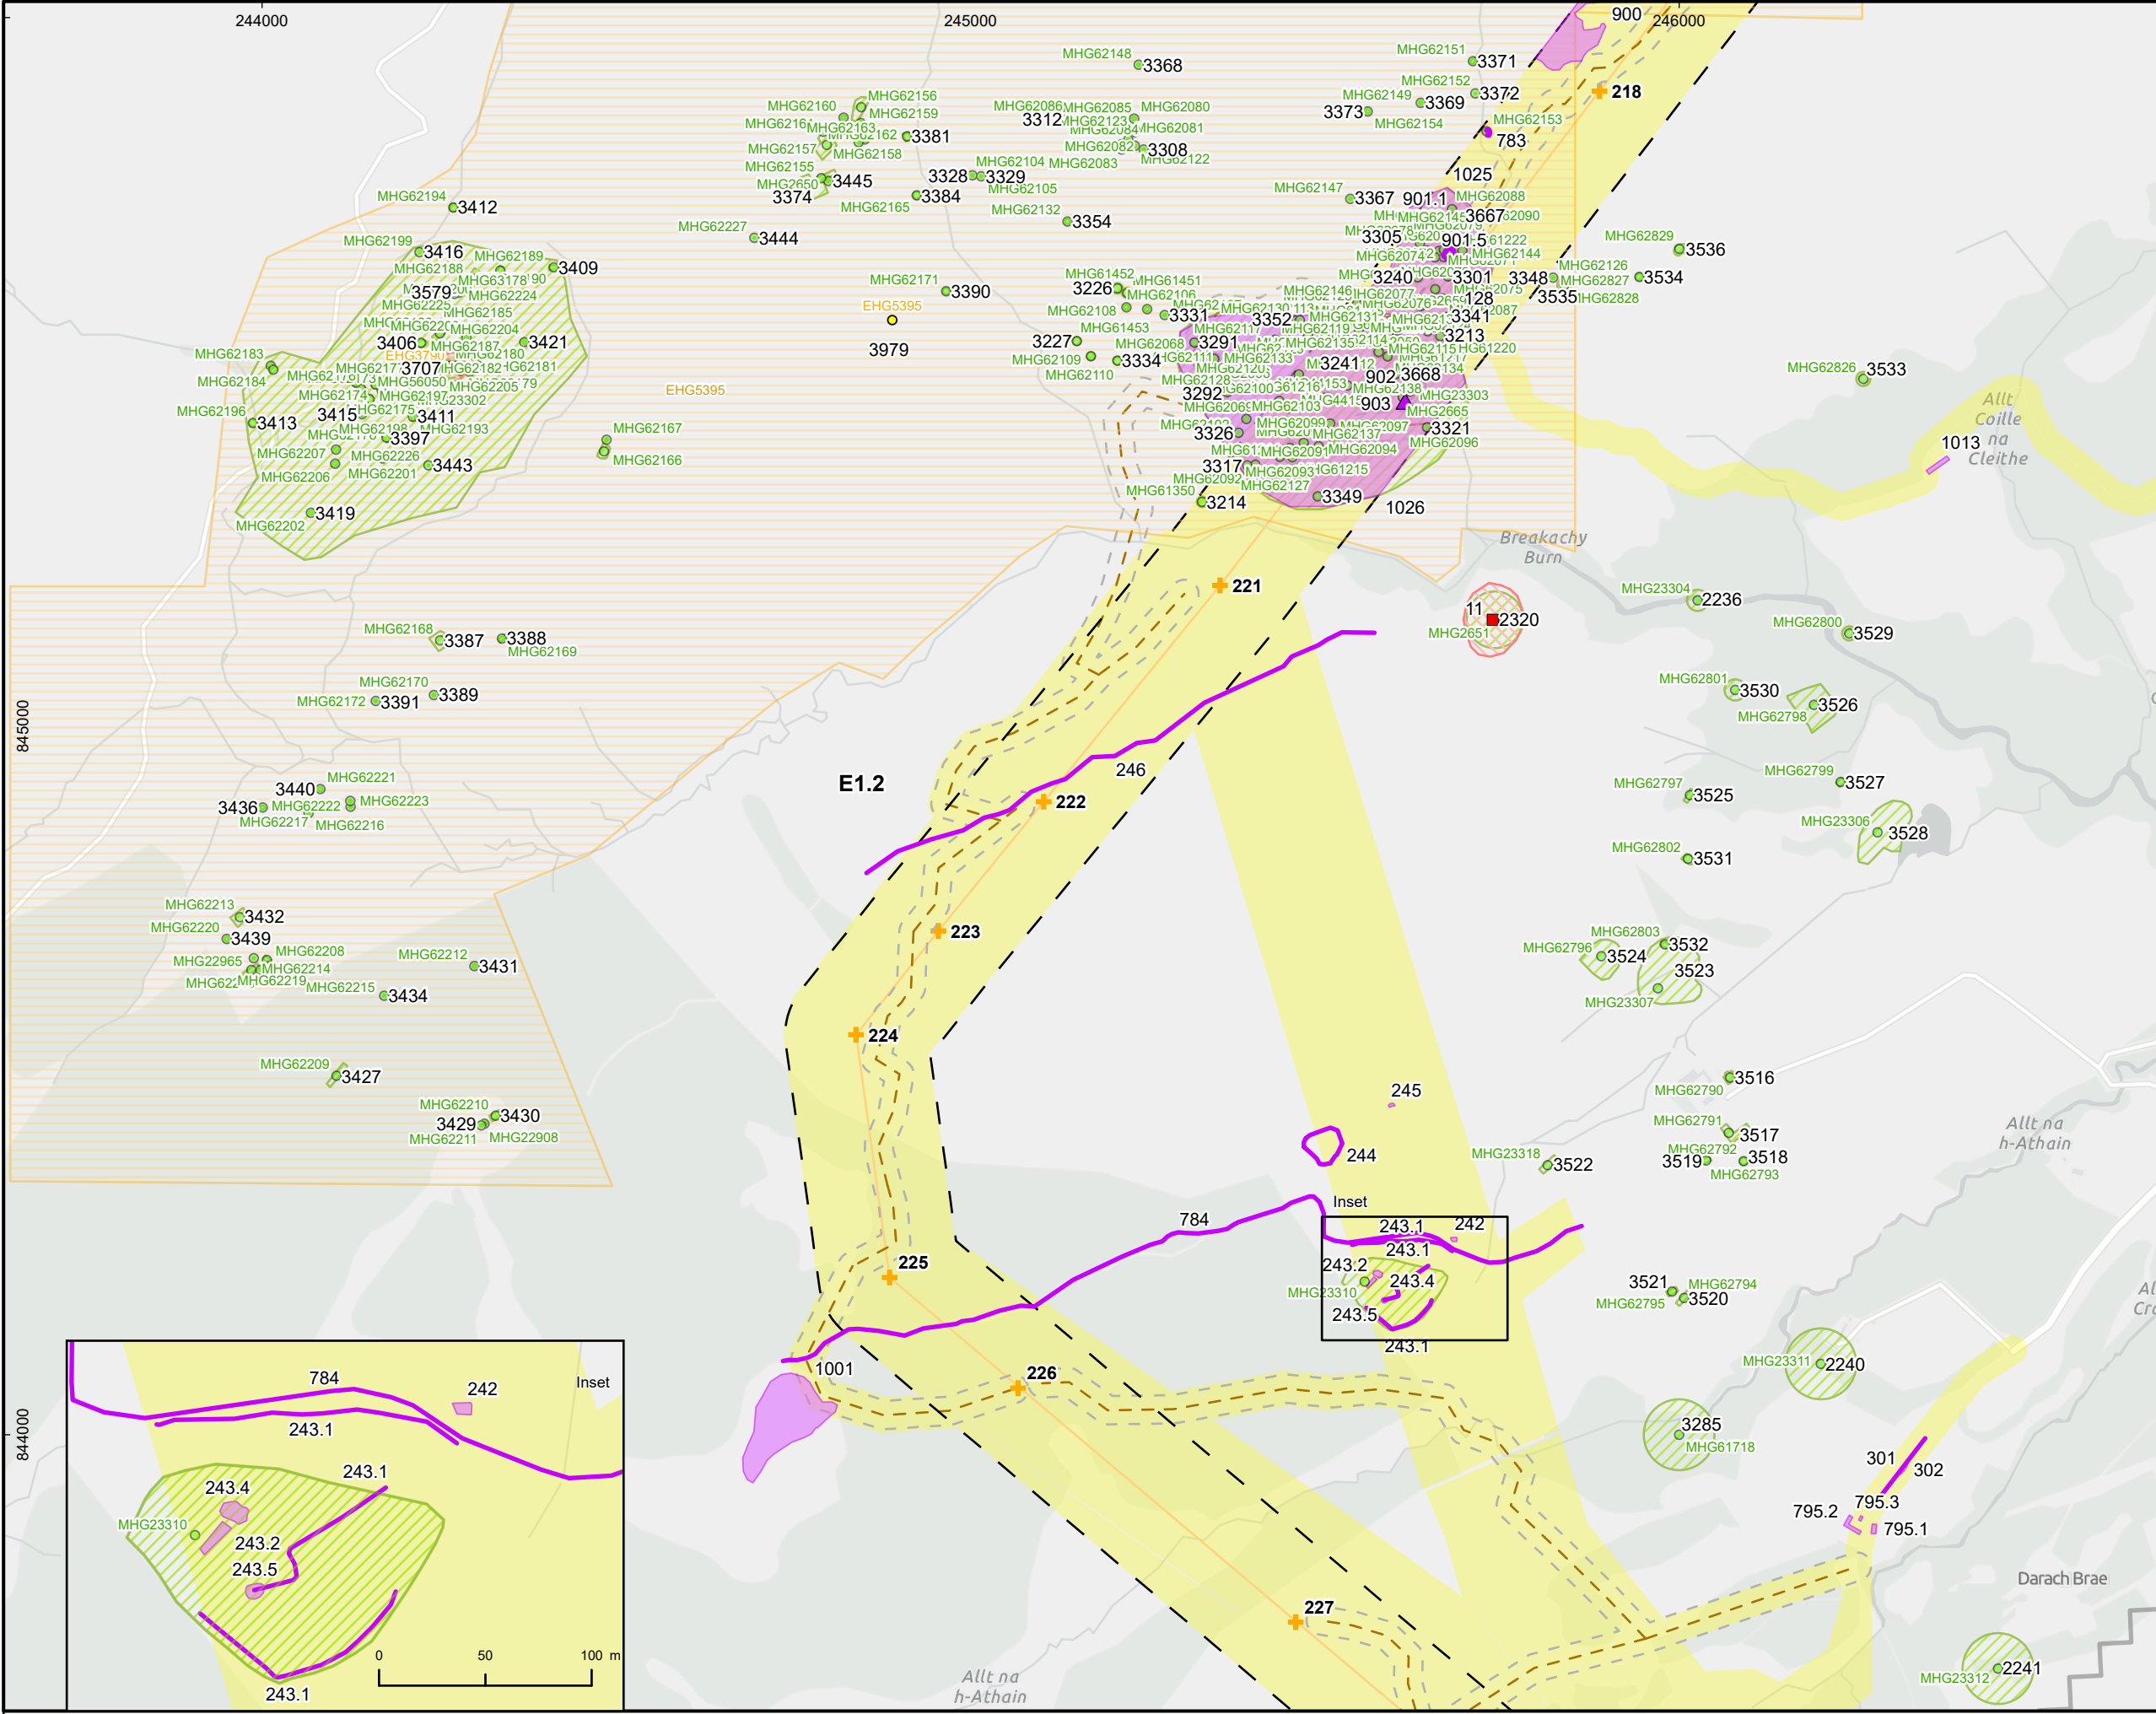

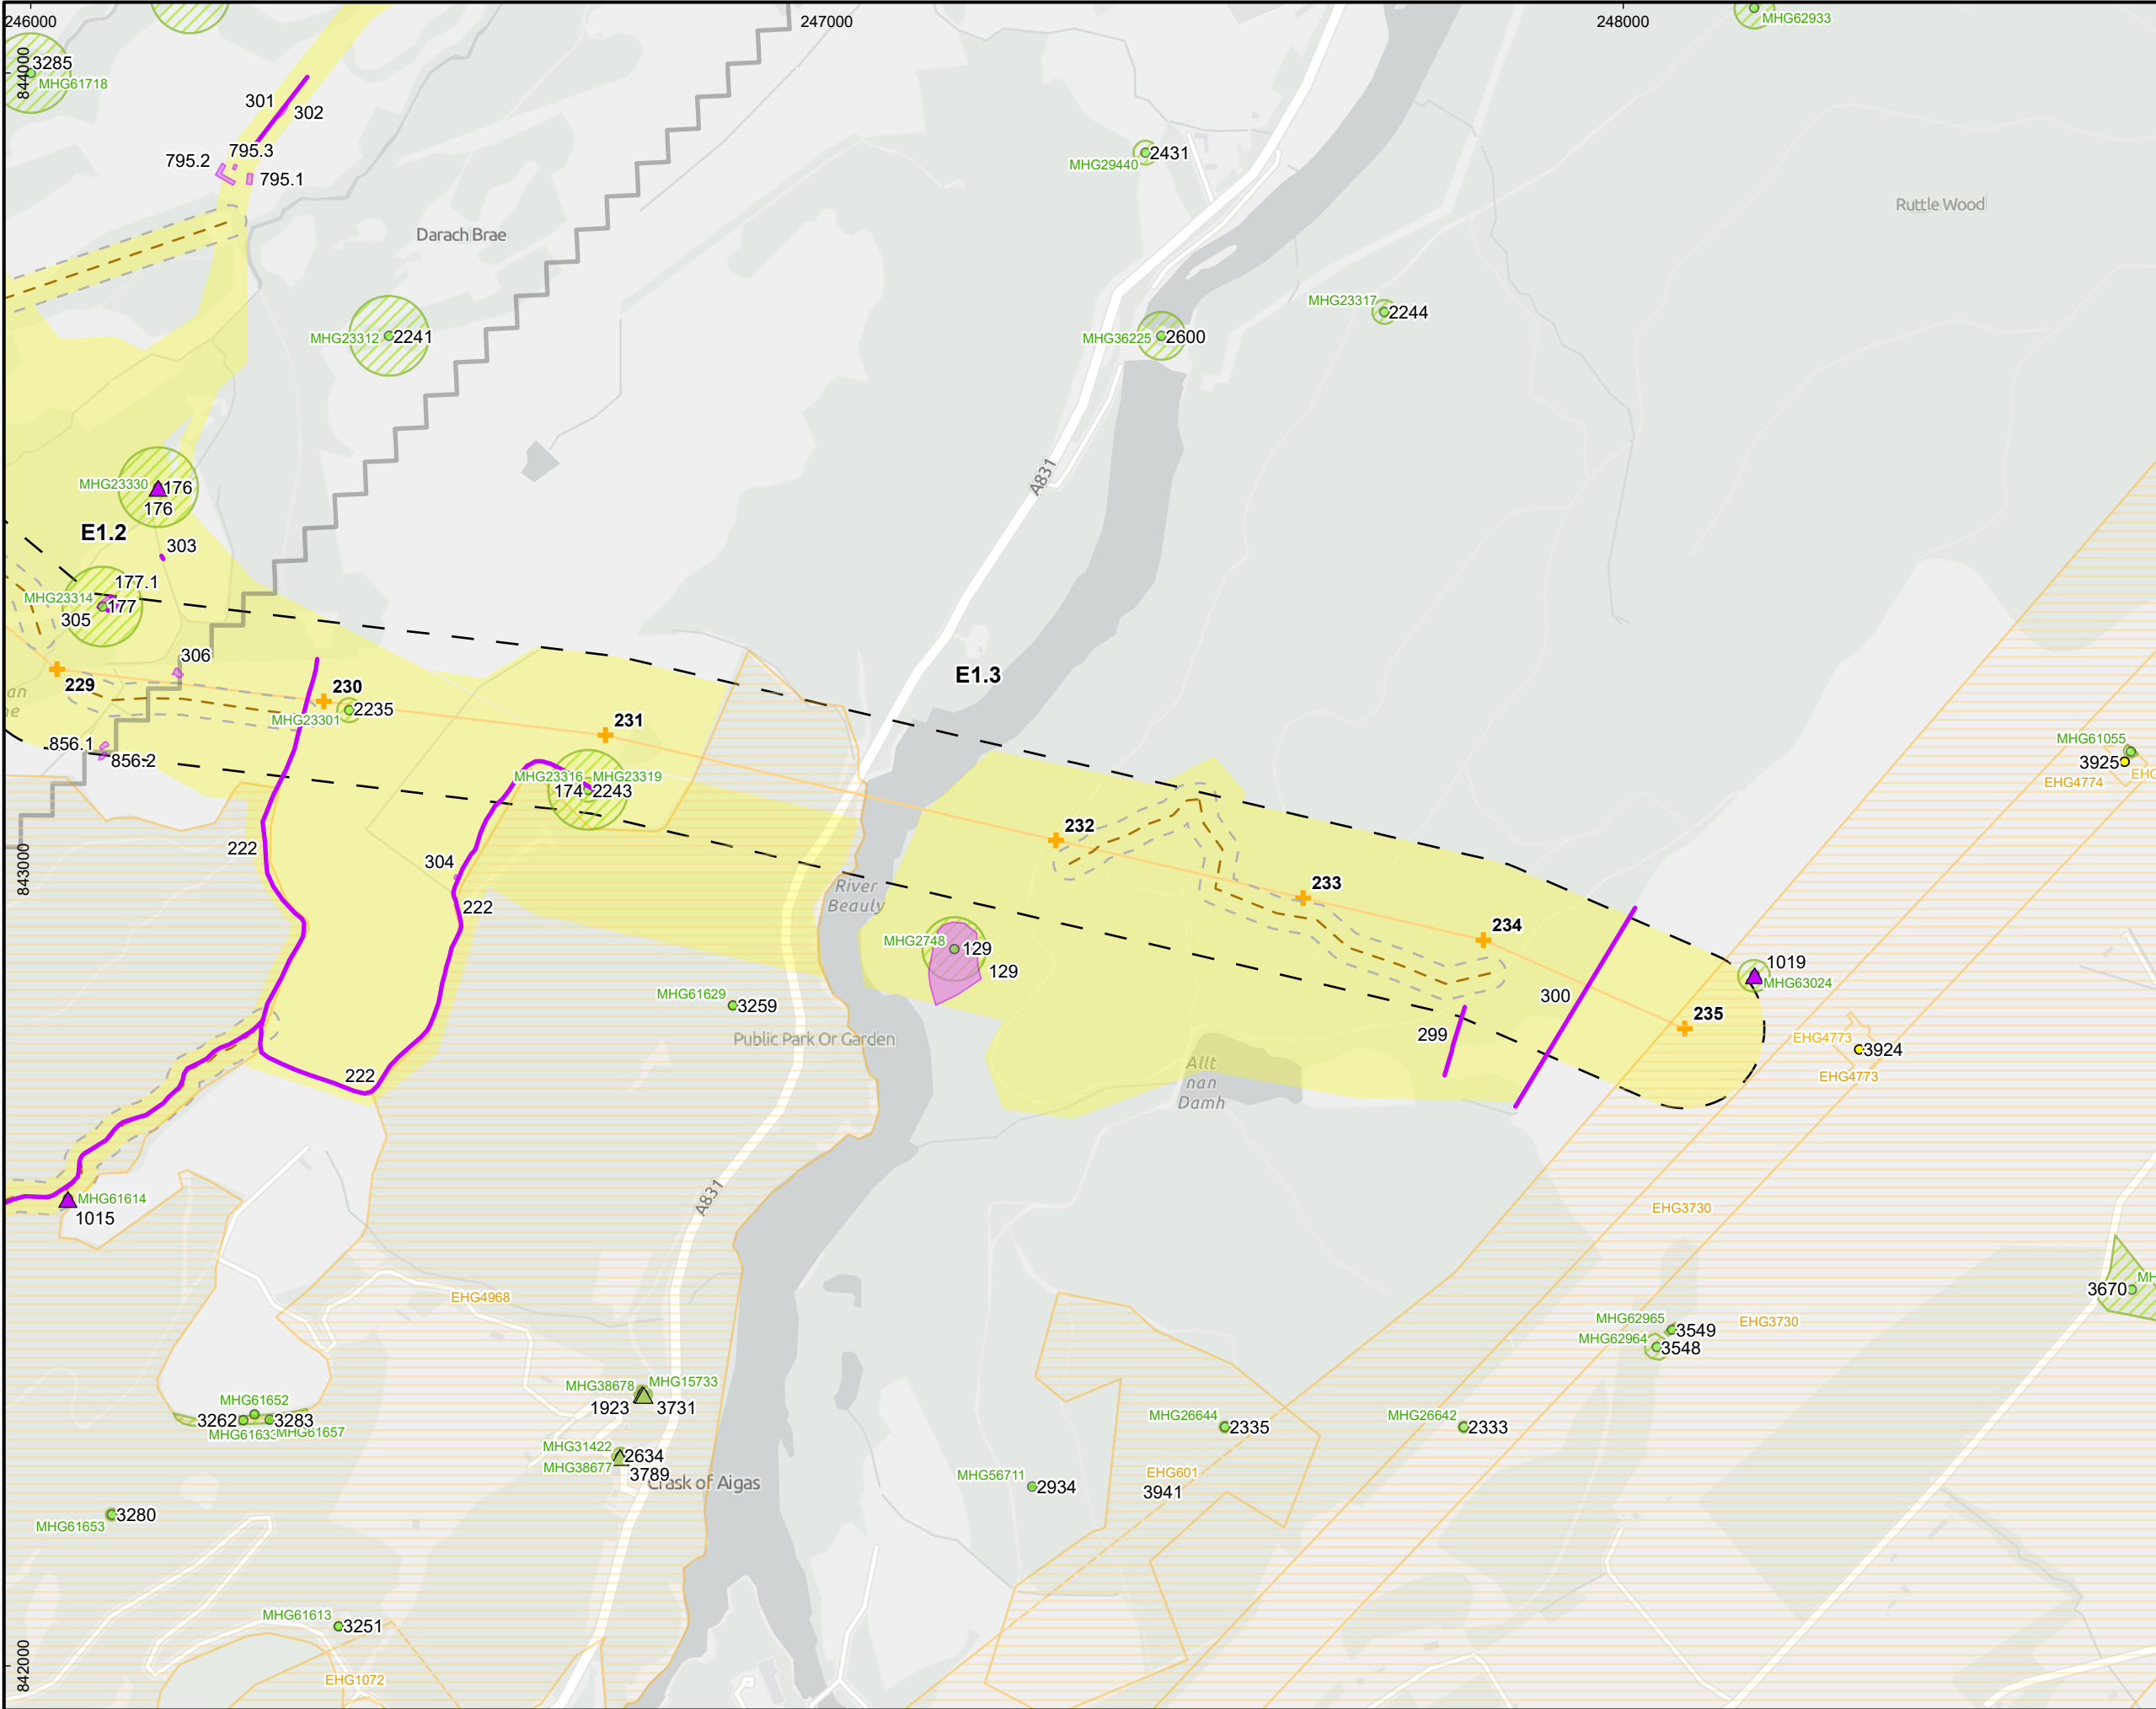


Figure		3.105	
Proposed Alignment with Walkover Survey Corridors and Heritage Assets			
Legend - Listed Building - Category C - Walkover Survey Asset - Point - Walkover Survey Asset - Line - Walkover Survey Asset - Polygon - HER Monument - Point - HER Event - Point - HER Asset - Polygon - HER Event - Polygon - Section Division - 200m-wide Alignment Survey Corridor - 40m-wide Access Track Survey Corridor - South Tower Location - Proposed Permanent Access Track - South - South 2C Alignment (centre line) - Walkover Survey Extent			
FOR ERM 6th Floor 102 West Port Edinburgh EH3 9DN			
Drawn/checked:		SW/SO	
DWG no:		01/27571/WO/2/01	
AOC Project No.:		27571	
SYSTEM Coordinate System: British National Grid Projection: Transverse Mercator Datum: OSGB 1936			
SCALE 1:8,000 @ A3			

Beauly to Loch Buidhe to Spittal 400Kv Overhead Line, Highland: Walkover Survey and Setting Sensitivity Assessment Appendix 1: Heritage Asset and Event Gazetteer

AOC Project Number: 27571

June 2025



Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	1
Asset/Event Name	Buolacrabher, settlement 1170m S of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM6014; ND13SE 43
HER Number	MHG1169; MHG1169
Status	Scheduled Monument
Section:	N/A
Easting	315467
Northing	933512
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM6014 The monument consists of a prehistoric settlement of 2 hut circles and associated traces of cultivation. The SW hut measures about 5.5m in diameter with a wall 0.2m high and spread to about 2m. The entrance is to the SSE. The E hut measures 7m in diameter with a wall 0.3m high and 2 to 2.5m wide. This hut incorporates a large quantity of stone in its construction and several stones may indicate radial partitions of the interior. The entrance to this hut appears to be to the NW. There are 2 clearance cairns immediately to the N of the huts and the area around the cairns and between the cairns is flat and appears to have been cultivated. The area to be scheduled measures 85m E-W by 80m N-S, to include the hut circles and cairns and an area around in which traces of activities associated with these structures may survive. The edge of the scheduled area to the N is defined by an old area of peat cutting. To the E an old track which ascends the hill slope is excluded from the scheduled area. To the S the scheduled area extends 20m beyond the hut circles, while to the W the edge of the area is marked by the steep slope 10m W of the W hut circle. The area proposed for scheduling is shown in red on the attached map. Statement of National Importance The site is of national importance for its potential to contribute to an understanding of prehistoric settlement and agriculture. The hut circles incorporate important information about prehistoric round house construction and evidence for the domestic life of their inhabitants. The cairns and area of arable land constitute information on later prehistoric farming practices. References RCAHMS records the monument as ND 13 SE 43.
Asset/Event Number	2
Asset/Event Name	Minera, hut circles 330m SSE of, 370m ESE of and 270m E of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM6015; ND13SE 42

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	315760
Northing	934449
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM6015 The monument consists of a number of prehistoric hut circles on W- facing moorland. A group of 4 hut circles and associated clearance cairns are centred at ND157344, 2 further hut circles at ND158345 and a single hut circle at ND15813467. Three areas are to be scheduled: The S area measures 150m E-W by 170m SSE-NNW, the E area measures 95m SW-NE by 50m NW-SE and the N area 40m in diameter. These three areas cover the hut circles and associated clearance cairns and are shown in red on the attached map. Statement of National Importance This monument is of national importance for its potential contribution to our understanding of prehistoric settlement and land use. The hut circles incorporate information about the architecture of prehistoric buildings and also evidence for the domestic life of their occupants. The fields include evidence about the agricultural economy of the settlement. Parts of the settlement are heavily peat covered and in these areas the evidence will be particularly well preserved. References RCAHMS records the monument as ND 13 SE 20, 21 and 42.
Asset/Event Number	3
Asset/Event Name	Cnoc Fionn, hut circle 250m SSW of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM3537; ND12SW 8
HER Number	MHG1124; MHG1124
Status	Scheduled Monument
Section:	N/A
Easting	310444
Northing	923542
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3537 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8110/cnoc-fionn. This is the same description for Asset 4/SM3559. Asset 3 is hut circle A described below.

At ND 1053 2351 [Asset 4/SM3559] and ND 1044 2354 [Asset 3/SM3537], on a NE-facing slope above the Berriedale Water are the slight remains of two heather-clad oval enclosures or hut circles, scooped into the hillside on the W, and formed by earth and stone banks up to 1.3m high externally in the N. The entrances, 1.0m wide, are in the E. The huts measure 12.0 by 10.0m and 11.4 by 9.5m respectively.
Visited by OS (R L), 29 February 1968.

There is a further hut circle at ND 1013 2364, some 300 m to the W. It is similar to the others, measuring some 11.0 by 9.0m, and with an entrance in the E. There is a small field system in the vicinity, but field boundaries are not obvious, only evidenced by low stone clearance heaps.

Hut circles surveyed at 1:2500. Visited by OS (R L) 29 February 1968.
(A: ND 1053 2351 [Asset 4/SM3559]; B: ND 1044 2354 [Asset 3/SM3537]) Hut Circles (NR) (C: ND 1013 2364) Hut Circle (NR) OS 25" map, (1969)

A settlement of three hut circles (A-C) and an associated field system. The huts are set into the slope and are heather and peat covered. They measure: 'A' - 9.0 by 7.0m; 'B' - 10.5 by 7.5m; and 'C' - 9.0 by 7.5m, within wall-spreads ranging from 2.5 to 4.0m by 0.6 to 0.9m high. Entrances are in the E or SE, on the line of the main axis in each case. The minor field system is delineated by a scatter of stone clearance heaps.
Visited by OS (J M), 23 November 1982.

Three hut-circles, a platform and eleven small cairns were recorded during a pre-afforestation survey of Langwell-Rinsary Braes, Berriedale. The platform lies to the SE of the hut-circles noted previously. Bisected by a drystone dyke, the platform is semi-circular and measures 12m in diameter. There are no visible traces of the platform within the improved ground to the SW of the dyke. The small cairns are concentrated between the hut-circles at ND 1053 2351 and ND 1044 2354.

References
Carter, S. (1999h) 'Langwell-Rinsary Braes (Latheron parish), pre-afforestation survey',
Discovery Excav Scot, 1999. Page(s): 57

Asset/Event Number	4
Asset/Event Name	Cnoc Fionn, hut circle 250m SW of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM3559; ND12SW 8
HER Number	MHG1124
Status	Scheduled Monument
Section:	N/A
Easting	310534
Northing	923514
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3537 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8110/cnoc-fionn . This is the same description for Asset 3/SM3537. Asset 4 is hut circle B described therein.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	5
Asset/Event Name	Bridge of Rhemullen, broch 180m SW of
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM5088; ND13SE 11
HER Number	MHG1139; MHG31272
Status	Scheduled Monument
Section:	N/A
Easting	315329
Northing	930969
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5088 This monument consists of the remains of a broch and an associated prehistoric settlement. The broch survives as a turf-covered, level-topped mound, approximately 20m in diameter and 1.6m high. On the SE edge of the mound the upper part of the broch entrance and a stretch of the external face of the broch wall have been exposed. The broch mound rises out of an irregular, extensive mound, about 50m N-S by 40m E-W, enclosed by an early-modern field wall. On the surface of this outer mound are traces of a number of small circular stone-walled buildings. These structures indicate an extensive settlement which may have originated at the time when the broch was occupied but probably continued in occupation after the abandonment of the broch. The area to be scheduled measures 80m NW-SE by 80m SW-NE, to include the broch mound, the outer mound and an area around in which traces of activities associated with the construction and occupation of the broch and settlement may survive. The external settlement extends as far as the modern walled enclosure which surrounds the broch and the scheduled area extends outside this walled enclosure in order to protect associated structures which probably once extended into the improved pasture. The area to be scheduled is shown in red on the attached map. Statement of National Importance This monument is of national importance for its potential contribution to our understanding of prehistoric settlement and domestic life. The broch is well preserved and there is an extensive associated prehistoric settlement. The broch is an example of a high-status Iron Age dwelling and incorporates evidence for defensive architecture, the domestic organisation of its inhabitants and their farming practices. With the exception of the excavation of the entrance passageway, it appears that the broch has not been investigated in recent times and this suggests that the wall structure, internal organisation and chronological sequence of development on this site will be particularly well preserved. The association of the broch with an extensive settlement of possible contemporary and later date is also important. Brochs in Caithness and Orkney are often associated with settlements of this type, but this example appears to be particularly well preserved. References RCAHMS records the monument as ND 13 SE 11.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	6
Asset/Event Name	Buolacrabher, chambered cairn 1350m SSW of
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5224; ND13SE 25
HER Number	MHG1152
Status	Scheduled Monument
Section:	N/A
Easting	315019
Northing	933370
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5224 The monument consists of the remains of a chambered cairn of Neolithic/Bronze Age date. The cairn is about 14.6m in diameter; a number of slabs of stone protrude through the turf in the approximate centre of the cairn and indicate the existence of a chamber. The cairn is crossed by a modern sheep shelter. The 2 longest slabs on the S of the shelter are 0.3m above the present ground level, while the 2 at right angles to the shelter and the slab to the N of them are 0.6m high. There is evidence for thick peat growth in the area around this chambered cairn and it is probable that much of the cairn and chamber remain in situ. The area to be scheduled measures 45m in diameter, to include the chambered cairn and an area around it in which traces of activities associated with its construction and use may survive, as shown in red on the attached map. Statement of National Importance The monument is of national importance for its potential contribution to an understanding of prehistoric ritual and burial practices. The monument also contains important information about the structure of Neolithic/Bronze Age tombs. References RCAHMS records the monument as ND 13 SE 25.
Asset/Event Number	7
Asset/Event Name	Invershin Primary School, settlement 760m NE of and 750m ENE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5462; NH59NE 13
HER Number	MHG9297; MHG12902
Status	Scheduled Monument
Section:	N/A
Easting	258055
Northing	898148
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5462 This monument consists of the remains of the foundations of several round houses and also traces of associated field systems in two forestry clearings on a W-facing hill slope. The NW clearing contains the remains of 2 stone-walled houses and an associated field system. One house is visible as an oval platform measuring about 15m by 12m bounded by the ill-defined traces of a stone wall. The foundations of the second house are about 12.5m in diameter between the centres of a wall spread to roughly 3m. The entrance is in the S. In close proximity are a number of cairns and lynchets indicating an area of former cultivation. The SE clearing contains a single house, which is set into the slope and measures 12m in diameter. The wall is 2.5m wide at the rear and splays to 3.5m to either side of the entrance, which is to the SSW. In this area there are traces of former cultivation, indicated by several clearance cairns. Two areas are to be scheduled: the NW area measures 155m N-S by 75m E-W, the SE area is 110m NNE-SSW by 75m WNW-ESE, to include the hut circles, field systems and an area around in which traces of activities associated with the building and use of the huts will survive, as shown in red on the attached map. Statement of National Importance The monument is of national importance for its potential to contribute to an understanding of prehistoric agricultural organisation and domestic life. References RCAHMS records the monument as NH 59 NE 9 and 13.
Asset/Event Number	8
Asset/Event Name	Invershin Farm, settlement and burnt mound 1200m E of
Type of Asset/Event	Prehistoric settlement; burnt mound
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5470
HER Number	MHG32590; MHG32590; MHG12917
Status	Scheduled Monument
Section:	N/A
Easting	258641
Northing	896626
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5470 This monument consists of a hut circle and a burnt mound situated in 2 forestry clearings on a SW-facing hill slope. The hut circle is situated on a low rise and is a circular heather-covered platform about 13m in diameter. There are traces of a wall defining the edge of the hut circle around the edge of the platform. The position of the entrance is not clear. The burnt mound is about 150m to the SE on the N bank of a small burn. It is roughly oval in ground plan, about 12m E-W by 7m and about 1m high. The mound is almost divided in half along its shorter axis by a depression 1.5m wide, that opens out into the burn. It is recorded that in 1976 some animal scrapes revealed black earth and burnt stone. Two areas are to be scheduled: The NW area is 80m NW-SE by 60m NE-SW, the SE area is 40m NW-SE by 50m WSW-ENE, to include the hut circle, burnt mound and areas around in which traces of

activities associated with the construction and use of these monuments may survive, as shown in red on the attached map.

Statement of National Importance

The monument is of national importance for its potential contribution to our understanding of prehistoric domestic life and land use. The burnt mound is a well preserved example and will contain important information on the uses to which these enigmatic monuments were put by our prehistory ancestors.

References

RCAHMS records the monument as NH 59 NE 11 and 23.

Asset/Event Number	9
Asset/Event Name	Invershin Farm, settlement and burnt mound 500m E of
Type of Asset/Event	Prehistoric settlement; burnt mound; cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5497; NH59NE 19; NH59NE 12; NH59NE 22
HER Number	MHG12916; MHG12912; MHG9298
Status	Scheduled Monument
Section:	N/A
Easting	257881
Northing	896619
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5497 This monument consists of a hut circle, a burnt mound and a cairn on a W-facing hill slope. The hut circle survives as an ill-defined platform about 10m in diameter, with traces of walling on the E, S and W. There are several stone clearance cairns in the area around the hut which indicate the location of prehistoric cultivation. About 70m NE of the hut is a cairn, measuring 6m in diameter and 0.6m high. It is edged with a kerb of stones. To the SW is a 'horn'-like projection about 4m long, of uncertain origin. About 180m NNW of the cairn is a burnt mound. It is about 13m diameter and 1m high and the crescent-shaped E side faces onto wettish ground. Records indicate that animal burrows in this burnt mound have revealed blackened earth and burnt stone. Two areas, about 140m apart, are to be scheduled. The S area measures 125m SSW-NNE by 85m NNW-SSE and the N area 60m N-S by 40m E-W, to include the hut circle, cairn, burnt mound and areas around in which traces of activities associated with the construction and use of the monuments may survive, as shown in red on the attached map. Statement of National Importance The monument is of national importance for its potential to contribute to an understanding of prehistoric burial practices, domestic life and land use. The cairn is likely to be a small prehistoric burial monument, while the burnt mound will contain important information about the uses to which prehistoric communities put these enigmatic structures. References RCAHMS records the monument as NH 59 NE 12, 19 and 22.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	10
Asset/Event Name	Invershin Primary School, settlement 600m E of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5498; NH59NE 10; NH59NE 41; NH59NE 11
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	258215
Northing	897353
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5498 This monument consists of an extensive area of prehistoric settlement on a W-facing hillslope to either side of a E-W running burn. There are remains of 3 hut circles to the N of the Allt na Ciste Duibhe. Associated with the hut circles are lynchets, field walls and clearance heaps which indicate the location of prehistoric cultivation. To the S of the burn are traces of three hut circles associated with field walls and clearance cairns. The area to be scheduled measures a maximum of 1030m NNW-SSE by a maximum of 555m WSW-ENE, to include the hut circles and traces of cultivation, as shown in red on the attached map. Statement of National Importance This monument is of national importance for its potential contribution to an understanding of prehistoric domestic organisation, settlement patterns and land use. References RCAHMS records the monument as NH 59 NE 10 and 11.
Asset/Event Number	11
Asset/Event Name	Dun Mor, fort
Type of Asset/Event	Fort
Date and/or Period	Iron Age
Listing No./NRHE Number	SM4979; NH44NE 8
HER Number	MHG2651
Status	Scheduled Monument
Section:	N/A
Easting	245737
Northing	845150
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Description	https://portal.historicenvironment.scot/designation/SM4979 The monument known as Dun Mor is a sub-oval fort of the Iron Age measuring c 22m NNE-SSW by 16m within a tumbled wall between 4.5m and 6.0m wide with outer and inner faces sporadically visible around most of the perimeter. The entrance is in the south east. Within the north side of the interior is a natural platform. Below the fort on the south and east are the remains of two further outer walls. The area to be scheduled measures 100m N-S by 80m E-W to include the fort and the outer defences, and an area around them in which traces of activity associated with their construction and use will survive, as marked in red on the attached map. Statement of National Importance The monument is of national importance as a well preserved example of a prehistoric fort; it is of particular interest because of the existence of additional outer defences on the most accessible sides. It has the potential to enhance considerably our understanding of prehistoric settlement and defensive structures. References RCAHMS records the monument as NH 44 NE 8.
Asset/Event Number	12
Asset/Event Name	Dun Fhamhair, fort
Type of Asset/Event	Fort
Date and/or Period	Iron Age
Listing No./NRHE Number	SM5212; NH44NE 7
HER Number	MHG2652
Status	Scheduled Monument
Section:	N/A
Easting	248416
Northing	847068
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5212 The monument comprises the remains of an oval fort of the Iron Age, measuring 43m N-S by 35m within a wall up to 3.5m across with outer facing stones visible for most of the perimeter. Outside the fort to the north east there is a 55m long rampart and ditch with an entrance through its centre. The area to be scheduled measures 100m in diameter to include the fort and the rampart, and an area around them in which traces of activities associated with their use will survive, as marked in red on the attached map. Statement of National Importance The monument is of national importance as a well preserved example of a stone walled Iron Age fortification; it is of particular interest because of the existence of an outer defence work. The monument has the potential to enhance considerably our understanding of prehistoric defensive structures and settlement activity. References RCAHMS records the monument as NH 44 NE 7.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	13
Asset/Event Name	Achorn Bridge, settlements 1100m NNE of
Type of Asset/Event	Prehistoric settlement; post-medieval settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5150; Various
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	313581
Northing	931464
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5150 This monument consists of areas of prehistoric settlement and a post medieval settlement situated to either side of the Allt Clais Raoin [NRHE: ND13SW 36-ND13SW 40]. The prehistoric features include a cairnfield of at least four cairns at about ND13453149. The largest of these cairns is about 4 by 3m and about 1m high. At ND13353147 is an irregular stone-built structure, possibly a hut circle. At ND13443150 is a well preserved hut circle about 8m in diameter and with an entrance which is on the SE. The wall of this hut is up to 1.7m wide and 0.5m high, with evidence of stone facing on both inner and outer wall faces. The post medieval settlement includes 3 clusters of buildings. At ND13853143 are 3 buildings on either side of a burn. These include a kiln barn and 2 rectangular buildings. At ND13693155 are 2 very well preserved buildings - a long house and a kiln barn. At ND13453143 is a small ruinous rectangular house attached to an oval enclosure. The foundations of a further rectangular building survive at ND13413144 and there are a number of stone dykes in the area between the 3 settlement clusters. The area to be scheduled measures 470m WSW-ENE by a maximum of 250m N-S, to include the prehistoric and post medieval features, as shown in red on the attached map. Statement of National Importance The monument is of national importance for its potential to contribute to an understanding of prehistoric and post medieval settlement and land use. The hut circles and clearance cairns incorporate important information on the way of life and agricultural economy of a prehistoric community. The post medieval settlements contain evidence for the domestic organisation and farming practices of a community and also important information on the process of the Clearances in this area of Caithness. The buildings in the NE cluster are particularly well preserved and important architectural details survive.
Asset/Event Number	14
Asset/Event Name	Loedebest, chambered cairn 400m WNW of
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5163; ND13SW 9
HER Number	MHG1267

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Scheduled Monument
Section:	N/A
Easting	313389
Northing	932300
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5163 This monument consists of a chambered cairn which is cut by the Loedebest-Achnaclyth road. The cairn appears to have been about 13m in diameter, although to the S it has been cut into by the roadside ditch. This roadside ditch has exposed stone and it is evident that the cairn survives to a height of 0.5m at this point. In the centre the remains of five pointed slabs, about 0.7m high, indicate the location of the chamber. The plan of the chamber is difficult to interpret, but it was evidently divided by transverse slabs. There is no obvious entrance passageway. The area to be scheduled measures 43m E-W by 26m N-S, to include the chambered cairn and an area around it to the W, N and E in which traces of activities associated with its construction and use may survive, as shown in red on the attached map. To the S the road and roadside ditch are excluded from the scheduled area. Statement of National Importance The monument is of national importance for its potential to contribute to an understanding of Neolithic/Bronze Age ritual beliefs and burial practices. Information about the construction methods of tombs survives at this site. References RCAHMS records the monument as ND 13 SW 9.
Asset/Event Number	15
Asset/Event Name	Loedebest, cairn 500m SSE of
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5191; ND13SW 13
HER Number	MHG1256; MHG38946
Status	Scheduled Monument
Section:	N/A
Easting	313935
Northing	931703
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5191 The monument consists of a cairn with a cist in the centre. The cairn is about 5m in diameter and 0.6m high and a number of slabs are visible forming an edge to the cairn. A cist formed by three stone slabs is exposed in the centre. The cist is 0.9m E-W by 0.4m wide and 0.2m deep. The area to be scheduled measures 25m in diameter, to include the cairn and an area

Appendix 1: Gazetteer of Heritage Assets and Events

around in which traces of activities associated with its construction and use may survive, as shown in red on the attached plan.

Statement of National Importance

The monument is of national importance for its potential to contribute to an understanding of prehistoric ritual and funerary practices.

References

RCAHMS records the monument as ND 13 SW 13.

Asset/Event Number	16
Asset/Event Name	Loedebest, prehistoric settlement and post medieval enclosure 1400m WSW
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5254; ND13SW 22
HER Number	MHG610
Status	Scheduled Monument
Section:	N/A
Easting	312427
Northing	931784
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5254 The monument consists of 3 prehistoric hut circles and traces of associated cultivation on sloping moorland to the S of Dunbeath Water. Hut circle 'A' is located at ND12393179 and is about 9.5m in diameter. The walls that define the hut circle are about 2m wide and 0.5m high and some facing stones are visible on both the inside and outside of the wall. There is a possible entrance to the SE of the hut. Hut 'B' is located at ND12473180 and is about 9m NW-SE by 6.5m SW-NE. The wall is spread to about 1.5m wide and is about 0.5m high. The entrance to this house is to the SE and 3 large loose stones have been dumped in the entrance presumably after the abandonment of the hut. Hut 'C' is at ND12393178 and was probably originally about 8m in diameter. The N portion of the hut wall has been destroyed at some time in the past by the construction of the track which skirts the settlement to the E. Where it is best preserved the wall of this hut is about 1.7m wide and 0.5m high. The position of the entrance is unclear. A length of turf-covered stone field wall extends for 20m to the NW of hut 'A' and there are a number of possible stone clearance cairns around these hut circles. To the S of the hut circles an area of land has been cleared of stone and enclosed within a stone wall presumably during the post medieval period. The area to be scheduled measures a maximum of 165m SW-NE by 130m NNW-SSE, to include the prehistoric hut circles, field wall, possible cairns and the post medieval enclosure, as shown in red on the attached plan. Statement of National Importance The monument is of national importance for its potential contribution to an understanding of prehistoric settlement and land use. The hut circles incorporate information on the architecture of prehistoric houses. The post medieval enclosure is presumably connected with the important group of abandoned post medieval settlements in Dunbeath Strath.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	17
Asset/Event Name	Bridge of Badnagie, settlement 400m NW of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5186; ND13SE 45
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	315613
Northing	932131
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5186 The monument is a prehistoric settlement consisting of a number of hut circles on a natural shelf above the E bank of the Burn of Houstry. Hut circle 'A' (ND15593215) measures 7m in diameter internally and has an entrance to the S. The wall, where best preserved, is 2m wide and 0.3m high. Hut 'B' (ND15633211) has bare stone walls and a profusion of stony debris in the interior and this probably indicates that the hut had substantial stone walls. This hut is about 7.5m in diameter internally and has a S entrance. To the W of the entrance, the wall of the hut expands to 3m in width and it is possible that this represents a well preserved souterrain running outside the wall of the house on its SW and W side. Hut 'C' (ND1563208) measures 8.5m NNW-SSE by 6.5m transversely with heather covered walls 2m wide and 0.2m high. The entrance is in the SSE. A cross wall in the interior of this hut may indicate a secondary hut 5.5m in diameter, with an entrance in common with the larger hut. 22m to the N of hut 'A' is a small circular enclosure or hut circle. The area to be scheduled measures 170m NW-SE by 45m NE-SW, to include the hut circles, enclosure and an area around in which traces of activities associated with the construction and use of the hut circles may survive. The scheduled area extends 20m beyond the edge of the archaeological structures except to the N of hut 'A', where the area extends to the break of slope (12m to the SW of the hut) and is shown in red on the attached map. Statement of National Importance The monument is of national importance as a well preserved prehistoric settlement which has the potential to considerably increase our understanding of the domestic life and farming practices of its inhabitants. The association of a possible souterrain with one of the hut circles is of particular importance. The hut circles vary in form and contain evidence for the architecture of Iron Age domestic dwellings. References RCAHMS records the monument as ND 13 SE 45.
Asset/Event Number	18
Asset/Event Name	Greentulloch, broch 180m NE of

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM5089; ND13SE 14
HER Number	MHG1142; MHG39562
Status	Scheduled Monument
Section:	N/A
Easting	316271
Northing	932336
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5089 The monument comprises a broch which is estimated to be about 17m in diameter and incorporated into a mound which is about 23m in diameter and 1.5m high. A small trench has been excavated at some time in the past on the SE of the mound and this has exposed the lintelled entrance to the broch and a curved stretch of the outer wall face 8m long. The outer mound extends someway beyond the wall of the broch on the SW and it is probable that ancillary structures outside the broch wall will survive in this area. The area to be scheduled measures 65m SW-NE by 50m SE-NW, to include the broch, the outer mound and an area around in which traces of activities associated with the building and occupation of the broch may survive, as depicted in red on the attached map. This area excludes the roofless long house to the SE, is defined by the modern wall to the SW and extends 20m beyond the walled enclosure on the NW and NE. Statement of National Importance The monument is of national importance for its potential to contribute to our understanding of prehistoric settlement and domestic life. The broch is fairly well preserved and will incorporate information about Iron Age defensive architecture, while the settlement contains evidence for the farming activities and domestic life of its inhabitants. References RCAHMS records the monument as ND 13 SE 14.
Asset/Event Number	19
Asset/Event Name	Bridge of Badnagie, standing stone 600m N of
Type of Asset/Event	Standing stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5304; ND13SE 29
HER Number	MHG1156
Status	Scheduled Monument
Section:	N/A
Easting	316016
Northing	932570
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5304 This monument is a prehistoric standing stone. The stone is situated on flat moorland and is 1.6m high, 1.5m wide and 0.6m thick. There are packing stones at the base of the standing stone. The area to be scheduled measures 20m in diameter, to include the standing stone and an area around in which traces of activities associated with its erection may survive, as shown in red on the attached map. Statement of National Importance The monument is of national importance for its potential contribution to our understanding of prehistoric ritual beliefs. References RCAHMS records the monument as ND 13 SE 29.
Asset/Event Number	20
Asset/Event Name	Dun Garbhlaich, fort, Kilmorack
Type of Asset/Event	Fort
Date and/or Period	Iron Age
Listing No./NRHE Number	SM2422; NH44NE 5
HER Number	MHG2654
Status	Scheduled Monument
Section:	N/A
Easting	246605
Northing	846572
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2422 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/12375 (NH 4662 4657) Dun Garbhlaich (NAT) Fort (NR) OS 6"map,(1957) Dun Garbhlaich, a fort, situated on the uneven rocky summit of an isolated crag. It is roughly D-shaped on plan measuring c.35.0m E to W by c. 28.0m transversely with a drystone wall which is completely tumbled on the N and SE, but well preserved in the SW where the outer face stands to a maximum height of c. 1.5m, and the inner face to a maximum height of c. 1.0m giving a wall thickness varying between 3.8m and 2.3m. In the NE the outer face is evident amidst tumble to a maximum height of c.0.8m. The entrance passage, 4.5m long and 1.1m wide is in the S at the easiest point of access and is faced by upright slabs towards the inner end. Within the fort in the E is a ruinous stone-lined well c.3.0m diameter. The plan by Wallace (T D Wallace 1921) is almost worthless. The outwork shown to the S of the fort is tumble from the main wall. Depicted at 1/10000 scale. Planned at 1/1250 Visited by OS (R L) 6 April 1970; Visited by RCAHMS 1957 Activities

Field Visit (31 August 1943) RCAHMS Emergency Survey (Archaeology)

Dun Garbhlaich is perched on a crag about 1030 ft OD that is an isolated SW outlier of the higher and often precipitous ridge of the Urchany & Farley Forest. The core of the site is formed by a ridge of naked rock some 36 ft [11m] wide precipitous on the N and W but sloping away more gently on the uphill NE side to a low col. Some 15 ft below the crest of this rocky spine on the SE is a broad platform some 48 ft [14.6m] wide that again falls away in sheer cliffs on the S & W. Both the ridge crest and the platform are included within the protection of a drystone wall. This runs nearly straight along the edge of the precipice on the N for about 105 ft [32m] but from each end of the spine sweeps out in a rough semi-circle to embrace the level terrace below, running downhill across the slope of naked rock in the SW quadrant. In this segment both inner and outer faces are exposed, 3 ft to 5 ft [0.9m to 1.5m] of almost vertical masonry being visible where the outer face traverses a cleft in the rock. In the S there is an entrance passage 3 ft 8 in [1.1m] wide at its inner end and traceable for 15ft [4.6m] on the W side but 14 ft [4.3m] further W from the inner corner the rampart seems only 11 ft [3.4m] thick. At the foot of the central ridge in the SE quadrant, just within the rampart, is a spring or well that still contained water when visited. Some good sections of outer face neatly adjusted to rock out crops are visible also on the E, but along the cliff edge to the N as well as to the SE the rampart is overgrown with peat and heather.

Visited by RCAHMS (VGC) 31 August 1943. (T.I.S.S, viii, 119 (plan))

Note (1951 - 1958) RCAHMS Marginal Land Survey

This fort is situated at a height of 1030 feet OD on a rocky eminence that stands up from the higher and broken ground N. of Farley, three- and three-quarter miles W of Beaulieu. The upper part of the knoll is formed by a ridge of naked rock, the N and W flanks of which are precipitous, while to the NE a gentle slope leads to a col from which the main massif is reached. Some 15 feet below to the SE. is a broad platform the S and W. flanks of which are precipitous. The fort, which encloses both ridge and platform, is D-shaped on plan, measuring 80 feet [24m] in width from E. to W. by 60 [18m] transversely within the ruined stone wall. Sections of both faces are visible, indicating that the wall varies in thickness from 11 feet to 15 feet [3.3m to 4.6m]. The entrance is in the S. A well lies just within the E sector of the wall but the interior is otherwise featureless.

Information from RCAHMS c.1951-8

Field Visit (March 1979) RCAHMS: The Archaeological Sites and Monuments of North East Inverness

Dun Garbhlaich NH 466 465 NH44NE 5 This D-shaped fort measures 27m by 23m within a wall up to 3.8m thick which encloses both the summit of a crag and a shelf some 4.5m below on the SE side: considerable portions of wall-face survive where the wall descends to the lower level. The entrance lies on the S.

RCAHMS 1979, visited March 1979 (Wallace 1886, 342-3) Note (4 March 2015 - 31 May 2016)

Atlas of Hillforts of Britain and Ireland

This small fort is situated on a rocky hillock rising from a S-facing hillside above Farley. D-shaped on plan, it measures about 35m from ENE to WSW along the chord extending along the crag on the NNW by 28m transversely within a wall from 2.3m to 4.5m in thickness. Long runs of the outer face are visible in the tumbled rubble everywhere except on the NNW, standing up to 1.5m high on the SW, where the inner face also survives to a height of about 1m. The wall is thickest to either side of the entrance, which is on the S; faced with upright slabs, the inner edge of the passage measures 1.1m wide and in 1943 was sketched with checks by RCAHMS investigators, though there is no hint in their description that these were actually visible. Much of the interior is bare rock, but there is what may be a well immediately within the line of the wall on the E.

Information from An Atlas of Hillforts of Great Britain and Ireland – 31 May 2016. Atlas of Hillforts SC2874

References

RCAHMS. (1979c) The archaeological sites and monuments of North-east Inverness, Inverness District, Highland Region, The archaeological sites and monuments of Scotland series no 8. Edinburgh. Page(s): 16, No. 95 RCAHMS Shelf Number: A.1.2.ARC(8)

Appendix 1: Gazetteer of Heritage Assets and Events

RCAHMS. (1942-3) Emergency Survey of archaeological monuments in military training areas, 1981, 2v. Typescripts. Page(s): TS 56, MS 143 RCAHMS Shelf Number: A.1.1.SUR
RCAHMS. (1950-9) Marginal Land Survey (unpublished typed site descriptions), 3 volumes. Page(s): v2 RCAHMS Shelf Number: A.1.1.MAR
Wallace, T. (1921a) 'Archaeological notes', Trans Inverness Sci Soc Fld Club, vol. 8, 1912-18. Page(s): 119 plan 120 RCAHMS Shelf Number: Ref

Asset/Event Number	21
Asset/Event Name	Dun a Chliabhain, fort
Type of Asset/Event	Fort
Date and/or Period	Iron Age
Listing No./NRHE Number	SM2424; NH44NE 5
HER Number	MHG2653
Status	Scheduled Monument
Section:	N/A
Easting	247701
Northing	846069
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	

<https://portal.historicenvironment.scot/designation/SM2424>
No description available from HES. Description taken from Canmore
<https://canmore.org.uk/site/12376/dun-a-chliabhain>.

(NH 4770 4606) Dun a' Chliabhain (NAT) Fort (NR) OS 6"map, (1957) Dun a' Chliabhain, a fort, occupies a steep-sided rocky boss. It is 77 ft by 48 ft within a stone wall up to 12 ft thick, with an entrance on the E. An outer wall covers this in the NE (2). Wallace gives the wall thick- ness as 6 ft 6 ins and adds that the S side is defended by a 5 ft broad ditch, gradually becoming wider towards the SE.
R W Feachem 1963; T D Wallace 1921

Dun a' Chliabhain, a fort, is situated on the SW extremity of a ridge which protrudes SW from the higher ground above Drumindorsair; the NW, SW and SE flanks of the ridge are steep and in parts precipitous, but the approach from the NE is gradual. Sub-oval on plan, the fort measures 23.5 m NW-SE by about 11.0 m within a wall averaging 3.6 m in thickness. Inner and outer wall faces, to a maximum height of three courses, can be traced amid tumble in all but the NW arc where the wall has slipped over the cliff. A shooting butt has been built into the wall in the S. The entrance passage, in the E, measures 3.8 m in length by 2.2 m in width; it is reduced to its lowest two courses. The interior of the fort is featureless. The wall barring the easiest approach from the NE survives as a discontinuous line of outer facing-stones with three inner facing-stones evident at the S end giving a wall thickness of 2.2 m. Outside the fort in the SW is a stony bank, about 1.5 m wide and 0.3 m high, with an internal ditch some 1.5 m wide and 0.3 m deep, which terminates on level ground at the SE end. It is possible that this is an unfinished outer defence. Outside the bank are the vestiges of another wall, of uncertain purpose.
Planned at 1/1250. Visited by OS (R L) 2 April 1970

Dun a' Chliabhain: This oval dun measures about 21.5 m by 11 m within a wall about 3.6 m thick, with an entrance on the E. The outer wall recorded by Feachem (R W Feachem 1963) does not appear to form part of the defences. This is a dun and is as described in the previous field report, but the 'uncertain wall' across the SW approach is an outwork.

RCAHMS 1979

Activities

Field Visit (31 August 1943) RCAHMS Emergency Survey (Archaeology)

This site was included within the RCAHMS Emergency Survey (1942-3), an unpublished rescue project. Site descriptions, organised by county, vary from short notes to lengthy and full descriptions and are available to view online with contemporary sketches and photographs. The original typescripts, manuscripts, notebooks and photographs can also be consulted in the RCAHMS Search Room.

Information from RCAHMS (GFG) 10 December 2014. Field Visit (March 1979)

RCAHMS: The Archaeological Sites and Monuments of North East Inverness Dun a' Chliabhain NH 477 460 NH44NE 6

This oval dun measures about 21.5m by 11 m within a wall about 3.6m thick, with an entrance on the E. An outer wall recorded by Feachem does not appear to form part of the defences.

RCAHMS 1979, visited March 1979 (Wallace 1886, 342; Feachem 1977, 127-8)

Note RCAHMS Marginal Land Survey

Undated description within v2. of Marginal Land Survey typescripts.

Asset/Event Number	22
Asset/Event Name	Kilphedir, hut circles & field system 750m NNE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2807; NC91NE 25
HER Number	MHG9858
Status	Scheduled Monument
Section:	N/A
Easting	299051
Northing	919408
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2807 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/6998/kilphedir .

(NC 990 194) (5) Enclosures (NR) (Undated) annotation on OS map. A settlement of five hut circles (I-V) excavated by Fairhurst between 1963 and 1968. Two types of huts were distinguished, type I and type II. The first occupation of the site was about 500 BC. RCAHMS 1911; H Fairhurst 1971; H Fairhurst and D B Taylor 1974.

Each of the four type I huts consisted of a low perimeter wall in which had rested the ends of the rafters of a conical roof supported on a ring of posts half way between the wall and the hut centre. There was no evidence of central posts. In, or near, the centre of each was a hearth. Internal diameters were between 20ft and 40ft. Coarse, generally flat rimmed, pottery was found. Hut V, the only type II hut, was found to incorporate the remnants of one of the earlier type I huts, and was dated to c. 130BC. It had a higher, thicker wall, lined on the inside with slabs, which expanded at the entrance to form a passage 5.0m long. Finds included potsherds of a smoother harder ware, one with an everted rim, a saddle quern,

and pounders and rubbing stones. Contemporary agriculture is evidenced by clearance heaps, and stony banks edging plots. Fairhurst (1971) implies that the clearance cairns were possibly contemporary with the type I huts, and the stony banks with the type II house, suggesting a change in cultivation methods.

E W MacKie 1969; Visited by OS (W D J) 20 May 1960.

This is a settlement of five huts (I-V) in association with a field system as described by Fairhurst. Re-surveyed at 1:10,560.

Visited by OS (W D J) 20 October 1976.

References

- Armit and Ralston, I and I B M. (2003) 'The Iron Age', in Edwards, K J and Ralston, I B M, Scotland after the Ice Age: environment, archaeology and history 8000BC - AD 1000. 2nd. Edinburgh. Page(s): 188
- Armit, I. (1992b) 'The Atlantic Scottish Iron Age: five levels of chronology', Proc Soc Antiq Scot, vol. 121, 1991. Page(s): 208
- Armit, I. (1998i) Scotland's hidden history. Stroud, Gloucestershire. Page(s): 107-9 fig 63 RCAHMS Shelf Number: E.2.1.ARM
- Armit, I. (1996) The archaeology of Skye and the Western Isles. Edinburgh. Page(s): 134 RCAHMS Shelf Number: E.2.1.ARM
- Close-Brooks, J. (1995a) The Highlands, Exploring Scotland's Heritage series, ed. by Anna Ritchie. 2nd. Edinburgh. Page(s): no.93), 134, 135, 136, 149-50 RCAHMS Shelf Number: A.1.4.HER
- Davidson and Carter, D A and S P. (2003) 'Soils and their evolution', in Edwards, K J and Ralston, I B M, Scotland after the Ice Age: environment, archaeology and history 8000BC - AD 1000. 2nd. Edinburgh. Page(s): 54-55, 57
- Fairhurst and Taylor, H and D B. (1974) 'A hut-circle settlement at Kilphedir, Sutherland', Proc Soc Antiq Scot, vol. 103, 1970-1. Page(s): 65-99 plans
- Fairhurst, H. (1971c) 'Kilphedir and hut circle sites in northern Scotland', Scot Archaeol Forum, vol. 3, 1971. Page(s): 1-10
- Halliday, S. (1999g) 'Hut-circle settlements in the Scottish landscape', in Frodsham, P, Topping, P and Cowley, D, 'We were always chasing time.' Papers presented to Keith Blood, Northern Archaeol (Spec Edition, vol. 17/18, 1999. Page(s): 49 RCAHMS Shelf Number: E.2.1.BLO
- MacKie, E W. (1969c) 'Radiocarbon dates and the Scottish Iron Age', Antiquity, vol. 43, 1969. Page(s): 17, 24 RCAHMS Shelf Number: E.9.1.MAC.P
- RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 113-14, No. 325 fig. 40 RCAHMS Shelf Number: A.1.1.INV(2)
- Romans and Robertson, J C C and L. (1975) Soils and archaeology in Scotland, in Evans, J G, Limbrey, S and Cleere, H, The effects of man on the landscape: the highland zone, Council for British Archaeology research report no.11. London. Page(s): 38

Asset/Event Number	23
Asset/Event Name	Kilphedir, hut circle 480m NNE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2808; NC91NE 28
HER Number	MHG9855
Status	Scheduled Monument
Section:	N/A
Easting	299145
Northing	919081

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2808 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7001/allt-cille-pheadair. This is the same description for Asset 67/SM1872. Asset 23 is the hut circle B described below. (Centred NC 991190) Enclosures (NR) (Three shown A-C) (NC 9913 1903) Earth House (NR). OS 6" map, 1964. There are two hut circles (A [Asset 67/SM1872] and B [Asset 23/SM2808]) of which one (A [Asset 67/SM1872]) incorporates an earth-house. J M Joass 1873; RCAHMS 1911. Three enclosures (A-C) can be identified. Visited by OS (W D J) 20 May 1960. On a gentle W-facing moorland slope, above the gorge of Allt Cille Pheadair on the E side, is a settlement of three hut circles (A-C). Hut A [Asset 67/SM1872], the best-preserved, measures 10.0m diameter within a massive wall, 1.5m maximum height, which is spread to 3.0m broad, widening to 5.0m at the entrance in the SSE arc. This entrance is club-shaped and choked with debris. Occasional slabs on edge indicate the remains of the inner wall face. The souterrain as described by RCAHMS is virtually complete and accessible along its whole length of 10.0m. It is of dry-stone construction roofed with flags. It measures 0.7m wide and 0.9m high at the entrance on the SW side of the hut, increasing to a maximum of 1.3 wide and 1.4m high. Towards the end of the passage, an opening has been cleared in the roof. The other huts are less substantial and peat-overgrown. B, set into the slope is 12.0m in diameter within a mutilated wall spread to 2.0m broad. A slight dip in the wall in the SW arc probably indicates the entrance. C measures 10.5m N-S by 8.5m within a wall spread to 3.0m broad. It is set into a W-facing slope. The entrance was presumably in the S but no details survive. There is no trace of cultivation plots, and apart from a ruckle of stones nearby, no clearance. However the surrounding ground is smooth and relatively stone-free suggesting some form of cultivation. Visited by OS (N K B) 19 July 1976. Scheduled as 'Kilphedir, hut circle and souterrain...' Information from Historic Scotland, scheduling document dated 8 November 2000. Publication Account (1995) RCAHMS: Exploring Scotland's Heritage - The Highlands, 1995 The broch [Asset 65/SM1870] is on the hill east of the burn but cannot be seen from the road by the bridge. A sheep track just east of the bridge leads up the hill, bearing slightly right, and passes through a deserted crofting settlement under the line of the electricity poles; there are the foundations of a longhouse, and some smaller buildings and a kiln barn. From the first skyline the broch is visible on the hillside above, some 15 or 20 minutes walk from the road. The broch is set on a prominent knoll with good views up and down the valley. It is ruinous, and appears as a great mass of rubble spilling down the hill, but it has a particularly impressive set of outer defences, now all covered with heather so that the stone walls look like banks. There are terraces east and west of the broch defended by an inner rampart, a deep ditch and a stout outer rampart. At the west end, the entrance is protected by an extra short stretch of rampart. Just below the broch is a good path along the side of the hill; follow it west to find three hut circles on the edge of the ravine above the burn (NC 991190). One hut circle (A [Asset 67/SM1872]) has much thicker walls than the other two, and this one has a souterrain leading out of it beneath its wall. The far end has been broken into, so light comes in, but it may be full of water and gumboots are needed. A muddy hole, originally provided with steps, drops down into the narrow souterrain passage; the latter has drystone walls and a lintelled roof and is about 9.50m long. There are more hut circles up the burn and on the west bank. Some of the latter were excavated in the 1960s, and shown to have interior posts that supported their thatched

roofs, while radiocarbon dates from two huts suggest they were occupied in the last few centuries BC. A number of clearance cairns round these and other hut circles are probably of the same date and show that some patches of ground were cultivated. Many other hut circles can be seen on the hill slopes along the north side of the Strath of Kildonan, some indicated on the OS map, and at least six other souterrains have been found, three still attached to hut circles. Part of one at Suisgill (NC 897250) is close to the east side of the road; only the far end survives, with lintelled roof and a curved end-wall, in which is a small built-in recess or cupboard.

Information from 'Exploring Scotland's Heritage: The Highlands', (1995).

Asset/Event Number	24
Asset/Event Name	Kilphedir, hut circles & field system 150m-600m E of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2809; NC91NE 29
HER Number	MHG9854
Status	Scheduled Monument
Section:	N/A
Easting	299268
Northing	918678
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2809 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7002 .

(Centred NC 994 186) Hut Circles (NR) (Even shown)
 (A: NC 9904 1880) Enclosure (NR)
 OS 6" map, 1964.

To the N of the road bridge over Allt Cille Pheadair, is a circular enclosure (A) formed by a single line of contiguous boulders. At the NE, a mound about 14' in diameter lies partly on the circumference. A number of mounds, several apparently excavated, and some hut circles lie nearby. Amongst these mounds are the remains of old banks or walls, in some instances connecting with small circular enclosures. One, 350 yards SSW of the broch (See NC91NE 27) is 9' internal diameter with a S entrance. Attached to it on the S is an oval enclosure measuring 15' by 11' internally.
 RCAHMS 1911, visited 1909.

A total of five hut circles (A, B, D, E and F) an enclosure ©, a sub-rectangular structure (G) and a scooped shieling-type structure (H) were locate during field perambulation.
 Visited by OS (W D J) 21 May 1960.

Centred at NC 993 187 on an undulating SW-facing slope in open moorland, is a settlement of five stone-walled huts (A-E) within a well-preserved field system. Huts C and E are more massive than the others, being broadly similar to Kilphedir type II (See NC91NE 25) whereas A, B and D can be equated with the earlier type 1 hut. F cannot be located.

Of the denuded hut A, 12.5m overall diameter, little more than the outer face of stones on edge can be seen. The mound overlying the wall in the NW is a clearance heap. B measures

7.0m N-S by 6.0m internally within a wall of 1.1m estimated thickness. Some outer facing stones are visible. C is 12.5m NW-SE by 10.0m within a wall now 0.8m internal height which is spread to 3.0m broad widening to 4.0m at the entrance which is clubbed. Hut D adjacent to C is 5.5m NW-SE by 5.0m within a wall spread to 2.0m broad, and E is 8.0m NW-SE by 7.0m within a wall of 2.0m estimated breadth widening to 3.0m at the entrance where one portal stone is extant. The entrance to each hut is in the S or SE arc, and, with the exception of C is of simple form. The field system occupies an area of about 15 hectares, best-preserved in the vicinity of huts A and B where a number of contiguous cultivation plots, 25.0m by 15.0m average size, are discernible. These plots are delineated by clearance, heaped and linear, and stony lynchets.

The 'sub-rectangular structure' (G) cannot be located, and the structure (H), as described by previous OS field investigator, is possibly a shieling.

Re-surveyed at 1:10,560

Visited by OS (N K B) 26 July 1976.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 116, Nos. 329-31 RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	25
Asset/Event Name	Kilphedir, hut circle 830m NNE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2810; NC91NE 3
HER Number	919453
Status	Scheduled Monument
Section:	N/A
Easting	299174
Northing	919453
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2810 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7003/allt-cille-pheadair. This is the same description for Asset 66/SM1871. Asset 25 is the hut circle A described below. Due E of a hut circle group (NC91NE 25 [Asset 22/SM2807]), on the opposite bank of Allt Cille Pheadair, are two hut circles. The more southerly example (B [Asset 66/SM1871]) appears to be placed within an oval enclosure. On the W side of the entrance is a small chamber entered through a passage, with a lintel at its inner end. This may be the entrance to an earth-house. RCAHMS 1911, visited 1909. Two hut circles as described. Visited by OS (W D J) 20 May 1960. On a gentle S-facing slope in open moorland, are two well-preserved stone-walled huts

within an associated field system. The huts appear to be broadly similar in size and construction. 'A' [Asset 25/SM2810] measures 9.0m NW-SE by 8.5m transversely within a heather-covered wall, 2.8m thick all round, which is faced inside and out with large stones on edge. The 'simple' entrance is in the SE arc. Hut 'B' [Asset 66/SM1871] (at corrected grid reference NC 99201941) is 9.0m internal diameter within a rubble wall about 2.0m to 3.0m thick, faced internally with a crude uncoursed wall of large stones, 1.0m high, the flatter side of the stone facing the inside of the hut. The wall thickens at the entrance in the SE arc to 4.0m; portal stones indicate the passage was 1.1m wide with parallel sides. The depression in the wall on the W side of the entrance may be the tumbled remains of a souterrain, but an absence of visible wall facing renders this uncertain. The hut appears to have been built within an earlier hut which was set into the hillslope and measured approximately 11.0m NW-SE by 9.5m within a heather-covered wall spread, where visible, to 2.5m. Two inner facing slabs are visible in the NW arc. The huts appear to share a common entrance in the SE.

The associated field system of 1 1/2 hectares comprises cleared plots, average size 40.0m by 30.0m defined mainly by lynchets and one or two field walls. There is little evidence of clearance heaps.

Re-surveyed at 1:10,560.

Visited by OS (N K B) 21 October 1976.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 114-15, Nos. 326, 327 fig.49 RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	26
Asset/Event Name	Kilphedir, hut circles & field system 1260m NNE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2811; NC91NE 30
HER Number	MHG9852
Status	Scheduled Monument
Section:	N/A
Easting	299227
Northing	919826
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2811 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7004/allt-cille-pheadair .

On the E side of the Cille Pheadair burn, about 1 mile N of its junction with the Helmsdale River, is a group of three contiguous enclosures, two of which appear to have been cattle or sheep folds. A horn projects on the W side of the entrance to the most easterly one. An opening has been broken through the banks of this and the northerly enclosure, apparently at a later date. Near the three enclosures are a dozen or so small mounds. Some 30 yards N, on the end of a slight knoll, is a cup-shaped hollow, with an opening to the S, 10' in diameter and apparently lined with stones. Some 30 yards S is a circular enclosure with traces of an inner compartment.

RCAHMS 1911, visited 1909.

The three contiguous enclosures comprise a hut circle (A) an enclosure (B), and a semi-enclosed area. In the interior of the hut are traces of two small compartments. Some 40.0m W of hut A is another hut circle (C) that is almost certainly the last enclosure noted by the RCAHMS. The cup-shaped hollow could not be identified. The mounds are probably field clearance heaps.

Visited by OS (W D J) 20 May 1960.

There are three stone-walled houses (A-C) in association with a field system. The situation is rising moorland open to the S. The huts are reduced and heather-covered but seem broadly similar.

'A' is 9.0m diameter inside a wall of main width 2.0m broadening to 3.0m at an obscure entrance from the SSE. The ground to the rear of the hut is partially enclosed on the N and E sides, by a low scarp scooped from the ascending slope and joining to the NE arc of the hut.

'B' is 9.5m diameter internally. The wall has a general spread of 3.0m that increases to 4.5m at a clubbed entrance, 3.0m wide, from the S. A form of forecourt precedes the entrance, evidenced by a seemingly built-up and levelled crescentic area 4.5m by 3.0m, partially enclosed on the S and W sides, by a low curving bank that connects in the W of the entrance.

'C' is 9.0m inside diameter. The wall, at a choked entrance, from the SSE, is spread to 3.5m but in the NNW has been broken through, and elsewhere is vague.

The alleged traces of inner compartments in huts A and C are too tenuous to be conclusive. In the slope some 90.0m N of hut C is a low depression, Approximately 3.5m diameter, inside a vaguely suggested bank. No stone is apparent. This may be the cup-shaped hollow referred to but it seems natural or at best a surface quarry.

The field system occupying four hectares, is best distinguished by a stone-free close-cropped appearance marked with scattered field clearance heaps, except to the N of hut B where there is an appreciable concentration. There are occasional substantial lynchets, and in the vicinity of the huts, indecisive signs of a pattern of field banks. Re-surveyed at 1:10,560. Visited by OS (J M) 1 July 1976.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 116-17, No. 332 RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	27
Asset/Event Name	Kilphedir, hut circle 1260m NE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2812; NC91NE 34
HER Number	MHG9900
Status	Scheduled Monument
Section:	N/A
Easting	299468
Northing	919748
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2812 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7008/allt-cille-pheadair. Asset 27 is the hut circle A described below. A hut circle (A) was found during field work. Visited by OS (J L D) 9 June 1960. There are two reduced and peat-covered stone-walled hut circles (A and B) - 'A' [Asset 27/SM2812] now at correct plan position NC 9947 1974 and 'B' located at NC 9945 1969 - set in the lower reaches of a westerly facing hillside. There are no signs of associated agriculture. Both huts are levelled into the slope, and a simple entrance in each is from the S on the line of the longer axis. 'A' [Asset 27/SM2812] is about 9.0m by 7.5m inside a wall spread to 3.0m. 'B' is about 8.5m by 7.5m within a wall spread on average to 3.0m. Surveyed at 1:10,560. Visited by OS (J M) 1 July 1976
Asset/Event Number	28
Asset/Event Name	Kilphedir, hut circle 740m ESE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2814; NC91NE 33
HER Number	MHG9901
Status	Scheduled Monument
Section:	N/A
Easting	299594
Northing	918491
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2814 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7007/kilphedir. A small sub-rectangular enclosure abutting the S side of an old track. Visited by OS (W D J) 21 May 1960. This is a reduced, circular stone-walled hut circle occupying a sheltered position in rising broken ground open to the SE. The hut is about 9.5m diameter internally. The wall, peat-covered generally, is vague in the N arc but otherwise indicates a main width of 1.2m that expands to 1.8m at an entrance from the E. Some largish stones are evident in the wall construction particularly in its exterior in the S half. Associated agriculture is noted by occasional mound and ruckles of field clearance on the hillside ascending from the S - no cultivation plots are discernible. About 45.0m S of the hut, on the slope, is a level circular

Appendix 1: Gazetteer of Heritage Assets and Events

patch, 11.0m diameter, slightly raised from its surround and with some stone in evidence, which may be remains of another hut circle.

Revised at 1/10,000.

Visited by OS (J M) 8 July 1976.

Asset/Event Number	29
Asset/Event Name	Allt Cille Pheadair, hut circles & clearance cairns
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2841; NC92SE 1
HER Number	MHG9531
Status	Scheduled Monument
Section:	N/A
Easting	298838
Northing	920073
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2841 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7149/allt-cille-pheadair.

A settlement of three hut-circles (A-C) accompanied by a few field clearance heaps and field banks, lying on a SE- facing slope.
RCAHMS 1911, visited 1909.

'A' has originated as a 'simple' oval hut, measuring 12.1m by 8.7m within an earth and stone bank 0.4m high and spread to 2.6m, and having an entrance in the SE on the line of the longer axis. Inside the hut and partially overlaying the SE wall arc is a secondary circular stone hut of Kilphedir type II (4), 7.3m diameter within a wall of main width 1.1m. An entrance passage, splayed and extending into the entrance of the original hut, is 2.4m long 0.9m to 1.2m wide and is flanked by large stones. The remains of a stone wall spring from the back of the secondary structure, and runs for a distance of about 20.0m passing through the wall of the original hut. A slight earth and stone bank springs from the east side of the latter turning sharply to the SE after a few metres.

'B' has been a 'simple' hut some 10.0m diameter internally but only a slight turf bank 0.1m high and 1.7m wide is now visible, with a red grit boulder standing in the east side. An entrance may be indicated by a slight depression in the south.

'C' is a 'simple' hut, slightly scooped out of the slope in the NW and measuring 10.5m by 8.5m internally. A wall width of 2.0m is estimated at a 1.0m wide entrance in the SE on the line of the longer dimension; elsewhere the wall is spread to 1.5m.

Using the Kilphedir excavation as an analogy (H Fairhurst and D B Taylor 1974) the sequence of occupation for this site would appear to be a settlement of three 'simple' huts, with associated field clearance heaps, dating about 500 BC, followed by a re-occupation and reconstruction of a single hut of about 130 BC with associated field banks.
Visited by OS (W D J) 8 December 1976

Details as in previous report. The associated agriculture is heavily masked by peat-silting and

cultivation plots are not discernible.
Visited by OS (J M) 8 December 1976.

References

Fairhurst and Taylor, H and D B. (1974) 'A hut-circle settlement at Kilphedir, Sutherland', Proc Soc Antiq Scot, vol. 103, 1970-1. Page(s): 65-99
RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 117, No. 333 RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	30
Asset/Event Name	Balcraggie Lodge, four hut circles 300m SSE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM3521; ND13SW 2
HER Number	MHG1259
Status	Scheduled Monument
Section:	N/A
Easting	314246
Northing	930258
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3521

Statement of National Importance

The monument is of national importance for its potential contribution to an understanding of prehistoric and post-medieval settlement and land use and the process of the Clearances in this area of the Highlands. The hut foundations are well-preserved and may retain information on the architecture of prehistoric houses.

<https://canmore.org.uk/site/8212/balcraggie-lodge>

A quarter of a mile SSE of Balcraggie Lodge and about 100 yds from the road is a hut circle, measuring some 28ft in diameter within a much broken-down bank of turf and stone. An old stone wall has at one time run along the N side of it, and stones appear to have been taken from the inner face of the bank.
RCAHMS 1911, visited 1910.

Centred ND 142 302 are four enclosures or hut circles, formed by earth-and-stone banks 0.6m in average height, and varying from 10.0 to 12.0m in diameter. The entrances are in the E sides, except for the hut at ND 1424 3024, which has its entrance in the N. The hut at ND 1429 3023 is that described by the RCAHMS (1911) and noted as a cairn on OS 6" map, Caithness, 2nd ed., (1909)
Visited by OS (W D J) 25 June 1960.

A settlement of four hut circles as described by the previous OS field surveyor. About six scattered stone clearance heaps remain. Further evidence of contemporary cultivation has probably been destroyed by more recent cultivation.
Surveyed at 1:2500.

Appendix 1: Gazetteer of Heritage Assets and Events

Visited by OS (R L) 15 March 1968.

(ND 142 302) Settlement (NR)
OS 25" map, (1970)

A settlement of four hut circles (A - D) accompanied by half a dozen stone clearance heaps. The huts are heather or turf-covered and in the case of both 'A' and 'B' there is a thick growth of bracken.

'A', at ND 1429 3023, measures 9.0m in diameter within a wall spread from 2.5 to 3.0m and varying from 0.5 to 0.9m high; the entrance is in the E. The N arc of the hut has been overlaid by an old field wall.

'B', at ND 1424 3024, measures 8.5m in diameter within a wall spread from 2.0 to 2.5m and up to 0.7m high. The only suggestion of an entrance is a depression in the N, but it is highly suspect as this arc of the hut has been overlaid by an old field wall.

'C', at ND 1420 3022, measures 10.5 by 9.5m within a wall spread from 2.5 to 3.0m and, in the W, up to 0.9m high. The entrance is in the E, on the line of the main axis, and has a lining slab in situ on the N edge. 'D', at ND 1412 3021, measures an estimated 9.5m in diameter within a wall spread from 2.5 to 3.0m and up to 0.5m high. The entrance has probably been in the now mutilated E side.

Visited by OS (J M) 19 August 1982.

References

RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 65, No. 239 RCAHMS Shelf Number: A.1.1.INV(3).R

Asset/Event Number	31
Asset/Event Name	Rinsary, homestead 500m WNW of, Berriedale
Type of Asset/Event	Prehistoric/early historic settlement
Date and/or Period	Prehistoric/Early Historic
Listing No./NRHE Number	SM3473; ND12SW 5
HER Number	MHG1121
Status	Scheduled Monument
Section:	N/A
Easting	311267
Northing	923858
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3473 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8107/rinsary .

ND 1127 2385. Situated on a knoll in arable land, about 500m WNW of Rinsary, are the remains of a double-ditched enclosure. A shallow gully flanks it on the NW, and a small stream on the SE.

A causeway, 5.2m broad, crosses the ditches on the E side. These ditches do not appear to

be palisade trenches, being 2 to 3m wide by 0.2m deep, and enclose a central area measuring some 24m E-W by 18.5m transversely. Within the enclosure and on the highest part of the knoll, are traces of a ring-groove hut circle, 7.0m in diameter, the trench being 0.4m wide by 0.1m deep. Some 5.0m beyond the main ditches, on the S and E, are traces of a palisade trench 0.4m wide by 0.1m deep, with an appropriate break at the causewayed entrance, and widening into an evident ditch towards the gully on the W.

Visible on RAF air photographs CPE/Scot/UK 179: 1308-9.

Visited by OS (J L D) 15 June 1960.

(ND 1127 2385) Earthwork (NR)

OS 6" map, (1964)

Generally as described by previous OS field surveyor, except that only a small portion of the ring-ditch hut on its SE quadrant is now evident; and no trace can now be seen of the palisade trench between the short stretch of ditch close by the gully and another similar ditch beside the entrance.

Surveyed at 1:2500.

Visited by OS (R L) 7 March 1968.

(ND 1127 2385) Homestead (NR)

OS 25" map, (1969)

Situated on the summit of a glacial knoll in what is essentially a non-defensive position are the remains of a double-ditched enclosure. It is generally as described by previous OS field surveyor (R L), except that there is some doubt as to the authenticity of the ring-groove hut. The groove does not form a regular curving circle, and it encloses a mounded area 0.2m high. There is no trace of banks or stone-built ramparts associated with the ditches, and it may therefore have been a palisaded enclosure; as such it would be unique in Caithness. It is almost certainly some form of homestead.

Visited by OS (N K B) 24 March 1983.

Asset/Event Number	32
Asset/Event Name	Tulach Bad a'Choilich, hut circles, settlement and cairns 400m ENE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM3475; ND12SW 6
HER Number	MHG1122
Status	Scheduled Monument
Section:	N/A
Easting	310469
Northing	924191
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3475 The monument comprises a group of at least 6 prehistoric hut circles or enclosures, 2 later rectangular foundations, traces of field walling and a scatter of field clearance cairns. It was partially scheduled in 1974, as two separate groups of small protected areas, but these were inadequate to cover even the most visible of these archaeological remains. This extension rectifies the situation.

The monument lies on a hill shoulder which protrudes into Strath Cuil from the E, at a height of between 320m and 400m above sea level. The hut circles are round or oval on plan, and measure between 8m and 13m across. 5 of the six lie in the S end of the area proposed for scheduling, together with a small number of field clearance cairns. The 6th hut circle lies towards the N end, and is bracketed by 2 later, rectangular, dwelling foundations. This northern area has rather more field clearance cairns and also traces of boundary walling. All of the remains are covered by moorland heather.

The area now to be scheduled is irregular on plan. It measures a maximum of 420m NW-SE by 320m NNE-SSW, to include all of the features mentioned above and an area between and around them in which evidence relating to their construction and use is likely to survive. The area is indicated in red on the accompanying map extract.

Asset/Event Number	33
Asset/Event Name	Tulach Bad a Choilich, broch 670m NW of Cnoc Fionn
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM3477; ND12SW 9
HER Number	MHG1125; MHG39556
Status	Scheduled Monument
Section:	N/A
Easting	310055
Northing	924046
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3477 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8111/tulach-bad-a-choilich .

Broch, 'Tulach Bad a Choilich': On a spit of land E of the Allt Bad a' Choilich, beside the path up the Berriedale Water, and about a mile NW of Langwell House, are the ruins of a small broch. Towards the river, but nowhere else, the lower face of the wall is visible; no measurements, however, are obtainable.
RCAHMS 1911.

All that remains of this broch is a large earth-and-stone mound measuring approximately 19.0m E-W by 15.0m transversely, and 3.0m high above the slope on the E. On this side, a small portion of the outer wall face can be seen, and there is also a slight depression on the top of the mound. It was not possible to obtain any measurements of the broch structure.

The remains of an earth and stone bank, 1.7m broad and 0.4m high, were noted at the S edge of the mound, but it is not clear if it is contemporary with, or later than, the broch.

On the opposite side of the path from the broch are the footings of a building some 15.0m long by 4.0m wide, divided into two compartments, with a wall now 0.6m high.
Visited by OS (W D J), 4 July 1960.

The remains of a broch, as described by the previous authorities.
Visited by OS (N K B), 10 November 1982.

Appendix 1: Gazetteer of Heritage Assets and Events

Publication Account (2007) Euan W Mackie Broch Corpus 2

ND12 5 TULACH BAD a' CHOIL-ICH ('Berriedale Water 2', 'Langwell House 2')

ND/1005 2404

Possible broch in Latheron, Caithness, in the form of a wrecked mound standing on a spit of land east of the stream Allt Bad a' Choilich. Traces of the outer face are visible towards the river.

Sources: 1. NMRS site no. ND 12 SW 9: 2. RCAHMS 1911b, 53-4, no. 202.

E W MacKie 2007

References

Mackie, E W. (2007) The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c.700 BC-AD 500: architecture and material culture, the Northern and Southern Mainland and the Western Islands, BAR British series 444(II), 444(1), 2 V. Oxford. Page(s): 427 RCAHMS Shelf Number: E.9.1.MAC

RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 53-4, No. 202 RCAHMS Shelf Number:

A.1.1.INV(3).R

Asset/Event Number	34
Asset/Event Name	Tulloch Tural, broch 500m WNW of Tural Rock, Langwell
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM3440; ND02SE 4
HER Number	MHG2425; MHG20201
Status	Scheduled Monument
Section:	N/A
Easting	309040
Northing	922854
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3440 The monument comprises the remains of a broch, a drystone-built, fortified dwelling of Iron Age date. It is already scheduled, but the scheduled area does not cover all of the area of archaeological importance. This proposal rectifies the position. The broch stands immediately to the S of an estate track. It stands about 2m high and is about 14m in diameter. Two courses of the outer wall face can be seen in places. No detail is visible in the interior, although a slight depression hints at the entrance being on the S side. There is an external ditch and bank on the E side, and this may once have extended around the N side of the broch, although its traces have been removed by later construction activity. The area now to be scheduled is semi-circular, 60m in diameter, with the S side of the track as its N edge. This includes the broch and the slight traces of outer defences as well as an area around them in which evidence relating to their construction and use may survive. The area is marked in red on the accompanying map extract.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	35
Asset/Event Name	Langwell Tulloch, broch 400m SE of Turnal Rock
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM3441; ND02SE 10
HER Number	MHG1508
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	309739
Northing	922315
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	High
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remains of a broch under dense vegetation, grass and small trees, situated on the edge of a terrace overlooking the Langwell Water. As described below.* https://portal.historicenvironment.scot/designation/SM3441 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7525/langwell-tulloch. On the S side of the road up the Langwell Water and some 200 yds W of the wall which divides the woodlands from the moor beyond the garden, are the very confused remains of a construction. Much stone has been removed from it, and its original character is not apparent. It is known as 'Langwell Tulloch'. RCAHMS 1911, visited 1910. The mutilated remains of a broch, now a shapeless mass of rubble measuring approximately 28.0 by 32.0m. Part of the face of the outer wall of the broch is visible on the S side and a wall, probably later, forming an outer enclosure or annexe, encloses the broch on the W, S and E. Visited by OS (W D J), 15 June 1960. This broch is generally as described by the previous OS field investigator. Although it has been extensively robbed, the common Caithness 'mound on mound' profile is evident. The broch mound measures approximately 16.0m NE-SW by 14.5m and is 1.5m high. Visited by OS (J B), 3 September 1982. This broch was visited by Headland Archaeology in the course of a pre-afforestation survey (NMRS MS 899/15, no.16). A large stone and turf enclosure, extending N from the outer broch enclosure was recorded in addition to the broch remains previously noted by RCAHMS (1911). C Moloney and L Baker (Headland Archaeology) 13 July 1998; NMRS, MS/899/93, no.17. Site recorded during a survey undertaken of c.2 sq km of land either side of the Langwell Water, by Berriedale. ND 0974 2231 Broch Sponsor: Historic Scotland, C Moloney and L Baker 1998. Publication Account (2007) Euan W Mackie Broch Corpus 2 ND02 1 LANGWELL TULLOCH ('Langwell Water 1') ND/0974 2231 A probable broch in Latheron, Caithness, in the valley of the Langwell Water, and now a much-mutilated mass of

rubble; part of the curved outer face of the wall is visible on the south [1]. The remains of the structure appear to be sited on an artificial mound [1]. A large stone- and-turf enclosure next to the broch was recorded later [3].

Sources: 1. NMRS site no. ND 02 SE 10: 2. RCAHMS 1911a, 83, no. 301: 3. Moloney and Baker 1998, 56-7. E W MacKie 2007

References

MacKie, E W. (2007) The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c.700 BC-AD 500: architecture and material culture, the Northern and Southern Mainland and the Western Islands, BAR British series 444(II), 444(1), 2 V. Oxford. Page(s): 404 RCAHMS Shelf Number: E.9.1.MAC
Moloney and Baker, C and L. (1998) 'Langwell Estate, Berriedale (Latheron parish), pre-afforestation survey', Discovery Excav Scot, 1998. Page(s): 56-57
RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 83, No. 301 RCAHMS Shelf Number: A.1.1.INV(3).R

Asset/Event Number	36
Asset/Event Name	Torball Farm, cairn 1450m WSW of
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1819; NH79NW 14
HER Number	MHG45299
Status	Scheduled Monument
Section:	N/A
Easting	273975
Northing	898444
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1819

The monument comprises a prehistoric burial cairn, between 4500 and 3500 years old, sitting on the eastern edge of a knoll in rough open moorland, just within a birch wood.

The cairn is roughly circular, measuring about 17.3 m from N to S, by 16.6 m transversely, and up to 2 m in height on the E side, which would have given this cairn pronounced visual emphasis when viewed from the E. Around the base of the cairn is a kerb of large contiguous boulders, averaging about 0.3 m in height and 0.4 m to 0.6 m in length. On top of the cairn is a slight circular depression, approximately 2 m in diameter. The main body of the cairn is composed of small stones covered in heather, grass and a small number of birch trees; a pheasant pen has also been constructed on the SE corner.

The monument was first scheduled in 1935, but an incorrect area was defined. The present rescheduling rectifies this. Furthermore, no legal documentation supporting the original scheduling survives.

The area to be scheduled is circular on plan, to include the cairn and an area around in which associated evidence for its construction and use may survive, as marked in red on the accompanying map. The above-ground parts of the pheasant pen fence-posts are to be excluded from the scheduling, to allow for their maintenance.

Statement of National Importance

Cultural Significance

The monument's archaeological significance can be expressed as follows:

Intrinsic characteristics: There is a strong likelihood that the characteristic structural features that define this class of monument, and the internal and external archaeological deposits associated with this particular monument, remain well preserved, despite the encroachment of trees and heather. The height of the mound and the survival and remaining conspicuousness of the kerb, a distinctive feature of this particular cairn, would appear to confirm this.

Contextual characteristics: The monument occupies a prominent position in the landscape with wide views over the surrounding moorland, where there is evidence for prehistoric settlement and associated field systems. It would have formed a significant place within the landscape of this area throughout later prehistory.

Few burial mounds in the eastern part of Sutherland have been identified in similar contexts, close by settlements, clearance cairns and agricultural activity. The majority are also either small with few distinctive architectural features, or much larger chambered cairns. This moderately large cairn with distinctive features is therefore a rare typological example that provides an opportunity for future study of how the spheres of life, agriculture and death interacted in the lives of prehistoric societies within this region.

National Importance

This monument is of national importance because it is a well-preserved example of a rare cairn form. It has the potential to inform future research about the dating and development of differing cairn types, and about the various ways in which these different forms may have been used, perceived and encountered. Its prominence suggests that it would have formed an intrinsic part of the prehistoric landscape in this area, coming to be incorporated into, and revered within, an agricultural and settled landscape in later prehistory. Its loss would affect our ability to understand this monument class as well as the surrounding landscape.

References

The monument is recorded by RCAHMS as NH79NW 14.

RCAHMS 1911, SECOND REPORT AND INVENTORY OF MONUMENTS AND CONSTRUCTIONS IN THE COUNTY OF SUTHERLAND, Edinburgh.

Asset/Event Number	37
Asset/Event Name	Firth View, settlement 1300m NW of
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM4728; NH 56 SW 10
HER Number	MHG8929
Status	Scheduled Monument
Section:	N/A
Easting	250833
Northing	862320
Council	Highland
Condition:	N/A
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM4728 The monument comprises a group of four hut circles and an area around them containing evidence of agricultural activity. Two of the hut circles are already scheduled; this re-scheduling proposal extends protection to the other two and to a larger surrounding area. The hut circles - the foundations for prehistoric timber houses - are loosely grouped together at around 250m OD on a SE-facing hillslope, overlooking upper Strath Sgitheach. The most easterly circle (which lies about 25m from the edge of a large forestry plantation) measures about 11m by 13m, with an entrance on the SSE side. Just over 100m to the NNE lies a second hut circle, of similar size but with no apparent entrance. Some 180m to the NE of the first circle lie another two hut circles, only 1m apart, one about 12m by 9m with an entrance on the SSE, and the other about 17m by 15m with an entrance on the S. Around these hut circles, especially noticeable by the first (most easterly) circle, lies a scatter of small cairns of field-cleared stone, indicating contemporary agricultural activity. The area now to be scheduled is an irregular oval, with a straight section on the WSW side, parallel to the edge of the forestry plantation. The area measures a maximum of 290m NE-SW by a maximum of 175m transversely, to include all four hut circles and an area around them scattered with small cairns, as marked in red on the accompanying map. Statement of National Importance The monument is of national importance as a well-preserved late pre-historic settlement, which has the potential to provide information about prehistoric domestic and agriculture activities. References RCAHMS records the monument as NH 56 SW 10.
Asset/Event Number	38
Asset/Event Name	Strath Sgitheach, settlement NW of Cnoc a'Mhuilinn
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM10495; NH56SW 11
HER Number	MHG8928
Status	Scheduled Monument
Section:	N/A
Easting	251412
Northing	862747
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM10495 The monument comprises the remains of an extensive prehistoric settlement on a SE-facing slope above Strath Sgitheach. The settlement contains at least eight hut circles, the circular foundations of prehistoric timber houses, set in areas of small cairns of field-cleared stones on a heather-clad hillside, just above forestry planting.

There are also at least three cup-marked boulders within the area, of unknown purpose but presumed prehistoric date, and more may well exist. The hut circles have dimensions ranging from 13m by 11m to 9m by 7m, and where entrances can be seen these are all in the SE or S arcs. The most easily visible hut circles are a loose group of three on the SW bank of the Allt nan Raichean.

The area to be scheduled is a very irregular figure-of eight shape on plan, measuring a maximum of 640m NE-SW by a maximum of 260m transversely. This area includes the hut circles, the field clearance cairns and the cup-marked boulders, as well as an area of land around and among these features in which evidence relating to their construction and use is likely to survive. The area is indicated in red on the accompanying map.

Statement of National Importance

The monument is of national importance as a well-preserved late prehistoric settlement which has the potential to provide information about prehistoric domestic and agricultural activities and land-use changes. The close association of a settlement with a number of cup-marked boulders is unusual, although the significance of this is not known.

References

Bibliography

RCAHMS records the monument as NH 56 SW 11.

RCAHMS (1979) The Royal Commission on the Ancient and Historical Monuments of Scotland. The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region, The archaeological sites and monuments of Scotland series no. 6, Edinburgh, 18, 21, Nos. 132, 172.

Asset/Event Number	39
Asset/Event Name	Kilphedir, hut circles & chambered cairns 700m E of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM290; NC91NE 32
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	299563
Northing	918691
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM290 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7006/kilphedir On the edge of a small plateau SE of the broch (Asset 65/SM1870/NC91NE 27) are two cairns (A and B) discovered during field investigation - one possibly chambered. Visited by OS (W D F) 21 May 1960. Of the two cairns, 'A' is roughly circular and chambered, measuring about 56ft NW-SE by 51ft transversely and 4 or 5ft high. Three large slabs are exposed, probably the back slab, a divisional or portal slab, and the NE portal at the passage entrance, indicating a chamber orientated NW-SE and entered from the SE.

Cairn 'B' measure about 70ft by 55ft and 3ft high. Parts of a boulder kerb or possibly two concentric kerbs together with several large earthfast slabs, are visible. As the plan is not evident, the classification of this cairn is uncertain.
A S Henshall 1972, visited 1963.

As described by Henshall, cairn 'A' is chambered, but insufficient details of 'B' are exposed to enable it to be classified as a chambered cairn, though the presence of large stones in the body of the cairn render this highly probable.

Re-surveyed at 1:10,560.
Visited by OS (N K B) 29 November 1976.

Asset/Event Number	40
Asset/Event Name	Achkinloch, stone setting SW of, Loch Stemster
Type of Asset/Event	Standing stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM420; ND14SE 2
HER Number	MHG1315
Status	Scheduled Monument
Section:	N/A
Easting	318790
Northing	941779
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM420 No description available from HES. Description taken from Canmore

<https://canmore.org.uk/site/8271/achkinloch>.

A setting of stones in the form of a truncated oval, open to the SE, which shows no sign of ever having been a completed oval. It measures 225ft long by 100ft and may originally have comprised about sixty stones of which about a third have either weathered or been removed. The stones are thick slabs of flag, standing to an average height of 5ft and set at intervals of about 8ft with their broad faces towards each another, not along the line.

A cist measuring 5ft by 3ft 9ins, formed by four slabs set on edge stands against the most northerly stone of the setting.

This monument, which can be compared only with the example at Broubster (ND06SW 19), should probably be assigned to the earlier part of the Bronze Age.
J Anderson 1886; RCAHMS 1911; R W Feachem 1963.

An unusual setting of standing stones generally as described and planned. One or two stones along the E side outside the uprights, particularly in the NE corner suggest that there may have been a retaining kerb on this side, which is on the edge of an escarpment. The cist, roughly oriented N-S, is of the dimensions noted by the RCAHMS (1911), but is not composed of four slabs. The E side is composed of four upright slabs and one similar slab on the W side suggests that this side has been the same. There is no trace of the end stones. Elsewhere the tops of a few other stones in a similar position immediately outside the line of uprights suggests the presence of similar structures as yet uncovered.

Surveyed at 1:10,000.
Visited by OS (I S S) 20 April 1972.

A horse-shoe setting possibly comparable to the arrangement known within some stone circles, including Croft Moraig (NN74NE 12) and Broubster (ND06SW 19) as well as Stonehenge, although its opening to the SSE instead of the SW is untypical.
H A W Burl 1973.

Thirty-six flat, thin stones and snapped-off stumps. In fine weather the conspicuous Mt Morven is visible in the S over the nearby ridge and seems to be indicated by some of the stones. It may well be an astronomical foresight.
E W MacKie 1975.

No change to the previous field report.
Visited by OS (N K B) 6 December 1982.

Activities
Field Visit (30 July 1910)
RCAHMS County Inventory: Caithness

At the SW. corner of Loch Stemster, about ½ m. SW of Achkinloch, is a remarkable setting of standing-stones (pl. XXX.). In form the monument is an irregular oval, broader at one end than the other, and like a horseshoe, having the setting discontinued across one end and that the narrow one. The main axis is N. and S. with the open end towards the latter direction. The total length is 226ft, the width in the middle from side to side, interior measurement, 110ft, and at the open extremity 85ft. The stones are placed with their broad faces at right angles to the direction of the setting, and are on an average from 4' to 5' in height, the highest stone-that at the SW. termination-measuring 6' 4" in height. In breadth they vary from 3' to 5', and in thickness from 8" to 20". They have been placed at distances of 8' or 9' from each other. There are a number of gaps, and presuming that the intervals were regular and that the stones from these gaps have been removed, the number of stones originally forming the monument would be fifty-four. There now remain in situ thirty-four, of which two are mere stumps, and there lie prostrate other three. Abutting against a high stone at the NE. of the monument, and on the outside, is a cist-like construction formed of four slabs set in the ground and measuring 5' X 3' 9" interiorly. There is no evidence of an interment having been found in it.

This monument was surveyed by Sir Henry Dryden in 1871, and his plan was reproduced by Dr Joseph Anderson in his work referred to below.
See Anderson, *The Bronze and Stone Ages*, p. 132 (plan).
RCAHMS 1911, visited 30 July 1911
OS 6" map (1907) 'Standing Stones'

Publication Account (1995) RCAHMS: *Exploring Scotland's Heritage - The Highlands*, 1995
A remarkable setting of large stones, arranged in an unusual way as a long U-shape with one open end. Some 36 slabs or stumps survive, but some stones are missing, and there may originally have been around 54. The average size of the stones is about 1.2m to 1.5m, and the tallest is nearly 2m high. Many of the stones have been taller, but their tops have weathered and split off. The broad faces of the stones are set at right angles to the perimeter of the setting, in contrast to the practice at stone circles. Only one comparable monument is known, a ruinous U-shaped setting at Broubster, Caithness (ND 047608) [Canmore ID 7945]. The purpose of these settings is unknown, but their date is thought to be Bronze Age from their general similarity to stone circles.

Just outside the stones, close to their northeast corner and also along the east side, are some small slabs set on edge, which may be the remains of cist graves, perhaps added to the monument long after its initial purpose was forgotten. A short distance southeast of the stones, on a low hillock, are the remains of an earlier Neolithic round cairn with traces of a central chamber.

Information from '*Exploring Scotland's Heritage: The Highlands*', (1995).

References

Anderson, J. (1886a) Scotland in pagan times: the bronze and stone ages: the Rhind lectures in archaeology for 1882. Edinburgh. Page(s): 133 Vol. 1 RCAHMS Shelf Number: E.2.AND
 Burl, {H} A {W}. (1973b) 'Stone circles and ring-cairns', Scot Archaeol Forum, vol. 4, 1972. Page(s): 72
 Close-Brooks, J. (1986a) Exploring Scotland's heritage: the Highlands, Exploring Scotland's heritage series. Edinburgh. Page(s): 160-1 No. 89 RCAHMS Shelf Number: A.1.4.HER
 Close-Brooks, J. (1995a) The Highlands, Exploring Scotland's Heritage series, ed. By Anna Ritchie. 2nd. Edinburgh. Page(s): 157 No. 97 RCAHMS Shelf Number: A.1.4.HER
 Feachem, R. (1963b) A guide to prehistoric Scotland. 1st. London. Page(s): 74 RCAHMS Shelf Number: E.2.FEA
 MacKie, E W. (1975a) Scotland: an archaeological guide: from the earliest times to the twelfth century. London. Page(s): 223 RCAHMS Shelf Number: E.2.MAC
 RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 80 No. 293 RCAHMS Shelf Number: A.1.1.INV(3).R

Asset/Event Number	41
Asset/Event Name	Cairn Liath, long cairn and round cairn
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM438; ND13SW 7 and 8
HER Number	MHG631; MHG1266
Status	Scheduled Monument
Section:	N/A
Easting	314028
Northing	932077
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM438 The monument consists of 2 prehistoric chambered cairns. The larger is a long cairn known as 'Cairn Liath'. This cairn is orientated WSW-ENE and is wider and higher at the latter end. It measures 58m long and is 18.3m wide to the ENE and 11.3 to the WSW. At its ENE end the cairn is about 1.5m high and there are faint traces of horn-like projections. There are also horn-like projections at its WSW end. There are traces of one chamber in the ENE end and three further chambers along the length of the cairn. About 30m NW of the long cairn are the remains of a circular cairn about 13.4m in diameter. Much of the cairn has been robbed, but three large upright stones in the centre indicate the presence of a chamber. The area proposed for scheduling measures a maximum of 90m NW-SE by 80m SW-NE to include the long cairn, the round cairn and an area around in which traces of activities associated with the construction and use of the cairns will survive. Statement of National Importance The monument is of national importance for its potential to contribute to an understanding of Neolithic/Bronze Age ritual and burial practices. The association of a circular and long cairn is important in the understanding of sequential development of cairn types in Scotland. There are indications that the chambers of the long cairn have not been robbed and it is probable that the burial deposits are complete.

Appendix 1: Gazetteer of Heritage Assets and Events

References

Bibliography

The monument is RCAHMS number ND 13 SW 7 and 8.

Asset/Event Number	42
Asset/Event Name	Cnoc na Maranaich, chambered cairn, burial cist and standing stone
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM443; ND13SW 19
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	313222
Northing	933110
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM443 This monument consists of a chambered cairn, a burial cist, a standing stone and an area of stone quarrying which may be contemporary with the chambered cairn and cist. The chambered cairn is about 19m in diameter and 2m high and is partly turf covered. The central area has been disturbed and this has revealed a number of slabs which once formed part of a chamber. 4 modern cairns surmount the chambered cairn and an old sheep shelter has been constructed on its NE side. 7m to the E is a standing stone formed of a slab of rectangular cross section, pointed at the top and about 2.6m high. About 75m SSE of the chambered cairn is a burial cist with the capping stone still in position. The capping stone measures about 1.2 by 0.9m and beneath its corner can be seen the upright slab of a cist. The interior appears to be untouched. Immediately to the N and NW of the burial cist are traces of quarrying which could be contemporary with the construction of the 2 burial monuments. Two or more large flat stones have been intentionally wedged with blocks of stone in an attempt to loosen them from a natural rock stratum. These stones appear similar to the capping stone used in the cist. The area to be scheduled measures 160m NNW-SSE by 65m NNE-SSW, to include the chambered cairn, the cist, the standing stone and the evidence for quarrying, as shown in red on the attached map.
Asset/Event Number	43
Asset/Event Name	Achorn, broch 200m NW of
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM511; ND13SW 3
HER Number	MHG1262
Status	Scheduled Monument
Section:	N/A
Easting	313696

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	930504
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM511 This monument consists of the remains of a broch. The surviving remains form a large mutilated mound of earth and stone measuring 30m N-S by 27m E-W and about 3.5m high on the N side. A small trench has been dug about 6m SE from the centre of the mound and this has revealed one side of a gallery, or room, in the width of the broch wall. The area to be scheduled measures 50m in diameter, to include the broch and an area around in which traces of activities associated with its construction and occupation will survive. Statement of National Importance The monument is of national importance for its potential contribution to an understanding of prehistoric settlement and defensive architecture. References Bibliography The site is RCAHMS number ND 13 SW 3.
Asset/Event Number	45
Asset/Event Name	Balantrath, broch 135m WNW of
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM522; ND13SW 6
HER Number	MHG1265; MHG13560
Status	Scheduled Monument
Section:	N/A
Easting	314394
Northings	930718
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM522 This monument is a broch situated on a rocky outcrop on the left bank of the Dunbeath Water. The site consists of a large mound of earth and stone situated on the edge of a short vertical cliff. The mound measures approximately 23m NW-SE by 15m NE-SW and is about 3m high. There is some loose stone on top of the mound and a ruined stretch of the outer wall of the broch is exposed on the N side. There are traces of 2 possible sub rectangular structures at the base of the mound to the SW and SE and traces of a ditch can be seen on the NE and SE side of the broch. The area to be scheduled measures a maximum of 50m NW-SE by 35m NE-SW, to include the broch, the associated structures, the ditch and an area around in which traces of activities associated with the construction and use of the broch will survive, as shown in red on the attached map.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	46
Asset/Event Name	Wag Hill, prehistoric settlement 1300m NE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM600; ND13SW 10
HER Number	MHG1254
Status	Scheduled Monument
Section:	N/A
Easting	311886
Northing	932955
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM600 The monument is a Post Medieval settlement which consists of a range of structures. These include 5 rectangular houses, 6 small oval shielings and 8 other irregular foundations, possibly shielings. The buildings vary in size from 3m across to 15m by 3.5m and survive in a variety of conditions which may indicate a fairly long period of occupation. There is also a stone-built sheepfold 14m in diameter to the S of the site. This settlement would appear to represent part of a 'cottar town', many of which were destroyed during the clearances of the late eighteenth and early nineteenth centuries. The area to be scheduled measures a maximum of 300m N-S and 240m E-W, to include the buildings and an area around them in which traces of activities associated with their use will survive, as shown in red on the attached plan. A recent forestry track and adjacent tipping is excluded from the area to be scheduled. Statement of National Importance This monument is of national importance for its potential to contribute to an understanding of prehistoric settlement and land use. This site incorporates important information on the domestic life and economic organisation of a prehistoric community. In addition the building contain evidence of prehistoric domestic architecture. References The monument is RCAHMS number ND 13 SW 10.
Asset/Event Number	47
Asset/Event Name	Wag Hill, prehistoric settlement 1050m NNW of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM603; ND13SW 5
HER Number	MHG1264
Status	Scheduled Monument
Section:	N/A
Easting	310651
Northing	933057
Council	Highland

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM603 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8217/wag .

Galleried Dwelling, 'The Wag', Achnaclyth: About 3/4 mile SE of Achnaclyth, on the low ground by the side of the Wag Burn, and adjoining a large sheepfold are the remains of three or four galleried houses bearing the name of 'The Wag'. They all appear to have been oblong on plan, with rounded ends. The best preserved, which lies E-W, measures some 34ft in length and 15ft in breadth. The entrance appears to have been through the S wall, 23ft from the W end. The thickness of the wall has been about 6ft 6ins. The pillars, several of which remain in situ, have been placed at from 3ft to 3ft 9ins from the side walls, and at distances of from 4 ft 9ins and 6ft from each other in the rows. The space in the centre between the rows of pillars measures 5ft 8ins across. Only two of the covering stones remain in position, one on each side. That on the N is 6ft in length and 2ft 8ins in breadth; that on the S, 5ft 9ins long and 2ft 6ins broad. They are both about 8ins thick. The greatest height of wall remaining exposed is 3ft, and the highest pillar measures 2ft 8ins above ground. Outside, as also at the E end, there are the indefinite remains of building. The walls, as usual in these structures, are built of large, flat stones, carefully laid. RCAHMS 1911, visited 1910.

ND 1063 3308. Generally as described by the RCAHMS. There would appear to be three 'wags', two abutting nearest the sheepfolds; the middle one of the three is the best preserved and is as described above. There are the indefinite remains of possible buildings at the E end of the group. The third one is indistinct and consists of a mound some 1.4m high and measuring 20.0 by 9.0m over all; a large quantity of stone lies over the site, the whole being in a very dilapidated state.

Within an area of pasture associated with a now-deserted crofting settlement, are two adjacent homesteads contained within separate mounds of debris, to which some later stone clearance has been added.

The SW mound contains two aisled rectangular houses (A and B). House 'A' is as described by the RCAHMS; 'B' is less well defined, but a single pillar stone and two stretches of inner wall-face are exposed. Its dimensions cannot be ascertained. Immediately to the E of 'A' is a mass of debris which may obscure a further structure, and E of 'B' are four probable pillar stones protruding through the mound, which may represent the remains of a further aisled house.

The NE mound (C) measures 22.0m E-W by 8.5m transversely and 0.6m

high, and contains fragments of an aisled rectangular house. There is much slab-stone in evidence, and towards the E end, which has been quarried, is an upright in situ, 0.7m high. The only other structural detail visible is a length of outer wall face near the W end of the mound. Dimensions of the house are not recoverable.

Revised at 1:10560.

Visited by OS (NKB), 22 December 1982.

References

RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 70, No. 257 illust RCAHMS Shelf Number: A.1.1.INV(3).R

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Clais-Cairn, chambered cairn 550m SW of
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM424; ND12NW 10
HER Number	MHG1074; MHG24192
Status	Scheduled Monument
Section:	N/A
Easting	313361
Northing	926807
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM424 The monument is a chambered cairn and consists of a low stone cairn with traces of a chamber in the centre. The cairn measures 17.5m N-S by 15m E-W and on the N side survives to a maximum height of 1.6m. The cairn is grass-grown, but where the cairn material can be observed it appears to consist of horizontal thin slabs. The entrance passageway to the chamber cannot be traced, but it probably ran from the SE side. A pair of large upright slabs facing in this direction have the appearance of portal stones. 5 or 6 other upright stones form part of the chamber, which may have been as much as 7m long. The area to be scheduled measures 40m SW-NE by 45m SE-NW, to include the chambered cairn and an area around in which traces of activities associated with the construction and use of the cairn will survive Statement of National Importance The monument is of national importance for its potential contribution to an understanding of Neolithic and Bronze Age burial and ritual practices. Much of the chamber and cairn survive at this site and information on the architecture of prehistoric tombs and burial deposits are preserved. References The site is RCAHMS number ND 12 NW 10.
Asset/Event Number	49
Asset/Event Name	Upper Borgue, standing stone 410m SSE of
Type of Asset/Event	Standing stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM502; ND12NW 13
HER Number	MHG1077
Status	Scheduled Monument
Section:	N/A
Easting	312636
Northing	926649
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM502 A high standing stone on the moor at Borgue. This is a slab rising 3.8m above the ground, pointed at its upper extremity, 1.7m broad at greatest breadth, 1m wide at base and 0.5m in thickness. It faces W by N and E by S. The area to be scheduled measures 20m in diameter to include the standing stone and an area around in which traces of activities associated with its erection will survive, as shown in red on the attached map.

Asset/Event Number	50
Asset/Event Name	Upper Borgue, broch
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM596; ND12NW 7
HER Number	MHG1095
Status	Scheduled Monument
Section:	N/A
Easting	312434
Northing	927089
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM596 Immediately behind the disused farm of Upper Borgue are the ruins of a large broch. The broch was built on a natural hillock and includes a large mound with an accompanying outer wall. The mound measures 25 by 26m and is about 4.5m high. There is a large depression on the summit of the mound. The entrance is to the ESE and has been partly opened up at some time in the past, although it is now filled with debris. A portion of the outer facing wall is exposed on the S side of the broch. The broch has been defended from the S round to the NW by a wall which survives as a broad bank. This wall is located about 6.4m from the base of the mound. There are traces of 2 possible associated buildings between the broch and the wall on the N of the site. The area to be scheduled measures 65m WSW-ENE by 50m SSE-NNW, to include the broch, wall and associated structures. The modern building to the SE of the broch is excluded from the scheduled area, which is shown in red on the attached map.

Asset/Event Number	51
Asset/Event Name	Cnoc Bad Asgaraidh, chambered cairn 570m E of, Langwell
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM423; ND02SE 5
HER Number	MHG2426
Status	Scheduled Monument
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	309148
Northing	922244
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM423 The monument comprises a prehistoric chambered burial cairn, situated about 10m E of the Allt Bad Asgaraidh. It is already scheduled, but an inadequate area was included to protect all of the area of archaeological importance, hence this extension. The cairn is about 16m E-W by 12m N-S overall. Much of the cairn material has been removed, and the chamber is exposed at the E end of the cairn. It is sub-divided into two by upright stones. At the E, the cairn abuts a stone wall of much more recent date, and a turf and stone bank runs N-S across the centre of the cairn. Both probably incorporate stone removed from the cairn. The area now to be scheduled is circular, 40m in diameter, to include the cairn, portions of the wall and bank, and an area around in which evidence relating to construction and use may survive, as marked in red on the accompanying map extract.
Asset/Event Number	52
Asset/Event Name	Caen, long cairn 530m NW of, Helmsdale
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM432; ND01NW 5
HER Number	MHG10145
Status	Scheduled Monument
Section:	N/A
Easting	301249
Northing	918022
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM432 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7467/caen-burn-north. On the W side of the Caen Burn are the remains of a long cairn. The cairn is much dilapidated, but no chamber is exposed. It lies ENE and WSW and measures about 100' in length, some 35' in breadth at the E end and 27' at the W. RCAHMS 1911, visited 1909; A S Henshall 1963; Visited by OS (W D J) 24 May 1960. This cairn is as generally described by the previous authorities. It consists of bare stones and rises to 1.0m near the E end, with part of this extremity destroyed by an old track and erosion. Several excavation pits have failed to reveal a chamber. Near the W end, to the S of centre is a rectangular flat-topped, heather covered mound with its axis parallel to that of

Appendix 1: Gazetteer of Heritage Assets and Events

the cairn. It measures 4.0m by 2.8m by 0.3m. Apparent wall coursing is visible on the E, N and S sides. It is a later feature possibly the result of piled excavation debris. Denuded field walls run from the SW and NW corners of the cairn; they are probably contemporary with the early modern ruins in the vicinity.

Visited by OS (J B) 7 May 1976.

References

Henshall, A S. (1963a) The chambered tombs of Scotland, vol. 1. Edinburgh. Page(s): 311, SUT 14 RCAHMS Shelf Number: E.7.1.HEN

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 126, No. 358 RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	53
Asset/Event Name	Bridge of Rhemullen, broch 450m NW of
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM574; ND13SE 12
HER Number	MHG1140
Status	Scheduled Monument
Section:	N/A
Easting	315086
Northing	931354
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM574 The monument consists of a broch with a closely associated settlement. The surviving remains of the broch consist of a turf- covered, level-topped mound, 19m in diameter and 1.3m high. In the NW edge of the mound there is a length of wall one course high which is part of the outer face of the broch wall. The broch is in the centre of a more extensive mound about 49m NW-SE by 41m NE-SW. There are faint traces of archaeological structures in this mound and it appears to represent the remains of a settlement associated with the broch. The area to be scheduled measures 80m NW-SE by 75m NE-SW, to include the broch and the associated settlement. The remains of a post medieval house lie just to the SW of the broch and this is included in the scheduled area in order to provide full protection for the broch and settlement. The area to be scheduled is marked in red on the attached map.
Asset/Event Number	54
Asset/Event Name	Bridge of Badnagie, chambered cairn 610m NNW of
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM425; ND13SE 2
HER Number	MHG963

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Scheduled Monument
Section:	N/A
Easting	315680
Northing	932470
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM425 This monument consists of the remains of a Neolithic/Bronze Age chambered cairn. The remains include traces of the round cairn, which was probably originally about 21m in diameter, and 7 upright stones which indicate the position and plan of internal chambers and an entrance passageway. The entrance was from the SSE, the outer end probably being marked by a small slab 3m within the apparent cairn edge. The outer chamber was 1.5m long, the centre one about 2.7m by 2.1m; no visible remains survive of the inner chamber. The area to be scheduled measures 45m in diameter, to include the chambered cairn and an area around in which traces of activities associated with its construction and use will survive, as shown in red on the attached map.
Asset/Event Number	55
Asset/Event Name	Minera, standing stone 470m S of
Type of Asset/Event	Standing stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM457; ND13SE 22
HER Number	N/A
Status	Scheduled Monument
Section:	N/A
Easting	315537
Northing	934235
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM457 The monument is a tall standing stone on moorland. The stone is a slab 2.4m in height, 0.7m wide and 0.4m thick. It is pointed at the top and faces E-W. There are a number of loose stones which pack the standing stone at its base. The area to be scheduled measures 20m in diameter to include the standing stone and an area around in which traces of activities associated with its erection may survive, as shown in red on the attached map.
Asset/Event Number	56
Asset/Event Name	Minera, broch 90m SSE of
Type of Asset/Event	Broch

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Iron Age
Listing No./NRHE Number	SM568; ND13SE 19
HER Number	MHG1146
Status	Scheduled Monument
Section:	N/A
Easting	315581
Northing	934611
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM568 The monument consists of a turf-covered stony mound approximately 24m in diameter and about 3m high. Near the foot of the mound to the NW a trench has revealed the outer face of the broch and a depression running to the centre of the mound from the W has lintel-like slabs at its outer end and probably marks the line of an entrance passage. The broch rises from a lower mound which contains the remains of an associated settlement. On the S side is a curving wall of stones which represents the enclosure which contained the outbuildings. The site is enclosed with an early modern wall. The area to be scheduled measures 70m E-W by 60m N-S, to include the broch, associated settlement and an area around in which traces of activities associated with the building and occupation of the settlement may survive, as shown in red on the attached map.
Asset/Event Number	57
Asset/Event Name	Carn Liath, cairn & chambered cairn 1200m WNW of Torboll
Type of Asset/Event	Cairns
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1772; NH79NW 1; NH79NW 7
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	273878
Northing	899581
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM17724 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/14795/craig-a-bhlair [north cairn; Asset 57.1] and https://canmore.org.uk/site/14829/carn-liath [south cairn; Asset 57.2; NH79NW 7] North cairn (Asset 57.1; NH79NW 1) On the lowest slope of An Droighneach, at its extreme E end, lies an oval cairn, with its longest axis SE and NW, measuring 60' x 49'. Though much excavation has been done on it, neither cist nor chamber is exposed.

RCAHMS 1911.

This cairn is formed by a large mound of bare stones 19.0m NW-SE by 16.0m transversely having a height of about 0.8m on its N side and a height of about 1.5m on its S side. Its top is mutilated but in the centre is a large slab set on edge which may indicate a chamber or its passage.

Visited by OS (W D J) 6 April 1964.

The dimensions of the cairn are as described by the previous OS field investigator. On the summit protruding through the cairn material are three, possibly four, upright slabs, the disposition of which suggest the back-slab and portal stone(s) of an Orkney-Cromarty type chamber. The entrance passage would have been from the SE arc; there is a hollow extending from this arc to the chamber, but no stones in situ are visible. The cairn is similar in all respects to Carn Liath (NH79NW 7 [Asset 57.2]), a chambered cairn visible some 500 m to the SE.

Revised at 1/10,000.

Visited by OS (N K B) 14 October 1980.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 48, No. 135 RCAHMS Shelf Number:

A.1.1.INV(2)

South cairn (Asset 57.2; NH79NW 7)

Torboll (Carn Liath): A round chambered cairn. The steep-sided cairn is of bare stones and has a diameter of 60ft. The line of the outer half of the passage is seen as a hollow running through the cairn material. The chamber is complete except for the roof.

RCAHMS 1911; A S Henshall 1963.

In 1860 when collecting stones from this cairn a large stone cup with perforated handle was found in this cairn and is now deposited in the museum at Dunrobin Castle.

Name Book 1873.

A large chambered cairn, generally as described above. It measures about 19.0m in diameter and has an average height of about 2.3m. The passage and chamber are well-defined.

Visited by OS (W D J) 7 April 1964.

Carn Liath, a chambered cairn, as described and planned by Miss Henshall, now preserved in a clearing in a forestry plantation.

In Dunrobin Museum is a steatite bowl from Torboll (Accession no: X 56) which may be the 'large stone cup with perforated handle' noted in the Ordnance Survey Name Book (ONB, 1873), but the date of accession is not known. It measures 6.7ins in diameter and 3.4ins high. (see also NH79NE 37)

Revised at 1:10,000.

Visited by OS (N K B) 15 November 1980.

References

Henshall, A S. (1963a) The chambered tombs of Scotland, vol. 1. Edinburgh. Page(s): 332, SUT 58 plan RCAHMS Shelf Number: E.7.1.HEN

Ordnance Survey (Name Book. (1848-1878) Object Name Books of the Ordnance Survey (6 inch and 1/2500 scale). Page(s): Book No. 9, 118 RCAHMS Shelf Number: Ref

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 47-8, No. 134 RCAHMS Shelf Number:

A.1.1.INV(2)

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	58
Asset/Event Name	Brae Cottage, two hut circles 120m and 200m ESE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1830; NH79NW 19
HER Number	MHG11682
Status	Scheduled Monument
Section:	N/A
Easting	270406
Northing	898677
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1830 The monument comprises the remains of two later prehistoric houses, usually referred to as hut circles. The monument was originally scheduled in 1935, but a mapping error led to the protected areas being located in the wrong position. The current proposal rectifies this. The hut circles lie at around 110m OD, in an area of gently sloping ground on the S side of Srath Carnaig, close to the junction of Abhainn an t-Sratha Charnaig and Allt Lochan Iain Bhuidhe. The northernmost hut circle measures approximately 18m in diameter with walls spread up to 3.5m and standing up to 1m high. The walls are thickest around the entrance in the ESE and traces of a bank or lynchet have been recorded running from the N side of the entrance. The second hut circle lies 80m to the SE and measures 15.5m in diameter over walls standing around 1m high and spread up to 3m wide. This hut circle also has an ESE-facing entrance, and possible elements of a field boundary have also been recorded next to the walls. The two areas to be scheduled are shown in red on the attached map extract. The first is circular, 40m in diameter centred on the NW hut circle; the second is circular, 35m in diameter, minus a chord on its SW side, centred on the SE hut circle.
Asset/Event Number	59
Asset/Event Name	Brae, broch, Strath Carnaig W of Mound Junction
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM1840; NH79NW 11
HER Number	MHG11624; MHG45709
Status	Scheduled Monument
Section:	N/A
Easting	270502
Northing	899016
Council	Highland
Condition:	N/A
Alignment:	N/A

Importance: N/A

Description

<https://portal.historicenvironment.scot/designation/SM1840>

No description available from HES. Description taken from Canmore

<https://canmore.org.uk/site/14797/strath-carnaig>.

The ruins of a broch with a circular enclosure abutting on its ENE side.

RCAHMS 1911, visited 1909.

A broch, surviving as a hollowed mound, c.2.0m high, on a rise above a flood-plain. The inner face, 1.2m maximum height, and the outer face, 0.4m high, are visible for most of the periphery, giving an internal diameter of c.8.3m within a wall c.4.3m thick in the ENE widening to c.5.7m in the WSW. According to OS (W D J) in 1963 there was an entrance, 1.5m wide in the WSW, and although this cannot be verified as it is obscured by tumble, the increased thickness of the wall and a hollow in the rim of the mound suggest that it was in this arc. There is a gap, 0.7m wide, in the inner face of the broch on the N side, probably the entrance to a mural gallery, the inner face of which is discernible for a short distance in the S. The central court is obscured by debris. Abutting on the E arc of the broch is a circular stone-walled enclosure of uncertain date and purpose. It measures 16.0m in diameter between the centres of a wall spread to c.2.5m wide, which is overlaid by a modern wall. No entrance is apparent. There are traces of a smaller enclosure on the NW side of the broch. They may both be associated with depopulated buildings in the vicinity.

Some 8.0m from the broch on the slopes to the S and W is a discontinuous line of stones, possible part of a revetment.

Visited by OS (W D J) 17 June 1963 and (N K B) 10 November 1969.

Activities

Field Visit (12 August 1909)

RCAHMS County Inventory: Sutherland

107. Broch, Brae.

On the left bank of the Allt Lochan Ianan Bhuidhe, ¼ m. above its junction with the Carnaig River, are the ruins of a broch. The situation is near the base of the hill, on the top of a bank whence the ground slopes sharply to the flat land by the river. The broch now occupies the upper end of a large walled enclosure. It is a complete ruin, and has been greatly pillaged. The interior diameter is 27'. The greatest height of walling visible in the interior is about 5', and externally the wall is reduced to the foundation. The position of the entrance is uncertain, but it appears to have been from the WSW. The thickness of the wall at that point is 19', while on the ENE. It is 14'. A large circular enclosure abuts on the broch towards the ENE.

OS 6-inch map, Sutherland, Sheet civ.

RCAHMS 1911, visited (AOC) 12th August 1909.

Publication Account (2007) Euan W Mackie Broch Corpus 2

NH79 1 BRAE ('Strath Carnaig') NH/7050 9903 (visited in 1989)

Probable broch in Dornoch, Sutherland, in the form of a crater-like mound of rubble on a rise above a flood plain; there is turf growing in the interior. The structure is badly ruined although both wall faces are visible throughout most of the circuit. These indicate an internal diameter of about 8.3m with the wall thickness varying from 4.3m to c. 5.7m.

An entrance was reported on the west-south-west in 1963 but later visitors, including the author, could not see it [1]. A gap 0.7m wide in the inner face on the north side was thought to be the entrance to an intramural gallery and by 1989 a fragment of this gallery had become exposed. A small section of scarcement can also be seen now.

Dimensions: internal diameter c. 8.3m, wall thickness 4.3m thick in the east-north-east, and c. 5.7m in the west-south-west. The overall diameter should therefore be about 18.3m (60.0 ft) along that diameter but is perhaps less elsewhere. In 1989 an accurate survey of the inner wall face was undertaken and showed it to have been set out close to a true circle with a radius of 4.05 +/- 0.11m (a diameter of 8.10 m, or 26.56 ft) .

Sources: 1. NMRS site no. NH 79 NW 11: 2. RCAHMS 1911a, 38, no. 107.

E W MacKie 2007

References

MacKie, E W. (2007) The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c.700 BC-AD 500: architecture and material culture, the Northern and Southern Mainland and the Western Islands, BAR British series 444(II), 444(1), 2 V. Oxford. Page(s): 783 RCAHMS Shelf Number: E.9.1.MAC

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 38, No. 107 RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	60
Asset/Event Name	Invershin Farm, standing stone 220m ENE of
Type of Asset/Event	Standing stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1791; NH59NE 3
HER Number	MHG12888
Status	Scheduled Monument
Section:	N/A
Easting	257610
Northing	896741
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1791 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/13012/invershin-farm .

'A quadrangular standing stone facing north-south and measuring 5'5" in height above ground, 2'6" in breadth at base, and 1'5" near the upper end, and 1'4" in thickness. Some 4' to the S of it a stone, 5' in length and 7" to 8" in thickness, hog-backed in form, protrudes to a height of about 1' from the ground.'

RCAHMS 1911.

The stone is as described as is the stone 4ft to the south of it.
Visited by OS (E G C) 8 June 1963.

These stones are as described by previous authorities. According to the farmer, (Mr Donald MacKay, Invershin Farm) large quantities of quartz are found in the vicinity of the stones whilst ploughing; much quartz was visible on the surface of the field which was under stubble at the time of investigation.
Visited by OS (N K B) 20 December 1976.

Activities

Field Visit (5 October 1909) RCAHMS County Inventory: Sutherland

96. Standing-Stone, Invershin Mains.

In a cultivated field at Invershin Mains about ½ m. S. of Inveran Inn, and 100 yards W. of the high road, is a standing-stone. It faces N. and S., is quadrangular in section, measuring 5' 5" in height above ground, 2' 6" in breadth at base, and 1' 5" near the upper end, and 1' 4" in

Appendix 1: Gazetteer of Heritage Assets and Events

thickness. Some 4' to the S. of it a stone, 5' in length and 7" to 8" in thickness, hog-backed in form, protrudes to a height of about 1' from the ground.

OS 6-inch map, Sutherland, Sheet cvii. (unnoted).

RCAHMS 1911, visited (AOC) 5th October 1909.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 35, No. 96 RCAHMS Shelf Number: A.1.1.INV(2

Asset/Event Number	61
Asset/Event Name	East Kinnauld, fort 1000m NE of Eiden
Type of Asset/Event	Fort
Date and/or Period	Iron Age
Listing No./NRHE Number	SM1861; NC70SW 17
HER Number	MHG11556
Status	Scheduled Monument
Section:	N/A
Easting	274216
Northing	901455
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1861 The monument consists of a prehistoric or early historic fort on the summit of a commanding bluff. The fort consists of an inner enclosure with outworks. The inner enclosure measures about 37m from NE to SW by 29m from NW to SE and is defined by walls about 3m thick. Within this enclosure is a small circular enclosure about 9m in diameter. The fort is surrounded with outworks. The bottom of a low cliff facing the W side of the fort has been scarped to form a ditch and outer bank. A natural trench across the steep N approach to the fort has been scarped and heightened on the N side to give added defence. Extending from the SW side of the fort in a S direction down the slope to end on a rock outcrop is a stony bank some 33m in length with an entrance gap. Tenuous traces indicate that the bank continued round to the E and then N to terminate on the NE side of the fort or on the rocky slope close by it. On the E side an elongated mass of stones represent the remains of another bank The area to be scheduled measures 120m N-S by 105m E-W, to include the fort and outworks and an area around the fort in which traces of activities associated with the construction and occupation of the fort may survive, as shown in red on the attached map.
Asset/Event Number	62
Asset/Event Name	East Kinnauld School, broch NE of
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM1862; NC70SW 5

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG9446
Status	Scheduled Monument
Section:	N/A
Easting	274385
Northing	901596
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1862 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/6005/east-kinnauld. The remains of a broch situated on a rocky peak and commanding an extensive view. It is much dilapidated, but the wall stands to a considerable height, beneath debris, all round. The interior diameter is 31ft and the wall thickness 17ft. The entrance, 2ft 9ins wide at the exterior and 3ft wide at the interior end, is in the west and has an orthodox guard-chamber in the south wall. Another chamber opens into the north wall, forward of the guard-chamber, its end being linked to the interior of the broch by a passage, at right angles to the chamber. The debris in the courtyard obscures the entrance to the staircase but the gallery is visible in the arc NW-NNE. The maximum height of wall visible above the debris on both the outside and the inside is 4ft. (RCAHMS 1911, visited 1909). The broch is as described and planned by the RCAHMS, except that the gallery is traceable round most of the circuit and short sections of the scarcement are visible on the inner wall-face of the south arc. Resurveyed at 1:2500. Visited by OS (R B) 28 February 1966. A broch 9.5m diameter within a wall 4.1m thick in the E arc increasing to 5.1m in the sides of the entrance passage, door-checked, from the west. There are traces of a mural gallery in the north half only, and no sign of a scarcement. Other features are as described in the RCAHMS report. Revised at 1:10,000. Visited by OS (J M) 18 March 1981. Activities Field Visit (6 June 1995) RCAHMS Afforestation Land Survey, Rogart This broch is situated on a rocky hill about 200m NE of East Kinnauld fort (NC70SW 17). The court measures 9.4m in diameter within a rubble wall, 5.2m thick and up to 3m high. The entrance-passage lies on the W, the internal opening of which is surmounted by a triangular lintel, and guard-chambers open off either side of the passage. An intra-mural gallery is visible within the N arc of the wall. (ROG95 541) Visited by RCAHMS (PJD) 6 June 1995 Publication Account (2007) Euan W Mackie Broch Corpus 2 NC70 1 EAST KINNAULD 1 NC/7438 0159 This broch in Rogart, Sutherland, stands in a very remote position, high among the crags on the north side of and overlooking Strath Fleet – a fertile valley with many modern farms (visited 11/7/63 and 9/7/85). The structure, now a vast heap of stones, is built of irregular blocks of igneous or metamorphic rock and is full of its own debris. It stands about 122m (400ft) above the sea.

The entrance is on the west and fairly clear of debris at the outer end. There is an oval guard cell on its right, choked with debris but apparently 3.05m (10ft) deep; the lintel of the doorway to this cell is visible, immediately behind a built door-check at a distance of 2.74m (9ft) from the exterior. The passage is 5.19m (17ft) long and 84cm (2ft 9in) wide at the outer end. Three lintels are still in position over the outer part of the passage, starting at the door-checks.

On the left of the passage is the curved wall of another mural cell with a doorway to the interior of the broch, capped with a small triangular lintel [2, fig. 65] It is not clear exactly what this is, but it is unlikely to be a second guard cell; such rarely communicate with the interior (but see Clach toll – NC02 1). However the Commission also saw what seemed to be the edge of a doorway leading from this cell to the entrance passage, but this feature is now obscured. Thus the broch may have two guard cells.

Traces of a mural gallery are visible in places all round the wallhead. At 7-8 o'clock it is higher than the entrance lintels, so it should be an upper gallery at this point. Yet it continues round to 12 o'clock where it looks as if it is at ground level since the natural rock surface outside the broch is much higher at this point. However at 8 o'clock there is a void from the gallery to the interior, the sill of which is exposed; thus the gallery here ought to be an upper one. The author saw no trace of a scarcement on the exposed inner wallface in 1963, but one was reported in 1966 and denied in 1981 [1]. The inner face is well built in spite of the coarse nature of the stone.

Dimensions (author's measurements): 6-12 o'clock, overall diameter 18.61m (61ft); internal diameter 9.61m (31ft 3 1/2 in). The wall is therefore c. 4.42m thick and the wall proportion would then be about 48.4% (the entrance passage was found to be only 4.88m (16ft) long, not 5.19m (17ft)). More recently the wall was stated to vary in thickness from 4.1m on the east to 5.1m on the sides of the entrance on the west [1]. This last measurement conflicts with the author's.

Sources: 1 NMRS site no. NC 70 SW 5; 2. RCAHMS 1911a, 164-5, no. 477. E W MacKie 2007.

References

MacKie, E W. (2007) The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c.700 BC-AD 500: architecture and material culture, the Northern and Southern Mainland and the Western Islands, BAR British series 444(II), 444(1), 2 V. Oxford. Page(s): 632 RCAHMS Shelf Number: E.9.1.MAC

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 164-5, No. 477 plan RCAHMS Shelf Number: A.1.1.INV(2)

Romankiewicz, T. (2011) The Complex Roundhouses of the Scottish Iron Age: An architectural analysis of complex Atlantic roundhouses (brochs and galleried duns) with reference to wheelhouses and timber roundhouses, BAR British series 550 (I), 550 (II), 2 V. Oxford. Page(s): 213-215 RCAHMS Shelf Number: E.9.1.ROM

Asset/Event Number	63
Asset/Event Name	Carrol, broch 600m SSW of, Loch Brora
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM1846; NC80NW 1
HER Number	MHG10822; MHG10833; MHG10834
Status	Scheduled Monument
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	284665
Northing	906460
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1846 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/6493/carrol .

The Broch of Carrol, measuring between 30ft 6ins and 31ft internal diameter and surviving to an average height of 10ft, has been excavated. The entrance in the ESE with two door checks and a guard chamber is still roofed, at this point the wall is 14ft thick. In the SW arc is an entrance to a ground floor chamber and to steps rising to first floor level. A first floor gallery is discernible in the NE arc.

The broch is surrounded by an outer wall 7 to 8 ft thick, with a ditch or trench outside it about 20ft wide. The entrance through this outer defence is in line with that of the broch, and a walled passage 5ft wide connects the two.

Finds from the excavation, now in Dunrobin Museum, include a steatite cup with side handle, a rude shale ring and a concave oval plate of ox horn with four rivet holes at one end and two iron rivets in situ.

J M Joass 1873; RCAHMS 1911, visited 1909.

A broch generally as described by RCAHMS (1911), the outer face being obscured by debris from the cleared interior. The existence of a walled passage between the entrances of the broch and outer defences is uncertain due to debris. The occasional earthfast stone protruding through the turf between broch and outer wall indicates secondary structures. Revised at 1/10,000.

Visited by OS (W D J) 24 April 1964 and (N K B) 3 November 1975.

The Accession no's of the finds from the broch, in Dunrobin Museum, are: 1868.51-4; sherd 1890.1; pebble tool 1891.3.

Information contained in TS of Catalogue of Dunrobin Museum by A S Henshall.

Field Visit (25 September 1909) RCAHMS County Inventory: Sutherland

27. Broch, Carrol. On the W. side of Loch Brora, about $\frac{3}{4}$ m. S. of Carrol Rock and $\frac{1}{2}$ m. NW. of Brora, at an elevation of about 200' above the level of the loch, is situated the broch of Carrol. The entrance is from the ESE. through a passage 14' in length, 2' 9" wide at the outer end, and 3' 9" at the inner. The passage has been protected by two doors, the checks of which occur at 3' 4" and 9' 1" from the outside. Within the outer checks the passage is 3' 10" wide. Its greatest height is 5' 8", and the roofing remains almost complete, only two slabs being wanting. Behind the inner jambs are bar holes at 2' and 2' 4" respectively from present ground level. That on the W. side passes through the wall into the chamber to the S. of the stair. At a distance of 2' behind the outer checks, or 5' 11" from the outside, on the right of the passage, is the entrance to a guard-chamber 2' wide, 3' 6" long, and 3' 11" high. The chamber closely resembles that at Kintradwell. It is oval, 8' 6" long by 6' 4" wide, and 9' 6" high. The roof is entire, except for an aperture in the apex about 2' square. The diameter of the interior of the broch is from 30' 6" to 31'. At 19' distant from the W. side of the doorway on the interior is the entrance to a chamber and stair 3' 6" above the present floor level, through a passage 6' long, 2' 10" wide at the entrance, and 3' 7" in the interior. The stair rises to the right for 11'. Thirteen steps are visible, varying from 2' 6" to 3' 3" in length, 7" to 8" across the tread, and 4" to 5" in height. To the left a narrow passage 18' long and about 2' 6" wide leads to a chamber some 7' 6" long and 4' wide at the back, which is straight. Only a small portion of the roof remains at the back of the chamber, which is 9' high above present floor level. The steps which have been described as leading to this

chamber are now obscured with debris. The breadth of wall across the top of the stair is 14' 8". The greatest height of wall above the present floor level in the interior is 13', and the average height about 10'. Some 9' above floor level is a scarcement about 1' 6" wide. The greatest height of wall visible on the exterior is 5'. From a point 7' distant from the side of the entrance passage towards the E. a portion of a gallery remains for 25', with a width of from 1' 8" to 2'. The width of the opening on to the interior above the entrance passage is about 2' 11".

Outside the broch a well-built wall from 7' to 8' thick surrounds it at a distance of about 23' on the N., 28' on the NW., and 13' on the S., having a ditch or trench outside it about 20' in width. The approach through these defences is in line with the entrance to the broch. The main wall, where it passes through it, is some 38' distant; and an outer wall, 7' thick, which here takes the place of the counterscarp of the ditch, is about 52' distant. From the main or inner wall, a passage 5' wide, walled on either side, leads to the broch. Some 53' to the S. of the entrance a small passage leads through the wall on the inner side of the ditch under a lintel, 3' wide, and, from present level, 2' high. The moor to the W. is marshy, and, in consequence, the ditch appears to have been discontinued in that direction. The setting of flagstones inside the broch on the left of the entrance, measuring 7' by 3', is in rather a ruinous state, and the flags are getting displaced. Lying in the interior is a round stone, with a circular depression on the top, in which the pivot of a door has evidently worked.

The broch has been excavated, and the relics found are preserved in the Museum at Dunrobin. These included a steatite cup, with a side handle; a rude shale ring; and a concave oval plate of ox horn, like the bowl of a large spoon, with four rivet holes at one end and two iron rivets in situ (fig. 2 and Pl. II.).

Some 40 yards to the N. of the broch is an ill-defined enclosure measuring about 66' in length by 33' at the W. end and considerably less at the E.

The shallow weem-like structure noted in Arch. Scot., 8' in diameter at top, and with well-built wall, is visible about 80 yards to the SE. of the entrance to the broch. The walling around it is now almost obscured by grass. The trench running NE. from it is still apparent, and is also visible running towards the bank of the Allt Coire Aghaisgeig on the SW. See Arch. Scot., v. pt. i. p. 107; (relics illus.).

OS 6-inch map: Sutherland Sheet xcvii.
RCAHMS 1911, visited (AOC) 25th September 1909.

Publication Account (2007) Euan W Mackie Broch Corpus 2
NC80 3 CARROL ('Craig Carril') NC/8462 0646

This solid-based broch in Clyne, Sutherland, is situated on the west side of Strath Brora overlooking the Loch Brora and about 61m (200ft) above it (visited 11/7/63, 1971 and 10/7/85: in 2002 it was behind a deer fence).

Description

The site, a huge heap of stones when seen from a distance, stands on a broad, level platform or plateau projecting from the shallowly ascending side of the valley. It is invisible from the water's edge. An outer wall, with traces of a ditch beyond, surrounds the broch and there are signs of a gateway in this in line with the broch entrance. This broch was cleared out by order of the Duke of Sutherland probably in about 1870 and "during the visit at Dunrobin of a distinguished lady associate of the Society of Antiquaries of Scotland" [2, 107] (This might have been Christine MacLaglan of Stirling (see Scott Archaeol Journ 27.1 (2005), 102-4)). A short description of the results of the work was published by the local minister, the Rev. J M Joass [2]. Most of the outer face is still buried by the debris which was thrown out of the interior at that time. The finds are in the museum in the grounds of Dunrobin Castle [3].

Thick bushes were growing in the interior of the broch in 1971 and were cut down by the author in that year for a theodolite and tape survey. They have since grown up again, sheltered by the massive wall which still stands 3.6m (12ft) high most of the way round. The

entrance passage is on the east-south-east and is 4.27m (14ft) long, 84cm (2ft 9in) wide at the outer end and 1.14m (3ft 9in) at the inner [3, fig. 2]. Traces of the lower parts of the sides of the chamber over the entrance, opening only to the interior, are clearly visible above the lintels and confirm that the structure is a hollow-walled broch. The passage does not seem to have been any better preserved at the beginning of the 20th century.

There are two door-frames at distances of 1.0m (3ft 4in) and 2.77m (9ft 1in) from the outside, and both sets of checks are faced with massive stone slabs set at right angles to the walls. The front checks are formed by the passage widening to 1.17m (3ft 10in) behind them but the rear ones are formed of slabs projecting from straight walls. All except two of the passage lintels are in situ and their height above the floor (which seems to be the original one, though strewn with rubble) is 1.73m (5ft 8in). A bar-hole and socket are behind the inner checks at heights of 60cm (2ft) and 71cm (2ft 4in) above the passage floor respectively.

A guard cell opens off the right of the passage 61cm (2ft) behind the outer checks; its doorway is 1.20m (3ft 11in) high and contrasts with the height of the almost complete corbelled cell behind, which is 2.90m (9.5ft).

The doorway to the mural stair is at 9 o'clock and its sill is at least 91cm (3ft) above the floor. The stair rises to the right and in 1909 13 steps were preserved up to a height of 3.3m (11ft) to the wallhead; the same number can be seen now and there could be more at the base of the flight hidden by rubble. The uppermost three steps of the flight are rising at a more inward angle than the rest, as if there was a shallow corner in the stairway here.

Three steps lead down to the left of the doorway into the stair-foot guard cell which is in fact a long stretch of mural gallery running for 5.80m (19ft), almost as far as the entrance passage and not far above ground level. This cell or gallery is now almost completely unroofed although it was apparently found with half the roof – described as “corbelled” [2] – intact. Joass describes how the bar-hole in the entrance passage mentioned earlier runs 91cm (3ft) back from the entrance passage to the end of this long cell, but the author omitted to look for this feature during his last visit; it does not appear on the relevant photograph (though the inner quarter of the end is invisible on this).

Because of the length of the stair-foot cell the broch might be classified as a hybrid form between the ground-galleried and solid-based types; however the remainder of the wall base is completely solid and in every way a standard northern structure.

A scarcement of the ledge type is preserved on the interior wallface from about 1 to 5 o'clock and 2.75m (9ft) above the floor; its width is about 40-46cm (15-18in). Part of the upper mural gallery is visible at about 5 o'clock, going anti-clockwise for some distance and on top of the massive solid wall base; it is about 46cm (18in) wide and its present base is at about scarcement level. The lintels for the stair-foot gallery would have been at about the same height. The upper gallery also runs over the guard cell, making use of the capstone of the latter in its floor, and it must be at least 91cm (3ft) higher than the entrance lintels here. The sides of the chamber over the entrance show no trace of the gallery, which presumably was blocked by it.

The outer wall is 2.14 - 2.44m (7 - 8ft) thick and its distance from the broch varies from 3.97 - 8.54m (13 - 28ft) ; there is a ditch 6.10m (20ft) wide beyond. The outer entrance is in line with that of the broch and a walled passage 1.53m (5ft) wide connects the two features; it is protected by a forework wall about 3.05m (10ft) further out, instead of by the ditch. There were various presumably secondary flagged structures inside the broch which were considerably dilapidated in 1909.

The excavations

The description of the excavations [2] is brief and simply refers to 91cm (3ft) of “unctuous earth” found lying on the floor of the central court, presumably covered by rubble. One extended human skeleton was found on the floor (presumably on top of the earth mentioned) to the right of the entrance, and another on the landing at the foot of the intra-mural stair; a copper finger-ring was found with the former, and both were presumably burials put in place shortly after the broch was abandoned.

Few traces of obvious secondary occupation were reported (there was no secondary wall around the central court, for example), though one might assume that the human burials were such. One might also suppose – judging from comparable deposits in more skilfully explored brochs – that the “unctuous earth” itself belonged to a later stage of the occupation of the tower but because of the primitive methods of exploration used decisive evidence is lacking.

Structural analysis

That this is a definite hollow-walled broch is shown by the remains of the chamber over the entrance passage and by those of the upper intra-mural gallery in the north-east arc. No further details are preserved so one cannot know, for example, if the stairway led up to a landing with a door-sized opening leading from it inwards to the scarcement.

Finds [2, 108 - 9] (in Dunrobin Castle Museum)

The internal deposits of the broch consisted of 91cm (3ft) of “unctuous earth” and ashes lying directly on the floor and surmounted by stony debris.

Evidence of iron consisted of 2 fragments of slag (outside the broch) and the 2 rivets mentioned below.

Bronze objects included 1 finger ring (with the human skeleton mentioned above, which was either put down through the “unctuous earth” or laid on top of it).

Objects of bone and antler included 1 horn oval plate with 4 rivet holes and with 2 iron rivets still in position, and 1 deer's horn handle with a pin-hole.

Stone objects included a few hammerstones, 2 mortars, some quern fragments (presumably rotary), a sandstone disc (diam. 17.5cm or 7in), 1 steatite handled cup (Illus. 7.383) and 1 crude jet ring 6.5cm (2.5in) in diameter.

Other items: there were also 1 amber bead, broken, 2 flint flakes and 1 chert flake.

Pottery: in the museum are 5 small, plain wall sherds (ARC 501B).

Dimensions

Internal diameter 9.30 - 9.46m (30.5 - 31ft); external diameter not measurable but should be about 18.0m (59ft) if the whole wall is the same thickness as the length of the entrance, that is 4.42m (14.5ft). In this case the wall proportion would be about 51.6%. In 1971 a fresh survey of the central court showed that the plan of this was almost exactly circular, and that the radius of the circle that fits it best is 4.69 +/- 0.06m. The internal diameter is thus close to 9.396m (30.81ft).

Sources: 1. NMRS site no. NC 80 NW 1: 2. Joass 1890, 107 - 9: 3. RCAHMS 1911a, 9 - 11, no. 27, fig. 2 and pl. II: 4. Close-Brooks 1995, 134.

E W MacKie 2007.

References

Close-Brooks, J. (1995a) *The Highlands, Exploring Scotland's Heritage series*, ed. by Anna Ritchie. 2nd. Edinburgh. Page(s): 134 RCAHMS Shelf Number: A.1.4.HER

Joass, J M. (1873) 'The brochs or "Pictish Towers" of Cinn-Trolla, Carn-Liath, and Craig-Carril, in Sutherland, with notes on other northern brochs', *Archaeol Scot*, vol. 5, 1, 1873. Page(s): 107

MacKie, E W. (2007) *The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c.700 BC-AD 500: architecture and material culture, the Northern and Southern Mainland and the Western Islands*, BAR British series 444(II), 444(1), 2 V. Oxford. Page(s): 643-645 RCAHMS Shelf Number: E.9.1.MAC

RCAHMS. (1911a) *The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland*. Edinburgh. Page(s): 9-10, No. 27 plan, illust RCAHMS Shelf Number: A.1.1.INV(2)

Romankiewicz, T. (2011) *The Complex Roundhouses of the Scottish Iron Age: An architectural analysis of complex Atlantic roundhouses (brochs and galleried duns) with reference to wheelhouses and timber roundhouses*, BAR British series 550 (I), 550 (II), 2 V. Oxford. Page(s): 208-209 RCAHMS Shelf Number: E.9.1.ROM

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	64
Asset/Event Name	Eldrable, broch SW of
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM1863; NC91NE 20
HER Number	MHG9863
Status	Scheduled Monument
Section:	N/A
Easting	298332
Northing	918169
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1863

The monument comprises the remains of a broch, an Iron Age fortified dwelling. It was scheduled in 1938, but the original documentation is defective and the area covered was much too small to include all of the area of archaeological importance, hence this extension.

The most prominent feature of this monument is the remains of the broch itself, a mass of drystone masonry standing well over 1.5m tall. Over half of the outer wall face is visible, as well as stretches of the inner wall face, suggesting an inner diameter of 7.5m and a wall thickness of from 3.5 to 4.5m. The entrance has been on the ESE side. Outside the broch there are traces of external buildings and a possible rampart and ditch, particularly on the N and W sides, although these are obscured by vegetation. A later wall runs approximately E-W across the site, incorporating some of the broch walling into itself, and a track crosses the area to the W of the broch, running over some of the possible outer works.

The area now to be scheduled is circular, 50m in diameter, centred approximately on the outer wallface of the broch in its NW sector. This area includes the broch itself and the outer works to N and W as well as an area around these in which further evidence relating to the construction and use of the broch is likely to survive. The area is marked in red on the accompanying map extract.

Asset/Event Number	65
Asset/Event Name	Kilphedir, broch 540m ENE of, Helmsdale
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM1870; NC91NE 27
HER Number	MHG9856
Status	Scheduled Monument
Section:	N/A
Easting	299439
Northing	918907
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition: N/A

Alignment: N/A

Importance: N/A

Description <https://portal.historicenvironment.scot/designation/SM1870>
No description available from HES. Description taken from Canmore
<https://canmore.org.uk/site/7000/kilphedir>.

Situated on the summit of a hillock is a broch measuring 33' NE-SW by 32' transversely, within a wall 7' average height and 12'6" thick, widening to 15'6" at the entrance which is 3' wide at the exterior, and 4'10" at the interior. It is checked for a door, but no entrance to a guard chamber is visible. Opposite the entrance there is a passage giving access to the stairway and a ground floor mural chamber.

The commanding position of the broch is strengthened by outworks, probably the most impressive in Sutherland. The base of the hillock is encircled by a ditch 9' deep below an outer rampart 14' broad. A short outer ditch runs parallel with the inner one for about 20' at the N end. A small oval enclosure is contained in the outer rampart to the W side of the broch. The course of the ditch is broken on the N side by the approach which passes between its open ends.

A quartzite pebble from the broch is in Dunrobin Museum Acc No: 1869.5 (Information from TS of Catalogue of Dunrobin Museum, by A S Henshall).

J M Joass 1865; J Nicol 1910; RCAHMS 1911, visited 1909; R W Feachem 1963; A Young 1964; E W MacKie 1975.

This broch has remained unaltered since the visit by the RCAHMS.

Re-surveyed at 1:10560

Visited by OS (W D J) 20 May 1960 and (N K B) 6 October 1976.

Activities

Publication Account (1995) RCAHMS: Exploring Scotland's Heritage - The Highlands, 1995

The broch is on the hill east of the burn but cannot be seen from the road by the bridge. A sheep track just east of the bridge leads up the hill, bearing slightly right, and passes through a deserted crofting settlement under the line of the electricity poles; there are the foundations of a longhouse, and some smaller buildings and a kiln barn. From the first skyline the broch is visible on the hillside above, some 15 or 20 minutes walk from the road.

The broch is set on a prominent knoll with good views up and down the valley. It is ruinous, and appears as a great mass of rubble spilling down the hill, but it has a particularly impressive set of outer defences, now all covered with heather so that the stone walls look like banks. There are terraces east and west of the broch defended by an inner rampart, a deep ditch and a stout outer rampart. At the west end, the entrance is protected by an extra short stretch of rampart.

Just below the broch is a good path along the side of the hill; follow it west to find three hut circles on the edge of the ravine above the burn (NC 991190). One hut circle has much thicker walls than the other two, and this one has a souterrain leading out of it beneath its wall. The far end has been broken into, so light comes in, but it may be full of water and gumboots are needed. A muddy hole, originally provided with steps, drops down into the narrow souterrain passage; the latter has drystone walls and a lintelled roof and is about 9.50m long.

There are more hut circles up the burn and on the west bank. Some of the latter were excavated in the 1960s, and shown to have interior posts that supported their thatched roofs, while radiocarbon dates from two huts suggest they were occupied in the last few centuries BC. A number of clearance cairns round these and other hut circles are probably of the same date and show that some patches of ground were cultivated. Many other hut circles can be seen on the hill slopes along the north side of the Strath of Kildonan, some indicated on the OS map, and at least six other souterrains have been found, three still

attached to hut circles. Part of one at Suisgill (NC 897250) is close to the east side of the road; only the far end survives, with lintelled roof and a curved end-wall, in which is a small built-in recess or cupboard .

Information from 'Exploring Scotland's Heritage: The Highlands', (1995).

Publication Account (2007) Euan W Mackie Broch Corpus 2

NC91 7 KILPHEDIR ('Kilphedir Tower') NC/9943 1891

This probable broch in Kildonan stands high up on the moor overlooking the valley of the river Helmsdale, with a clear view up and down the strath (visited 12/7/63). It stands on a natural knoll which has been entirely surrounded at its base by a formidable ditch 2.75m (9ft) deep within an earthen rampart 4.27m (14ft) wide. There is a short outer ditch, parallel with the inner and about 6.10m (20ft) long, at the north end, facing the river where the approach is over flat ground. On the south-west a causeway crosses the main surrounding ditch and Swanson describes a ramp on the north-west which she thinks was the main approach to the broch[8].

The broch itself is almost completely hidden under a vast pile of stones which look as though they have never been disturbed. Several features are visible however. The entrance is on the north-west (facing the ramp) with three lintels still in position: it is 4.73m (15.5ft) long, 92cm (3ft) wide at the outer end, 1.48m (4ft 10in) at the inner and with 15cm (6in)-deep door-checks at a distance 3.05m (10ft) in; these are presumably built rebates but were not noted by the author in 1963, though Swanson saw the one on the right [8, 780]. No signs of a guard cell are visible.

At 12 o'clock can be seen the doorway from the interior to an intra-mural gallery which probably contains the stair: this was in fact seen here, together with a stair-foot guard cell, in 1909, but there were no signs of the steps in 1963 even though the gallery – 76-92cm (2.5 - 3ft) wide – is exposed down to 61cm (2ft) below the present wallhead. A short stretch of the inner face of a mural gallery is visible at 10 o'clock but no signs of a scarcement ledge are apparent on the interior wallface. Three lintels are in position over the gallery in the arc from 2-5 o'clock. A quartzite pebble from the broch was in the collection of the Dunrobin Castle Museum [1].

This is another site which seems to have been somewhat better preserved in the recent past. Stuart visited it in about 1866 and stated that "The present example has walls of about fifteen feet in thickness, containing chambers which enter from the central open space." He also noted that "A flight of stairs, formed of flags in the centre of the wall, is yet entire." [7, 290]. The drawing from the early 1860s shows this better preservation well.

Dimensions: the broch's internal diameter is 10.07m (33ft) from north-east to south-west (on the 6-12 o'clock axis) and 9.76m (32ft) transversely. Swanson gives it as 9.6m north-south [8]. The wall thickness at the entrance is 4.27m (14ft) (4.73m, or 15.5ft, according to the Commission) and the total diameter here is 18.15m (59.5ft): the wall proportion would thus be 45.5%.

Sources: 1. NMRS site no. NC 91 NE 27: 2. Joass 1864, 246: 3. RCAHMS 1911a, 104-05, no. 307, fig. 35 and pl. III: 4. Young 1962, 186: 5. Feachem 1963, 173: 6. MacKie 1975, 218: 7. Stuart 1868: 8. Swanson (ms) 1985, 779-82: 9. Close-Brooks 1995, 152-3, no. 84: 10. Armit 2003, 36, 80: 11. Dockrill 2002, 160.

E W MacKie 2007

Note (7 February 2015 - 18 October 2016) Atlas of Hillforts of Britain and Ireland

The Kilphedir broch is situated in a commanding position overlooking the Strath of Kildonan, occupying the crest of a hillock high up on the northern flank. Around the foot of the hillock, however, there is also a substantial earthwork comprising a ditch up to 6m in breadth, with a counterscarp rampart standing up to 2.5m above its bottom. In places, particularly around the eastern half of the circuit, there are also traces of a bank on the inner lip of the ditch, but this detaches itself from this line on the SE and appears to be forming a smaller enclosure on the crest of the hillock. A gap in the ditch on the NW marks the position of the entrance, and is flanked on the E by a short length of an outer ditch with a counterscarp

bank. The area enclosed measures about 60m from NNW to SSE by up to 32m transversely (0.16ha), though aerial photographs suggest that there may also be a rather smaller enclosure occupying the crest of the hillock. The interior around the broch is otherwise featureless. The broch itself, which is largely choked with rubble, measures about 10m in diameter within a wall about 4.3m in thickness, its features including a gallery on the S and a checked entrance passage on the NW.

Information from An Atlas of Hillforts of Great Britain and Ireland – 18 October 2016. Atlas of Hillforts SC2797

References

- Armit, I. (1998i) Scotland's hidden history. Stroud, Gloucestershire. Page(s): 107-9 fig 63
RCAHMS Shelf Number: E.2.1.ARM
- Armit, I. (2003) Towers in the North: the Brochs of Scotland. London. Page(s): 36, 80
RCAHMS Shelf Number: E.9.1.ARM
- Close-Brooks, J. (1986a) Exploring Scotland's heritage: the Highlands, Exploring Scotland's heritage series. Edinburgh. Page(s): 152-3, No. 84 RCAHMS Shelf Number: A.1.4.HER
- Close-Brooks, J. (1995a) The Highlands, Exploring Scotland's Heritage series, ed. by Anna Ritchie. 2nd. Edinburgh. Page(s): 149-50 No. 93 RCAHMS Shelf Number: A.1.4.HER
- Davidson, Cowley, Barneveld and Ferguson, J L, D C, J and L M. (1999) 'Archaeological mapping in the north of Scotland', in Frodsham, P, Topping, P and Cowley, D, 'We were always chasing time.' Papers presented to Keith Blood, Northern Archaeol (Spec Edition, vol. 17/18, 1999. Page(s): 18 RCAHMS Shelf Number: E.2.1.BLO
- Dockrill, S. (2002) 'Brochs, economy and power', in Ballin Smith, B and Banks, I, In the shadow of the brochs: the Iron Age in Scotland, A celebration of the work of Dr. Euan Mackie on the Iron Age of Scotland. Stroud. Page(s): 160
- Feachem, R. (1963b) A guide to prehistoric Scotland. 1st. London. Page(s): 173 RCAHMS Shelf Number: E.2.FEA
- Joass, J M. (1865a) 'Two days' diggings in Sutherlandshire', Proc Soc Antiq Scot, vol. 5, 1862-4. Page(s): 246
- Mackie, E W. (1975a) Scotland: an archaeological guide: from the earliest times to the twelfth century. London. Page(s): 218 RCAHMS Shelf Number: E.2.MAC
- Mackie, E W. (2007) The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c.700 BC-AD 500: architecture and material culture, the Northern and Southern Mainland and the Western Islands, BAR British series 444(II), 444(1), 2 V. Oxford. Page(s): 651-652 RCAHMS Shelf Number: E.9.1.MAC
- Nicol, J. (1910) Orkney and Shetland miscellany. Page(s): 107-10
RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 104-5 No. 307 RCAHMS Shelf Number: A.1.1.INV(2)
- Romankiewicz, T. (2011) The Complex Roundhouses of the Scottish Iron Age: An architectural analysis of complex Atlantic roundhouses (brochs and galleried duns) with reference to wheelhouses and timber roundhouses, BAR British series 550 (I), 550 (II), 2 V. Oxford. Page(s): 219-221 RCAHMS Shelf Number: E.9.1.ROM
- Young, A. (1964) 'Brochs and duns', Proc Soc Antiq Scot, vol. 95, 1961-2. Page(s): 186

Asset/Event Number	66
Asset/Event Name	Kilphedir, hut circle 800m NNE of, Helmsdale
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1871; NC91NE 3
HER Number	MHG9853
Status	Scheduled Monument
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	299211
Northing	919411
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1871 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7003/allt-cille-pheadair . This is the same description for Asset 25/SM2810. Asset 66 is the hut circle B described therein.

Asset/Event Number	67
Asset/Event Name	Kilphedir, hut circle and souterrain 450m NNE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1872; NC91NE 28
HER Number	MHG9855
Status	Scheduled Monument
Section:	N/A
Easting	299133
Northing	919034
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1872 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7001/allt-cille-pheadair . This is the same description for Asset 23/SM2808. Asset 67 is the hut circle A and souterrain described below.

Asset/Event Number	68
Asset/Event Name	Salscraggie Lodge, souterrain 40m SW of
Type of Asset/Event	Souterrain
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1884; NC91NE 26
HER Number	MHG9857
Status	Scheduled Monument
Section:	N/A
Easting	299879
Northing	918279
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1884 The monument consists of a souterrain, filled in many years ago, but with masonry surviving underground. The souterrain was discovered when an earthen mound, about 7.5m in diameter and 2m high, was being cleared away. This mound may have been the remains of a hut circle. The souterrain was entered by a flight of 6 steps leading into a covered passage. The passage was 6.7m long, about 1m wide and 1.4m high. The sides were built of boulders and the roof flagged. Within the souterrain were found a human arm bone, and parts of 3 querns. A slight mound now marks the site of the souterrain and possible hut circle. The area to be scheduled measures 40m in diameter, to include the souterrain, hut circle and an area around in which traces of activities associated with the construction and use of the souterrain may survive, as shown in red on the attached map. https://canmore.org.uk/site/6999/salscraggie-lodge In the centre of the lawn in front of Salscraggie Lodge is a souterrain, the entrance to which was discovered when an earthen mound, some 25' in diameter and 6' to 8' high, possibly the remains of a hut circle, was being cleared away. It is entered by a flight of six steps, 2' wide, leading to a covered passage 3' wide and 4' to 5' high, its extreme length being 22'. The sides are built of boulders and the roof is flagged. Within the gallery, when it was cleared, were found a "human arm bone", a rotary quern, a portion of another, and a saddle quern, all of which with the exception of the first item, are lying around the entrance. A B Scott 1899; RCAHMS 1911, visited 1909. This souterrain was filled in many years ago, and there are now no surface indications. Visited by OS (W D J) 20 May 1960 and (N K B) 19 November 1976 References RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 112, No. 324 fig. 34 RCAHMS Shelf Number: A.1.1.INV(2) Scott, A B. (1899) 'The earth-houses of Kildonan, Sutherland', The Scot Antiq Northern Notes Queries, vol. 13, 52, 1899, April. Page(s): 55-60
Asset/Event Number	69
Asset/Event Name	Clach Mhic Mhios, standing stone, Glen Loth 4000m N of Lothbeg Bridge
Type of Asset/Event	Standing stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1778; NC91NW 11
HER Number	MHG9980
Status	Scheduled Monument
Section:	N/A
Easting	294040
Northing	915080
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Description	https://portal.historicenvironment.scot/designation/SM1778 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/7059/clach-mhic-mhios. Situated on a slight eminence on the moor, to the E of the hill road from Loth to Kildonan, is a standing stone of red sandstone. It is 11' high, 4' 11" broad where broadest about 7' from the ground, 2' 9" broad at the base, and 1'3" thick. It faces ESW and WNW. It is known as the 'Clach Mhic Mhios'. Near the large standing stone are two stones of smaller size erected "in the same manner". Statistical Account (OSA) 1793; RCAHMS 1911. This stone is as described above. The two smaller stones mentioned were not located. Visited by OS (E G C) 4 June 1961 and (J B) 20 April 1976. References OSA. (1791-9) The statistical account of Scotland, drawn up from the communications of the ministers of the different parishes, in Sinclair, J (Sir. Edinburgh. Page(s): Vol. 6, 321 RCAHMS Shelf Number: B.2.2.STA RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 163, No. 474 illust RCAHMS Shelf Number: A.1.1.INV(2) Ruggles, C L N (ed.. (1988a) Records in stone: papers in memory of Alexander Thom. Cambridge. RCAHMS Shelf Number: E.7.RUG
Asset/Event Number	70
Asset/Event Name	Caen, long cairn 460m NNW of
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1771; ND01NW 13
HER Number	MHG10227
Status	Scheduled Monument
Section:	A1.4
Easting	301473
Northing	918157
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	High
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A pronounced mound of stone extending along a low terrace mid-way up the slope of the NE side of the Caen burn's glen. Tall and dense bracken surrounds the cairn and partially overgrows it on the periphery, distorting the dimensions. https://portal.historicenvironment.scot/designation/SM1771 The monument is a prehistoric chambered burial cairn. The monument is a long cairn, 41m WNW-ESE and varying from 7m to 9m transversely. It has been built into a hillslope and is a maximum of 1.3m tall. The remains of a ruined field wall associated with a nearby depopulated settlement extend from either end of the cairn. The area to be scheduled measures a maximum of 80m WNW-ESE by 45m N- S, to include the chambered cairn and an area around it in which traces of activities associated with its construction and use may survive, as indicated in red on the accompanying map.

Statement of National Importance

The monument is of national importance for its potential contribution to an understanding of prehistoric ritual, religious behaviour and burial practices. There is no indication of the location of the chamber of this cairn, which may indicate that any burials associated with the monument are undisturbed.

References

The monument is recorded in the RCAHMS as ND 01 NW 13.

Asset/Event Number	71
Asset/Event Name	Greysteil Castle, broch, Loch Rangag
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM555; ND14SE 4
HER Number	MHG1588
Status	Scheduled Monument
Section:	N/A
Easting	317941
Northing	941677
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM555 The monument comprises the remains of a partially-excavated broch. The monument was first scheduled in 1938 but an inadequate area was included to protect all of the archaeological remains. The present rescheduling rectifies this. The monument is situated on a partly artificial peninsula on the E side of Loch Rangag. It survives as a turf-covered mound approximately 20m in diameter and 4m in height. A guard chamber is visible on the N side of the debris-filled entrance passage in the E. Part of a mural chamber is visible in the NW. On the landward side of the peninsula is a heather-covered stone bank approximately 1m in height and 3-4m wide, extending N-S for a distance of 26m. About 11m from the N end of the bank is a gap with a turf-covered causeway extending from it across the isthmus to terminate on the broch. However, the causeway is off-set from the broch entrance and may not be contemporary with the broch. Stonework is evident extending into the loch for a distance of several meters. The area to be scheduled is a circle 55m in diameter centred on the centre of the broch to include the broch and an area around (including under water) in which evidence relating to its construction and use may survive, as marked in red on the accompanying map.
Statement of National Importance	This monument is of national importance as the remains of an Iron Age broch which the partial excavation demonstrates has the potential to provide information on the nature of settlement and defensive architecture during this period of prehistory. Significant archaeological remains - perhaps some waterlogged - will survive in and around the broch.
References	The monument is recorded by RCAHMS as ND 14SE 4.

Appendix 1: Gazetteer of Heritage Assets and Events

RCAHMS 1911, THIRD REPORT AND INVENTORY OF MONUMENTS AND CONSTRUCTIONS IN THE COUNTY OF CAITHNESS, Edinburgh, HMSO, 60-1, No. 222.

Asset/Event Number	72
Asset/Event Name	Turnal Rock, hut circle complex 250m NW of Langwell Tulloch broch.
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM13631; ND02SE 13
HER Number	MHG811; MHG39431
Status	Scheduled Monument
Section:	N/A
Easting	309624
Northing	922540
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM13631

The monument comprises a complex of three conjoined roundhouses or hut circles, likely to date to the Iron Age (between 500 BC and AD 500). The monument is located approximately 90m above sea level on rising ground on a southeast facing slope above Langwell Water.

The hut circles form a roughly trefoil grouping; the smallest positioned at the north with one to the northeast and another to the south. Each structure is roughly circular and survives as low stone and turf walls up to 3m wide and 1.25m high. The hut circles measure between 10.5m and 15.5m in diameter. Each hut circle has an entrance approximately 1m wide facing into a small enclosed yard. The yard is to the southeast of the hut circles and is defined by a low stone wall, measuring 4m in length and running between the south and northeast circles, with a break for an entrance. The hut circle to the northeast contains a substantial mound of stones in the centre measuring up to 3.5m in diameter and 1m high. A low wall runs southeast from the northeast hut circle and terminates at a sub-rectangular enclosure measuring 6m by 4.5m. This low wall may be contemporary with the hut circles and the enclosure is possibly of later date. Abutting and possibly cutting the northeast hut circle, on the east side, is a sub-oval enclosure, perhaps of a later date.

The scheduled area is rectangular in shape and includes the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map.

Statement of National Importance

The monument is of national importance as an example of a well-preserved prehistoric settlements. It has an inherent potential to make a significant addition to our understanding of the past, in particular the design, construction and use of hut circles in northern Scotland and the Caithness region. There is high potential for well-preserved archaeological remains to survive within and immediately outside the buildings. Unusually for this type of monument, the three hut circles are conjoined with a related connecting yard forming a rare and interesting complex. Its value is enhanced as one of a group of monuments in a remote upland landscape with possibly contemporary defended sites in close proximity. The loss of the monument would significantly diminish our future ability to appreciate and understand

Appendix 1: Gazetteer of Heritage Assets and Events



late prehistoric domestic buildings in Scotland and the relationship between other sites such as single houses and brochs in the Iron Age.

References

Royal Commission on the Ancient and Historical Monuments of Scotland:
<http://www.rcahms.gov.uk/canmore.html> CANMORE ID 7528.

Highland Council HER reference MHG9852.

Fairhurst, H and Taylor, D (1970), 'A hut circle settlement at Kilphedir, Sutherland', *Proc Soc Antiq Scot*, 103, 65-103.

Asset/Event Number	73
Asset/Event Name	Carn nan Uaigh, prehistoric settlement
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM13627; NC91SW 1
HER Number	MHG9941; MHG43811
Status	Scheduled Monument
Section:	N/A
Easting	293476
Northing	914054
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM13627

The monument consists of the upstanding remains of a later prehistoric or early historic settlement, consisting of two aisled buildings known as 'wags', probably dating to between around 100 BC and AD 600. They are visible as two long buildings, set around 10m apart, defined by low turf banks with pairs of edge-set slabs in the interior. The settlement lies 170m above sea level, on the sloping ground of the valley side, overlooking the Loth Burn.

The southeast most structure is rectangular on plan, defined by low turf banks measuring about 13m east-west by 6.6m transversely, though the west end is overlain by a later wall. In the interior two parallel rows of edge-set stones define a central space around 2m wide. The second structure lies around 10m to the northwest and measures about 13m east-west by 5.8m transversely with upright slabs in the interior. The west end is overlain by the foundations of a later structure, and the north wall line has been robbed and is indistinct, with large displaced stones visible.

The scheduled area is irregular on plan, to include the remains described above and an area around within which evidence relating to the monument's construction and use is expected to survive as shown in red on the accompanying map. To the northwest, the scheduled area extends up to, but excludes, a later stone wall.

Statement of National Importance
Cultural Significance

The cultural significance of the monument has been assessed as follows:

Intrinsic Characteristics

The monument is visible as two rectangular structures defined by low turf covered banks with edge set slabs in the interior. The east structure appears the better preserved of the two and is visible as turf covered banks representing the outer walls. Pairs of edge-set slabs set two metres apart are visible within the interior. It is overlain by a later wall at the west end. The west structure is overlain by the later foundations of a probable farmhouse and the north wall line has been robbed in the past.

Both structures have been disturbed by later buildings but the structures are in relatively good, stable condition at present, with their plans discernible. Furthermore there is good potential for the survival of archaeological deposits, including occupation and abandonment debris, floor deposits, artefacts and environmental remains such as charcoal or pollen within, beneath and around the upstanding structures. The settlement therefore has the potential to add to our understanding of settlement and economy during the later Iron Age and early historic periods.

Only two 'wag' settlements have been excavated, both before the advent of modern scientific techniques, so no radiocarbon dates have been obtained. From the excavated finds and sequences uncovered, and on the basis associated structures, it would appear that 'wag' settlements were constructed and in use during the later Iron Age or early medieval period. The precise function of such buildings is unclear but the stalls suggest that they have housed livestock. It has been further suggested that they were storehouses for produce, potentially in the form of cattle, the collection of which related to local networks of tribute (Baines 1999, 358).

At Carn Nan Uaigh, there is no clear indication whether the settlement had an extended development sequence or what its precise function was. Scientific study of the structure of the settlement would enhance our understanding of the development sequence and function of this site and of 'wag' settlements in general.

Contextual Characteristics

Wags are a rare class of monument, found only in Caithness and Sutherland. Around 20 examples are currently known. Carn Nan Uaigh is one of a group of 'wag' sites identified within Glen Loth. Two structures lie around 210m northeast at Uiaigh Bheag (Canmore ID 7110), a second 'wag' is recorded around 270m to the south (Canmore ID 7131) and a further two about 1.5km southeast (Canmore ID 7132).

The group within Glen Loth is of significance as it lies at the southernmost extent of the known distribution of this site type and is the only known concentration of these sites away from the 'wag' sites further north in Caithness. All four sites are in a similar landscape context and this context contrasts with earlier Iron Age settlement in the area. The proximity of these monuments can give important insights into the late Iron Age and early historic landscape and add to our understanding of settlement patterns, social organisation, land division and land-use. There is high potential for comparative study of this monument with other settlements in the area to better understand the function of such monuments, their interrelationship and place within contemporary society and economy.

The structures are situated on sloping ground on the valley side, overlooking the Loth Burn. They stand at 170m above sea level, in the upper reaches of Glen Loth.

Associative Characteristics

At this time, there are no known associative characteristics which significantly contribute to the site's cultural significance.

Statement of National Importance

This monument is of national importance because it makes a significant addition to our understanding of the past, in particular of late Iron Age and early historic society in north Scotland and the construction, use and development of 'wag' settlements. Such settlements are restricted to Caithness and Sutherland. The survival of outer walls as well as internal features means that the monument can significantly expand our understanding of domestic buildings, agriculture and economy. As an example of a rare form of domestic settlement, this monument represents an important component of the wider late Iron Age and early historic landscape of settlement and agriculture. The loss or damage of the monument would diminish our ability to appreciate and understand the character of late Iron Age and early historic settlements, as well as society and economy during these periods.

References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 7108 (accessed on 5/9/16).

The Highland Council Environment Record reference is MHG43811 (accessed on 5/9/16).

Baines, A C W 1999 An archaeology of Iron Age domestic settlement in northern Scotland, Unpublished PhD thesis, University of Glasgow.

Canmore

<https://canmore.org.uk/site/7108/>

HER/SMR Reference

<http://her.highland.gov.uk/SingleResult.aspx?uid=MHG43811>

Asset/Event Number	74
Asset/Event Name	Bail A' Chairn, broch
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM13634; ND25SW 8
HER Number	MHG1981
Status	Scheduled Monument
Section:	N/A
Easting	322816
Northing	951715
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM13634

The monument is a broch, a complex stone-built substantial roundhouse, dating to the Iron Age (between 600 BC and AD 400). The monument is visible as an oval mound up to 5.5m high with a terrace approximately 4m wide running round it. To its north are the remains of a slight ditch and bank. It is located approximately 60m above sea level and is surrounded by level, open ground approximately 190m west of the Burn of Acharole.

The mound on which the broch is located is artificial or, if natural, has been significantly altered. The terrace rises from ground level by around 3m as it circles the mound from the southwest to the southeast in a clockwise direction. The broch is visible as a smaller turf-covered mound but excavation in 1904 has shown that the broch was 17.5m in diameter with the wall approximately 4m thick at the entrance located on the east side. Excavation also revealed internal details such as doorways, internal upright flagstone partitions, recesses and intramural stairways. The broch entrance has an extended passage way, a

secondary feature.

The scheduled area is circular in shape, with the exception of a small segment to the southeast, includes the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map. The following are excluded from the scheduling; the top 30cm of the track to the southeast and east and any post and wire fences.

Statement of National Importance

Cultural Significance

The cultural significance of the monument has been assessed as follows:

Intrinsic Characteristics

The monument is a broch, visible as a grass-covered mound sitting on a larger mounded feature with a terrace approximately 4m wide running around its circumference. The upper mound is an accumulation of collapsed building material over the lower levels of the broch structure and its flooring, while the lower mound, if not wholly artificial, has been significantly altered. This lower mound is likely to retain evidence of subsidiary buildings. To its north are the remains of a slight ditch and bank which would have surrounded the mound but has been reduced through agricultural activity.

The site was excavated by Sir Francis Tress Barry in 1904. This revealed the walls of the broch and internal features. An extended entrance passage running 6.7m east from the broch entrance was also discovered. This passage contains evidence of two doorways and an intramural cell on its north, indicating the presence of other structures on the lower mound. The site was backfilled in 1904 but a series of contemporary watercolours and sketches by John Nicholson of Lybster recorded the results of the excavation and show that the interior of the broch was only partially excavated and the exterior mound not at all. The drawings also demonstrate that the broch structure is well-preserved within the mound with its walls surviving to around first floor level, and that it was surrounded by a bank and ditch, of which only slight remains survive. The extended entrance passage and the potential presence of outbuildings on the lower mound indicates this site may have had a complex development sequence. Scientific investigation would allow us to develop a better understanding of the chronology of the site, its date of origin, state of completeness, survival of outer works and outbuildings or related structures, and any development sequence.

By analogy with other excavated brochs, the broch mound, the lower mound and surrounding bank and ditch are likely to contain deposits rich in occupation debris, artefacts and paleoenvironmental evidence that can tell us about how people lived, their trade and exchange contacts, and their social status, as well as provide information about broch architecture and construction methods. A drawing by John Nicholson of Lybster shows finds from the excavation of the broch. These include a stone spindle whorl for textile making, a piece of pottery, a piece of antler which may have been a handle, a tooth from a wolf or dog, and two other bone objects of unknown function, demonstrating the survival of artefacts, including those made from bone.

Brochs in Caithness are typically thought to date from the mid first millennium BC to the early part of the first millennium AD. They are a specific development of complex Atlantic roundhouses and were large complex structures that would have had numerous purposes and a multifaceted role in prehistoric society. They could have accommodated either an extended family or a small community and the construction of broch towers is often understood in terms of elite settlement. Some interpretations have stressed a role as fortified or defensive sites, possibly serving a community across a wider area.

Contextual Characteristics

Brochs are a widespread class of monument across northern Scotland. This example is one of a larger local/regional group in Caithness. It follows the typical Caithness broch pattern of 'mound on mound', where the upper mound is an accumulation of collapsed building material over the lower levels of the broch structure, while the lower mound may retain

evidence of subsidiary buildings and/or defences. The extended entrance passage is a feature found at other Caithness brochs such as at Achvarasdal House broch (scheduled monument reference SM514, Canmore ID 7373).

Location is a significant factor in understanding brochs, as too is intervisibility and relative position with other examples. This monument is within a small group of brochs in the Watten area, mostly located along the burns that feed Loch Watten. These include Carn A' Chladha (scheduled monument reference SM13632, Canmore ID 8805), Achingale broch (Canmore ID 8783) and Nether Banks broch (scheduled monument reference SM609, Canmore ID 8782) located 700m, 2.3km and 2.6km respectively north northeast of Bail a' Chairn. Together they offer the potential to study a group of brochs within a distinct geographic area (along the course of the Scouthal Burn) and draw comparisons with evidence from other brochs around the locality and in Caithness more widely.

Associative Characteristics

There are no known associative characteristics which contribute to the site's cultural significance.

Statement of National Significance

The monument is of national importance because it contributes to our understanding of the past, in particular of Iron Age society in Caithness and the function, use and development of brochs. It is a well-preserved example of a broch with surviving elements of the structure, occupation material and associated remains indicated by the substantial mound and surrounding bank and ditch. Excavation has demonstrated that the broch structure survives within the upper mound to a marked degree and that there is potential for remains of associated buildings on the lower mound. The broch is a prominent feature in the landscape and adds to our understanding of the siting of such monuments in the landscape. This in turn can help our understanding of settlement patterns and social structure during the Iron Age in Caithness. This potential is enhanced by the proximity of other brochs. The informative and significant early archaeological drawings of the excavation of the monument by John Nicholson of Lybster adds to the understanding of the monument. The loss of the monument would significantly diminish our future ability to appreciate and understand the development, use and re-use of brochs, and the nature of Iron Age society, economy and social hierarchy in the north of Scotland.

References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 8805 (accessed on 27/06/2016).

The Highland Council Historic Environment Record reference is MHG 1981 (accessed on 27/06/2016).

Feachem, R, 1963, A guide to prehistoric Scotland. London.

Mackie, E W, 2007, The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c. 700 BC - AD 500: architecture and material culture. Part 2 The Mainland and the Western Islands. BAR, vol 444. Oxford.

RCAHMS, 1911, The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London.

Canmore

<https://canmore.org.uk/site/8805/>

HER/SMR Reference

MHG1981

Asset/Event Number	75
Asset/Event Name	Carn A' Chladha, broch
Type of Asset/Event	Broch
Date and/or Period	Iron Age

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number SM13632; ND25SW 4

HER Number MHG1977

Status Scheduled Monument

Section: N/A

Easting 323148

Northing 952336

Council Highland

Condition: N/A

Alignment: N/A

Importance: N/A

Description

<https://portal.historicenvironment.scot/designation/SM13632>

The monument is a broch, a complex stone-built substantial roundhouse, dating to the Iron Age (between 600 BC and AD 400). It is visible as a grass-covered stony mound 3m high and about 21m in diameter. The monument is located approximately 50m above sea level, on the southwest end of a narrow spur of rising land and lies approximately 100m west of Scouthal Burn.

The broch is prominently sited on an artificially altered mound at the southwest end of natural spur that rises from ground level at its northeast end. This spur appears to have formed the approach to the broch which sits on a levelled mound approximately 1m high with a terrace between 1m and 3.5m wide running round it which broadens out at the approach to the broch. The broch is approximately 21m in diameter with grass covered collapsed walls standing to 3m in height. A stretch of outer facing stones are visible for approximately 3.5m at the south southeast arc of the broch.

The scheduled area is irregular in shape, includes the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map. The following are excluded from the scheduling; the top 30cm of the track to the southeast and east and any post and wire fences.

Statement of National Importance

Cultural Significance

The cultural significance of the monument has been assessed as follows:

Intrinsic Characteristics

The monument is a broch, visible as a prominent grass-covered mound with some exposed outer walling. The mound is an accumulation of collapsed building material over the lower levels of the broch structure and its flooring. It appears relatively undisturbed and surviving features are likely to include the broch walls, intramural cells and stairs, hearths and internal partitions. In addition, there may be later structures within or around the abandoned broch tower. By analogy with a number of excavated brochs, this broch and any associated structures will contain deposits rich in occupation debris, artefacts and palaeoenvironmental evidence that can tell us about how people lived, their trade and exchange contacts, and their social status, as well as provide information about broch architecture and construction methods.

The siting of the broch at the end of a long, narrow, spur is of significance. The highest point has been adapted to provide a level platform for the broch, while the tail of the spur would have served as an approach to the broch and may itself have been adapted for this purpose. Further research could establish the relationship between the broch and the natural feature, and how it was altered for the purposes of siting the broch. The location of the broch and terracing around the broch may indicate that it is the site of an earlier dun with the defences being re-used and altered by the broch builders. The larger terraced area to the north could be a later addition to the site or relate to an earlier phase of development. Scientific investigation would allow us to develop a better understanding of the chronology of the

site, its development sequence and the extent that the natural spur was altered as part of the construction of the broch.

Brochs in Caithness are typically thought to date from between 600 BC and AD 400. They are a specific development of complex Atlantic roundhouses and were large complex structures that would have had numerous purposes and a multifaceted role in prehistoric society. They could have accommodated either an extended family or a small community and the construction of broch towers is often understood in terms of elite settlement. Some interpretations have stressed a role as fortified or defensive sites, possibly serving a community across a wider area. The location of Carn a' Chladha supports the view that defensive considerations could be a factor in the location of brochs but the choice of such prominent sites in the landscape could also relate to control over land and route ways and/or conspicuous demonstrations of status.

Contextual Characteristics

Brochs are a widespread class of monument across northern Scotland. This example is within a small group of brochs in the Watten area, mostly located along the burns that feed Loch Watten. These include Bail a' Chairn broch (scheduled monument reference SM13634, Canmore ID 8805) located 700m to the southwest, Achingale broch (Canmore ID 8783) and Nether Banks broch (scheduled monument reference SM609, Canmore ID 8782), 1.7km and 1.9km respectively north northeast of Carn a' Chladha. Together they offer the potential to study a group of brochs within a distinct geographic area (along the course of the Scouthal Burn) and draw comparisons with evidence from other brochs around the locality and in Caithness more widely.

Many broch towers were deliberately sited to be focal points in the landscape, and is Carn a' Chladha broch is such an example; it is sited in an elevated position on a spur above what may have been a routeway along the Scouthal Burn.

Associative Characteristics

There are no known associative characteristics which contribute to the site's cultural significance.

Statement of National Importance

The monument is of national importance because it contributes to our understanding of the past, in particular of Iron Age society in Caithness and the function, use and development of brochs. This large intact mound will contain the buried remains of a substantial broch. Features such as terraces and wall facings are clearly visible. The adaption of a natural feature, a long and narrow spur, is a significant aspect of the importance of this site, demonstrating how topography was in some instances exploited and accentuated by those building brochs. Carn a' Chladha broch is located in close proximity to a number of other brochs located along the Scouthal Burn and damage or loss of the monument would diminish our future ability to appreciate and understand the development, use and re-use of brochs, and the nature of Iron Age society, economy and social hierarchy in this area and further afield.

References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 8801 (accessed on 27/06/2016).

The Highland Council Historic Environment Record reference is MHG 1977 (accessed on 27/06/2016).

Feachem, R, 1963, A guide to prehistoric Scotland. London.

Mackie, E W, 2007, The Roundhouses, Brochs and Wheelhouses of Atlantic Scotland c. 700 BC - AD 500: architecture and material culture. Part 2 The Mainland and the Western Islands. BAR, vol 444. Oxford.

RCAHMS, 1911, The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London.

Canmore

<https://canmore.org.uk/site/8801/>

Appendix 1: Gazetteer of Heritage Assets and Events

HER/SMR Reference
MHG1977

Asset/Event Number	76
Asset/Event Name	Caen, hut circles and souterrain 982m, 1035m and 1083m NNW of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1841; ND01NW 29; ND01NW 30; ND01NW 6
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	301092
Northing	918669
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1841 The monument is the remains of three roundhouses and a souterrain, probably dating to the Late Bronze Age or Iron Age (between 1500 BC and AD 400). They are visible as the turf-covered upstanding remains of three roundhouses, defined by substantial turf and stone walls. The entrance to a souterrain is visible within the southernmost roundhouse, and the footings of three post-medieval buildings lie adjacent to the northernmost roundhouse. The monument lies at around 90m above sea level, on the hillside above the Caen Burn. The most northerly of the roundhouses measures about eight metres in diameter within walls up to four metres wide and one metre high, increasing in height to about 1.5m around the southeast facing entrance. This entrance is filled with rubble, and wall facings noted within the tumbled south section of the wall west of this entrance may represent the remains of a souterrain. The footings of three post-medieval buildings, the largest measuring 12.5m in length and three metres across, lie adjacent to this roundhouse and appear to have disturbed its western section. The second roundhouse lies around 59m to the south. It is terraced into the slope and measures about nine metres in diameter within banks around 1.7m in height and 1.5m in width, with an entrance on the southeast. The southernmost roundhouse lies around 102m to the south-southwest and measures around 10m in diameter within a turf and stone bank measuring about 0.75m in height and 1.5m in width, increasing to around three metres wide towards the entrance on the southeast. The entrance to a souterrain is visible within the internal wall face in the eastern arc of this roundhouse. The passage runs under and extends beyond the wall of the roundhouse. The scheduled area is in three parts, two of which are circular on plan and the third irregular, to include the remains described above and an area around within which evidence relating to the monument's construction, use and abandonment is expected to survive as shown in red on the accompanying map. The monument was first scheduled in 1934 and the documentation does not conform to current standards. The present amendment rectifies this. Statement of National Importance This monument is of national importance because it can make a significant addition to our understanding of the past, in particular of Bronze Age and Iron Age society and the construction, use and development of settlement in the north of Scotland. It is a good example of later prehistoric settlement that retains its field characteristics and there is good

Appendix 1: Gazetteer of Heritage Assets and Events

potential for the survival of archaeological deposits within and around the roundhouses. As a well-preserved example it can significantly expand understanding of domestic buildings, agriculture and economy. The monument's importance is enhanced by its association with a wider cluster of later prehistoric remains and with later settlement. The loss or damage of the monument would diminish our ability to appreciate and understand the character and development of later prehistoric settlements in Sutherland, society and economy during this period, as well as the long-term use and development of the landscape.

References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 7444, 7446, 7478 (accessed on 11/05/2016).

The Highland Council HER references are MHG10131, MHG10133, MHG10148.

Fairhurst, H. and Taylor, D. B. (1974) A hut-circle settlement at Kilphedir, Sutherland, Proceedings of the Society of Antiquaries of Scotland, vol. 103, 1970-1.

MacIntyre, A. (1998) Survey and excavation at Kilearnan Hill, Sutherland, 1982-3. Proceedings of the Society of Antiquaries of Scotland, vol. 128, 167-201.

RCAHMS (1911) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh.

RCAHMS (1993) Strath of Kildonan: an archaeological survey. RCAHMS: Edinburgh.

Canmore

<https://canmore.org.uk/site/7444/>

<https://canmore.org.uk/site/7446/>

<https://canmore.org.uk/site/7478/>

HER/SMR Reference

MHG10131

MHG10133

MHG10148

Asset/Event Number	77
Asset/Event Name	Caen, long cairn and round cairn 470m and 490m W of
Type of Asset/Event	Cairns
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1770; ND01NW 3; ND01NW 25; ND01NW 67
HER Number	MHG10132; MHG10292; MHG10161
Status	Scheduled Monument
Section:	N/A
Easting	301224
Northing	917759
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey. The main element of the Scheduling, the long cairn, extends into the NW periphery of the corridor, while the round cairn and hut circle lie outwith the survey corridor. The long cairn is highly visible as a pronounced extended mound of stone, whereas the hut circle and round cairn stand below heather.* https://portal.historicenvironment.scot/designation/SM1770 The monument is a chambered long cairn dating from the Neolithic period, probably built

between 3800 BC and 2500 BC, a round cairn, probably Bronze Age in date (between 2500 BC and 800 BC), and a roundhouse, likely dating to the Late Bronze Age or Iron Age (between 1500 BC and AD 400). The long cairn is visible as a substantial trapezoidal cairn of exposed stone. The round cairn visible as a small mound of earth and stone, the roundhouse as a small upstanding structure defined by a penannular bank of turf and stone. The monument is located on a level terrace on the hillside overlooking the Strath of Kildonan, about 38m above sea level.

The long cairn measures about 53m in length by 19.5m in width at the east end, narrowing to around 10m at the west end. It reaches a maximum height of about 3m near the eastern edge, reducing in height towards the west end which is parallel-sided and squared. The cairn has been robbed and disturbed in places, and the presence of a chamber is indicated by two large parallel slabs visible in the disturbance at the eastern end. The round cairn and roundhouse both lie about 10m south of the west end of the long cairn, set around 4m apart. The round cairn lies to the west and measures about 5m in diameter and about 0.6m in height, while the roundhouse is around 3m in diameter within low turf and stone walls with an entrance on the southwest.

The scheduled area is irregular on plan, to include the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map.

Statement of National Importance

The monument is of national importance because it has an inherent potential to make a significant addition to our understanding of the past, in particular the design and construction of burial monuments, and the nature of burial practices and their significance in Neolithic society, as well as Bronze Age and Iron Age society, agriculture and economy in the north of Scotland. The long cairn is a visually impressive monument that retains its field characteristics and demonstrates a complex development sequence. It can be compared with a varied group of other long cairns that survive in the vicinity. The burial cairn and roundhouse are good examples of a burial monument and later prehistoric settlement located with reference to an earlier ritual monument. Chambered cairns are often our main source of evidence for the Neolithic in Scotland, and can enhance our understanding of Neolithic society and economy, as well as the nature of burial practices and belief systems. They are an important component of the wider prehistoric landscape of settlement, agriculture and ritual. Round cairns and roundhouses can significantly expand our understanding of burial practices and belief systems, domestic buildings, agriculture and economy during later prehistory. The monument's importance is enhanced by its association with a wider cluster of later prehistoric remains. The loss of the monument would diminish our ability to appreciate and understand the meaning and importance of death and burial in the Neolithic and Bronze Age and the placing of cairns within the landscape, as well as our understanding of Bronze Age and Iron Age settlements, society and economy and the influence of Neolithic ritual monuments on the siting of later prehistoric ritual and domestic sites.

References

Royal Commission on the Ancient and Historical Monuments of Scotland:
<http://www.rcahms.gov.uk/canmore.html> CANMORE ID 7486, 7440, 7445
The Highland Council HER references are MHG10161, MHG10292, MHG10132.
Fairhurst, H. and Taylor, D. B. (1974) A hut-circle settlement at Kilphedir, Sutherland, *Proceedings of the Society of Antiquaries of Scotland*, vol. 103, 1970-1.
Henshall, A. S. (1963) *The chambered tombs of Scotland*, vol. 1. Edinburgh.
Henshall, A.S. and Ritchie J.N.G. (1995) *The chambered cairns of Sutherland*. Edinburgh University Press: Edinburgh.
MacIntyre, A. (1998) Survey and excavation at Kilearnan Hill, Sutherland, 1982-3. *Proceedings of the Society of Antiquaries of Scotland*, vol. 128, 167-201.
RCAHMS. (1911) *The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland*. Edinburgh.

Canmore

Appendix 1: Gazetteer of Heritage Assets and Events

<https://canmore.org.uk/site/7445/>
<https://canmore.org.uk/site/7440/>
<https://canmore.org.uk/site/7486/>
HER/SMR Reference
MHG10132
MHG10292
MHG10161

Asset/Event Number	78
Asset/Event Name	Caen Burn West, 935m WNW of Caen
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM13647; ND01NW 2
HER Number	MHG10122
Status	Scheduled Monument
Section:	N/A
Easting	300766
Northing	917835
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM13647 The monument is the remains of a long cairn dating from the Neolithic period, probably built and in use between 3800 BC and 2500 BC. It survives as a substantial trapezoidal cairn located on a level terrace on the hillside overlooking the Strath of Kildonan, about 38m above sea level. The cairn measures about 44m in length by around 17m in width at the east end, narrowing to about 12m at the west end. It measures around 1m in height. The eastern end of the cairn narrows gently from east to west, while the western end is parallel sided with a squared end. Remains of a possible kerb are visible on the north side. The cairn has been disturbed and much of the stone removed from the centre of the monument. A later enclosure, likely constructed from robbed cairn material, overlies and extends to the east of the cairn. The scheduled area is irregular on plan, to include the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map. Statement of National Importance This monument is of national importance because it has an inherent potential to make a significant addition to our understanding of the past, in particular the design and construction of burial monuments, and the nature of burial and ritual practices and their significance in Neolithic society. The long cairn is an impressive monument and can be compared with a group of other long cairns that survive in the vicinity. Long cairns can enhance our understanding of Neolithic society and economy, as well as the nature of burial practices and belief systems. They are an important component of the wider prehistoric landscape of settlement, agriculture and ritual. The loss of the monument would diminish our ability to appreciate and understand the meaning and importance of death, burial and ritual in the Neolithic and the placing of cairns within the landscape.

Appendix 1: Gazetteer of Heritage Assets and Events



References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 7434 (accessed on 29/04/2015).

The Highland Council HER reference is MHG10122 (accessed on 29/4/2015)

Henshall, A. S. (1963) The chambered tombs of Scotland, vol. 1. Edinburgh.

Henshall, A.S. and Ritchie J.N.G. (1995) The chambered cairns of Sutherland. Edinburgh University Press: Edinburgh.

RCAHMS. (1911) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh.

Canmore

<https://canmore.org.uk/site/7434/>

HER/SMR Reference

MHG10122

Asset/Event Number	79
Asset/Event Name	Achkinloch, chambered cairn 755m SW of, Loch Stemster
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM419; ND14SE 1
HER Number	MHG1313
Status	Scheduled Monument
Section:	N/A
Easting	318862
Northing	941718
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM419 The monument is the remains of a chambered cairn dating from the Neolithic period (between 3800 and 2500 BC) and is visible as a stone and turf covered oval mound from which large edge set slabs protrude. The cairn lies 160m above sea level on a small knoll overlooking Loch Stemster with good views in all directions. The monument is an Orkney-Cromarty type chambered cairn, which are typically made up of a single long chamber, divided into stall-like "compartments" by stone uprights. The cairn is approximately 24m in diameter and survives to 1.7m in height. There are three large edge set slabs visible near the centre of the cairn, and they likely represent the remains of the multiple compartments which would have been set off the main east-west aligned chamber. The scheduled area is circular on plan, 35m in diameter and centred on the monument, to include the remains described and an area around within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map. The monument was first scheduled in 1933, but the documentation does not meet current standards: the present amendment rectifies this. Statement of National Importance Cultural significance

The monument's cultural significance has been assessed as follows:

Intrinsic Characteristics

The monument has been denuded of most of its cairn material exposing the key structural features of the chamber and passage. However, the monument is in a stable condition at present. The extent of the surrounding cairn is defined by a well-defined turf covered mound of stones measuring approximately 24m in diameter. The large, exposed stones of the chamber form a visually impressive monument. Although the chamber and passage are exposed, excavations of chambered cairns elsewhere show that there is potential for undisturbed deposits, including human burials, artefacts and environmental remains such as charcoal or pollen, within, beneath and around the upstanding structure of the cairn.

This cairn has potential to add to our understanding of ritual and funerary practices during the Neolithic period, and to provide information about contemporary agriculture, economy and environment. Few radiocarbon dates have been obtained for Orkney-Cromarty chambered cairns because many of them were excavated before the advent of modern scientific techniques. However, from the dates available, and on the basis of typological study of the pottery found at such sites, it appears that chambered cairns were constructed and in use between around 3800 and 2500 BC.

At Achkinloch, there is no clear visible evidence of an extended development sequence. However, it is likely that this tomb was in use through several or many generations. Scientific study of the tomb's form and construction techniques compared with other tombs would enhance our understanding of the development sequence of this site and of chambered cairns in general. The monument was a place of burial and ritual during the Neolithic and is likely to have been a prominent place within a group's territory as well as a focal point in the landscape.

Contextual Characteristics

Orkney-Cromarty cairns are found only in north and west Scotland, with the greatest concentration in Orkney. Their design is particularly interesting because the shape and form, with subdivisions formed by upright slabs, is comparable with contemporary house forms such as Knap of Howar, Orkney. It is likely that this was deliberate, with the tombs representing 'houses for the dead'. Achkinloch is an interesting and impressive example with massive stones delineating a large chamber.

While there are few other cairns in the vicinity of Achkinloch cairn, it is located around 50m to the southeast of an impressive horseshoe shaped stone setting which is likely to be related to the cairn (scheduled monument reference number SM420, Canmore ID 8271). Spatial and landscape analysis of this cairn in comparison to other prehistoric monuments in the vicinity could enhance our understanding of the placing of such sites in the landscape and the organisation, division and use of land in the Neolithic.

Chambered cairns are often placed in conspicuous locations within the landscape, at the edge of arable land and overlooking or inter-visible with other ritual monuments. Achkinloch is located on a small knoll overlooking an important north-south route way in Caithness. The cairn overlooks the Loch of Sternster and, of great significance, has a relationship with the large horseshoe shaped stone setting to the northwest.

Associative Characteristics

There are no known associative characteristics which contribute to the site's cultural significance.

Statement of National Importance

The monument has potential to make a significant contribution to our understanding of the past, in particular the design and construction of burial monuments and the nature of burial practices and belief systems in the Neolithic. Ritual and funerary monuments are often our main source of evidence for human activity during the Neolithic in Scotland. They are particularly important for enhancing our understanding of Neolithic society, its organisation, economy, religion and demography. This monument retains its field characteristics to a marked degree. The large upright stones of the chamber are visually impressive and the form of the monument, with evidence for multiple chambers, can contribute to our

understanding of the development and architecture of chambered cairns. Chambered cairns are an important component in understanding the prehistoric landscape of land-use, settlement and ritual. The orientation and position of Achkinloch cairn within the landscape and its close spatial relationship with the nearby stone setting is likely to be significant. The loss of the monument would diminish our ability to appreciate and understand the meaning and importance of death and burial in prehistory.

References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 8269 (accessed on 27/05/2016).

The Highland Council Historic Environment Record reference: MHG1313

Davidson, J L and Henshall, A S. (1991) The chambered cairns of Caithness: an inventory of the structures and their contents. Edinburgh: 89.

Henshall, A S. (1963) The chambered tombs of Scotland, vol. 1. Edinburgh: 257.

RCAHMS. (1911) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London: 76, No. 278.

Canmore

<https://canmore.org.uk/site/8269/>

HER/SMR Reference

MHG1313

Asset/Event Number	80
Asset/Event Name	Carrol, fish farm 430m SE, 410m SSE, 660m and 890m SSW of
Type of Asset/Event	Fish farm
Date and/or Period	Post-medieval
Listing No./NRHE Number	SM13617
HER Number	MHG29870
Status	Scheduled Monument
Section:	N/A
Easting	284620
Northing	906344
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM13617 The monument is a late 19th century fish farm, visible as the earthwork remains of three groups of artificial ponds with feeder and collector lades, set around 220m and 470m apart along the Allt Coire Aghaisgeig, along with the footings of a rectangular building. The monument is located on the hillside on the western side of Strath Brora, between about 30m and 100m above sea level. The fish farm was built before 1878 and in use between 1878 and 1921. The first group of ponds comprise three straight parallel ponds measuring around three metres in width, 55m in length and about 0.8m in depth. A fourth pond, which is less well defined and at least five metres wide, lies to the northeast. The remains of at least one sluice are visible. The second group of ponds lie around 220m downstream to the northeast and comprise a half hexagon arrangement of narrow ponds, together with a bypass lade. At least three parallel ponds around three metres in width are visible to the south and two ponds about five metres wide lie to the north. Edge set slabs, probably for controlling the flow of water, are visible at the

outflow. The third set of ponds lie a further 470m downstream, close to the shore of Loch Brora, and comprise two parallel ponds around 25m long and five metres wide. The footings of a rectangular building lie about 55m west-southwest.

The scheduled area is in four parts, one of which is rectangular in plan and the others irregular, to include the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map.

Statement of National Importance

The monument is of national importance because it has an inherent potential to contribute to our understanding of the establishment and growth of fish farming in Sutherland and Scotland during the late 19th century and early 20th century. It is a good example of an early fish farm that retains its field characteristics. As a well preserved example it can significantly expand our understanding of fish farming, its operation and development within the economy of Scotland. As many of the techniques of artificial fish propagation were first developed in game hatcheries in Scotland, it can enhance our understanding of the role of game hatcheries in the development of modern aquaculture and the fish farming industry in Scotland and more widely. It is notable for the survival of a range of features, including sluices and lades. The loss or damage of this monument would diminish our ability to understand the development and operation of fish farming in Sutherland and across Scotland during the late 19th century and early 20th century, as well as the place of game hatcheries in the development of modern aquaculture.

References

The Highland Council HER reference is MHG29870.

Calderwood, W. L. 1921 The Salmon Rivers and Lochs of Scotland. E Arnold: London.

The Fishery Board for Scotland. 1901 Report for 1900, part II. HMSO: Glasgow.

Hodgson, William Earl. 1906 Salmon Fishing: With a Frontispiece By Joseph Farquharson, A Facsimile in colours of a model set of flies for Scotland, Ireland, England and Wales, illustrations of angling scenes characteristic of these parts of the United Kingdom, and pictures of salmon passes. Adam and C Black: London.

HER/SMR Reference

MHG29870

Asset/Event Number	81
Asset/Event Name	Carradh nan Clach,two standing stones
Type of Asset/Event	Standing stones
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1775; NC91SW 4
HER Number	MHG10029
Status	Scheduled Monument
Section:	N/A
Easting	293736
Northing	912736
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1775 No description available from HES. Description taken from Canmore

<https://canmore.org.uk/site/7138/glen-loth>.

Two standing stones 21ft apart and facing NNE-SSW, on top of the bank above the confluence of two burns. The more easterly stone is a flat slab 4ft 11ins high, 3ft 6ins across the base and 5ins thick. The other stone is square in section, 4ft 8ins high, 1ft 6ins across the front and 1ft 2ins thick. Two or three flat slabs lie on the slope to the SE. These may have formed part of the construction which is known as 'Carradh nan Clach'.

RCAHMS 1911, visited 1909.

The standing stones are as described.

Visited by OS (E G C), 3 June 1961.

No change to previous field report. The name 'Carradh nan Clach' cannot be verified.

Visited by OS (J M), 17 February 1976.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 163, No. 473 RCAHMS Shelf Number:

A.1.1.INV(2)

Asset/Event Number	82
Asset/Event Name	Buolacrabher, chambered cairn 1550m S of
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM445; ND13SE 1
HER Number	MHG1138
Status	Scheduled Monument
Section:	N/A
Easting	315312
Northing	933148
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM445 The monument consists of a heel-shaped chambered cairn of Neolithic/Bronze Age date. The chambered cairn is about 17m N-S by 21m E-W. The chamber is indicated by the tops of 5 stone slabs which protrude through the cairn. There was a passage to the S side of the cairn and on the S side some digging has revealed a straight kerb of drystone walling 3 courses high and about 10m long. The entrance is visible just off centre in the S kerb. The area to be scheduled measures 45m in diameter, to include the chambered cairn and an area around in which traces of activities associated with the building and use of the cairn may survive, as shown in red on the attached map.

Asset/Event Number	83

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Carn na Buaile, fort 750m NNW of Comrie, Contin
Type of Asset/Event	Fort
Date and/or Period	Iron Age
Listing No./NRHE Number	SM11056; NH45NW 5
HER Number	MHG7789
Status	Scheduled Monument
Section:	N/A
Easting	241151
Northing	856690
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM11056 The monument consists of a multi-period hill-top fort, situated at around 180m OD in coniferous woodland. The origins of the fort are probably in the Bronze Age, with continued use into the Iron Age through to modern times, with the ruins of a shepherd's cairn within the interior. The monument is approximately oval on plan, measuring internally 27m ENE-WSW by 16.5m transversely. It is defined by a tumbled stone wall, best preserved in the E where it defends the eastern approach through natural rises in the topography. Here, inner and outer wall faces survive up to two courses in height and a maximum width of 3.3m. To the NW, W and S the wall has largely slipped down the slope. The entrance is in the SE and its S side is visible for c1.5m. The N side of the entrance has collapsed but there are indications that the passageway was around 1.5m wide. The interior is featureless apart from a ruinous cairn, probably erected by shepherds, lying towards the W. The area to be scheduled is irregular on plan, measuring a maximum of 65m E-W and 50m transversely. This area includes the fort and a small area around within which evidence relating to the occupation and use of the site is expected to survive, as marked in red on the accompanying map extract. Statement of National Importance This monument is of national importance as the remains of a multi-period fort which has the potential to provide valuable information on defensive architecture, as well as the nature of settlement and economy, from a number of different periods. References RCAHMS records the monument as NH45NW 5.
Asset/Event Number	84
Asset/Event Name	Preas Mairi, chambered cairn
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2397; NH45NE 5
HER Number	MHG6308; MHG7893
Status	Scheduled Monument
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Eastings	246084
Northing	855847
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2397 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/12447/preas-mairi-contin .

Contin Mains (Pris Maree): This Orkney-Cromarty, rectangular, chambered cairn has been almost entirely removed, only some stones of the chamber remaining. The entrance has been from the E and two portal stones survive, 3' and 3 1/2' high and 2' 4" apart, with a low sill between them. Only the N slab of the outer compartment remains; on its upper edge are three cup marks from 9" - 10" in diameter and 1 1/2" - 5" deep. Two transverse slabs subdivide the chamber whose inner compartment is formed of two slabs; the northern is 2'3" high and the southern 3'4". N of the entrance is a prostrate slab over 7' long; 30' W of the chamber two small parallel slabs 1' apart are exposed - possibly these are slightly displaced and belong to a cist.

A S Henshall 1963

The remains of this chambered cairn are as described above.

Resurveyed at 1/2500.

Visited by OS (R D) 20 January 1965

There is no trace of the alleged cist. Otherwise as described.

Visited by OS (A A) 23 April 1975

No change.

Visited by RCAMS (JRS) March 1989.

Field Visit (29 August 1943) RCAHMS Emergency Survey (Archaeology)

This site was recorded as part of the RCAHMS Emergency Survey, undertaken by Angus Graham and Vere Gordon Childe during World War 2. The project archive has been catalogued during 2013-2014 and the material, which includes notebooks, manuscripts, typescripts, plans and photographs, is now available online.

Information from RCAHMS (GF Geddes) 4 December 2014.

Note (11 November 2019) Scotland's Rock Art Project

Date Fieldwork Started: 11/11/2019 Compiled by: NOSAS

Location Notes: The panel is situated within the small family burial ground of the Mackenzies of Coul. The burial ground is enclosed by a stone wall and is accessed by gates on the W side. The burial ground also contains the remains of a chambered cairn (SM 2397) in the SE part of the enclosed area. The panel is one of the seven remaining stone slabs of the cairn chamber. It is part of the bipartite chamber, located is on the NE side slab of the cairn, just to the W of the 2 portal stones and to the E of the inner portal stones. The vegetation in the burial ground is not being controlled in any way and ivy covers the ground and many of the memorials and the cairn stones. There are some very large trees and ornamental shrubs which make access limited. Prior to the building of the wall around the burial ground there would have been views over the confluence of the Black Water and the River Conon to the S. There is at least one other cup marked stone in the nearby area, Coul Woods. There are other chambered cairns in the area and a henge and crannog.

Panel Notes: This is a large schist slab measuring 1.8 x 0.4m wide and 0.8m high on the S side and 0.6m on the N side. The 3 large cups are on the top of the slab, they are all about 25cm across. The western-most cup is about 15cm deep, the central cup is 11cms deep and the E cup is very shallow in comparison only 5cm deep with no clear edge. The central cup

has an upper overflowing lip on the N side. On the day of the visit the two deep cups were full of water and locally the water from the cups is still thought to be able to cure warts. Whether this belief, which may have considerable antiquity, has encouraged the deepening of the original cups is not clear, but there is no suggestion that there have been any modern changes in the shape of the cups.

References

Henshall, A S. (1963a) The chambered tombs of Scotland, vol. 1. Edinburgh. Page(s): Vol. 1, 346, (ROS 19) plan 347 RCAHMS Shelf Number: E.7.1.HEN
RCAHMS. (1942-3) Emergency Survey of archaeological monuments in military training areas, 1981, 2v. Typescripts. Page(s): Ross 37 RCAHMS Shelf Number: A.1.1.SUR

Asset/Event Number	85
Asset/Event Name	Balnacrae, chambered cairn 230m WSW of
Type of Asset/Event	Chambered cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM2396; NH56SW 1
HER Number	MHG8930
Status	Scheduled Monument
Section:	N/A
Easting	253350
Northing	864635
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM2396 The monument is the remains of a chambered cairn dating from the Neolithic period, probably built between 3800 and 2500 BC. It is visible as a group of large upstanding stones defining a chamber and an entrance passage, and is surrounded by a slight scarp that probably indicates the original extent of the cairn. The cairn lies 245m above sea level, part way up the northwest side of Strath Sgitheach. The River Sgitheach is about 600m to the south southeast and there are long views up the strath to the south southwest. The monument is an Orkney-Cromarty type chambered cairn with the chamber aligned northeast by southwest and is defined by several large stones, some upright or leaning, others slumped. The chamber measures about 7m long by 4m wide. At the northeast end there are two low, transverse portal stones that give access to the chamber from a passage about 5.5m long and 1.5m wide. The remains of a low scarp surrounding the stones of the chamber and passage suggest the original cairn measured about 27m in diameter. The scheduled area is circular on plan, measuring 40m in diameter, centred on the north corner of the chamber, to include the remains described above and an area around them within which evidence relating to the monument's construction, use and abandonment is expected to survive, as shown in red on the accompanying map. The monument was first scheduled in 1964, but the documentation did not meet current standards: the present amendment rectifies this. Statement of National Importance The monument has the potential to enhance understanding of the past, in particular the design and construction of burial monuments and the nature of burial practices and belief systems. Ritual and funerary monuments are often our main source of evidence for human

activity during the Neolithic in Scotland. They are particularly important for enhancing our understanding of Neolithic society, its organisation, economy, religion and demography. This monument retains its field characteristics to a marked degree. The large upright stones of the chamber are visually impressive and the form of the monument can contribute to our understanding of the development and architecture of chambered cairns. Chambered cairns are an important surviving component of the wider prehistoric landscape of land-use, settlement and ritual and the position of Balnacrae within the landscape is likely to be significant. The loss of the monument would diminish our ability to appreciate and understand the meaning and importance of death and burial in prehistoric times and the placing of cairns within the landscape.

References

Historic Environment Scotland <http://www.canmore.org.uk> reference number CANMORE ID 12919 (accessed on 27/04/2016).

The Highland Council Historic Environment Record reference is MHG8930 (accessed on 27/04/2016).

Henshall, A S 1963, The chambered tombs of Scotland. Vol 1. Edinburgh. P.334-335

Davidson, J L and Henshall, A S 1989, The chambered cairns of Orkney: an inventory of the structures and their contents, Edinburgh.

Canmore

<https://canmore.org.uk/site/12919/>

HER/SMR Reference

<http://her.highland.gov.uk/SingleResult.aspx?uid=MHG8930>

Asset/Event Number	86
Asset/Event Name	Blairmore, hut circles & field system 590m NE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1838; NC70SW 6
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	274658
Northing	904229
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1838 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/6006/blairmore. On the N slope of a low hill at Blairmore, is a large group of small mounds. Some 100 yards NE of the hill are the remains of a hut circle of the ordinary character with entrance from the SE, and a group of ten or twelve mounds lying near. One mound lies directly opposite the entrance and within 20ft of it. Some 30ft SW of the entrance is a long low mound lying N-S, measuring 27ft by 16ft tapering towards each end, and 2 1/2ft high. About 40ft S is another, not quite so high, lying N-S and measuring 22ft by 9ft. On the E flank of the hill are a further two hut circles. The larger of the two measures 33ft by 34ft internally, with entrance, 4ft across, from the SE. Some 30ft S is another hut circle

measuring 18ft by 15ft internally with entrance, 3 1/2ft wide, in the SE. In both huts the banks, 6ft to 8ft across and some 3 1/2ft high, project to flank the entrances on the NE. RCAHMS 1911, visited 1909.

Three hut circles (A, B and C) and an associated field system. Huts A and B are as described by the RCAHMS.

Hut 'C' (probably the first mentioned) is 9.0m in diameter internally, with a turf-covered wall 4.0m thick and 1.0m high. The entrance, 1.0m wide, is in the SE.

The field system, approximately 160m NW-SE by 90m transversely, is delimited by lynchets, field banks, and clearance heaps.

Hut circles surveyed at 1:2500.

Visited by OS (N K B) 15 February 1966.

(NC 746 042) Settlement (NR) (Three hut circles, A-C)
OS 1:10,000 map, (1971)

On the E flank of a hill is a settlement of three hut circles (A-C) accompanied by a field system.

'A', heather-covered, measures 11.0m in diameter inside a collapsed wall 0.6m high with a general spread of 3.0m expanding to 4.0m in the sides of a slubbed entrance in the SE.

'B', set into the slope and completely heather-blanketed, measures 5.0m in diameter within a wall spread to 2.5m on average and up to 0.5m high; the entrance is in the SE.

'C', levelled back into the slope and turf-covered, measures 20.0m N-S overall; the E wall arc is mutilated and only a conjectural, transverse length of 17.0m is indicated. The entrance is in the SE. Large blocks are evident in the hut build, in particular two contiguous slabs in the N, one up to 1.0m high, that may be inner facing-stones in situ. The collapsed walling where not disturbed is 4.0m broad and up to 1.0m high. In comparison with huts A and B, hut C, notwithstanding the poor state of preservation, presents a markedly more robust construction.

The field system is evident in numerous field clearance heaps, spaced on average from 8.0m to 20.0m apart, No measurable plots are discernible. Interspersed with occasional signs of lynchets and banks.

Revised at 1:10,000.

Visited by OS (J M) 12 March 1981.

Field Visit (21 March 1995) RCAHMS Afforestation Land Survey, Rogart

There are three hut-circles, a burnt mound, and a field-system and small cairns on a heather-covered hill to the E of Blairmore.

The three hut-circles lie on a terrace on the E of the hill. One of the huts (ROG95 415) is much smaller than the other two; oval on plan, it measures about 5m from WNW to ESE by 4m transversely within a stony bank spread to 2.5m in thickness and up to 0.5m in height with an entrance in the ESE. The other two are both about 10m in diameter. The wall of the E hut-circle (ROG95 417) are up to 3.2m thick and 1m high; there is a probable entrance gap on the SSE and a second gap on the NW. The W hut-circle (ROG95 416) comprises a stony bank 2.4m thick and 0.5m high; the entrance lies on the ESE and there is a water-filled hollow in the centre of the interior.

The burnt mound lies a short distance to the E (ROG95 419, NC 7474 0422) on the opposite side of the track from the hut-circles. Set against the slope of the hill, the oval-shaped mound measures 6.2m from N to S by 4.5m transversely and 1m in height. There is no trough visible, but there are exposures of burnt, shattered small stones in the body of the mound.

The spread of small cairns (ROG95 418) extends in a strip about 100m wide over the whole

of the hill from the road at the W to the track in the E, a distance of 300m. The cairns are up to 5m across by 0.5m high with occasional banks of stone visible, especially where the heather is burnt off.

(ROG95 415-419)

Visited by RCAHMS (PJD) 21 March 1995.

References

RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 170, No. 489-90 plan RCAHMS Shelf Number: A.1.1.INV(2)

Asset/Event Number	87
Asset/Event Name	Killin, chambered cairn 800m N of, Loch Brora
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM1794; NC80NE 4
HER Number	MHG10815
Status	Scheduled Monument
Section:	N/A
Easting	285659
Northing	907840
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM1794 No description available from HES. Description taken from Canmore

<https://canmore.org.uk/site/6486>

(NC 857 077) Allt name Ban: Orkney-Cromarty with a Camster type chamber. The cairn lies in a thin birch wood gently sloping down to the E shore of Loch Brora and close to the left bank of the burn at 200ft OD. It is composed of small rounded boulders, has been greatly disturbed and a large part of it carted away for road metal but the N half of a tripartite chamber remains backed by cairn material which still reaches a height of 6ft. The cairn has been oval in plan and now appears to measure about 66ft by 47ft, but when seen in a less ruined state by RCAHMS (1911) he judged the length to be about 54ft. The chamber is orientated E - W along the main axis.

The entrance has been from the W side which faces the loch. The S wall of the passage, built of large slabs set on end, still survives, 27ft long. The entrance into the chamber is between transversely set portal stones 2ft 6ins high and 2ft apart. Two lintels remain, the inner over the portal stones but resting on an intervening stone on each side which serves to increase the height of the entrance; the outer lintel rests on the passage walls, here 2ft 7ins apart. The height of the lintel is 2 - 3ft above the present floor level.

The chamber has three compartments, with a total length of 15ft. The N wall of drystone, attains a maximum height of 4ft but the S wall is virtually destroyed.

RCAHMS 1911, visited 1909; Antiq J 1928; W D Simpson 1936; A S Henshall 1963, visited 1957.

The cairn is generally as described above. Due to the birch and dense bracken it is not

possible to determine the exact dimensions of the cairn but it appears to have measured 24.0m E to W by 20.0m N to S.

Only parts of the N and W sides remain, together with the tripartite chambers. The S wall of the entrance passage is not now apparent.

The maximum height of the cairn is 1.7m, measured on the N side, this side being a mass of rubble.

There are several field clearance mounds in the vicinity.
Visited by OS (E G C) 16 July 1961

No change since report of 16 July 1961.

Revised at 1/10,000.
Visited by OS (J B) 10 November 1975.

Field Visit (25 August 1909) RCAHMS County Inventory: Sutherland
44. Chambered Cairn, Allt nam Ban. On the left bank of the Allt nam Ban, which flows into the middle one of the three divisions of Loch Brora, near the centre of the E. bank and about 30 yards back from the road, in a birch wood, are the remains of an excavated chambered cairn. The passage which approaches the chamber from the W. has been removed almost up to the lintel covering the entrance, which is at 20' from what appears to have been the outside. The passage exists for the last 3' 8", including the part covered by the lintel, and is 3' wide. The portals which support the lintel are 2' high and have on the top of each an additional stone, raising them to 2' 9". The lintel is 5' long, 1' 8" deep, and 1' 4" across. The chamber appears to have been tripartite. The first compartment is 5' long: the S. side has fallen, but the width has been about 7'. The sides have been curved, and are entirely built instead of having large upright slabs forming a portion of the walls. Two partition stones 3' long by 1' thick and 3' in height, as far as exposed, and about 2' apart, separate the first and second compartments. The second compartment, which is also built, is 4' 9" in length by 8' 3' in breadth. At the back are two other division stones 1' 9" apart: that on the N. 3' 6" long, that on the S. 3'. They are in great measure covered with debris, and no part of the chamber beyond is visible. The diameter of the cairn along the line of the direction of the chamber from E. to W. has been about 54' and across the chamber about 46'. The remains of the cairn are covered with moss and fern.
OS 6-inch map, Sutherland, Sheet xcvi. (unnoted).
RCAHMS 1911, visited (AOC) 25th August 1909.

References

Henshall, A S. (1963a) The chambered tombs of Scotland, vol. 1. Edinburgh. Page(s): 307-8, SUT 6 plan RCAHMS Shelf Number: E.7.1.HEN
RCAHMS. (1911a) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Second report and inventory of monuments and constructions in the county of Sutherland. Edinburgh. Page(s): 17-18, No. 44 RCAHMS Shelf Number: A.1.1.INV(2)
Simpson, W D. (1936c) Scottish archaeological studies. Aberdeen. Page(s): 171-4
Simpson, W D. (1928) 'A Chambered Cairn at Allt-nam-Ban, Strathbrora, Sutherland', Antiquaries' Journal, vol. 8, 1928. Page(s): 485-8

Asset/Event Number	88
Asset/Event Name	Langwell Plantation, souterrain 130m W of Kennels
Type of Asset/Event	Souterrain
Date and/or Period	Iron Age
Listing No./NRHE Number	SM3436; ND12SW 7
HER Number	MHG1123

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Scheduled Monument
Section:	N/A
Easting	310166
Northing	922410
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM3436 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8109. Some 200 yds W of the gamekeeper's house at Langwell, within the wood and close to the park railings, is an earth-house. Access is gained to it by a hole broken through the roof towards its inner end, the portion towards the entrance being unopened. At the aperture it is 5ft 3ins in width. It extends inwards for a distance of 10ft 6ins in, expands to 6ft at greatest width, and measures at highest, 4ft 7ins above the debris that covers the floor. The sides are built of boulders, the end is rounded, and the roof formed of flagstones. Near the opening an upright stone set in the floor 2ft out from the N wall forms a pillar for support of the flag above it. RCAHMS 1911, visited 1910. This earth-house has been completely destroyed. Only a few stones, and a cavity covered by a fallen tree, mark the site. Visited by OS (J L D), 29 June 1960. (ND 1016 2240) Earth-house (NR) (site of) OS 6" map, (1964) The area has been ploughed and planted with trees. There are no recoverable traces of the souterrain and no local knowledge in respect of it. Visited by OS (J M), 23 November 1982. References RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 66, No. 246 RCAHMS Shelf Number: A.1.1.INV(3).R
Asset/Event Number	89
Asset/Event Name	Burg Ruaidh, or Borgue Roy, broch, Berriedale Water
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM526; ND12NW 6
HER Number	MHG1094
Status	Scheduled Monument
Section:	N/A
Easting	311611
Northing	928529
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM526 The monument comprises the remains of a broch, a drystone-built, fortified dwelling of Iron Age date. It is already scheduled, but the scheduled area does not cover all of the area of archaeological importance. This proposal rectifies the position. The broch stands 3.5m high, and is about 16m in internal diameter. The outer wall face is visible for the majority of its circuit, and is especially well-preserved on the N and NE. The entrance was probably on the SW, but this area is obscured by tumbled stone. There are traces of intra-mural chambers or galleries within the thickness of the wall. Internally the broch is filled with rubble, and the inner wall-face is not clear at any point. Around the broch are a series of traces of other structures, including an outer enclosure wall, which is clearest on the E and S sides, and a number of other field or enclosure walls on the W. A modern shelter and a heap of piled stones on the W side of the broch are also included, as they are probably constructed of stone taken from the broch. The area now to be scheduled is a circle of diameter 100m, to include the broch, shelter and outer walling, and an area of ground around and between these features in which evidence for their construction and use may survive, as marked in red on the accompanying map extract.
Asset/Event Number	90
Asset/Event Name	Cor Tulloch, prehistoric settlement
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM543; ND13NE 1
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	315141
Northing	935535
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM543 This monument consists of the well preserved remains of a prehistoric settlement which survives as a turf-covered mound of stones, 32m NW- SE by 30m NE-SW and 1.5m high. This mound contains the remains of 3 structures. Two structures are aisled rectangular houses - these have evidence for displaced pillar stones and lintel slabs and in one case a number of roofing slabs remain in situ. Three upright slabs forming part of a third structure are visible at the centre of the mound. On the S of the site are traces of a boulder-faced wall. This probably once surrounded the settlement, but the margins of the mound have been disturbed by ploughing and robbing. The area to be scheduled measures a maximum of 70m WSW-ENE by 65m N-S, to include the mound with houses and an area around in which traces of activities associated with the construction and occupation of the settlement will survive, as shown in red on the attached map.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	91
Asset/Event Name	Tiantulloch, broch, prehistoric and post-medieval settlements
Type of Asset/Event	Broch
Date and/or Period	Iron Age
Listing No./NRHE Number	SM585; ND13NE 2
HER Number	MHG1127
Status	Scheduled Monument
Section:	N/A
Easting	315251
Northing	935223
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM585 The monument consists of the remains of a prehistoric broch with the closely associated remains other contemporary buildings. The broch appears to have been about 17m in diameter and survives to 3m high. The broch mound rises from a larger mound which contains the outbuildings of an associated settlement. The latter mound is faced by walling 1.3m high which abuts the SW end on the outside of the broch. Removal of some stones near the broch end of the wall has revealed the corbelled roof of an outbuilding and an apparently lintelled passage or gallery leading off it. The area to be scheduled measures 60m NW-SE by 50m SW-NE to include the broch and associated mound containing outbuildings. This area includes the remains of the post medieval croft of Tiantulloch. This building is of no great antiquity, but is in very close proximity to the edge of the broch mound and the broch cannot be fully protected unless the post medieval building is scheduled. The area to be scheduled is marked in red on the attached map.
Asset/Event Number	92
Asset/Event Name	Rangag, standing stone by Latheron to Thurso Road, 750m N of
Type of Asset/Event	Standing stones
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM473; ND14SE 5
HER Number	MHG1317
Status	Scheduled Monument
Section:	N/A
Easting	317678
Northing	944875
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM473

Appendix 1: Gazetteer of Heritage Assets and Events

No description available from HES. Description taken from Canmore
<https://canmore.org.uk/site/8274/rangag>.

A four-sided stone pillar, about 2ft 9ins square, standing to a height of 9ft 5ins above ground level. It seems to face E, and is tilted slightly towards the W. On its S face, near the W edge and about 3ft above ground level, are some raised markings which have the appearance of sculpture, but are probably natural.
RCAHMS 1911; R W Feachem 1963.

As described above.

Visited by OS (R L) 9 May 1967.

No change to the previous reports.

Visited by OS (N K B) 6 December 1982.

References

Close-Brooks, J. (1995a) The Highlands, Exploring Scotland's Heritage series, ed. By Anna Ritchie. 2nd. Edinburgh. Page(s): 154 RCAHMS Shelf Number: A.1.4.HER

Feachem, R. (1963b) A guide to prehistoric Scotland. 1st. London. Page(s): 74 RCAHMS Shelf Number: E.2.FEA

RCAHMS. (1911b) The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness. London. Page(s): 78, No. 284 RCAHMS Shelf Number: A.1.1.INV(3).R

Asset/Event Number	93
Asset/Event Name	Halsary, standing stones 450m WNW of and 620m NW of
Type of Asset/Event	Standing stones
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM5301; ND14NE 2 and 3
HER Number	N/A
Status	Scheduled Monument
Section:	N/A
Easting	317639
Northing	949228
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5301 This monument consists of 2 standing stones which have been left in clearings in a forestry plantation. The S stone is a grey schistose slab, now split vertically into 3 portions and leaning slightly to the SE. It faces NW-SE and measures 1.4m high by 0.8m to 1m broad and 0.4m thick. The stone sits in a hollow about 0.3m deep and a number of packing stones are visible around the base. The N stone is about 0.6m high, 0.7m broad and 0.3m thick. This stone is set in a low and ill-defined mound. The two areas to be scheduled measure 10m in diameter, to include the stones and areas around both stones in which traces of activities associated with their erection may survive, as shown in red on the attached map. Statement of National Importance These monuments are of national importance for their potential contribution to an

understanding of prehistoric ritual beliefs. The stones are set in thick peat and significant archaeological remains may survive in the area around the base of both stones.

References

Bibliography

RCAHMS records the monument as ND 14 NE 2 and 3

Asset/Event Number	94
Asset/Event Name	Gallow Hillock, cairn on Backlass Hill
Type of Asset/Event	Cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	SM450; ND25SW 2
HER Number	MHG1965
Status	Scheduled Monument
Section:	N/A
Easting	320493
Northing	954115
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM450

The monument is a prehistoric cairn visible as a grass covered mound. The monument was first scheduled in 1938, but an inadequate area was included to protect all of the archaeological remains: the present rescheduling rectifies this.

The monument is visible as a grass-covered mound situated at 110m OD on the top of Backlass Hill. It is circular, 1.2m in height with maximum dimensions 24m NE-SW by 21m transversely. The mound rises to a flat top with a diameter of c.11m.

Historical mapping shows the presence of an old market stance, and it may be that the cairn was indeed reused as a gallows hill in the Middle Ages, as part of an area used for markets and the administration of justice.

The area to be scheduled is a circle 40m in diameter centred on the centre of the cairn, to include the cairn and an area around in which evidence relating to its construction and use may survive, as marked in red on the accompanying map. The above-ground portion of the triangulation pillar, situated on the NE side of the cairn, is excluded from scheduling.

Statement of National Importance

This monument is of national importance because of its potential to contribute to our understanding of prehistoric ritual and funerary practices: it is likely to contain at least one central burial as well as secondary burials dug into the mound. A mound of this size should also cover an area of prehistoric land surface, which would have the potential to enhance considerably our understanding of prehistoric environmental conditions.

References

The monument is recorded by RCAHMS as ND25SW2.

RCAHMS 1911, THIRD REPORT AND INVENTORY OF MONUMENTS AND CONSTRUCTIONS IN THE COUNTY OF CAITHNESS, Edinburgh, HMSO, 133, No 482.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	95
Asset/Event Name	Scouthal Burn, chapel & The Clow
Type of Asset/Event	Chapel; burial ground
Date and/or Period	Post-medieval
Listing No./NRHE Number	SM721; ND25SW 3; ND25SW 3.01; ND25SW 3.02
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	323302
Northing	952412
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM721 No description available from HES. Description taken from Canmore https://canmore.org.uk/site/8800/clow-chapel (ND25SW 3), https://canmore.org.uk/site/90913/the-clow (ND25SW 3.01) and https://canmore.org.uk/site/90914/the-clow (ND25SW 3.02). ND25SW 3 ND25SW 3.00 2331 5245 ND25SW 3.01 ND 233 524 Farmstead ND25SW 3.02 ND 2328 5232 Mill (possible) (ND 2331 5245) Chapel (NR) (Remains of) (ND 2331 5246) Grave Yard (NR) (Site of) (ND 2323 5242) Red Well (NR) (Chalybeate) OS 6" map, Caithness, 2nd ed., (1907) These are the remains of St Mary's Chapel, standing in its graveyard with St Mary's Well on the opposite side of the Scouthal Burn. Only fragments remain of the chapel, which appears to have consisted of a chancel, 14 by 10ft, and a nave, about 26 by 16ft. The walls, apparently unmortared, have been some 4ft thick. In 1726, the chapel is described as having been 'ruinous before our time', and was used as a burial place only of strangers and unbaptised children. It seems to have been abandoned altogether about 1770. The Scouthal Burn is said to occasionally disclose stones and bones belonging to the graveyard. The area is known as 'The Clow', probably from 'Cladh' - a church-yard. To the W of the chapel is an old enclosure with the foundations of several old rectangular buildings around it. The Red Well is described by the ONB (1871) as a healing well of great popularity in the neighbourhood, and was believed to have been a holy well. Name Book 1871; W Macfarlane 1906-8; D Beaton 1909; RCAHMS 1911, visited 1910; A MacKay 1914.

St Mary's Chapel is as described above. The interior wall face survives to a maximum height of 0.5m in the NE of the nave, and the exterior wall face is exposed only in the SE. There is no trace of the graveyard. There are no structural remains of the 'Red Well' and the only indication is a small marshy area, reddish in colour.

In the vicinity of the chapel are four ruined buildings, one of which contains a corn-drying kiln, and several enclosures (The Clow).

Survey of St Mary's Chapel revised at 1:2500.

Visited by OS (N K B) 22 October 1965.

(ND 2331 5245) Chapel (NR) (rems of)

(ND 2322 5246) Red Well (NR) (site of)

OS 1:10,000 map, (1976)

Extensive documentary search failed to locate any early reference to the site. Excavation in 1975-7 indicated that the nave was secondary and that the chancel is the only remnant of a unicameral structure whose proportions of roughly four to one suggest a later date than the Early Christian. A line of burning towards the S wall of the nave, which was thought to suggest the presence of an earlier timber church, proved to be only a slight scatter of charcoal; but an L-shaped arrangement of large stones, possibly indicating an earlier foundation, was located a little to the E of the entrance, which was confirmed towards the E end of the S side of the nave.

A slight ridge to the N of the nave suggested a churchyard enclosure, but a cut failed to locate this and the only feature of interest was a series of skulls neatly placed in small cists. Decapitation had taken place, a wide range was represented, and some skulls showed evidence of re-burial.

Excavation of the settlement nearby, which included a mill, showed it to be 18th and 19th century.

E Talbot 1977; Information from Ts of E Talbot's excavation report.

A further season of excavation has yielded more burials of skulls with the upper seven vertebrae, and fragments of a possible 13th century jug were found close to the foundations of the nave wall.

E Talbot 1980.

The chapel remains are generally as described. There is no sign of the graveyard. The area of the excavations has been backfilled. The Red Well, at ND 2323 5248, is across the Southall Burn and on the W side of the road. It is set into the face of a natural bank and shows an open side, 0.6m wide by 0.4m high. The slab roofing of the well is partly collapsed.

Surveyed at 1:10,000.

Visited by OS (J M) 11 March 1982

Longhouse farm (ND 2330 5240), comprising;

A: Chapel, St Mary's. Dimensions: 10.5 x 7m. Rectangular structure with porch 5 x 5m on the NE wall. Orientation NE-SW.

B-D: See ND25SW 3.01

E: See ND25SW 3.02

R J Mercer, NMRS MS/828/19, 1995

An unroofed building is shown on both the first edition 6-inch map (Caithness 1877, sheet xiii) and the current edition of the OS 1:10,000 map (1994).

Information from RCAHMS (FO) 27 March 1996.

References

Beaton, D. (1909) Ecclesiastical history of Caithness and annals of Caithness parishes. Wick. Page(s): 57 RCAHMS Shelf Number: D.6.11.BEA

Clark, J. (1981) 'Medieval Britain in 1980. II. post-conquest', *Medieval Archaeology*, vol. 25. Page(s): 199

Close-Brooks, J. (1995a) *The Highlands, Exploring Scotland's Heritage series*, ed. by Anna Ritchie. 2nd. Edinburgh. Page(s): 29, 121 RCAHMS Shelf Number: A.1.4.HER

Dobie, W. (1887) 'On an old grave containing two skeletons covered by a slab at Ladykirk Church', *Hist Berwickshire Natur Club*, vol. 11, 1, 1885-6. Page(s): 109

MacKay, A. (1914) *History of the Province of Caithness and Sutherland from the Earliest Times to 1615*, in Beaton, D. Wick. Page(s): 37

Macfarlane, W. (1906-8) *Geographical collections relating to Scotland*, in Mitchell, A and Clark, J T, 3v. Edinburgh. Page(s): Vol. 1, 180 RCAHMS Shelf Number: D.20.MAC.R

Ordnance Survey (Name Book. (1848-1878) *Object Name Books of the Ordnance Survey* (6 inch and 1/2500 scale). Page(s): Book No. 12, 109 RCAHMS Shelf Number: Ref

RCAHMS. (1911b) *The Royal Commission on the Ancient and Historical Monuments and Constructions of Scotland. Third report and inventory of monuments and constructions in the county of Caithness*. London. Page(s): 126, No. 460 RCAHMS Shelf Number: A.1.1.INV(3).R

Talbot, E. (1977) 'Watton, Clow, chapel', *Discovery Excav Scot*, 1977. Page(s): 11

Talbot, E. (1980a) 'Clow (Watten p) chapel', *anan p) Motte*, *Discovery Excav Scot*, 1980. Page(s): 17

Talbot, E J. (1978) 'Excavations at Clow Chapel, Watten, ND 233 524', *Caithness Fld Club Bull*, vol. 2, 3, 1978, April. Page(s): 93-4

Webster and Cherry, L E and J. (1976) 'Medieval Britain in 1975', *Medieval Archaeology*, vol. 20, 1976. Page(s): 183-4

Webster and Cherry, L E and J. (1978) 'Medieval Britain in 1977', *Medieval Archaeology*, vol. 22, 1978. Page(s): 167

ND25SW 3.01

Longhouse farm (ND 2330 5240), comprising;

A: See ND25SW 3.00

B: Longhouse. Dimensions: 21 x 5m. Rectangular structure divided into five compartments. Associated with an enclosure 45 x 7m. It lies 14m W of A. Orientation E-W.

C: Kiln. Dimensions: 9 x 4m. Rectangular structure with a corn-drying kiln 2.5m in diameter attached to the NE end. It lies 2m S of B and with it forms part of an enclosure 25 x 7m. Orientation E-W.

D: Structure. Dimensions: 5 x 4m. Rectangular construction. Orientation E-W.

E: See ND25SW 3.02

R J Mercer, NMRS MS/828/19, 1995

A farmstead comprising three unroofed buildings, three enclosures and a length of wall are depicted on the 1st edition of the OS 6-inch map (Caithness 1877, sheet xxiii). Three unroofed buildings and an enclosure are shown on the current edition of the OS 1:10000 map (1994).

Information from RCAHMS (SAH) 24 November 1995

ND25SW 3.02

Longhouse farm (ND 2330 5240), comprising;

A-D: See ND25SW 3.00 & 3.01

E: Longhouse. Dimensions: 18 x 5m. Rectangular bipartite structure, possibly with a kiln at the NW end. Orientation NW-SE.

R J Mercer, NMRS MS/828/19, 1995

An unroofed long building of two compartments is shown on the 1st edition of the OS 6-inch map (Caithness 1877, sheet xxiii) and is similarly depicted on the current edition of the OS 1:10000 map (1994).

Information from RCAHMS (SAH) 24 November 1995

The first edition of the OS 6-inch map (Caithness 1877, sheet xxiii) does not show any trace of a mill lade, sluice or mill dam and the building may be part of the farmstead at ND25SW 3.01.

Information from RCAHMS (FO) 27 March 1996

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	96
Asset/Event Name	Fairburn Tower
Type of Asset/Event	Tower house
Date and/or Period	Medieval; Post-medieval;
Listing No./NRHE Number	LB14030; NH45SE 1
HER Number	MHG7784
Status	Listed Building - Category A
Section:	N/A
Easting	246952
Northing	852356
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/LB14030 Fairburn Tower is a 16th century tower-house with early 17th century additions, located on a ridge between the Rivers Conon and Orrin. Restored, 2020-22. The narrow, square plan tower has four stories (including vaulted basement) and an attic. The walls are of lime pointed and harled rubble. There are gun-loops at the ground floor level. A projecting tower containing a broad circular stair was added to the south side during the 17th-century. The attic level has crow-stepped gables and corbelled-out turrets on the northeast and southwest angles. There is a corniced apex chimney stack to the stair tower. The vaulted basement was not initially accessible from the exterior and was reached from a straight stair within the north wall. The projecting stair tower masks the earlier first-floor entrance doorway with plain moulded surround. The first floor contains the main hall and several mural closets or wall chambers. Each of the upper floors consists of one room of the same size as the hall, again with several wall chambers. The tower was restored as holiday accommodation by Simpson and Brown Architects for the Landmark Trust (2020-2022). The spiral staircase and the conical roof turrets have been reintroduced, and the roof recovered with grey slate. Adjoining the east wall of the tower is the roofless remains (2022) of a two-roomed thatched cottage containing a large arched fireplace with an oven which appears to have been from an earlier kitchen wing. Statement of Special Interest The tower occupies a commanding position on a hilltop ridge overlooking Strathconon and the Orri valley. A former stronghold of the Mackenzies, the tower was probably built for Murdo Mackenzie after he received a charter for the lands with the understanding that he built a house there. Listed Building Record revised 2022. References Canmore: http://canmore.org.uk/ CANMORE ID: 12479 Gifford J (1992) <i>The Buildings of Scotland, Highlands and Islands</i>, London, p.412. MacGibbon D and Ross T (1887) <i>The Castellated and Domestic Architecture of Scotland</i>, Edinburgh, Vol. 3, pp.462-465. Stell G (1986) 'Architecture and Society in Easter Ross before 1707', in <i>Firthlands of Ross and Sutherland</i>, Edinburgh, pp.116-18. Tranter N (1970) <i>The Fortified House in Scotland: South West Scotland</i>, Edinburgh, Vol. 5,

Appendix 1: Gazetteer of Heritage Assets and Events

pp.156-7.

Fairburn Tower, The Landmark Trust - Fairburn Tower | The Landmark Trust [accessed 2022]

Asset/Event Number	97
Asset/Event Name	Fairburn House
Type of Asset/Event	Mansion house
Date and/or Period	1878
Listing No./NRHE Number	LB14031; NH45SE 21
HER Number	MHG16666
Status	Listed Building - Category B
Section:	N/A
Easting	245507
Northing	853014
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/LB14031 Wardrop and Reid, 1877-78 (house dated 1878). Scottish Baronial mansion house; stugged and sneck coursed rubble, contrasting tooled ashlar dressings. Mainly 3 storeys, blocks of varying height group round taller entrance bay and tower. Off-centre crenelated tower on south elevation, 5 storeys with corbelled circular angle stair turret in re-entrant angle former with entrance bay, conical roof and weathervane above crenelations. Projecting near-centre gabled 3-storey entrance bay in south elevation with round-headed doorway and initialled plaque above; angle bartizans. Elsewhere asymmetrical design with angle drum towers, bipartites and tripartites; 2- and 3-storey canted bay windows, crowsteps and gabled dormers. 2-pane glazing throughout. Ridge and end corniced stacks; slate roof. Interior: entrance hall with stone Baronial chimneypiece to medieval design and wide wooden staircase rising to 1st floor and principal rooms. Drawing room with pendant plaster ceiling and 2 marble chimney-pieces. Dining room with panelled dado and ceiling, all with lozenge detailing; high carved and panelled wooden chimney piece with inserted portrait. Further wooden staircase with heavy balusters rising to 2nd floor and principal bedrooms. Nursery suite with decorative preses, one having illustrations from Barrie's PETER PAN. Statement of Special Interest Built and owned by Stirling family from 1878-1982. References Original drawings with owner. Copies in National Monument Record of Scotland.
Asset/Event Number	98
Asset/Event Name	Gate Lodge, Aultgowrie Lodge, Fairburn House
Type of Asset/Event	Gate lodge
Date and/or Period	1877

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	LB14032; NH45SE 21.04
HER Number	MHG42732; MHG42726; MHG16683
Status	Listed Building - Category B
Section:	N/A
Easting	247668
Northing	851714
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/LB14032 Wardrop and Reid, 1877. Arts and Crafts. Cruciform plan; single storey and dormerless attic; asymmetrical coursed stugged rubble, contrasting polished ashlar dressings. Centre door on south and flanking narrow recessed windows under deep timber framed gable supported on 4 wooden columns on stone plinths to give verandah. 4-light window in centre of gable; large canted bay window in east gable; decorative bargeboards with carved foliage and apex finials at south and east (facing drive and road), simple bargeboards elsewhere. Centre ridge battery of 4 corniced stacks. Multi-pane glazing in attic casements, and in upper lights of sashes, 2- and 4-pane in lower sashes. Gate piers and gates; 2 pairs octagonal ashlar gate piers with shallow pyramidal caps linked to similar end piers by low coped quadrants; single large wooden carriage gate; flanking matching pedestrican gates. Statement of Special Interest Initials JS for John Stirling who bought the estate of Fairburn from Seaforth and Muirton from Robert Ainslie in 1865. Present Fair-Burn House Built on or near site of former Muirton House. References Original drawings at Estate Office.
Asset/Event Number	99
Asset/Event Name	Coul House
Type of Asset/Event	Villa
Date and/or Period	1821
Listing No./NRHE Number	LB1769; NH45NE 80
HER Number	MHG14110
Status	Listed Building - Category A
Section:	N/A
Easting	246249
Northing	856404
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/LB1769 1821, additions Alexander Ross, 1860. Unusual villa of 1821 centred on 2 octagons, 1 to

south of 2 storeys with 2-bay wings. Sympathetically enlarged in 1860 in identical masonry style. Now 2-storey, of varying heights, 7 bays with further 2-storey, 3-bay service wing to south gable Pinned rubble, contrasting tooled and polished ashlar dressings and base course.

West front; tall octagonal central core projects as semi-octagon with octagonal piended roof; tall corniced ground floor windows and small square windows in 1st floor on 3 faces, all with moulded architraves; flanking 2-storey 2-bay wings with original ground floor windows as octagon; 2nd floor either re-windowed or raised in 1860. East entrance front; centre entrance in semi-octagonal porch, leading to octagonal hall, with pedimented portice; supported by painted Roman Doric columns; moulded eaves cornice and shallow leaded roof. Porch flanked by slightly advanced piended outer bays, to right (west) containing stairwell (which appears to date from 1821)

1860 2-storey, 2-bay extensions flank west front, extending east to form outer wings. Tall flat-headed ground floor windows, and segmental headed 1860 windows in 1st floor (except front octagon); later 19th century rectangular bay window at ground floor immediately right of centre octagon; later 19th century 2-storey 3-bay gabled service wing to south gable. Some lying-pane glazing survives in ground floor windows; multi-pane in 1st floor; square corniced end and ridge stacks, single and in batteries of 2 and 4; shallow slated roof with projecting eaves.

Interior; semi-octagonal pilastered entrance hall; octagonal drawing room with ornate plaster ceiling with central roundel decorated with acanthus leaves, key-patterned panels radiate to cornice; original black marble chimney piece.

Flanking ground floor rooms (present dining room and bar) again with central acanthus roundels and circular panels with anthemion and palmette detailing to ceilings, moulded cornices Simple side staircase with plain cast iron balustrade and continuous polished wooden handrail; simple panelling with moulded plaster dados; corniced ceiling to stairwell.

Statement of Special Interest

Former mansion of Mackenzies of Coul. In 1837 described as handsome and commodious" and "surrounding grounds. Tastefully laid out, garden of ... superior style "An elegant mansion, the seat of Sir George Mackenzie, Bart". (c. 1858). Precise original Lay out difficult to ascertain without plan or without documentation on 1860 alterations. South 2-storey, 3-bay service wing may be of 1860 date or slightly later; appears on 1st edition OS of 1877.

References

NEW STATISTICAL ACCOUNT (1837) xiv, p.238.

IMPERIAL GAZETTEER OF SCOTLAND (circa 1858) p.299 N.M.R.S.

Asset/Event Number	100
Asset/Event Name	Orrin Bridge, Aultgowrie
Type of Asset/Event	Bridge
Date and/or Period	Post-medieval
Listing No./NRHE Number	LB14020; NH45SE 26
HER Number	MHG16375
Status	Listed Building - Category B
Section:	N/A
Easting	247642
Northing	851570
Council	Highland
Condition:	N/A
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/LB14020 Mid 19th century; high, single span bridge; coursed rubble, dressed rubble arch ring; ashlar coped parapet with shaped terminals; splayed approach; shallow end buttresses. References THE STATISTICAL ACCOUNT, vii, (1793) p.251. A.R.B. Haldane, NEW WAYS THROUGH THE GLENS (1962 and 1973) pp.121-2, 140
Asset/Event Number	101
Asset/Event Name	Fairburn
Type of Asset/Event	Garden and Designed Landscape
Date and/or Period	Post-medieval
Listing No./NRHE Number	GDL00174
HER Number	N/A
Status	Inventory Garden and Designed Landscape
Section:	N/A
Easting	246349
Northing	852719
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/GDL00174 Dating from the late 18th / early 19th century, the designed landscape consists of gardens, woodland and architectural features, and together makes an impressive impact on the local scenery. Fairburn is famous for its trees, especially conifers planted by John Stirling in the 1870s. *Minor corrections to Inventory record in 2024. The inventory site as a whole has not been reviewed. Artistic Interest Level of interest: Little The designed landscape at Fairburn has a little value as a Work of Art. Historical Level of interest: Some Fairburn has some Historical value although there is limited evidence of its development. Horticultural Level of interest: Outstanding The range and size of the conifers in the woodland garden provide Fairburn House with outstanding Horticultural value. Architectural Level of interest: High The policies are of high Architectural value as they provide the setting to buildings recognised for their special architectural or historic interest. Archaeological Level of interest: Not Assessed Scenic Level of interest: Outstanding The woodland canopy and open parkland of the designed landscape make an outstanding contribution to the surrounding scenery.

Nature Conservation Level of interest: Little

The woodland flora provides a little Nature Conservation interest.

Location and Setting

Fairburn House is situated about 6 miles (9.5km) north-west of Muir of Ord. The policies lie along the south side of Strathconon. To the north they run down to the River Conon, and to the south, to a tributary river of the Conon called the Orrin. Upland scenery dominates the landscape to the west and south where the hills lead up to Beinn an Rubha Riabhaich and the Cabaan Forest. To the north the land slopes to the Conon valley and is farmed, mainly with grazing livestock. The soil is mostly boulder clay and some sandy gravel on the low ground with peat soils in areas of poor drainage. The climate is mild and the annual rainfall is about 35" (890mm). There are extensive views north across Strathconon to Ben Wyvis 3,233' (1,060m). The mature woodland canopy and the open pasture of the park are significant in the wider landscape especially from the valley.

Fairburn House lies within 2,000 acres (445ha) of designed landscape. Documentary evidence of the designed landscape is provided by General Roy's map of c.1750, the 1st edition OS map of c.1860 and the 2nd edition OS map of c.1910. They show that the original designed landscape was extended considerably to the west and south between 1750-1850. Embellishments were made in the 1870s and the policies were further extended to the east when the driveway was extended from Muirton Lodge to the Marybank/Aultgowrie road.

Site History

The present designed landscape was established in the late 18th/early 19th century. It was redesigned and extended in the late 19th century by John Stirling when the house was rebuilt. There are no known designers.

The name of Fairburn was taken from a 16th century tower house, built as a Mackenzie stronghold (Fairburn Tower, (LB14030)). It stands to the south-east of the present Fairburn House. In around 1800, the Mackenzies built Muirton House, which was later demolished by a subsequent owner - John Stirling (1820-1907). John Stirling bought the estate in c.1872. Following the demolition of Muirton House, he commissioned the building of the present Fairburn House on the same site between 1877-78.

In the surrounding grounds, John Stirling made a fine woodland garden and planted many exotic species. He also extended the east drive and established the beech hedge and woodland which flanks it today. His son inherited in 1908. The house was used as a convalescent home during World War I and foreign servicemen on leave were welcomed into the Stirlings' home during World War II. Sir John Stirling KT handed the estate over to his son as a wedding present in 1963. Sir John remained as tenant of Fairburn House until his death in 1975. The house was let for a short period thereafter but was sold, with some 80 acres of ground, in 1982. It was subsequently used as a private nursing home.

Landscape Components

Architectural Features

Fairburn House (LB14031) was designed by Wardrop & Reid between 1877-78 and built in the Scottish Baronial style in Tarradale stone. Fairburn Tower (LB14030) is a 16th century tower house, with early 17th century additions. It stands on a hilltop ridge overlooking the Strathconon and Orri valleys. It was restored in 2020-22. Aultgowrie Lodge (LB14032) stands on the south drive on the River Orrin and was also designed by Wardrop & Reid in 1877. The stable-block is also by Wardrop & Reid; it has been converted into homes for the staff in the nursing home. The curling pond, built in 1886, still has its original stones and the necessary facilities required, including floodlights. An ice house, situated near the Curling Pond, is now overgrown. The walled garden and ancillary buildings were built c.1880. Other buildings and estate offices include a Fire Station, Gardener's Cottage, Butler's Cottage, two kennels and a sawmill. The family burial ground is enclosed by iron railings and is situated to the north of the south drive near Aultgowrie Lodge.

Parkland

The parkland extends to the north and east of the house. Much of the wider landscape was improved during the early part of the 19th century when the shelterbelt strips were planted

and the land drained. At this time, these outlying areas of parkland belonged to Lord Seaforth of Brahan. They were acquired by John Stirling c.1873. There are one or two specimen trees remaining in the inner parkland including some oak and beech. A plantation of Scots pine, established c.1800 by the Mackenzies, accents the rising hill to the east. Hardwood clumps in the parkland were established by John Stirling, partly for amenity and partly as pheasant cover. Over the past decade, these have gradually been replanted.

Woodland

Fairburn is famous for its trees and, in particular, for conifers planted by John Stirling in the 1870s. Many are planted around the house and along the Orrin (South) Drive and these will be described under the woodland garden. The policy woodlands extend to the west of the house and were originally planted c.1800. The outlying mature and semi-mature commercial woodlands on the higher ground were felled in World War I and II. Sections of the policy woodlands were replanted in 1920 mainly with Scots pine but the majority of the woodlands were not planted until after World War II under a Forestry Commission Dedication Scheme, with Scots pine and Sitka spruce, although there are some small pockets of oak, ash and beech.

Woodland Garden

The woodland garden extends from the house southwards around the kitchen garden and along the Orrin Drive. The exotic specimen trees were mainly planted by John Stirling. Although the majority of the trees are amenity planting, some have always been considered as a commercial crop. There is a planting list dated 1872 and many of the larger specimens can be identified. Alan Mitchell measured 120 trees in 1982; 60 were over 100 ft high and 10 over 150 ft high. The tallest is a grand fir (*Abies grandis*) over 185 ft high. Some of the finest trees grow around the burial ground; in particular some tall grand firs, a *Calocedrus decurrens*, a 175 ft tall *Pseudotsuga menziesii*, and a large *Wellingtonia* (*Sequoiadendron giganteum*). A small pinetum was planted along the drive and includes many interesting *Chamaecyparis* varieties including a large *Chamaecyparis nootkatensis* 'Pendula'. The pinetum is underplanted with species rhododendrons. Other specimen trees were planted in the old garden and along the drive. The garden extends to the river and alongside the spectacular Orrin Falls.

The Gardens

The formal gardens around the house are partly evident, with overgrown hedges, grass terraces and paths indicating the original design (1987). On the west side of the house, a path, lined with yew trees, leads to the site of a rock garden which was laid out by the grandmother of Mr Stirling. There are several interesting trees including one enormous *Picea sitchensis* planted in 1874 which has a large skirt reaching down to the ground, and three large Monkey puzzles. Double white Narcissus and pheasant eye are established in the understorey in large numbers.

Walled Gardens

The walled garden was laid out by John Stirling c.1874. It extends over some one and a half acres. Soil was imported from neighbouring areas and a deep drainage system was installed. Lean-to glasshouses, with a central conservatory, lined an inner face of the north wall. Under this glass, fruit and flowers were grown, whilst pot plants were grown in the conservatory.

A rose garden was sited adjacent to the conservatory, covering approximately a quarter of an acre. A Caithness stone path led to a large stone font in the centre. The rose garden was removed in 1976. Vegetable plots lay beyond the rose garden. They were enclosed by a row of apple trees, then a border in which grew Primulas, irises and daffodils. Around this border was a gravel path with a box hedge. Between the path and the wall was a perimeter bed filled with flowers for cutting, bedding plants, vegetables and soft fruit.

Outside the west wall of the garden was an orchard which extended over an acre. Outside the south wall was an area of more fruit and flower production. Beyond the east wall an area was set aside in the later 20th century as the 'Children's Gardens.'

Before World War II some lilies, *Meconopsis* and flowers for cutting were grown

commercially. After the war, production was considerably increased including tomatoes, carnations, lettuce, soft fruit, vegetables and cut flowers. Lady Stirling raised daffodils acquired from Brodie Castle which she sent to Covent Garden for sale. Production at this level ceased in 1971 and, following Sir John's death in 1975, the garden was leased to Highland Liliams.

References

Sales Particulars, June 1982
A. Mitchell, Tree Survey, 1982
NMRS, Photographs

Asset/Event Number	102
Asset/Event Name	The Spa Gardens, Strathpeffer
Type of Asset/Event	Garden and Designed Landscape
Date and/or Period	19th century
Listing No./NRHE Number	GDL00370
HER Number	N/A
Status	Inventory Garden and Designed Landscape
Section:	N/A
Easting	248366
Northing	858024
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/GDL00370 Strathpeffer Spa Gardens comprise an unusual example of pleasure grounds laid out as part of a 19th century health resort. They illustrate a contemporary acknowledgement of the important curative role of landscape and gentle recreation. Type of Site: Picturesque pleasure grounds and ornamental walks, part of a Spa development. Main Phases of Landscape Development: Mid 19th century – mid 20th century. Artistic Interest Level of interest: High: The design of the picturesque pleasure grounds skillfully integrates a variety of amenity requirements on a comparatively small site. Its picturesque character is significant in the Strathpeffer townscape and essential to the locality. Historical Level of interest: High: The gardens are an important aspect of the development of Strathpeffer Spa as a premier health resort. They are interesting for their associated social and economic history, and constitute an unusual example of a specific type of pleasure grounds. Horticultural Level of interest: High: The collection of exotic specimen trees gives this site high Horticultural value. Architectural Level of interest: High: The Spa Gardens are a prominent feature in the Strathpeffer townscape and are integral to the picturesque landscape character of the town. Scenic Level of interest: High: The Spa Gardens have high Scenic value due to their important contribution to the townscape, as well as the overall landscape character of Strath Peffer itself. Nature Conservation Level of interest: Some: The Spa Gardens provide a variety of wildlife habitats, particularly birds. This gives the site some Nature Conservation value.
	Location and Setting

The Spa Gardens are in the centre of Strathpeffer, on the south side of the A834. They are laid out on a north-facing hillside and bounded to the south by the fields of Park Farm. The Peffer enters the gardens from the west and runs eastwards, parallel to the A834, through the north part of the gardens.

Views out from the gardens extend into the town. The gardens are an important component of the Strathpeffer townscape.

The gardens expanded eastwards to accommodate new bowling greens in 1904. They have retained the same boundaries since that time and measure c 2.2ha (5 acres).

Site History

Strathpeffer belonged to the Cromartie Estate (see Castle Leod; Tarbat House; Cromarty House). The value of 'Castle Leod Waters', as the mineral springs were then known, was recounted to the Royal Society in London in 1772. Thereafter, in 1777, Colin Mackenzie, factor to Cromartie Estate, suggested to the Board of Commissioners for the Forfeited Estates the value in building a house nearby to attract visitors. The wells were enclosed to prevent cattle fouling them, but his suggestion came to nothing. It was in 1819 that a wooden Pump Room was constructed, over one of the wells. The work was supervised by Dr Morrison, who moved from Aberdeenshire to Strathpeffer after being cured of chronic rheumatism by the sulphurous waters (Fortescue-Fox, 1896).

Thereafter, the reputation of the Spa grew. Dr Morrison, who recommended a stay of six weeks and three to four tumblerfuls of spa water both morning and afternoon, strictly supervised visitors' diets. By the mid 1800s, the Cromartie Estate again turned its attention to the potential attractions of the waters, which were 'so beastly as to prove there must be some virtue/reality in it' (Andrew Scott, the factor in 1857 quoted in Landscape Conservation Studio, 1996). The 1850s saw plans for the building of a harled Poor's House and a stone house over the Upper Well, wooden bridges over the burn and gravelled walks through the adjacent plantations – gentle exercise being part of the regime. By this time there were three wells, the Upper Well being within the gardens. The walks were constructed in 1853 at a cost of 13/4d per linear yard and the plantation was enclosed with a wire fence.

The 1860s saw the promotion of the Spa in earnest. The impetus came from George Granville Sutherland-Leveson-Gower (1828-92), created 3rd Duke of Sutherland in 1861. The Spa was the catalyst for the development of the settlement at Strathpeffer and the landscape of the Strath itself. This was then serviced by the main Dingwall-Strorne Ferry railway line opened in 1869 (Close-Brookes, 1995). The estate commissioned the architect George Devey to plan the proposed expansion but, although the layout of the roads relate to his proposals, his full scheme was not adopted. Altogether, the Duke spent about £2,500 in capital to lay out a new Pump Room (which replaced the original wooden one) and Bath House, a Well-Keeper's House, shops, post office and Postmaster's house. By 1876 the Pump Room (demolished 1950) was complemented by a latrine block, screened by shrub planting (1876, OS 6").

The 1880s saw the further expansion of activities and facilities. Renewed impetus was given to the Spa with the arrival of the Dingwall-Strathpeffer branch line of the railway (1885), new Ladies Baths and experimental peat baths. Explorations for new springs in the shale strata resulted in new wells in 1884 and 1886, which increased the volume of sulphurous waters from 279 gallons (1867) to 1482 (1886). A fourth well, named Lady Cromartie's Well or the Challis Spring, was exploited in 1889. Strathpeffer Spa Pavilion, designed by William Joass, was built 1879-81. It was designed to be the social focus of the Spa, as opposed to the medical and curative centre at the Upper Pump Room. It provided a refreshment room, tearoom, billiard table and games room. The central concert hall was overlooked by a gallery, which housed a reading room, and the whole building was surrounded by a covered verandah. An octagonal Bandstand (removed when the main road frontage was fenced in, c 1908), stood at the entrance to the complex, in view of the town centre.

From early on in the planning and promotion of the Spa, the pleasure grounds and drives were recognised as important aspects of the town's promotion. John Martin, assistant

factor, renewed the plantations in 1864 by interplanting many evergreens in the belts and transplanting trees from a plantation along the public road, to form an approach. The walks were planted and path junctions were highlighted with 'clumps of evergreens with a spiral or weeper plant in the middle to relieve the mass' (SRO, GD305/2/1858 p.39).

In 1867, William Gunn of Nutwood, successor to Andrew Scott, wrote about 'the constant brushing up during the Season required by the Spa Beltings and Sundry plots of fancy plantation, together with the gravelling & Keeping in order of all the public roads & walks around the Spa ...'. The Spa Gardens were considered integral with the Spa itself. Gunn recalled in 1889 that the Strathpeffer estate had been 'exceedingly bare of Wood, and with no Hedges' when he had started in post. He was responsible for extensive planting and woodland improvement throughout Strath Peffer as far as Castle Leod. A major feature was a walk made in 1888 for visitors to reach the summit of Ord Hill and admire the views. In 1898-1900, a pleasure drive was made through Blackmuir Wood, a 93ha (230 acres) pinewood planted c 1820, by way of the Knockfarrell vitrified Fort. Other walks, furnished with rustic rain-shelters, were laid out through the Kinettas Plantation, Ord Hill.

A tennis/croquet terrace behind the Pavilion (1882) provided recreation within the gardens. A four-rink curling pond (1890) was followed, in 1904, by a Bowling Green incorporated into an eastward extension to the gardens. These facilities all necessitated terracing the hillside with stone-retaining walls.

In 1908 the Spa Syndicate Limited acquired the rights to the Spa wells. The Spa facilities were run on more commercial lines, thus the gardens were enclosed and an entrance fee charged. Park Farm Road, which led through the middle of the gardens, from north to south, was removed, and the garden paths adjusted to accommodate this and further changes. Summer entertainments were important to the venture, so the Curling Rink was converted into tennis courts and curling moved to the Jubilee Pond. A major change in 1909 was replacing the 1870s Pump Room with the present Upper Pump Room.

Thereafter, from 1914 to 1949, there were few changes in the gardens. A leaflet of c 1925 describes the:

'spacious pleasure gardens, charmingly laid out with lawns, pergolas of roses, parterres of flowers, noble trees and dainty summer houses, while a picturesque note is supplied by a little burn which wimples over falls or broadens into little lakes...' (Landscape Conservation Studio, 1996).

In 1949 the gardens were sold to the owner of the Ben Wyvis Hotel. Subsequently, the Spa manager's house was demolished, the fountain pool infilled and the tennis court area redeveloped for curling. Management of the gardens was abandoned due to costs, in 1970. The Highland Council now owns the gardens.

Landscape Components

Architectural Features

The Spa Pavilion, designed by Joass in 1879, was subsequently altered and extended. It is harled with applied timber framing. A large multi pane lunette-window fills the north gable facing the town square. The slate roof has a ridge skylight and the eaves are coved and barge-boarded. A continuous, originally fully open verandah supported by timber columns, skirts the building. The verandah also has a slate roof and dogtooth eaves decoration.

The Pump Room, (originally known as the Upper Pump Room) built in 1909, is constructed of rubble masonry with dressed quoins and margins. It has a complex slate roof and a verandah on its north-eastern elevation. Other architectural features within the gardens include retaining walls, steps and ramps associated with the garden terraces and the Band House and a number of small pavilions associated with recreational facilities.

Paths & Walks

The main entrance from the public road leads into a yard between the Upper Pump Room and the Pavilion. From here, a drive leads between two Wellingtonias, to climb uphill to the Curling Rink terrace, the Band House and the rear of the Pavilion. A network of informal footpaths leads through the gardens at different levels along the hillside. Ramps and steps link the terraces. Footpaths were originally gravel surfaced, and boulder-edgings survive in

certain locations. Although benches and small summerhouses once located along the path network have not survived, seating recesses still remain.

Woodland Garden

The gardens are essentially wooded pleasure grounds. Some notable specimen conifers remain, including Wellingtonias, deodar cedars, Douglas and noble firs planted c 1870-80. The earliest surviving planting is from c 1850 and includes some large deciduous specimens, notably beech, oak and sycamore. Later plantings included lime, horse chestnut, Norway maple, copper beech, poplar and many Lawson cypress. Laurel and Rhododendron are surviving shrubs, although there is some snowberry and remnants of more recent shrub planting, including cornus, fuschia and lilac. Patches of herbaceous and groundcover plants are found, but in general the garden has suffered from overshadowing, waterlogging and the regeneration of invasive species. Early 20th century photographs illustrate the then extent of open lawn in the grounds, which enabled a more open aspect. The terraced areas for recreation are important within the garden design. The site of the Curling Rink, redeveloped as a concrete platform (1960) remains intact. It occupies one of the hillside terraces retained by dry-stone walls and with bench recesses overlooking the rink. Behind the Pavilion is another terrace, previously used for croquet, bowls, tennis and putting. The large Bowling Green to the east of the Pavilion is still in use.

References

1876 survey, 1st edition OS 1:10560 (6"), published 1881
 1904 survey, 2nd edition OS 1:2500 (25"), published 1906
 Scottish Record Office: RHP 45180; RHP 34705
 Close-Brookes, J. Exploring Scotland's Heritage The Highlands (1995), pp.22-3
 Fortescue-Fox, R. Strathpeffer Spa, Its Water and Climate (1896)
 Historic Scotland on Behalf of the Scottish Ministers, The List of Buildings of Special Architectural or Historic Interest
 Landscape Conservation Studio. The Spa Gardens, Strathpeffer. Report to The Highland Council (September 1996)
 Old Statistical Account, Statistical Account of the Parish of Fodderty, vol. 7, (1793), p.410

Asset/Event Number	103
Asset/Event Name	Battle of Carbisdale
Type of Asset/Event	Battlefield
Date and/or Period	1650
Listing No./NRHE Number	BTL19
HER Number	Various
Status	Inventory Battlefield
Section:	N/A
Easting	257307
Northing	894431
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/BTL19 Overview and Statement of Significance Carbisdale is significant as the last battle of James Graham, the 1st Marquis of Montrose, in support of the Royalist cause. Widely thought to be one of Scotland's finest ever military commanders, Montrose is a highly significant figure within Scottish history. After Carbisdale, he was finally apprehended by the Covenanters and unceremoniously executed. Carbisdale

also marks the end of the internal struggles within Scotland as part of the Wars of the Three Kingdoms, as with the Covenanters' subsequent agreement with Charles II, they come into open conflict with Oliver Cromwell and the Protectorate, rather than Royalist supporters in their own lands.

Following his defeat at Philiphaugh in 1645, Montrose had fled abroad, only to return in 1650 as the Captain-General of the forces of Charles II. The battle was a decisive victory for the Covenanter forces arrayed against Montrose, with his forces routed almost without firing a shot. Montrose himself escaped the field but he was handed over to the Covenanters a few days later and taken to Edinburgh for his trial and subsequent execution.

Inventory Boundary

The Inventory boundary defines the area in which the main events of the battle are considered to have taken place (landscape context) and where associated physical remains and archaeological evidence occur or may be expected (specific qualities). The landscape context is described under battlefield landscape: it encompasses areas of fighting, key movements of troops across the landscape and other important locations, such as the positions of camps or vantage points. Although the landscape has changed since the time of the battle, key characteristics of the terrain at the time of the battle can normally still be identified, enabling events to be more fully understood and interpreted in their landscape context. Specific qualities are described under physical remains and potential: these include landscape features that played a significant role in the battle, other physical remains, such as enclosures or built structures, and areas of known or potential archaeological evidence.

The Inventory boundary for the Battle of Carbisdale is defined on the accompanying map and includes the following areas:

The low passage between the river and the high ground to the north of the area along which Montrose entered onto the flood plain from the north. This also takes in the craggy peak which accommodates Carbisdale Castle and the southern portion of the craggy ground known as Creag a' Choineachan, which has been translated as Lamentation Hill, a place name which may be related to the battle.

The eastern side of the area runs along the western bank of the river, in which numbers of troops are reported to have drowned during the rout.

The southern limit of the area takes in the pass of low ground along which Strachan's men advanced, continuing to the south of Balinoe. It also takes in the higher ground to the west which may have provided a less obvious line of advance for at least some of his men.

The western limit of the area takes in the slope which bounds the western edge of the flood plain and accommodates the area of woodland to the north-west into which Montrose's men fled. The boundary joins with the northern boundary at the eastern end of the lochan from which the Culrain Burn flows.

Historical Background

Following the execution of Charles I in 1649, his son Charles II became the leader of the Royalist cause. In 1650, he appointed James Graham, the Marquis of Montrose to be Lieutenant ' Governor of Scotland and Captain ' General of the Crown's forces. Montrose's first task was to gain support for an invasion from the other crowned heads of Europe, but he only had limited success in this area.

Undeterred by this, in March 1650 Montrose headed to Orkney, where he took command of a force of Danish troops who had been deployed there since the previous September, along with local levies raised from the islands, giving him a total force of at most around 1500 men. Montrose and his army crossed to the mainland at John O' Groats on 12 April, possibly after sending a vanguard of around 500 men to secure the landing. Once on the mainland, Montrose moved swiftly, besieging and taking Dunbeath Castle and within six days Montrose had advanced as far as Strathoykel in Sutherland. He subsequently moved south to Carbisdale where he made camp and awaited reinforcements, although none were forthcoming.

As Montrose waited, he would once more be let down by the inadequate scouting and poor intelligence which were so characteristic of many of his battles, and he failed to determine the presence nearby of a Covenanter force under the command of Colonel Archibald

Strachan. Strachan, upon learning of Montrose's position, quickly advanced upon Ferne, a mile and a half from Montrose's camp, with his own force of around 200 cavalry, along with a small troop of around 30 musketeers and about 400 infantry from local levies of the Monro and Ross clans (although sources indicate these levies may not have been wholly committed or even sympathetic to Strachan's cause).

Once the Covenanters had reached Ferne, Strachan's scout, Captain Andrew Monro, reported back that Montrose had deployed 40 horse on patrol and suggested Strachan send a small force forward while keeping the remainder hidden, in an attempt to draw Montrose to battle and set an ambush. As some evidence suggests Montrose had his forces within a fortified camp in a strong position, it would seem that Strachan wished to draw him out into the open rather than risk assaulting his defences.

Whether or not Montrose's camp was well defended, the ruse by Strachan appears to have worked, with Montrose deploying a vanguard to the field under Sir John Hurry and taking command of the remainder of the army himself. When the remainder of the Covenanter force sprang their ambush and began advancing on Montrose, he appears to have attempted an orderly withdrawal towards the wooded and rocky slopes at his rear, which would have been ill-suited to Strachan's cavalry. Seeing this, Strachan attacked with around 200 of his cavalry, overtaking the Royalists just as they reached the woods and turning the retreat into a rout. Montrose's Danish troops appear to have been the only elements of his force to play any part in the fighting, managing to fire a single volley of musket fire before they too were driven off. While Montrose himself escaped with a few others, the remainder of his force was not so lucky. The pursuit of his army was a brutal affair and the slaughter in the wood continued for another two hours, with around 200 Royalists drowned while trying to cross the Kyle of Sutherland in a desperate bid to escape the massacre and another 400 captured.

The Armies

The Royalist forces were commanded by James Graham, the Marquis of Montrose, and the government forces by Colonel Archibald Strachan. Sallagh's account is alone in assigning joint command of the Covenanters to Strachan and Hackett (Sallagh 1813).

Numbers

Royalists: Sallagh does not give numbers for Montrose's forces (Sallagh 1813). Balfour quotes Royalist prisoners as saying they had 1200 men (Balfour 1825). Gardiner claims that Montrose had 1200 foot and 40 horse (Gardiner 1903). Reid uses the same figures adding, that some of the foot were Danish mercenaries but most of them Orcadians (Reid 1990). Cowan states that the charters of Kirkwall show that the town supplied 60 fully armed men, and 800 from the rest of Orkney travelled south. He believes the force could barely have exceeded 1600 and adds that the slowness of the march south was dictated by the speed of transporting cannon (Cowan 1977). No mention is made of Royalist artillery in other sources. Williams says the original expeditionary force numbered 1500, of whom nearly 1000 were Orcadians (Williams 2001). Roberts says he had 1600 men at most with hardly any cavalry (Roberts 2000).

Covenanters: Sallagh says that the Covenanters had five troops of cavalry; Strachan's, Montgomerie's, Cullace's Irish troop, Ker's and Hackett's, plus Monro and Ross foot 'not passing four hundreth' (Sallagh 1813). Balfour has the same five troops, which he numbers as 230 horse, and also mentions 36 musketeers of Lawers' regiment and 80 Ross foot (Balfour 1825). Williams gives the same composition for the cavalry, but calculates the number of horse at 256, and the number of musketeers at 36. He emphasises that Strachan's forces were experienced, well mounted and under competent officers. They were also joined by 400 Rosses and Monros, who may have been on their way to join Montrose but decided to throw in their lot with the government forces when they encountered them. Strachan did not mention this large force in his despatch following the battle (Williams 2001).

Reid differs significantly, saying that Strachan had only three troops of cavalry; Colonel Gilbert Carr's two troops of cavalry under his personal command, and a third troop under Lieutenant Colonel Robert Hackett. In addition he had 36 musketeers of Campbell of Lawers'

regiment under Captain Collace, and a force of 400 local levies (Reid 1990). Cowan gives the same composition, specifying that the 400 were Monros and Rosses (Cowan 1977). Roberts says Strachan had 200 cavalry but does not give the make-up of this number. He also has 36 musketeers and 400 levies raised by the Monros. He comments that it is believed that the Monros waited to see the likely outcome of any fighting before declaring their allegiance (Roberts 2000). Gardiner records that Strachan had 220 horse and 30 musketeers 'to say nothing of 400 Rosses and Monros upon whom no dependence could be placed.' (Gardiner 1903).

Losses

Sallagh gives no total figure for Royalists killed, but says 200 were drowned, 400 were taken, and only a few escaped. The only Covenanter casualty was one trooper drowned in pursuing the Orcadians who were trying to escape by swimming the Kyle (Sallagh 1813).

Balfour on Royalist losses says ten of their best commanders were killed and most of their officers and 386 common soldiers taken. He says only 100 were not killed, drowned or captured from a total of 1200. The only Covenanter casualties were the drowned trooper and two wounded. He also lists the Royalist officers killed and captured (Balfour 1825).

Other, secondary, sources say that 400 Royalist troops were killed, and another 450 were captured, while 200 Orcadians drowned, trying to swim the Kyle (Cowan 1977; Roberts 2000). Two other sources put the number of killed at 450, and the captured at 400 in addition to the 200 drowned (Stevenson 1977; Williams 2001). There is no advance in these sources on the one dead Covenanter.

Action

Although the sources differ on whether Montrose was on the march or encamped, and on the precise sequence of events, they all agree, other than Balfour, that Montrose was successfully ambushed by Strachan, in part at least, because his scouting and intelligence was poor, as it had been many times in the past. His army was shattered and he fled, only to be handed over to the Covenanters a few days later.

Balfour, a contemporary source, says that Strachan, on learning that Montrose was marching to Carbisdale, divided his forces into three parties; the first of 100 horse led by himself, a second of more than 80 horse led by Lieutenant Colonel Hackett and a third of about 40 horse led by Captain Hutcheson along with 36 musketeers of Lawers' regiment to be led by Quartermaster Shaw. After prayers they marched at about 3pm towards the enemy who were drawn up near a hill of 'Scrogie Wood' to which they quickly retired. Strachan pursued them into the wood and at the first charge 'made them all to rune'. Two Ross officers joined in with 80 foot and gave good service (Balfour 1825).

According to Sallagh, another contemporary source, the Covenanters marched to Ferne, where they hid in the broom a mile and a half from the Royalists. Their scout, Captain Andrew Monro, reported that Montrose had sent out 40 horse on patrol and he suggested that Strachan send out one troop to be seen and keep the rest hidden so that Montrose would not realise the size of their force. Upon getting this information Montrose put Hurry in charge of the vanguard and took command of the remainder. He then ordered a retreat to 'a wood and craggie mountain which was not far distant'. Strachan and Cullace then attacked with a vanguard of 200 horse, with Hackett and the rest close behind, trying to prevent the Royalists reaching the wood and the craggy rocks. Strachan overtook the Royalists just as they were entering the woods. The Danish mercenaries stood and delivered a volley which did very little harm, then began to flee to the woods, but were intercepted by Hackett's force and entirely dispersed. The Monro and Ross foot entered the wood and the killing went on for two hours. Two hundred Royalists were drowned while trying to escape across the river and about 400 prisoners were taken, although Montrose and a few others escaped (Sallagh 1813).

Gardiner gives a shorter but similar account, but also points out the difference between Sallagh's view that Montrose was at Carbisdale for some days, and Balfour's, who claims Montrose only arrived there on the day of the battle. Gardiner is inclined to believe Balfour, whose account is based on a despatch, believed to be Strachan's (Gardiner 1903).

Cowan also takes this line, arguing that, although Sallagh's account states that Montrose camped for some days at Carbisdale, a newspaper, 'The True Relation', probably based upon Strachan's own report of the battle, says the Royalists had marched from Strathoykel to Carbisdale. He believes that this is more likely, as if Montrose had been camped he would have had entrenchments which would have allowed him to mount a stronger resistance to Strachan's attack. He thinks it likely that Montrose was fording the Oykel, just west of the point where it is joined by the Cassley, to march along the south bank of the river. He says that Strachan exposed only 100 horse, since the Covenanters seem to have known that Montrose was already aware of the presence of only one troop of horse in the area; possibly Montrose was betrayed or misled by his own Monro scouts. The hundred charged Lisle's forty Royalist horse, whilst the Royalist foot retreated to the woods, but the Royalist cavalry broke, pushing back against their own infantry. Hurry in the centre tried to make a stand but only the Danish mercenaries attempted a volley. Local tradition has it that before the fighting the Monros and Rosses advanced up Strathcarron to shelter behind the ridge of Feith Tharsuinn to await the outcome of the battle and then joined in once they saw the way it was going (Cowan 1977).

Roberts' account (2000) is similar and he too believes that Montrose was on the move. He adds that Strachan, advancing north from Tain, learnt on the afternoon of Saturday 27 April that Montrose was moving south and advanced quickly to engage because he did not want to fight on the Sabbath. Stevenson (1977) also believes that Montrose was on the move.

Williams, however, like Sallagh, takes the view the Montrose was encamped. 'With the hills to the north and the Kyle estuary to the east, the burn enclosed a triangle of level ground admirably suited to cavalry. At the northern point of this triangle was Carbisdale Loch, and, beyond, a narrow defile overhung by Creag a' Choineachan. Here, in the jaws of the pass was Montrose's camp. His left flank rested on the Kyle. His right and rear were protected by the hills and on the bluff facing south-east towards the open ground the Royalists had thrown up a formidable breastwork. The position was a strong one and could not be taken by cavalry in a frontal assault.' Strachan realised he had to tempt Montrose out, so sent out the single troop of horse which he knew Montrose was aware of, to act as a decoy. Williams then has Montrose ordering Lisle to halt his horse and advancing with his main army towards the Covenanter cavalry, rather than retreating to the woods. Once Montrose was committed in the open Strachan charged with the cavalry concealed in the broom followed by Hackett with 80 dragoons. The Royalist horse was driven back on to the foot and a number of the gentlemen who made up the cavalry were killed. The Orcadians panicked and fled, and although the Danish mercenaries stood and fired a volley they were soon overwhelmed. At this point the Monros and Rosses, who had previously detached and taken up position in the lea of the hills flanking Carbisdale to see what would happen, fell upon the fleeing and defeated Royalists (Williams 2001).

Aftermath & Consequences

Montrose escaped from the battlefield with a few companions and after wandering for several days reached Assynt. According to Sallagh, he was discovered, together with a Major Sinclair, by a patrol sent out by Neil MacLeod, Laird of Assynt, in response to a letter from Andrew Monro, Strachan's scout. He was brought to Ardvreck Castle and handed over to Major-General Holbourne (later to command the Scottish infantry at the Battle of Inverkeithing in 1651). Other versions differ slightly, in having Montrose seeking food and shelter and being taken to MacLeod, who handed him over to the Covenanters in return for the reward which had been put on Montrose's head in 1644 (Williams 2001). Whether or not this constituted a 'betrayal' as Royalist literature alleged, the result was the same. On 21 May in Edinburgh, Montrose was executed by hanging.

Montrose remained loyal to Charles until his death; unfortunately his loyalty was not reciprocated. On 12 April it was reported that Charles had all but agreed terms in the negotiations with the Covenanters which had started again in mid-March although on 26 April it seems Charles was still trying to prolong negotiations to allow Montrose time to make progress with his invasion. On May 1, apparently without any knowledge of the battle or its outcome, Charles accepted the terms offered the previous year in what both he and the Covenanters recognised to be a hollow agreement, and he later signed the Solemn

League and Covenant on 23 June. Shortly after this, the Covenanters invaded England on his behalf. On 3 May Charles sent Montrose orders to disband without having any idea what his situation was and he later denied any involvement in the invasion. '...there is every indication that he abandoned Montrose with the same cynicism which allowed him to accept the solemn league' (Cowan 1977). Essentially, the outcome of the battle which cost the life of Montrose and hundreds of men was politically irrelevant.

Events & Participants

Although the battle itself could be regarded as a fairly minor event with no more than 2000 men on the field, it is notable as the last action in which the by then legendary Montrose was engaged. He escaped the field but was captured within a couple of days and held in Ardvreck Castle, after which he was tried and executed for treason in Edinburgh. Charles II is generally held to have behaved in a somewhat duplicitous fashion with regard to Montrose, encouraging him to lead an invasion into Scotland against the Covenanters, while also negotiating with them for his return as King of Scotland. Even at the end of it all, Charles did nothing to save Montrose from execution.

James Graham was the fifth Earl of Montrose and the first Marquis of Montrose. He was the chief of Clan Graham. Montrose had been a supporter and signatory of the National Covenant in 1638, but had then become a Royalist, although he was driven by motives other than a desire to impose the Divine Right of Kings upon Scotland. He and Archibald Campbell, the eighth Earl of Argyll, were bitter rivals, and Montrose believed that the Covenant had become nothing more than a vehicle for Argyll's ambition. Always a moderate among the Covenanters, Montrose considered that the agreement in 1641 with Charles that had removed episcopacy from Scotland had fulfilled the demands of the Covenant and that to continue in opposition to him would be breaking that agreement. Following the signing of the Solemn League and Covenant in September 1643, Montrose presented himself to Charles I service at his headquarters in Oxford. On behalf of the King, he then fought a campaign intended to draw Covenanter forces away from supporting the Parliamentarians in England, and in this it was a success. Montrose fought a series of seven battles against Covenanter armies across the Highlands in 1644 and 1645, beginning with Tippermuir and ending at Philiphaugh, where he suffered his only defeat. He attempted to do the same on behalf of Charles II in 1650, but on this occasion fought only a single battle at Carbisdale. After his defeat there, he was captured and brought to Edinburgh for trial. On 21 May 1650, he was hanged and then beheaded. His head was fixed to a spike on Edinburgh's Tollbooth, his body quartered, and his limbs were displayed in Stirling, Glasgow, Perth and Aberdeen. Following the Restoration of Charles II as king in 1660, Montrose's remains were collected together once more and were interred in the High Kirk of St Giles in Edinburgh in May 1661.

Sir John Hurry was in command of Montrose's vanguard in the battle. Hurry had fought in Germany as a young man before returning to Scotland. He had a chequered career, switching sides repeatedly. He first came to prominence in the so-called 'Incident' when Royalists plotted to kidnap the Marquis of Argyll, the Marquis of Hamilton and the Earl of Lanark, who were the leading Covenanter nobles; Hurry betrayed the plot to the Covenanters and joined the Covenanter cause. He fought for the Parliamentarians at Edgehill and Brentford before switching sides to the Royalists for whom he fought at the Battle of Chalgrove Field and at Marston Moor. He switched sides again, and it was as a Covenanter that he led the army sent to bring down Montrose in the Spring of 1645 that was utterly defeated at Auldearn. After losing at Auldearn to Montrose, he drifted back into the Royalist cause, joining the Engagers; this was a faction of Covenanters who signed an agreement with Charles I in 1647 to fight for him against the English Parliamentarians. He was one of the few Covenanter officers to join the Duke of Hamilton's expedition into England and was captured at the Battle of Preston in 1648. He escaped to the Continent, where he fell in with Montrose, and accompanied him on his last adventures; like Montrose, it ended in his execution in Edinburgh, on 29 May 1650.

Archibald Strachan, commander of the Covenanter forces at Carbisdale, is little remembered today but had an eventful career as a dragoon officer during the Wars of the Three Kingdoms. Born in Musselburgh, he fought on the Parliamentarian side at the Battle of Lansdown, outside Bath, in July 1643, after which he was promoted to major. By 1645 he had returned to Scotland and joined the Covenanter army and was noted for his religious

conviction. In 1649 he was promoted to the rank of Lieutenant-Colonel in Ker's Regiment. He distrusted Charles II in his dealings with the Covenanters but fought well at the second Battle of Dunbar against Cromwell in 1650; it was his regiment on the Scots' right flank halted Lambert's initial cavalry charge. He was a member of the Remonstrant party that after Dunbar pledged neutrality in the war against Cromwell until or unless Charles repented and genuinely embraced the Covenant. Strachan himself went even further and defected to Cromwell with a small group of men. He was excommunicated from the Kirk for this in January 1651. He died in November 1652.

Context

In 1638 the National Covenant was signed by many in Scotland, pledging opposition to the reforms proposed by Charles I, the King of the two separate nations of England and Scotland. Amongst other proposals Charles wanted to replace the democratic Presbyterian system with a hierarchy of bishops and create a church modelled on High Anglican lines, and to finance his reforms by re-possessing the former land holdings of the Catholic Church which had been sold on at the Reformation and now formed the basis of many landowners' status and wealth. In 1639 and 1640 Charles was defeated in the two Bishop's Wars. Desperately short of finance, Charles was forced to recall the English Parliament, the so-called Long Parliament, and they reached a peace with the Covenanters in the Treaty of London in 1641. However, Charles and the English Parliament remained at odds over who should control the army, and the first English Civil War began in 1642. Initially the Royalists and the Parliamentarians were relatively evenly matched, and the Parliamentarians opened negotiations with the Covenanters for their assistance in breaking the deadlock. In 1643, under the terms of the Solemn League and Covenant, the Covenanter government of Scotland allied itself with the English Parliament and entered the war in England in early 1644, marking a major turning point in the war. Charles attempted unsuccessfully to foment rebellion in Scotland and the Scottish army went on to make a major impact in the campaign for the north of England. Following crushing defeat at Marston Moor on 2 July 1644 the King tried again, appointing James Graham, the 5th Earl of Montrose, as his military commander in Scotland. Montrose had been part of the abortive rebellion and was a former Covenanter himself who had joined the King in 1643. On 28 August 1644, Montrose raised the royal standard and embarked on a campaign against the Covenanter forces in the Highlands (Reid 2003).

In the next two years, Montrose, with forces which changed constantly in size and composition, won a series of victories over the Covenanters under a number of different commanders, including: Tippermuir (1 September 1644), Aberdeen (13 September 1644), Inverlochy (2 February 1645), Auldearn (9 May 1645), Alford (2 July 1645) and Kilsyth (16 August 1645) and was elevated to 1st Marquis of Montrose by Charles as reward. However, he was defeated at Philiphaugh near Selkirk on 13 September 1645 by much superior Covenanter forces commanded by Lieutenant-General David Leslie. He endeavoured to carry on his campaign in the North-East, and also tried to threaten Glasgow, but lack of co-operation and poor relations between the leading Royalist commanders meant that they achieved little success and Montrose's campaign petered out in early May when his forces besieging Inverness were taken by surprise by Major-General Middleton's advance and fled without a fight. Although Huntly, another Royalist commander, stormed Aberdeen on 14 May, a few weeks later Charles, who had surrendered at Newark on 5 May, ordered his forces in Scotland to lay down their arms. Although Montrose was reluctant to do so, he finally disbanded his forces at Rattray on 30 July after agreeing terms with Middleton and then fled abroad (Reid 2003).

After the executions of Charles I in January 1649 and the Marquis of Huntly in March, Royalist unrest allied to hatred of the extreme Covenanter government led to rebellion in the Highlands which was put down by Sir Archibald Strachan who routed the rebels at Balvenie Castle near Dufftown on 8 May 1649. In the meantime, the Covenanter government had proclaimed the exiled Charles II as King of Scotland and attempted to negotiate with him in Holland, hoping to get him to accept the Covenants and abandon his father's ideas of establishing an Episcopal church and re-possessing land once belonging to the Catholic Church. Charles had, however, appointed Montrose to be Lieutenant-Governor of Scotland and Captain-General of the Crown's forces and sent him to seek military assistance from the monarchs of Europe in mounting an invasion of Scotland. He had only

limited success, but got enough support from Sweden and Denmark to obtain arms, ammunition and ships and money enough to employ several hundred mercenaries. An advance party reached Orkney in September 1649 under the command of the Earl of Kinnoul, consisting of 80 officers and 100 Danish soldiers. Although Kinnoul died, he was replaced by his younger brother. More reinforcements reached Orkney in the spring, but two supply ships were lost on the voyage. When Montrose arrived in March 1650, he found that Charles had agreed to enter further negotiations with the Covenanters. However, Charles still encouraged Montrose to proceed with invasion, perhaps hoping that success would allow him to ignore the Covenanters completely or at least allow him to extract concessions (Roberts 2000).

Once Montrose had arrived at Kirkwall in Orkney with reinforcements of a mixed group of Royalist exiles and Danish mercenaries, he began to prepare for an invasion of the mainland. Reid states that Montrose was on very shaky ground and a more prudent general might have waited in Kirkwall to see the outcome of negotiations being conducted between the Covenanter government and Charles (Reid 1990). Gordon of Sallagh, a contemporary and a follower of the Covenanter Earl of Sutherland, stated that Montrose landed in Caithness with one thousand six hundred and fifty, not exceeding fifteen hundred men (presumably 'men' refers to foot soldiers, rather than gentlemen and horse). He then comments 'With an arrogant pride, he thought with that number to overrun this kingdom, which a man of his experience would not have undertaken, without the assurance of friends in Scotland' (Sallagh 1813). Events were to prove that Montrose's hopes of raising support were groundless.

According to Sallagh, Montrose sent Sir John Hurry, once a Covenanter commander, across with an advance guard of 500 to secure the Ord of Caithness, a narrow defile separating Caithness from Sutherland, Montrose landed near John O'Groats on 12 April, and then moved south, besieging and taking the surrender of Dunbeath castle, before moving into Sutherland. The Earl of Sutherland, lacking horse, gave ground before Montrose, but left strong garrisons in the castles of Dunrobin, Skelbo, Skibo and Dornoch. Sallagh says that Montrose arrived at Strathoykel on the sixth day after landing and moved to Carbisdale, where he waited in vain for the recruits he hoped would join from Strathnaver (Sallagh 1813). Throughout this campaign, his attempts to recruit had very limited success because of the hold the Covenanting nobility had over the area (Roberts 2000). Cowan says that Montrose had completely failed to appreciate that the balance of power in the north had shifted to the Covenanters in the shape of the Earl of Sutherland and the few gentlemen who joined him were those who had already lost out from Sutherland's rise and had little left to risk (Cowan 1977).

Unknown to Montrose, whose intelligence and scouting, not for the first time, was woefully deficient, a sizeable government force under Colonel Archibald Strachan was in the area and was well aware of Montrose's presence. Montrose, on the other hand, believed that there was only one cavalry troop in the area (Reid 1990). Sallagh says it was agreed in a council of war that the Earl of Sutherland should return to Sutherland to protect his lands from possible attack by Harry Graham, the brother of Montrose, who had been detached to raise recruits in Caithness and whom they feared might be joined by recruits from Strathnaver, and that the government forces should move to meet Montrose. This they did on 27 April 1650 at the Battle of Carbisdale (Sallagh 1813).

Battlefield Landscape

Montrose entered the area of the battle, on the wide flood plain, from the north, having marched through the narrow pass between the high ground on which Carbisdale Castle now stands and the river. Although a source of debate within the sources, the presence of earthworks at the eastern end of the village of Culrain suggests that he was here for several days and did fortify his camp. Although the earthworks have not been subject to any form of detailed investigation, the angled bank and ditch in the field to the south of the village hall does bear a striking similarity to a ravelin. If this interpretation is correct, then it places Carbisdale within a very small number of battlefields in Scotland, and indeed in Britain, with associated earthwork defences.

Strachan and his Covenanters approached from the south, though it is difficult to be certain

about the deployment of his men, given that the accounts describe his attack as an ambush carried out by three groups. It seems likely that the battle took place on the flood plain, possibly in front of the camp, with Montrose's men quickly retiring into the woods, which can still be seen, on the slopes to the west of Culrain village.

Location

A number of detailed descriptions of the site of the battle are given in the various sources.

One contemporary source says the battle took place at 'Craigchoynechan', beside Carbisdale. (Sallagh 1813). Another says only that they were drawn up in a place near a 'Scrogie Wood' (Balfour 1825). Reid describes the Royalists being ambushed by Strachan on the open strath at Carbisdale, near the present day village of Culrain (Reid 1990). Roberts puts the action at Kincardine, just south of Ardgay, on the flat ground just north of the Culrain Burn (Roberts 2000).

Cowan gives a more detailed picture. He believes Montrose was on the move, fording the Oykel, just west of the point where it is joined by the Cassley, to march along the south bank of the river. He puts the present day village of Culrain in the middle of the battlefield, situated in the middle of level ground roughly triangular in shape, bounded to the north and west by the densely wooded slopes of Craig a' Choineachan and the low wooded slopes of the 'Scroggie Wood', on the east by the Kyle and on the south by the Culrain Burn. He believes that Montrose marched through the narrow pass between the Creag and the Kyle into the centre of the triangle, facing south-eastwards towards Bonar Bridge and the Dornoch Firth (1977).

Another very detailed suggestion is made by Williams:

'With the hills to the north and the Kyle estuary to the east, the burn enclosed a triangle of level ground admirably suited to cavalry. At the northern point of this triangle was Carbisdale Loch, and, beyond, a narrow defile overhung by Craig-caoinichean. Here, in the jaws of the pass was Montrose's camp. His left flank rested on the Kyle. His right and rear were protected by the hills and on the bluff facing south-east towards the open ground the Royalists had thrown up a formidable breastwork. The position was a strong one and could not be taken by cavalry in a frontal assault.' (Williams 2001).

The location is considered in Highland Council's Historic Environment Record MHG9159, which nominally places the battle site at Lamentation Hill, Carbisdale, Grid Ref. NH5680 9450. Scroggie Wood is not mentioned on current or 19th century maps. If Montrose was indeed entrenched as some sources claim,

'There are no current indications of location of the entrenchments, the lower flat lands above the river are heavily improved and now cut by the railway-the only earthworks (slight) are opposite Mains Farm and these do not appear defensive. The lower slopes have seen various levels of agricultural improvement, but in a general check of the area no early earthwork features were seen. Only structures are dyke walls (ruinous) abutting some of the road.'

This record also says that, according to some sources, the dead from the battle were buried in the Carn non Conach (NH59SE0004) at Rhelonie, which is some distance away to the south. It also says there are reports of undated bodies from the peat (laid out in rows) 'at Culrain'. The record also suggests that if the hidden cavalry at Wester Fearn attacked Montrose's army as they approached onto the flat area and skirmishing stretched back as far as Carbisdale farm and also on to the Rhelonie area then the battle will have occurred over an extremely large area.

The Record quotes The National Statistical Account 1845 (Rev H Allan),

'Montrose was surprised on level ground, near a pass called Invercharron (Invercharron Hill - NH 5791), on Saturday, 27 April 1650. Montrose tried to reach a wooded, craggy hill in his rear but was overtaken and defeated by Lt-Col. Strachan. The ground where the battle was fought ... took its present name, Craigcaoineadhan, which may be translated the Rock of Lamentation, - from the event ...'.

The record goes on to say that

'Creag a'Choineachan is the name applied to the area on the Ross-shire OS 6" map 1907 which is named Lamentation Hill, etc. on OS 6" 1881. If Lamentation Hill is indeed the hill towards which Montrose was retreating the 1907 OS site could well be that of final engagement, and could thus be accepted as the site of the battle, the 1881 OS site being more commemorative than factual.'

Terrain

The battlefield is centred on the low lying plain to the west of the river which debouches into the loch (this is most likely a raised beach). The main action is likely to have been contained within the area to the north of burn which cuts across the plain from the south east to the north west, creating a triangle of flat ground. Montrose appears to have chosen his location at the north end of the plain, at the foot of the crags, as this would allow him to observe the approach of any force from the south, across the plain. It is difficult to envisage how Strachan's force managed to surprise Montrose, who was securely placed behind what appears to be field fortifications, unless the attack came once Montrose had left the cover of his camp and was moving his army south across the plain. It is possible that Strachan moved his men into the cover of the depression which accommodates the burn under cover of darkness and also across the higher ground to the west after approaching from the south.

The gentle wooded slope which fringes the north western edge of the plain is consistent with Montrose's retreat to 'Scroggie Wood', while some of his force appears to have fled to the east and come to grief in the river.

Condition

The open plain to the south of Culrain is almost entirely given over to improved grazing, with large fields bounded by fences. The gentle slopes to the north-west, which appears to represent Scroggie Woods is occupied by mixed deciduous woodland and therefore may retain some of the character of the 1650 landscape. The village of Culrain was not present in 1650 and represents a mix of late nineteenth/early twentieth century and modern dwellings. There has been some recent development in the form of house construction but this has thus far been very limited.

The possible field fortifications present in the field just to the south of the village hall are relatively clear, their good condition probably reflecting their pronounced character when freshly constructed: they appear to be a ravelin. A later track has been driven through the eastern flank of this feature, and this may represent an earlier continuation of the road as it leaves the bridge across the railway, to the east of the feature.

To the rear (north) of the village hall, is the area where the main camp would be expected, if the triangular shaped feature on the south side of the hall is the tip of a ravelin. There is a deep ditch running along the western side of the road where it runs north to south to the north of the village hall, and this may represent part of the camp defences, and indeed judging from its angle may be a continuation, with the ditch better preserved but the bank lost, of the ravelin to the south.

It was noted on the field visit that there has been recent tree planting in the area which may represent the camp and this is likely to have had an impact on any buried archaeology in that area.

Archaeological & Physical Remains and Potential

The question of physical remains above ground was considered in the Highland Council Historic Environment Record (HER) MHG9159, discussed in detail below under Battlefield Landscape. This concluded that further work comparing historical accounts with features on the ground would be required.

The area of the battle, on the flat ground to the west of the river is a relatively open landscape, with the village of Culrain having a fairly small footprint. The initial actions of the battle are likely to have taken place on the plain to the south of the village, with the Royalists then retreating to the wooded hills to the north-west. The potential for battle archaeology within this area is therefore good, with metal objects including musket shot, probably existing in the topsoil.

As noted above, there has in the past been doubt about the status of upstanding remains in the vicinity of the village. However, following a site visit in association with the compilation of the Inventory of Historic Battlefields it is now clear that an earthwork located in the field immediately to west of the road bridge over the railway, on the outskirts of the village, may well represent an arrowhead-shaped ravelin. This feature, which is represented by linear banks and ditches coming to a point which projects to the south, is typical of sixteenth century field fortifications and was probably located in advance of a fortified camp or other position. The orientation of the feature, which is at odds with all the later field boundaries, is in keeping with an earthwork sitting in advance of Montrose's camp, in the expectation that an attacking force will be advancing from the south, across the flood plain, which appears to have been the case.

The clear implication of this feature is that Montrose did indeed have a camp at this location, which given the scale of the fortifications, appears to have been occupied for at least several days prior to the battle. There are some banks and ditches to the rear (north) of the ravelin, behind the village hall, which may represent defensive works associated with the main part of the camp.

Cultural Association

The battle is not particularly well known today and there are no known poems or ballads about the engagement, although it is briefly referred to in *The Braes of Sutherland*, a ballad of the Highland Clearances by the contemporary Scottish folk-rock band Wolfstone. There is one place name which may be associated with the battle. This is Creag a' Choineachan; the hill to the north of the flood plain on which the initial encounter seems to have taken place. The Gaelic name of the hill is commonly translated as Lamentation Hill, which may refer to the retreat and defeat of Montrose and his Royalists.

Commemoration & Interpretation

In autumn 2009, the 1st Marquis of Montrose Society was considering establishing a memorial in tribute to the sacrifices made by many Orcadians during and prior to the battle of Carbisdale. (Kirkwall and St Ola Community Council minutes 29 August 2009).

References

Bibliography

- Cowan, E. J. 1977. *Montrose for Covenant and King*. Weidenfeld and Nicholson, London. 280-91.
- Reid, S. 1990. *The Campaigns of Montrose*. The Mercat Press, Edinburgh. 177-78.

Asset/Event Number	104
Asset/Event Name	Loedebest, settlement 650m W of
Type of Asset/Event	Settlement
Date and/or Period	Post-medieval
Listing No./NRHE Number	SM5145; ND13SW 33
HER Number	MHG629
Status	Scheduled Monument
Section:	N/A
Easting	313140
Northing	932167
Council	Highland
Condition:	N/A
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5145 This settlement consists of three buildings, associated dykes and field systems. One building (at Grid Ref. ND12883204) is small and rectangular and isolated some way to the W of the main settlement. The other two buildings include one small rectangular building and a long house. The long house has stone walls attached to the NW and NE; the wall to the NE forms part of a stone walled enclosure. There are faint traces of wall foundations to the SE of the long house and this could indicate the existence of an earlier settlement on this site. There is evidence for rig cultivation alongside the river. Two areas are proposed for scheduling. One measures 30m SW-NE by 30m SE-NW and covers the isolated rectangular building. The second area measures a maximum of 250m WNW-ESE by 110m WSW-ENE to include the other buildings, linear dykes and rig and furrow. The areas proposed for scheduling are shown in red on the attached map. Statement of National Importance This monument is of national importance for its potential to contribute to an understanding of post medieval settlement, land use and the process of the Clearances in this area of Caithness. The buildings are well preserved and incorporate architectural information.
Asset/Event Number	105
Asset/Event Name	Loedebest, settlement
Type of Asset/Event	Settlement
Date and/or Period	Post-medieval; possible medieval
Listing No./NRHE Number	SM5152; ND13SW 44
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	313599
Northing	932200
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5152 This monument consists of four clusters of houses with associated arable fields. A settlement has probably existed here since at least the later sixteenth century, as Timothy Pont's map marks 'Lybuster' which probably relates to Loedebest. The settlement is also recorded in charters of 1619 ('Lodubiste') and 1624 and is marked on Roy's map of 1747-1752 as 'Lodbas'. At ND13853195 are the foundations of three long houses, two kiln barns and a number of enclosures. At ND13393240 are the foundations of a long house, a kiln house, a rectangular building which has been reused as a sheepfold and enclosures. At ND13463225 are the more substantial remains of three long houses, a kiln barn and a field system. At ND13913205 are the foundations of two long houses, a rectangular building, a kiln barn and a field system. At ND13743223 are the foundations of a rectangular building and field system. The field systems of the post medieval and modern farms surround all of these settlement clusters.

The area to be scheduled measures 1060m NW-SE by a maximum of 550m N-S, to include the house clusters and field systems. The road from Loedebest to Achnaclyth is excluded from the scheduled area, as is the recently abandoned farmhouse and farmyard at Loedebest. The chambered cairn 400m WNW of Loedebest is also excluded as this is subject to a separate scheduling proposal. The area proposed for scheduling is shown in red on the attached map.

Statement of National Importance

The monument is of national importance for its potential to contribute to our understanding of post medieval settlement, land use and the process of the Clearances in this area of Caithness. The settlement areas and field systems form an extensive and well preserved landscape of post medieval settlement. The documentary references indicate early occupation on this site and some of the less substantial foundations could represent buildings of early post medieval or earlier date.

Asset/Event Number	106
Asset/Event Name	Loedebest, settlement 1300m W of
Type of Asset/Event	Settlement
Date and/or Period	Post-medieval
Listing No./NRHE Number	SM5189; ND13SW 34
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	312458
Northing	932336
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5189 This site is a post medieval settlement with the remains of 6 buildings, associated enclosures and an extensive area of rig cultivation. The 6 buildings include 4 which survive as turf-covered foundations and 2 better preserved structures. A fairly long period of occupation is probably indicated on this site. The enclosure to the E of the settlement is oval in shape.

Associated linear dykes and field systems occur on all sides of the settlement. The area to be scheduled measures 600m E-W by a maximum of 300m N-S, to include the buildings, other structures and the field system of this settlement, as shown in red on the attached map.

Statement of National Importance

This monument is of national importance for its potential to contribute to our understanding of post medieval settlement and land use and the process of the Clearances in this area of Caithness. The settlement appears to show evidence for a long phase of occupation. The less well preserved buildings may indicate an early phase of occupation on this site, while the buildings of the presumed later phase are well preserved and incorporate important architectural information.

Asset/Event Number	107

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Loedebest, settlement 900m WNW of
Type of Asset/Event	Settlement
Date and/or Period	Post-medieval
Listing No./NRHE Number	SM5198; ND13SW 32
HER Number	Various
Status	Scheduled Monument
Section:	N/A
Easting	312929
Northing	932435
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://portal.historicenvironment.scot/designation/SM5198 This post medieval settlement consists of the remains of a long house, an enclosure, an oval mound and a sheepfold. The long house is 32m long and 5.5m wide. The walls are defined by lines of boulders, 2 or 3 courses high in places and about 1m thick. The building is divided into 3 compartments, each with an entrance from the E. The enclosure is 22m by 28m is three-sided and attached to the long house. The walls are much denuded. Nearby are the remains of an oval mound about 13m by 6.5m which consists of a low earth bank heavily overgrown with heather and with a hollow in the centre. Nearby is a circular stone walled sheepfold. The whole complex is defined by a dyke. The area to be scheduled measures 280m NW-SE by 125m NE-SW, to include the long house, enclosure, mound, sheepfold and dyke. The area is defined to the S by the Achnaclyth-Loedebest road and on the other sides is taken 15m beyond the dyke which defines the settlement area. The roadstone quarry beside the road is excluded from the scheduled area. The area to be scheduled is shown in red on the attached map. Statement of National Importance The site is of national importance for its potential to contribute to an understanding of post medieval settlement, land use and the process of the Clearances in this area of Caithness. References The monument is number DB18/18 in Dr A Morrison's survey of Dunbeath Estate

Asset/Event Number	108
Asset/Event Name	Ousdale
Type of Asset/Event	Hut Circle(s)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND02SE 16.00
HER Number	MHG814
Status	Non-designated Heritage Asset
Section:	N/A
Easting	306700
Northing	920600

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 108 for details.* https://canmore.org.uk/site/7531/ Centred at ND 067 206 and levelled into a S-facing slope are two circular, stone-walled huts. Hut 'A' [Asset 108.1] measures 8.0m in diameter between the centres of a wall spread to 2.5m all round. Several inner facing-stones are visible in the N and E arcs and an occasional measurements or wall thickness. The simple entrance is in the SSE. Hut 'B' [Asset 108.3] measures 7.0m in diameter between the centres of a peat-covered wall spread to about 3.0m. The simple entrance is in the S. There are several heavily peat-covered stone clearance heaps and traces of probably contemporary walls in the area, but peat growth hides details of cultivation plots. Visited by OS (I S S) 21 April 1972. The hut circles (A and B) are as described by the previous OS field surveyor. At ND 0670 2059 is a further example [Asset 108.4], measuring 6.5m NW-SE by 5.5m transversely within a heather-covered wall 0.2m average height and spread to 2.0m. The entrance, of simple form, is in the SE. Huts A-C surveyed at 1:2500. Visited by OS (N K B) 8 November 1982.
Asset/Event Number	109
Asset/Event Name	Morvich Burn
Type of Asset/Event	Cairnfield (Period Unassigned)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24.00
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275260
Northing	902180
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see Assets 384 and 385.1-385.5 for details* https://canmore.org.uk/site/5933/ NC 752 021 Fringing a later depopulated settlement to the SW is an area of scattered stone clearance heaps, most numerous in the SE, and of the type usually associated with hut circles though none are evident. Visited by OS (J M) 31 July 1975. The small cairns extend W and merge into the area of small cairns associated with the three hut-circles (NC70SW 34) to the E of the Allt Bad a' Chrasgaidh.

Appendix 1: Gazetteer of Heritage Assets and Events

Information from RCAHMS (PM) 4 December 1997

Asset/Event Number	111
Asset/Event Name	Loch Farlary
Type of Asset/Event	Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 29.00
HER Number	MHG59296; MHG41270
Status	Non-designated Heritage Asset
Section:	N/A
Easting	276600
Northing	904300
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/5938/ NC 7667 0438; NC 7672 0445. Two hut circles 'A' and 'B' respectively. 'A', of unusual definitivity though peat-overgrown, is 13.0m in diameter between wall centres. An earthfast stone slab 0.7m high edges the W side of a well-defined entrance gap in the S. 'B', ill-defined and obscured by peat, is 11.0m NW-SE by 9.5m between centres of a wall, much depleted around SE arc. The wall appears to expand to 5.0m at a probable entrance gap in the S though this effect could be due to tumble. About 20.0m to the NE of hut 'B' an arc of peat-overgrown rubble and a large slab on edge in the S arc may indicate the remains of a hut with portal stone. Contemporary cultivation is marked by one or two stone clearance heaps around hut 'B'. Surveyed at 1:10,000. Visited by OS (J M) 11 August 1975.

Asset/Event Number	112
Asset/Event Name	Loch Farlary
Type of Asset/Event	Hut Circle (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 30.00
HER Number	MHG9433
Status	Non-designated Heritage Asset
Section:	N/A
Easting	277030
Northing	904400
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/5940/ NC 7703 0440. A hut circle measuring 9.0m in diameter between centres of a peat-overgrown wall, with an entrance in the SE. There are no indications of contemporary cultivation. Surveyed at 1:10,000. Visited by OS (J M) 11 August 1975.
Asset/Event Number	113
Asset/Event Name	Achork
Type of Asset/Event	Field System (Period Unassigned), Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 36.00
HER Number	MHG11120
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275600
Northing	904200
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/5946/ NC70SE 36 756 042. ('A' NC 7460 0429) Undescribed sub-circular feature. OS 1:10,000 map, (1970) NC 756 042. A settlement of three oval huts ('A'-'C') set within a contemporary field system well marked by stone clearance heaps particularly around the S half, and some wasted field walls. Hut dimensions are between wall centres. 'A' is 11.0m NE-SW by 9.5m with an entrance in the SW. 'B', the best preserved, is 14.0m NNE-SSW by 12.0m with an entrance in the SSW. 'C' is 11.0m NNW-SSE by 9.0m with an entrance in the SSE. Hut 'A' revised at 1:2500. Huts 'B' and 'C' surveyed at 1:2500. Visited by OS (J M) 12 August 1975.
Asset/Event Number	114
Asset/Event Name	Dunrobin Glen
Type of Asset/Event	Cairnfield (Period Unassigned), Hut Circle (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 39.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG11123
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279410
Northing	904690
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/5949/ NC70SE 39 7941 0469. At NC 7941 0469, towards the base of a steepening south-facing slope is a peat-silted hut circle measuring 10.5m N-S by 8.0m E-W within a tumbled wall 0.4m maximum height and spread to 2.0m. The entrance of simple form is in the south quarter. In the vicinity are a number of stone clearance heaps and one or two lynchets which are associated with the hut. Surveyed at 1:10 000. Visited by OS (N K B) 15 May 1981.
Asset/Event Number	115
Asset/Event Name	Dunrobin Glen
Type of Asset/Event	Cairnfield (Period Unassigned), Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279544
Northing	904515
Council	Highland
Condition:	Various
Alignment:	Various
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 115 for details.* https://canmore.org.uk/site/5951/ NC70SE 40 795 045. At NC 795 045, at the base of a steepening south-facing slope, is a close group of three similar hut circles (A-C), now overgrown with heather. They measure from 13.0m by 11.5m to 12.5m by 10.5m within tumbled walls spread from 2.5m to 3.5m, and up to 0.6m high. The entrance in each case is in the south or south-south-east on the line of the longer axis. There is no definite evidence of cultivation around the huts, but some 200m to the NE are several stone clearance heaps and cleared ground, which are probably contemporary with the huts. Surveyed at 1:10,000. Visited by OS (N K B) 15 May 1981. References

Appendix 1: Gazetteer of Heritage Assets and Events

Harden, J. (1990) 'Survey Dunrobin Glen (Golspie parish)', Discovery Excav Scot, 1990.
Page(s): 28

Asset/Event Number	116
Asset/Event Name	Allt Bad A' Chrasgaidh
Type of Asset/Event	Field System (Prehistoric), Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274920
Northing	902520
Council	Highland
Condition:	Various
Alignment:	Various
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 116 for details.* https://canmore.org.uk/site/5990/ NC70SW 34 centred on 7488 0249 (A:NC 7488 0249) Hut Circle (NAT) OS 1:10,000 map, (1971) Centred on NC 749 024, along a hillside shelf, is a settlement of three hut circles (A-C) accompanied by a field system. Huts B and C are newly located. 'A', turf-covered, measures 9.0m diameter within a wall spread from 2.0 to 2.5m and up to 0.6m high. The entrance is no longer evident but was probably in the S. 'B', heather covered, measures about 11.0m diameter inside a wall spread to 2.0m and 0.3m high. The entrance is in the S but there is some indication of a break in the wall in the E. 'C' measures some 9.0m diameter internally. The wall is reduced to an ill-defined spread. There is a possible entrance in the W side. The field system is evident in numerous clearance heaps, spaced from 10.0 to 25.0m apart, and occasional ruckles of cleared stone; no measurable plots are discernible. South and west of hut A there is some intrusion of 18/19th century strip cultivation. Revised at 1:10,000. Huts B and C surveyed at 1:10 000. Visited by OS (J M) 13 March 1981.
Asset/Event Number	117
Asset/Event Name	Allt Bad A Chrasgaidh
Type of Asset/Event	Building (Post Medieval), Enclosure (Period Unknown), Settlement (Prehistoric)(Possible)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SW 35.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG10631
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274670
Northing	902050
Council	Highland
Condition:	Various
Alignment:	Various
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 117 for details.* https://canmore.org.uk/site/5991/ NC70SW 35 7467 0205. (NC 7467 0205) Stone Circles (NAT) OS 1:10,000 map, (1971) This is a homestead on an exposed rise in high ground. It is sub-circular, and measures approximately 13.0m across within a wall ranging in thickness from 1.4m to 1.6m, and distinguished by a fairly complete inner face, up to 0.7m high, of contiguous slabs. There is an entrance in the south south east. Encircling the homestead at a distance of 4.0m to 9.0m are the remains of a wall; in the east margin between the homestead and this wall, and outside the latter in the north west, are further walling remains. Extending from the north east sector of the encircling wall in a sinuous north west direction, is the peat covered course of a field wall. A stony mound overlies the homestead wall in the north. Some 15.0m south south east down the slope is what appears to be another homestead, but it is almost certainly later, probably contemporary with a deserted post Medieval settlement to the east. It comprises a 'D' shaped enclosure 10.0m by 7.0m internally, and recessed in the straight north side. A sub circular enclosure measuring 4.0m across internally abuts on the east, and no entrance is evident in either. The walling is of boulder slab construction but is now mainly visible as a peat covered spread 1.0m to 1.3m broad and up to 0.5m high. About 25.0m west is a sub oval enclosure of similar mature appearance but slight build, it measures 9.5m by 3.5m within a peat covered wall spread from 0.7m to 0.8m and 0.2m high. It too may be associated with the neighbouring settlement. Planned at 1:500. Surveyed at 1:10,000. Visited by OS (J M) 18 March 1981. Field Visit (6 June 1995) RCAHMS Afforestation Land Survey, Rogart An unusual enclosure, possibly a homestead, occupies the top of a heather-covered, craggy knoll to the SW of the Allt Bad a' Chrasgaidh. An irregular two-compartment enclosure and a building lie on the SE and S slopes of the knoll respectively. The homestead (ROG95 538-9), which may never have been completed, is defined by two concentric circles of orthostatic stones, 1.5m apart and up to 0.6m high, measuring 13m in diameter within the inner ring, with a lined entrance on the E. An oval heap of stones, measuring about 6.5m from E to W by 4.5m transversely and 1m in height, overlies the outer ring of stones on the N arc. Outside the enclosure there is an another ring of stones, which is not concentric to the main structure, but it may have been intended as an outwork to the homestead. The irregular enclosure comprises two unequal compartments, of which the larger is D-shaped and measures 9.1m from NE to SW by 5.2m transversely within stony banks spread to 1.5m in thickness, with a small recess like a bedneuk on the W, 2.3m in length by 1.3m in breadth. The second compartment adjoins it to the SW and measures 4m across, but displays no visible method of access (ROG95 537).

Appendix 1: Gazetteer of Heritage Assets and Events

The building measures 9m from NNE to SSW by 3m transversely within faced-rubble walls, 0.7m thick by 0.4m high, with what may be an entrance on the ESE (ROG95 135). It may be an outlying structure of the township to the NE (NC70SE 55.01).
(ROG95 135, 537-9)
Visited by RCAHMS (PJD) 6 June 1995

Asset/Event Number	118
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 18.00
HER Number	MHG10049
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292600
Northing	912529
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under grass and heather is situated on an edge of a somewhat high riverine terrace overlooking the Sletdale burn. Measures c16m in diameter with banks surviving up to 0.6m tall and spread 2.5m wide. Entrance appears to be in the SE. Slightly depressed interior. https://canmore.org.uk/site/7117/ NC91SW 18 9255 1252. NC 9255 1252. A stone-walled hut-circle was discovered during field investigation on an old river terrace. It measures 10.5m in diameter within an overgrown wall, 0.7m high and spread to 3m, which has an entrance in the east. There is no sign of contemporary cultivation but the smooth appearance of the level area which extends about 100m ENE from the hut suggests early clearance. Surveyed at 1:10,560. Visited by OS (J M) 14 January 1976.

Asset/Event Number	119
Asset/Event Name	Glen Sletdale
Type of Asset/Event	Field System (Period Unassigned), Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292866

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	912761
Council	Highland
Condition:	Various
Alignment:	Various
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see Assets 119.3-119.11 for details.* https://canmore.org.uk/site/7118/ Centred NC 928 127. A settlement of four stone-walled hut-circles ('A'-D') and an associated enclosure within a small field system were discovered during field investigation on the lower slopes of a SE-facing hillside. The huts are similar in form and condition, each set into the slope with an entrance in the SE arc, but peat growth obscures structural details. The sizes vary from 9.0m to 11.0m internal diameter within a wall of about 1.6m estimated thickness. A single portal stone remains at the entrance to hut 'A'. Closing on the SE arc of hut 'B' is a roughly circular enclosure about 13.0m in diameter within a wall spread to 2.5m broad. There is an entrance in the SE. The field system occupies 3/4 hectare around the huts, and comprises an area of cleared ground bounded by four or five stone clearance heaps and some lynchets. One plot 20.0m by 10.0m is visible. Surveyed at 1:10,560. Visited by OS (J M) 13 May 1976.
Asset/Event Number	120
Asset/Event Name	Hut Circle, Sletdale Burn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 7.00
HER Number	MHG10027
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292930
Northings	912700
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see Assets 119.1 and 119.2 for details.* https://her.highland.gov.uk/monument/MHG10027 A track constructed has damaged one side of one of the hut circles. Pottery was discovered and reported to Inverness Museum and Art Gallery and was found to be generally of Iron Age in date. Finder and photographer, N G Lindsay. A M Fox, Highland Council, 27.04.01 The pottery bears general comparison with material recovered from upland sites(principally hut circles) in Northern Scotland. See assoc. docs. File for Pottery descriptions. J Aitken : 19/06/01.

NC91SW 7 9293 1270 to 9304 1269.
(A - NC 9292 1269 : B - NC 9304 1268) Enclosures (NR)
OS 6" map, (1963)

Two circular enclosures were found during fieldwork.
Visited by OS (E G C) 1 June 1961.

Two stone-walled hut circles (A and B) at corrected grid references NC 9293 1270 and NC 9304 1269 respectively, situated in open heathland to the north of an old river terrace. 'A', on the edge of a slope, is about 10m diameter within an ill-defined wall surviving a sparse band of overgrown rubble spread to 2m; the wall has been further obscured by a rough track crossing north arc. A depression in the east arc may indicate an entrance. 'B', levelled into a low rise and peat overgrown, is well preserved. It is 11m NNW-SSE by 10.5m inside a wall spread to 3m. The east side of an entrance in the SSE still retains a lining of stone slabs, indicating a wall thickness of about 2.0m at this point. A break in the wall in the ESE is a modern mutilation. About 120m to the ESE are ruins of a dwelling and enclosures of 18th/ 19th century abandoned settlement. Contemporary cultivation is restricted to a well-defined lynchet about 55m south of hut 'A' crossing the slope, and containing between it and the hut an elongated area, of smooth, heather-covered ground free of stone.
Revised at 1/10,000. Visited by OS (J M) 15 January 1976.

Asset/Event Number	121
Asset/Event Name	Broch, Killin
Type of Asset/Event	Broch
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC80NE 3.00
HER Number	MHG10805
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286736
Northing	907623
Council	Highland
Condition:	Ruinous
Alignment:	N/A
Importance:	Medium
Description	https://canmore.org.uk/site/6475/ NC80NE 3 8673 0761. (NC 8673 0761) Broch (NR). OS 6" map, (1964)

The ruins of a broch, now a structureless mass of stones. What was probably the entrance is exposed towards the WNW as is one side of the passage for about 10ft. At the inner end of the wall face, placed at right angles to its line of direction, is a slab standing 5ft 4ins above present level, and 3ft broad by 6ins to 8ins thick, which may have formed one of the jambs of the doorway. A very small portion of the wall is visible for a foot or two of its height on the N and a part of the outer wall of a chamber on the S.

The inner face of the broch wall is in no place exposed and without excavation it is not possible to obtain accurate measurements.

The massive rampart which protects the broch on the W, some 200 yards distant, appears to be of natural formation.
RCAHMS 1911, visited 1909.

The broch is generally as described above, reduced to a massive heap of stones, up to 1.0m in height.

Short portions of the outer face are visible around the periphery giving an overall diameter of 19.6m and a length of inner face is exposed in the ENE indicating a wall thickness of about 4.7m at this point. In the SW the outer wall of a chamber is visible. Connecting this chamber to the outside face of the broch is what appears to be a secondary entrance, 0.9m wide, which is partially exposed in the tumble, suggesting the broch was re-used at a later date.

The only evidence of outworks are two upright slabs on line on the level area W of the broch.

Re-surveyed at 1/10,560.

Visited by OS (E G C) 16 July 1961 and (J B) 11 November 1975.

Field Visit (24 August 1909) RCAHMS County Inventory: Sutherland

26. Broch, Killin. About 1¼ m. SE. of Oldtown and ¼ m. back from the old road leading thence to Wester Clynekirkton, at an elevation of some 650' above the sea, are the ruins of a broch, now a structureless mass of stones. What was probably the entrance is exposed towards the WNW. By one side of the passage for a distance of about 10'. At the inner end of the wall face, placed at right angles to the line of its direction, is a remarkable slab standing 5' 4" above present level and 3' broad by 6" to 8" thick, which may have formed one of the jambs of the doorway. A very small portion of the outer wall is visible for a foot or two of its height on the N. and a part of the outer wall of a chamber on the S. The inner face of the broch wall is in no place exposed, and without excavation it is not possible to obtain accurate measurements. The massive rampart which protects the broch on the W., some 200 yards distant, appears to be of natural formation.

OS 6-inch map: Sutherland Sheet xcvii.

RCAHMS 1911, visited (AOC) 24th August 1909.

Publication Account (2007) Euan W Mackie Broch Corpus 2

NC80 7 KILLIN ('Loch Brora')

NC/8673 0761

This probable broch stands about 198m (650ft) above the sea and was already a structureless mass of stones in 1909 [2]. The entrance is probably on the west side where one side of a passage is exposed for 3.05m (10ft). A very large slab – at least 1.63m (5ft 4in) in height, 91cm (3ft) wide and 15 - 20cm (6 - 8in) thick – may be a door-check. Short lengths of the outer wallface are visible, suggesting that the overall diameter is 19.6m, and the wall of a mural cell can be seen on the south-west [1]. There seems to be a secondary doorway connecting this chamber to the exterior [1].

Sources: 1. NMRS site no. NC 80 NE 3: 2. RCAHMS 1911a, 9, no. 26.

E W MacKie 2007

Asset/Event Number	123
Asset/Event Name	Caen
Type of Asset/Event	Hut Circle (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND01NW 67.00
HER Number	MHG10161
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	301220
Northing	917730
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Observation by AOC Archaeology during 2024 walkover survey. Hut circle, part of the Scheduled asset SM6014 (Asset 77); did not fall within the survey corridor* https://canmore.org.uk/site/7486/ ND01NW 67 0122 1773 Situated 500m W of Caen. Information from SDD record map (1:10,000)
Asset/Event Number	124
Asset/Event Name	Dunbeath Water, Graveyard
Type of Asset/Event	Burial Ground (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND13SW 20.00
HER Number	MHG1260
Status	Non-designated Heritage Asset
Section:	N/A
Easting	312985
Northing	932354
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/8213/ A graveyard in which interments still take place. It is said to date from the mid 17th century and is the property of the people of the district. (Two names 'Toch na Guall' and 'Toit na Gualainn', and their translation, 'Heap of the Shoulder' have been cancelled and 'Grave Yard' substituted.) OS Name Book 1871. https://her.highland.gov.uk/Monument/MHG1260 'Caithness Monumental Inscriptions', pre 1855 Monumental inscription survey completed by A.S.Cowper & I.Ross. The survey may not include inscription information after 1855 and each inscription transcribed does not give the full details that appear on the stones, abbreviations used. Some omissions and inaccuracies. Published 1992. J Aitken : 20/12/02
Asset/Event Number	125
Asset/Event Name	Creagan Reamhar
Type of Asset/Event	Clearance Cairn (Period Unassigned)

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Undated
Listing No./NRHE Number	ND12NW 19.00
HER Number	MHG966
Status	Non-designated Heritage Asset
Section:	N/A
Easting	312840
Northing	926050
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/8049/ (ND 1284 2605). A clearance heap 10.2 by 12 by 1m high, with an upright slab. Visited by OS (W D J) 23 June 1960. Modern field clearance. Visited by OS (R L) 6 March 1968.
Asset/Event Number	126
Asset/Event Name	Breakachy Burn
Type of Asset/Event	Clearance Cairn(s) (Prehistoric) - (Post Medieval), Field System (Prehistoric), Hut Circle(s) (Pre
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH44NE 10.00
HER Number	MHG44150
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	245510
Northing	845450
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Unknown
Description	*Observation by AOC Archaeology during 2024 walkover survey. Asset and surrounds under tall bracken/dense heather, no detailed survey undertaken. https://canmore.org.uk/site/12356/ Clearance Cairn(S) (Prehistoric) - (Post Medieval), Field System (Prehistoric), Hut Circle(S) (Prehistoric), Souterrain (Prehistoric) (NH 4545) Depop., cairns, etc. OS 6"map annotated by A L F Rivet (nd) Centred at NH 455 455 is a settlement of ten stone-walled huts and a field system. Hut 'E' is circular, the remainder are oval. Except for 'A', 'G' and 'H' the measurements are given between wall centres. Hut 'A', set into a SW-facing slope, is visible as a platform measuring about 12.0 m NNW-SSE by 10.0 m trans- versely, bounded by a stony build-up round the SW arc and a back scarp. The entrance is in the SSE at the change of slope. 'B', set into a W-facing slope, measures about 10.5 m NW- SE by 9.0 m transversely with the

wall spread to about 2.5 m. The 'simple' entrance is in the SE, at the change of slope. 'C', adjacent to 'B', measures about 12.5 m N-S by 10.0 m transversely with the wall spread to about 2.5 m all round. The outer wall face is visible round the E arc. The 'simple' entrance, about 1.0 m wide, is in the S, at the change of slope. 'D', at the base of a knoll, measures about 10.0 m from the NNW through the 'simple' entrance in the SSE by about 9.0 m transversely with the wall spread to about 2.5 m all round. The outer wall face is visible round the S arc. Attached to the W arc of the hut and following the curve of the wall of the hut is an elongated enclosure measuring approximately 10.0 m long by 2.5 m wide within a stone wall spread to about 1.5 m. There is no apparent entrance. It is similar in appearance to the 'souterrains' described on NJ40SW 3. (See 1:250 plan.) 'E', built up on a S-facing slope, measures about 6.5 m in diameter with the wall spread to about 2.0 m. The entrance is not apparent. 'G' has the outer wall face visible round most of the perimeter giving overall measurements of 13.5 m NNW-SSE by 12.0 m transversely. The wall is spread to about 2.0 m all round. The S arc has been robbed and the entrance is not apparent. 'H' has the inner wall face evident round most of the perimeter giving internal measurements of 10.0 m NNW-SSE by about 8.0 m transversely. The wall is spread to an indeterminate thickness. The entrance is not apparent. 'J' is denuded and measures about 9.0 m NW-SE by 8.0 m transversely with the wall spread to about 2.0 m all round. The entrance is not apparent. 'K', set into an E-facing slope, measures about 13.5 m N-S by about 11.5 m transversely with the wall spread to some 2.5 m all round. Stone clearance has been piled over the W arc. The 'simple' entrance, about 1.3 m wide, is in the S at the change of slope. About 15 m NE of hut 'K' is a circular hollow, about 6.0 m in diameter, with traces of walling round the edge. Stone clearance has been piled within.

The field system, partly overlaid by a depopulated steading, is marked by stone clearance heaps, lynchets and walls forming fields varying in size from about 15 m by 10 m to about 50 m by 30 m.

Divorced survey at 1:10,000.

Visited by OS (R L) 17 March 1970

(Name: NH 4555 4550) Settlement & Field System (NR)
OS 1/10,000map, (1975)

The suggested enclosure attached to hut circle 'D', at NH 4550 4545 is almost certainly the line of a collapsed souterrain. Otherwise, the hut circles and field system are as described by OS surveyor.

Visited by OS (J M) 11 February 1981.

Field Visit (March 1979)

RCAHMS: The Archaeological Sites and Monuments of North East Inverness
Tighnaleac NH 455 455 NH44NE 10

This unenclosed settlement comprises the remains of four oval stone-walled houses and two scarped platforms which may represent the sites of timber houses. In the vicinity there are several other platforms of unknown function and also extensive remains of stone clearance, some of which may be of relatively recent date.

RCAHMS 1979, visited March 1979

References

Feachem, R W. (1973a) 'Ancient agriculture in the highland of Britain', Proc Prehist Soc, vol. 39, 1973. Page(s): 344 fig. 12

RCAHMS. (1979c) The archaeological sites and monuments of North-east Inverness, Inverness District, Highland Region, The archaeological sites and monuments of Scotland series no 8. Edinburgh. Page(s): 20, No. 130 RCAHMS Shelf Number: A.1.2.ARC(8)

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	127
Asset/Event Name	Breakachy Burn
Type of Asset/Event	Burial Cairn (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH44NE 11.00
HER Number	MHG2665
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	245609
Northing	845465
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Unknown
Description	*Observation by AOC Archaeology during 2024 walkover survey. Asset and surrounds under tall bracken/dense heather, no detailed survey undertaken. https://canmore.org.uk/site/12357/ At NH 4560 4546, on a knoll and within a field system (NH 44 NE10) are the remains of a cairn measuring about 9.0m in diameter and about 0.5m high. A kerb of eleven contiguous stones survives around the SW arc. The N and E arcs of the cairn are encroached upon by a depopulation steading. Divorced survey at 1/10,000 scale. Visited by OS (R L) 17 March 1970 Activities Field Visit (March 1979) RCAHMS: The Archaeological Sites and Monuments of North East Inverness Tighnaleac 1 NH 456 454 NH44NE 11 This cairn measures about 9m in diameter and 0.5m in height and is bounded by a low kerb of bounded by a low kerb of boulders on the Sand W. RCAHMS 1979, visited March 1979 References RCAHMS. (1979c) The archaeological sites and monuments of North-east Inverness, Inverness District, Highland Region, The archaeological sites and monuments of Scotland series no 8. Edinburgh. Page(s): 11, No. 46 RCAHMS Shelf Number: A.1.2.ARC(8)
Asset/Event Number	128
Asset/Event Name	Tighnaleac
Type of Asset/Event	Burial Cairn (Prehistoric)(Possible)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH44NE 21.00
HER Number	MHG62118
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	245690
Northing	845600
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/12368/ No cairn is identified in the area. There is a scatter of stones at NH 4557 4563, but this is almost certainly stone clearance associated with the hut circles and field system described on NH44NE 10. Visited by OS (J M) 11 February 1981. Field Visit (March 1979) RCAHMS: The Archaeological Sites and Monuments of North East Inverness Tighnaleac 2 NH 456 456 NH44NE A mutilated cairn measuring about 11 m in diameter is situated on the summit of a knoll about 160m N of cairn NH44NE 11. This cairn, and NH44NE 11 both fall within the settlement and field system described on NH44NE 10. RCAHMS 1979, visited March 1979 References RCAHMS. (1979c) The archaeological sites and monuments of North-east Inverness, Inverness District, Highland Region, The archaeological sites and monuments of Scotland series no 8. Edinburgh. Page(s): 11, No. 47 RCAHMS Shelf Number: A.1.2.ARC(8)
Asset/Event Number	129
Asset/Event Name	Dun Fionn
Type of Asset/Event	Dun (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH44SE 10.00
HER Number	MHG2748
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247159
Northing	842884
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Medium
Description	https://canmore.org.uk/site/12382/ (NH 4716 4290) Dun Fionn (NR) Vitrified (NAT) Excavated by Lord Lovat about 60 or 70 years ago, who cut two sections through this vitrified fort, which defaced its original appearance and rendered it difficult to determine its dimensions. On the N side there was until recently a wall from 1 ft to 5 ft high. Outwith the fort there are four circles, two of which measure 4 yds in diameter, one 5 yds, and the other, 2 yds. There is also an oblong or oval space of the same character as the circle. T Wallace 1921 Fort, Dun Fionn: On approaching the remains from the NE along the saddle which unites their site to the hillside beyond, a grass-grown rampart can be seen running athwart the line of approach, a gap in it possibly representing the original entrance. To the S of the gap the rampart runs for about 200 ft before turning W and fading out. From the other side the rampart fades out almost at once, though a distinct low broad ridge runs on what might

have been its course to meet the brink of the precipitous descent to the river. Numerous masses of vitrified matter can be seen among the ruins of the rampart. It is probable that the structure was originally oval on plan, measuring about 200 ft NW-SE by a little less transversely.

Visited by RCAHMS 1957

Dun Fionn overlooks the River Beaully and is flanked by wooded slopes to the E, S and W, with an easy approach from the NE.

The RCAHM description bears little relationship to what can now be seen. The knoll occupied by Dun Fionn measures over all about 38.0 m NNE-SSW by 34.0 m and is about 3.0 m high with a level top measuring some 20.0 m by 18.0 m. Around the NE arc are traces of a wall containing vitrified material. Lord Lovat's excavation remains as a T-shaped trench with no trace of excavation on the W side as depicted by Wallace, whose plan is worthless. The knoll is otherwise featureless. There is no trace of the 'rampart' described by the RCAHMS.

Between about 3.0 m and 6.0 m outside the base of the knoll and encircling it is a terrace, some 2.0 m wide, well-defined around the S and E arcs but almost obliterated elsewhere; this is probably the remains of an additional defence.

There is no trace of Wallace's circular or oval features but halfway down the slope to the S is an oval platform measuring about 7.0 m N-S by 9.0 m.

Visited by OS (R L) 19 March 1965

A small amount of vitrification was observed in the 19th century excavation, at this visit.

At the base of the hill in the S are two ditches with outer ramparts abutting on to steep slopes in the W, with traces of a possible third outside them, denuded by timber operations. These defences are only 20.0 m long and possibly represent an unfinished defence. Traces of a terrace, 3.5 m wide where best preserved, occur along the E flank of the hill. This possibly joins the inner ditch and rampart, but soil slip and mutilation by timber operations have virtually destroyed it at this point.

Between the ramparts and the main fort, and set into the S-facing slope is an eyebrow-shaped platform some 11.0 m E-W by 7.0 m; this is probably a timber hut platform.

Published survey (25") revised.

Visited by OS (A A) 13 January 1972

Dun Fionn: A severely mutilated dun occupies a slight knoll at the SW end of a steep-sided spur on the E side of the River Beaully. The summit of the knoll measures about 18 m by 16 m and is defined by a scarp which represents the remains of a vitrified wall; a further scarp on the NE probably represents the remains of an outwork.

RCAHMS 1979

A dun is the appropriate classification. A blanket cover of dead bracken at the time of visit made proper ground inspection impossible. However, authorities 2, 3 and 4 seem to have distinguished the same outer rampart despite varying descriptions. Authority 5 has obviously seen a second outer defence which he conjectures may have joined with an unmistakeable series of succeeding ditches and banks at the foot of the hill; the latter is puzzling in that being so removed from the accepted citadel area it appears superfluous to any defensive requirement in that respect. A natural trench across the NE approach may be a significant link in the defensive network. An uprooted tree on the SW edge of the citadel area has uncovered some reddened fragments of stone and a small piece of vitrification. There is no trace of any circles or platforms; in the hillside are one or two small shelves probably formed by uprooted trees.

There are some unresolved features about the site, particularly the series of ditches and banks at the foot of the hill, and it may be that the first outwork constitutes the fort proper and that Dun Fionn itself is a separate phase. The site could be likened to that at Langwell in Strath Oyke (NC40SW 3).

Visited by OS (JM) 9 February 1981

Activities

Field Visit (21 August 1943) RCAHMS Emergency Survey (Archaeology)

This site was recorded as part of the RCAHMS Emergency Survey, undertaken by Angus Graham and Vere Gordon Childe during World War 2. The project archive has been catalogued during 2013-2014 and the material, which includes notebooks, manuscripts, typescripts, plans and photographs, is now available online.

Information from RCAHMS (GF Geddes) 12 November 2014.

Field Visit (10 April 1957)

RCAHMS Marginal Land Survey

This site was included within the RCAHMS Marginal Land Survey (1950-1962), an unpublished rescue project. Site descriptions, organised by county, are available to view online - see the searchable PDF in 'Digital Items'. These vary from short notes, to lengthy and full descriptions. Contemporary plane-table surveys and inked drawings, where available, can be viewed online in most cases - see 'Digital Images'. The original typescripts, notebooks and drawings can also be viewed in the RCAHMS search room.

Information from RCAHMS (GFG) 19 July 2013.

Field Visit (March 1979) RCAHMS: The Archaeological Sites and Monuments of North East Inverness

Dun Fionn NH 471 429 NH44SE 10

A severely mutilated dun occupies a slight knoll at the SW end of a steep-sided spur on the E side of the River Beauly. The summit of the knoll measures about 18m by 16m and is defined by a scarp which represents the remains of a vitrified wall; a further scarp on the NE probably represents the remains of an outwork.

RCAHMS 1979, visited March 1979

(Stat. Acct, xiii 1794, 524; Wallace 1886, 346)

Note (5 March 2015 - 25 November 2016) Atlas of Hillforts of Britain and Ireland

The defences of Dun Fionn, which occupies a hillock at the SW end of a low ridge with steep slopes dropping away to the River Beauly on the W and SW, comprise two elements: an inner dun with a massively vitrified wall; and a series of outer defences which though possibly no more than outworks, might equally be the remains of a free-standing enclosure. The dun occupies the summit of the hillock, which is slightly oval and measures about 18m from NE to SW by 16m transversely and is defined by a scarp formed by the ruin of a vitrified wall. The full extent and plan of the outer defences is uncertain, and the observations contained in the descriptions of successive investigators vary widely. In 1957, RCAHMS investigators observed the remains of a rampart crossing the spine of the ridge on the NE, noting numerous vitrified masses along its line and suggesting that it enclosed an area up to 60m across from NW to SE (about 0.23ha). This is perhaps the terrace 2m wide noted by the OS in 1965 enclosing an area in the order of 47m from NNE to SSW by 43m transversely (0.15ha), but in a later visit Alan Ayre of the OS also found at the foot of the slope on the S at least two ditches with external banks extending for a distance of no more than 20m from the steep slopes on the W; he speculated that these may be the remains of an unfinished circuit of defences.

Information from An Atlas of Hillforts of Great Britain and Ireland – 25 November 2016.

Atlas of Hillforts SC2877.

References

RCAHMS. (1979c) The archaeological sites and monuments of North-east Inverness, Inverness District, Highland Region, The archaeological sites and monuments of Scotland series no 8. Edinburgh. Page(s): 17, No. 104 RCAHMS Shelf Number: A.1.2.ARC(8)

RCAHMS. (1942-3) Emergency Survey of archaeological monuments in military training areas, 1981, 2v. Typescripts. Page(s): TS 26, MS 111 RCAHMS Shelf Number: A.1.1.SUR

RCAHMS. (1950-9) Marginal Land Survey (unpublished typed site descriptions), 3 volumes. Page(s): v2 RCAHMS Shelf Number: A.1.1.MAR

Wallace, T. (1921a) 'Archaeological notes', Trans Inverness Sci Soc Fld Club, vol. 8, 1912-18. Page(s): 103-5 plan 104 RCAHMS Shelf Number: Ref

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	131
Asset/Event Name	Invershin
Type of Asset/Event	Axehead (Stone)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 26.00
HER Number	MHG12885
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257000
Northing	896000
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://her.highland.gov.uk/Monument/MHG12885 The butt of a flint axe from Invershin (NH 57 96) is in Dunrobin Museum, possibly received in 1875. (Acc. No. 1875.1). Info from A S Henshall (Dunrobin Museum catalogue) to OS 1966. This GR is seriously wrong as gives location W of the river instead of E. - HAW 10.2002 The axehead was catalogued during an inventory of Dunrobin Castle Museum's collection in 2019 by ARCH. Listed under Acc. No. 1875.1 and ARC 11. Is it stored in one of the cupboards. See attached photos. <1> SHG28514 Collection/Finds Collection: Archaeology for Communities in the Highlands (ARCH). 2019. Finds Collection At Dunrobin Castle Museum. 1875.1 and ARC 11.
Asset/Event Number	132
Asset/Event Name	Cnoc A' Mhargadaidh
Type of Asset/Event	Beaker (Prehistoric)(Possible)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56NE 14.00
HER Number	MHG8976
Status	Non-designated Heritage Asset
Section:	N/A
Easting	255680
Northing	867790
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*SW *27/08/2024

Appendix 1: Gazetteer of Heritage Assets and Events

*Cnoc a' Mhargadaidh is a mis-spelling of Cnoc a' Mhargaidh Dhuibh (Hill of the Black Market)

References

Ross and Cromarty OS Name Books, 1848-1876. OS1/28/1/28.

<https://canmore.org.uk/site/12877/>

NH56NE 14 5568 6779

According to Mr Munro-Fergusson (Novar House, Alness), an ornamented urn was found at NH 5568 6799 during the construction of a forestry road about 1965. It crumbled away when picked up. Fergusson didn't see it, but from a workman's description believes it was a beaker.

Visited by OS (I S S) 29 August 1972

(2010) Area known locally as Cnoc an Each, Swordale. Norman Macrae (Romance of a royal burgh: Dingwall's story of a thousand years, 1923) identified the area as a cairnfield, but without cists or finds. However, in the 1960s a cist containing a beaker was found while bulldozing a forest road, but the beaker disintegrated on exposure to the open air. Information from the ARCH Community Timelines Course, 2010.

References

MacRae, N. (1923) The romance of a royal burgh: Dingwall's story of a thousand years.

Dingwall. RCAHMS Shelf Number: D.6.43.DIN

RCAHMS. (1979a) The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region, The archaeological sites and monuments of Scotland series no 6. Edinburgh. Page(s): 15, No. 95 RCAHMS Shelf Number: A.1.2.ARC(6)

Asset/Event Number	133
Asset/Event Name	Strath Sgitheach Allt Na Criche 2
Type of Asset/Event	Cup Marked Rock (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 13.00
HER Number	MHG63114
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252130
Northing	862976
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://her.highland.gov.uk/Monument/MHG63114 NH56SW 13 522 630. Centred around NH 522630 are eight cup marked rocks ('A' - 'H'). 'A' is a boulder measuring 3.1m x 1.9m x 0.6 m high with at least fifteen shallow cup marks on its upper surface. 'B' a large block 3.6m x 1.8m x 1.0m maximum height. It is largely earth-covered. It has twenty-three cup marks on its two outer edges. 'C' a boulder 1.8m x 1.2m x 0.6m high with six cup marks. 'D' a boulder 2.4m x 1.0m x 0.6m high with seven small shallow cup marks. 'E' a small boulder 1.1m x 0.7m x 0.3m high with two probable cup marks. 'F' a boulder lying close by has seven shallow cup marks upon it. 'G', a boulder, 2.8m x 1.5m x 0.6m, lying on the bank of a stream, has probably slipped from

its original position due to erosion. It has six extremely shallow cup marks on its upper surface.

'H' is a slab 2.2m x 1.3m lying flush with the ground; it has three probable cup marks on its surface.

Surveyed at 1:10 000.

Visited by OS (J B) 16 November 1976

Field Visit (September 1978) RCAHMS: The Archaeological Sites and Monuments of Easter Ross

Strath Sgitheach 2 NH 522 630 NH56SW 13

Eight outcrops of rock with shallow cup-marks.

RCAHMS 1979, visited September 1978

Note (7 August 2018) Scotland's Rock Art Project

Date Fieldwork Started: 07/08/2018

Compiled by: NOSAS

Location Notes: THIS IS CANMORE PANEL B AND IS THE FIRST OF THIS SET RECORDED

The panel is located on the lower S facing open slopes of Meall a'Ghuail, overlooking the river Sgitheach. It is one of a group of 8 panels (7 located at the time of writing) close to the Allt an Criche, in rough grazing interspersed with pine trees and patches of heath. A track crosses the river Sgitheach (ford and stepping stones) and heads NW and passes 60m W of the panel.

There is a large broken down pine tree 2m E of the panel, and its roots are visible in places around the panel. Rigg is visible in the ground immediately S of the panel. The area generally has a number of hut circles, field systems and burnt mounds, including those identified in Canmore 12921 about 0.6km to the SW. Panel 3 (C in Canmore) is 5m to the W and is part of the same rock outcrop.

Panel Notes: The panel is an L-shaped outcrop, up to 1.1m high, and with a S face 3.7m long and an E face 1.7m long. There are deep cracks separating a section of the panel at the 'corner'. There are 29 cups, along the two edges of the outcrop. The carved surface slopes at about 20degrees to the N, and disappears under turf. Some turf was lifted and no cups more than 0.3m from the exposed edges were found.

References

RCAHMS. (1979a) The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region, The archaeological sites and monuments of Scotland series no 6. Edinburgh. Page(s): 18, No. 133 RCAHMS Shelf Number: A.1.2.ARC(6)

<https://her.hi.gov.uk/monument/MHG63114>

This panel was recorded as part of the ScRAP (Scotland's Rock Art project) by members of NoSAS in August 2018. This is panel B and is the first of the set to be recorded. The panel is located on the lower south facing open slopes of Meall a'Ghuail, overlooking the river Sgitheach. It is one of a group of 8 panels (7 located at the time of writing) close to the Allt an Criche, in rough grazing interspersed with pine trees and patches of heath. A track crosses the river Sgitheach (ford and stepping stones) and heads north west and passes 60m west of the panel. There is a large broken down pine tree 2m east of the panel, and its roots are visible in places around the panel. Rigg is visible in the ground immediately south of the panel. The area generally has a number of hut circles, field systems and burnt mounds, including those identified in Canmore 12921 about 0.6km to the southwest. Panel 3 (C in Canmore) is 5m to the west and is part of the same rock outcrop.

The panel is an L-shaped outcrop, up to 1.1m high, and with a south face 3.7m long and an east face 1.7m long. There are deep cracks separating a section of the panel at the 'corner'. There are 29 cups, along the two edges of the outcrop. The carved surface slopes at about 20 degrees to the north, and disappears under turf. Some turf was lifted and no cups more than 0.3m from the exposed edges were found. <1>

NGR adjusted based on 2018 vertical aerial photographs. <2>

--- SHG2670 Text/Report: RCAHMS. 1979. The Royal Commission on the Ancient and Historical Monuments of Scotland. The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region. . 18, No. 133.

Appendix 1: Gazetteer of Heritage Assets and Events

<1> SHG28055 Interactive Resource/Online Database: Historic Environment Scotland. 2017-. Scotland's Rock Art (ScRAP). ScRAP ID 613.
<2> SHG28282 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2018. Getmapping aerial photography 2018. XY

Asset/Event Number	134
Asset/Event Name	Strath Sgitheach
Type of Asset/Event	Corn Drying Kiln (Period Unassigned), Settlement (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56SW 31.00
HER Number	MHG8906
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253500
Northing	864100
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 134 for details.* https://canmore.org.uk/site/12943/ NH56SW 31 535 641 This pre-improvement settlement survives as low stone wall spreads (1.0 - 2.0m wide), which are completely grassed over. The settlement is focused on a long house (33.0m by 5.0m) oriented NE-SW with two internal partitions. At its SW end is a second smaller house or byre (14.0 by 5.0m), which was oriented NW-SE. Nearby, to the SW, is a probable grain drying kiln and to the NE a substantial stone enclosure which measures 24.0 by 14.0m and is oriented NW-SE. A number of less prominent field walls extend from the settlement away from the river. Visited June 1989. Information from S T Driscoll and S M Foster (Mss, 5, No. 4.1.) 1989. Project (June 1989) Pre-afforestation Short Notice Surveys Pre-afforestation archaeological survey undertaken in Strath Sgitheach, funded by HBM SDD. S T Driscoll and S M Foster, 1989.

Asset/Event Number	135
Asset/Event Name	Cup-marked stone, Sgitheach
Type of Asset/Event	Cup-marked stone
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 36.00
HER Number	MHG8901
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	253202
Northing	863808
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A cup-marked stone on a prominent small knoll within the enclosure Asset 260.2. The rock art comprises four shallow cupmarks on the NW side edge and three deep cupmarks on the NE side. Panel continues below sediment and moss that has accrued, and field clearance cairn Asset 260.3 has built up on the SW side.* https://canmore.org.uk/site/12948 NH56SW 36 5320 6381 The rock outcrop at this spot has 7 good cup-marks and presumably others are obscured by the large modern clearance heap which covers much of the outcrop. Visited June 1989. Information from S T Driscoll and S M Foster (Mss, 7, No. 8.1.) 1989. Activities Project (June 1989) Pre-afforestation Short Notice Surveys Pre-afforestation archaeological survey undertaken in Strath Sgitheach, funded by HBM SDD. S T Driscoll and S M Foster, 1989. Note (7 August 2018) Scotland's Rock Art Project Date Fieldwork Started: 07/08/2018 Compiled by: NOSAS Location Notes: The outcrop which faces E is in a prominent mound of moss and grass covered stones, and is near the western end of an enclosure around a ruined farmstead. Panel Notes: The exposed part of the panel is an outcrop of schist about 0.7m high and roughly triangular at the top. At the NW edge of the top (carved surface) are four cups in a gentle arc. Towards the S edge is a row of three larger, deeper and very clearly defined cups.
Asset/Event Number	136
Asset/Event Name	Alltan-Riabhach
Type of Asset/Event	Corn Drying Kiln (Period Unassigned), Farmstead (Period Unassigned), Field System(s) (Period
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NE 24.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG10342
Status	Non-designated Heritage Asset
Section:	N/A
Easting	267442
Northing	898080
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 136 for details.* https://canmore.org.uk/site/13934/ Corn Drying Kiln (Period Unassigned), Farmstead (Period Unassigned), Field System(S) (Period Unassigned) NH69NE 24 674 980. Farmstead, including corn-drying kiln, fields: noted during pre-afforestation survey. D Ross 1983. The long rectangular building foundation at Alltan-Riabhach measures 15.5m by 2.8m internally with an annexe, a corn-drying kiln and 'fields'. To the SW lie a contemporary rectangular building and a sheepfold. Information from D W Ross, S E Finlay and P Ashmore 1983, NMRS MS/578/1, 7) A farmstead, comprising two roofed buildings and an enclosure is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879-81, cviii). One roofed building, one unroofed building, a field and an enclosure are shown on the current edition of the OS 1:10,000 map (1990). Information from RCAHMS (AKK) 22 November 1995. References Ross, D. (1983) 'Achormlaire Hill (Creich and Dornoch p) survey', Discovery Excav Scot, 1983. Page(s): 15-16
Asset/Event Number	137
Asset/Event Name	Strath Of Kildonan
Type of Asset/Event	General View
Date and/or Period	N/A
Listing No./NRHE Number	NC91NE 0.04
HER Number	MHG34139
Status	Non-designated Heritage Asset
Section:	N/A
Easting	295000
Northing	916000
Council	Highland
Condition:	N/A
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	N/A
Description	https://canmore.org.uk/site/87626/ No description. [General view - not an archaeological feature in and of itself.]
Asset/Event Number	138
Asset/Event Name	Allt Cnoc Na Gamhna
Type of Asset/Event	Farmstead (Period Unassigned)(Possible)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 50.00
HER Number	MHG10395
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279000
Northing	903920
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 138 for details.* https://canmore.org.uk/site/72864/ NC70SE 50 7900 0392. 'Post-medieval settlement - enclosures, subrectangular structure, wall' noted during pre-afforestation survey and to be avoided when planting. No details given. J Harden 1990. References Harden, J. (1990) 'Survey Dunrobin Glen (Golspie parish)', Discovery Excav Scot, 1990. Page(s): 28
Asset/Event Number	139
Asset/Event Name	Allt Cnoc Na Gamhna
Type of Asset/Event	Building(s) (Period Unassigned), Corn Drying Kiln (Period Unassigned), Quern
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 49.00
HER Number	MHG10398
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279070
Northing	904000
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 139 for details.*

<https://canmore.org.uk/site/72863/>
NC70SE 49 7907 0400.

'Medieval, post-medieval settlement - long houses, dykes, kiln, lazy beds, rotary quern, rectangular structures' noted during pre-afforestation survey and to be avoided when planting. No details given.
J Harden 1990.

Asset/Event Number	140
Asset/Event Name	Allt Na Cruaiche
Type of Asset/Event	Bank (Earthwork) (Post Medieval), Track (Post Medieval)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57NE 13.00
HER Number	MHG8418
Status	Non-designated Heritage Asset
Section:	N/A
Easting	255700
Northing	875400
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A

Description	https://canmore.org.uk/site/68518/ Field Visit (14 November 1989) RCAHMS Afforestation Land Survey, Strathrusdale NH57NE 13 5570 7540 On the N bank of the River Averon to the E of the Allt na Cruaiche, a trackway cuts the river terrace on an E-W axis; to the N a heather-grown stony bank runs for 17m uphill into the conifer plantation. The trackway may be part of an old route leading to Coire Sliogaich along the N bank of the River Averon; further traces of trackways were observed between this location and Coire Sliogaich. Visited by RCAHMS (PJD) 14 November 1989.

Asset/Event Number	141
Asset/Event Name	Ceann An Locha
Type of Asset/Event	Farmstead (Medieval) - (18Th Century), Kiln Barn (Medieval) - (18Th Century)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57NE 24.00
HER Number	MHG8407

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Non-designated Heritage Asset
Section:	N/A
Easting	255620
Northing	875100
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/68529/ Field Visit (15 November 1989) RCAHMS Afforestation Land Survey, Strathrusdale NH57NE 24 5562 7510 This farmstead is shown abandoned on the 1st ed OS 6" map of Ross-shire (1880,52) and is identified as Kinloch by Roy (1747-55, sheet 26/1). It is situated on the hillocks which form part of the glacial meltwater terraine between a forestry plantation and the River Averon. The farmstead comprises three buildings, a kiln-barn and several small enclosures; there are also a number of ruinous stone dykes which may be coeval with the farmstead. At the core of the farmstead there is an E-W, two-compartment building standing up to 1m in height; midway along the S wall it has a bedneuk, which measures 3.5m in external length by 1.75m transversely with an entrance 1m to the W. An outshot is appended to the N wall. A second two-compartment building is set at right-angles to the first on the N; its grass-grown rubble footings stand up to 0.35m high and there are also the footings of an attached enclosure on the W. Some 30m E there is a square enclosure with banks 0.6m high and in between there is a bank which stops at a stone revetment 0.3m high, just short of the building with the bedneuk. Several hollow trackways lead down towards a second knoll to the NNE, into which a kiln-barn with walls still up to 2m high has been built. To the W of the kiln-barn the knoll has been hollowed out to a depth of 0.65m, possibly with an entrance on the W. A further 10m to the W there is a two-compartment building; its drystone walls stand about 1m in height and within the E compartment, against the E gable, it has a raised platform 0.25m in height. A sinuous trackway leads from here to the river. On a knoll to the W of the core of the farmstead is a second, larger, scooped out hollow, 1m in depth with an entrance to the S and an internal entrance to one of a pair of appended folds on the N. Visited by RCAHMS (PJD) 15 November 1989. Note (23 February 1996) RCAHMS First Edition Survey Project Five unroofed buildings are depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartyshire 1880, sheet lii) and on the current edition of the OS 1:10000 map (1986). Information from RCAHMS (SAH) 23 February 1996 References Roy, W. (1747-55) Military Survey of Scotland.
Asset/Event Number	142
Asset/Event Name	Dunrobin Glen
Type of Asset/Event	Enclosure(s) (Post Medieval), Farmstead (Post Medieval), Hut Circle (Prehistoric)(Possible), L
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 47.00
HER Number	MHG10399

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Non-designated Heritage Asset
Section:	N/A
Easting	279150
Northing	904850
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/72861/ NC70SE 47 7915 0485. Post-medieval settlement, dykes, lazy-beds' noted by Harden. (A number of unroofed buildings and enclosures are shown on OS 1:10,000 map, 1970 in the area indicated.) J Harden 1990. A field is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet xcvi). Three unroofed buildings, two enclosures and two fields are shown on the current edition of the OS 1:10,000 map (1970). Information from RCAHMS (SAH) 1 November 1995 Activities Desk Based Assessment (1 April 2014) An archaeological desk-based assessment and walkover survey was carried out on 1 April 2014 on behalf of Scottish Water from Loch Farlary to Bridge of Horn, Golspie in advance of the proposed construction of a new water main. The work was undertaken to assess the nature and extent of any archaeology likely to be directly affected by the proposed development in order to inform recommendations for the protection and management of any sites identified. Seven archaeological sites, two of which will be directly impacted by the current development layout, were recorded. These included a burnt mound, hut circles and Post Medieval structures. Information from OASIS ID: rosscrom1-177267 (L Fraser and M Peteranna) 2014 Field Visit (1 April 2014) A complex of mostly Post Medieval buildings, enclosures and clearance cairns. There were three irregularly-shaped enclosures all constructed from large stones and boulders. Site 1a had been cut through by a previous water pipeline. Sites 1c and 1d appeared to be folds or pens within enclosures 1a and 1b. Site 1k also formed part of a possible pen. A dyke (Site 1i) running off the south corner of Site 1l may have been part of a head dyke. Three buildings were recorded: the largest (Site 1f) measured approximately 20m x 3m and had a small porch on the south-southwest side. Site 1g was a small sub-rectangular building with two compartments. To the south of site 1g was another building (Site 1h), which was interpreted as a kiln-barn due to the circular nature of its northern compartment (Plate 1). Sites 1m-q were recorded as clearance cairns, although some presented as 'lumps' and may have been natural features. The presence of cairns is indicative of former cultivation practices; the lazy beds previously recorded at this site were not visible. Site 2 (NC 79258 04870), located to the northeast of site 1, was a sub-circular, turf-covered stone structure revetted into the slope on the north side with an entrance on the south side. It was interpreted as a possible hut circle. Information from OASIS ID - rosscrom1-177267 (L Fraser and M Peteranna) 2014 Field Visit (1 April 2014) An archaeological desk-based assessment and walkover survey was carried out on 1 April 2014 on behalf of Scottish Water from Loch Farlary to Bridge of Horn, Golspie in advance of the proposed construction of a new water main. The work was undertaken to assess the nature and extent of any archaeology likely to be directly affected by the proposed development in order to inform recommendations for the protection and management of any sites identified. Seven archaeological sites, two of which will be directly impacted by the

Appendix 1: Gazetteer of Heritage Assets and Events

current development layout, were recorded. These included a burnt mound, hut circles and Post Medieval structures.

Information from OASIS ID: rosscrom1-177267 (L Fraser and M Peteranna) 2014

References

Harden, J. (1990) 'Survey Dunrobin Glen (Golspie parish)', Discovery Excav Scot, 1990.

Page(s): 28

Asset/Event Number	143
Asset/Event Name	Building, Garbhairidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH58SE 3
HER Number	MHG7367
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257530
Northing	883808
Council	Highland
Condition:	Good
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular modified bothy building that has been constructed from the remnants of the building shown on the 1st edition OS map, which depicts an unroofed structure or pen with a roofed structure to the S. In total the building measures 19m by 5m over walls, and the roofed portion measures 12m long, encompassing the S part. The walls of this stand 2m tall and 0.5m wide, and gable ends stand c6m tall. Entrance in the E elevation with windows flanking the doorway and a fireplace in S gable. The walls to the N stand between 0.3 and 1.5m tall and are constructed from roughly shaped river stones. Possibly a small pen constructed along the N end from the tumbled stone. OS. 1881. Ross-shire & Cromartyshire (Mainland) XXXIX, Surveyed: 1875, Published: 1881. https://canmore.org.uk/site/68474/ Field Visit (14 November 1989) RCAHMS Afforestation Land Survey, Strathrusdale NH58SE 3 575 838 The remains of at least two buildings and several enclosure banks lie in the vicinity of the deserted cottage at Garbhairidh. The first lies 80m NE of the cottage (NH 5757 8387) and measures at least 7.5m by 4.2m over grass-grown walls about 0.6m in height and spread to about 1.5m in thickness. Its S end is truncated by an old stream channel. The second building is attached to a bank 105m N of the cottage (NH 5751 8391); it measures 6.5m from N to S by 4.5m over grass-grown footings spread 1.3m in thickness and from 0.2m to 0.4m in height. What may be fragments of a third building, truncated by the stream, are visible a further 20m to the NW, while a possible fourth lies at the junction of three banks midway between the third building and the deserted cottage. Visited by RCAHMS (SPH) 14 November 1989. Note (21 February 1996) RCAHMS First Edition Survey Project Two unroofed buildings are depicted on the 1st edition of the OS 6-inch map (Ross-shire 1881, sheet xxxix), but they are not shown on the current edition of the OS 1:10000 map

Appendix 1: Gazetteer of Heritage Assets and Events

(1986).

Information from RCAHMS (AKK) 21 February 1996.

Asset/Event Number	144
Asset/Event Name	Garbh-Leathad
Type of Asset/Event	Building (Period Unassigned), Farmstead (Period Unassigned), Rig And Furrow (Medieval) - (P
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND13SW 33.00
HER Number	MHG39370
Status	Non-designated Heritage Asset
Section:	N/A
Easting	313000
Northing	932100
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/72002/ Building (Period Unassigned), Farmstead (Period Unassigned), Rig And Furrow (Medieval) ND13SW 33 130 321. Situating S of the Dunbeath Water, 650m W of Loedebest is a post medieval settlement comprising three buildings, associated dykes and field systems. One building (at ND 1288 3204) is small and rectangular and isolated some way to the W of the main settlement. The other two buildings include one small rectangular building and a long house. The long house has stone walls attached to the NW and NE; the wall to the NE forms part of a stone walled enclosure. There are faint traces of wall foundations to the SE of the long house and this could indicate the existence of an earlier settlement on this site. There is evidence for rig cultivation alongside the river. Information from Historic Scotland July 1992. A farmstead comprising one unroofed long building and two enclosures is depicted on the 1st edition of OS 6-inch map (Caithness 1877, sheet xxxviii), but the building at ND 1288 3204 is not shown. Two unroofed buildings and two enclosures are shown on the current edition of the OS 1:10,560 map (1962). Information from RCAHMS (AKK) 5 January 1996.

Asset/Event Number	145
Asset/Event Name	Borgue
Type of Asset/Event	Cruck Framed Cottage (Post Medieval)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND12NW 29.00
HER Number	MHG18000
Status	Non-designated Heritage Asset
Section:	N/A
Easting	312791

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	926030
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/86609/ ND12NW 29 128 260 NGR (ND 128 260) cited by Stell probably refers to open rectangles on 1:10,560 OS map (1965 ed.) at ND 1280 2603. Information from RCAHMS (RJCM), 23 September 1985. References Stell, G. (1981a) 'Crucks in Scotland: a provisional list', in Alcock, N W, Cruck construction: An introduction and catalogue, Council for British Archaeology Research Report no.42). London. Page(s): 82 RCAHMS Shelf Number: J.2.ALC.P
Asset/Event Number	146
Asset/Event Name	Bridge Of Horn
Type of Asset/Event	Corn Drying Kiln (Period Unassigned), Enclosure(s) (Period Unassigned), House (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70NE 50.00
HER Number	MHG19453
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279400
Northings	905000
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/91629/ Corn Drying Kiln (Period Unassigned), Enclosure(S) (Period Unassigned), House (Period Unassigned), Hut Circle (Prehistoric)(Possible), Rig And Furrow (Medieval) NC70NE 50 Centred NC 794 050. The footings of a house, enclosures, a corn-drying kiln, numerous clearance heaps and a possible hut circle are on this SW-facing hillside, within a still evident head dyke and foot dyke. There are also signs of rig cultivation, but the site is infested with bracken and heather, making mapping of the features impossible at date of visit. M Macdonald 1994k. Activities Ground Survey (1 April 2014) NC 78764 05100 (centred on) A desk-based assessment and walkover survey were carried out on 1 April 2014 from Loch Farlary to Bridge of Horn, in advance of the proposed construction of a new water main. Seven sites including a burnt mound, hut circles and post-medieval settlement, were recorded. The settlement, located under dense bracken and high grasses, was a complex of buildings

on the NE side of the Allt nan Sgeith. It included a probable kiln, pen, enclosures and dykes that appeared to predate the 1872 Ordnance Survey of the area. Within the settlement, one hut circle was recorded along with small clearance cairns, which may be associated with the extensive prehistoric settlement in the glen. The other hut circle and the burnt mound surveyed had been previously identified by the Ordnance Survey.

Report: Highland HER, OASIS and RCAHMS (intended)

Funder: Scottish Water

Lynn Fraser and Mary Peteranna – Ross and Cromarty Archaeological Services

(Source: DES)

References

Fraser and Peteranna, L and M. (2015) Highland, Bridge of Horn, Desk-based assessment and walkover survey, Discovery Excav Scot, New, vol. 15, 2014. Cathedral Communications Limited, Wiltshire, England. Page(s): 108

Macdonald, M. (1994k) 'Bridge of Horn, Dunrobin Glen (Golspie parish): settlement', Discovery Excav Scot, 1994. Page(s): 44

Asset/Event Number	147
Asset/Event Name	Allt Na H-Innse Aonar
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38.00
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	N/A
Easting	272500
Northing	899100
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 147 and 471 for details. The farmstead is shown as abandoned by the time of the 1st edition OS map. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879. https://canmore.org.uk/site/91343/ NH79NW 38 7250 9910 A farmstead, comprising one unroofed building and an enclosure within a field is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet civ). One unroofed building and one enclosure are shown on the current edition of the OS 1:10560 map (1969). Information from RCAHMS (AKK) 21 November 1995. Innis Aonar. Footings of enclosures noted on the 6" OS map, and of a cruciform building and well-preserved corn-drying kiln were found (Macdonald 1995, fig 18). NH 725 992 The long axis of the cruciform building is c16.5m by 2m, with the extensions being 4m by 2m and 3m by 2m, and slightly offset. NH 725 991 Corn-drying kiln, with 1.5m bowl, flue opening to SE. NH 724 991 Oval outline of stones 4.6m by 2m. Sponsor: Tain Archaeological Group 1995. M Macdonald 1995.

Appendix 1: Gazetteer of Heritage Assets and Events

References

Macdonald, M. (1995) 'Dalnamein (Dornoch parish), multi-period', Discovery Excav Scot, 1995. Page(s): 47 Fig 18

Ordnance Survey (Name Book. (1848-1878) Object Name Books of the Ordnance Survey (6 inch and 1/2500 scale). Page(s): Book No. 9, 112 RCAHMS Shelf Number: Ref

Asset/Event Number	148
Asset/Event Name	Boath Farmstead
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57NE 25.00
HER Number	MHG18719
Status	Non-designated Heritage Asset
Section:	N/A
Easting	255700
Northing	875100
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey -Asset 148/NH57NE 25.00/MHG18719 is to the immediate E of Asset 141/NH57NE 24.00/MHG8407. It seems likely that, given the title of this asset and its location amidst the post-medieval settlement remains and improved fields described in the Asset 141 listing, that this is a duplication of the same.*

<https://canmore.org.uk/site/90002/>

No description on Canmore.

<https://her.highland.gov.uk/Monument/MHG18719>

No description on HER.

Asset/Event Number	149
Asset/Event Name	Garvary, Suspension Bridge
Type of Asset/Event	Footbridge (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH58NE 8.00
HER Number	MHG18712
Status	Non-designated Heritage Asset
Section:	N/A
Easting	259660
Northing	886170
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Good
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey* A pedestrian suspension bridge constructed from metal leads across the Wester Fearn Burn. https://canmore.org.uk/site/90011/ No description. https://her.hIGHLAND.gov.uk/Monument/MHG18712 No description.
Asset/Event Number	150
Asset/Event Name	Loch Toftingall
Type of Asset/Event	Township (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 16.00
HER Number	MHG18918
Status	Non-designated Heritage Asset
Section:	N/A
Easting	319600
Northing	952300
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	See sub-elements of Asset 150 for details. https://canmore.org.uk/site/90832/ RCAHMS First Edition Survey Project A small township comprising three unroofed buildings, one of which is a long building, and an enclosure, all lying within an area of cultivation is depicted on the 1st edition of the OS 6-inch map (Caithness 1877, sheet xxiii). A two compartment enclosure and a sheepfold are shown on the current edition of the OS 1:10000 map (1976). Information from RCAHMS (SAH) 23 November 1995
Asset/Event Number	151
Asset/Event Name	Leathad Breac
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NW 36.00
HER Number	MHG18357
Status	Non-designated Heritage Asset
Section:	N/A
Easting	261450

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	897080
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/91368/ RCAHMS First Edition Survey Project A farmstead, comprising two unroofed buildings and an enclosure, and some field walls are depicted on the 1st edition of the OS 6-inch map (Sutherland 1879-81, cviii) and on the current edition of the OS 1:10560 map (1970). Information from RCAHMS (AKK) 22 November 1995.

Asset/Event Number	152
Asset/Event Name	Acharole
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND25SW 37.00
HER Number	MHG18400
Status	Non-designated Heritage Asset
Section:	N/A
Easting	322300
Northings	951400
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/90905/ RCAHMS First Edition Survey Project An unroofed long building is depicted on the 1st edition of the OS 6-inch map (Caithness 1877, sheet xxiii), but it is not shown on the current edition of the OS 1:10000 map (1994). Information from RCAHMS (SAH) 23 November 1995

Asset/Event Number	153
Asset/Event Name	Acharole
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND25SW 43.00
HER Number	MHG19135
Status	Non-designated Heritage Asset
Section:	N/A
Easting	322100
Northings	951900

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/90911/ RCAHMS First Edition Survey Project An unroofed building is depicted on the 1st edition of the OS 6-inch map (Caithness 1877, sheet xxiii), but it is not shown on the current edition of the OS 1:10000 map (1994). Information from RCAHMS (SAH) 23 November 1995
Asset/Event Number	154
Asset/Event Name	Glen Glass, 'Garabil'
Type of Asset/Event	Clearance Cairn(s) (Period Unassigned), Head Dyke (Post Medieval), Township (Period Unassi
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 26.00
HER Number	MHG14142
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256100
Northing	869000
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/92101/ NH56NE 26 centred 561 690. This site consists of the footings of five features, of drystone construction, overgrown with gorse and is now in very boggy ground of bog myrtle and juniper. The name appears on the first edition 6" OS map with one ruin and has an entry in the OS name book, but local and estate enquiries have turned up no further information. (1) Turf-covered footings measuring 4.5m by 3m: walls are 1m thick. (2) Enclosure measuring 13m by 7.5m. (3) Footings measuring 6m by 3m, with a large pile of stones at one end. (4) Thick-walled feature, very overgrown with whins, measuring 12m by 3m. (5) An enclosure measuring c 6m by 6m. In the field to the N/W are large clearance heaps. The site may be Norse in origin. M Macdonald 1994a. What may be a township, comprising four unroofed buildings and a head-dyke are depicted on the 1st edition of the OS 6-inch map (Ross-shire & Cromartyshire 1881, sheet lxiv), but they are not shown on the current edition of the OS 1:10000 map (1992). Information from RCAHMS (AKK) 29 February 1996. References Macdonald, M. (1994a) 'Garabil, Glen Glass (Alness parish): settlement', <i>Discovery Excav Scot</i>, 1994. Page(s): 38

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	155
Asset/Event Name	Langergill
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	N/A
Easting	318800
Northing	954700
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/90861/ ND15SE 20 188 547 Longhouse farm (ND 1882 5477), comprising; A: Longhouse. Dimensions: 23 x 6m. Tripartite rectangular structure with a fireplace in the ESE unit. Orientation ESE-WNW. B: Longhouse/ outhouse. Dimensions: 7 x 5m. Bipartite rectangular structure following the same line as A. Orientation ESE-WNW. C: Mill. Dimensions: 7 x 5m. Rectangular structure associated with mill machinery and a lade running N lying 24m N of A. Orientation N-S. D: Dam. Diameter: 18m. Circular grassy bank 1.5m high at the other end of the lade. R J Mercer, NMRS MS/828/19, 1995 A farmstead comprising one roofed long building, one unroofed building and three enclosures is depicted on the 1st edition of the 6-inch map (Caithness 1877, sheet xviii). An unroofed building is shown on the current edition of the OS 1:10000 map (1976). Information from RCAHMS (SAH) 6 December 1995

Asset/Event Number	156
Asset/Event Name	Black Burn
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 49.00
HER Number	MHG20030
Status	Non-designated Heritage Asset
Section:	N/A
Easting	319530
Northing	953680
Council	Highland
Condition:	N/A
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	N/A
Description	https://canmore.org.uk/site/96437/ ND15SE 49 1953 5368 Structure. Dimensions: 8.5 x 5m. Rectangular structure. Orientation E-W. R J Mercer, NMRS MS/828/19, 1995
Asset/Event Number	157
Asset/Event Name	Lodge Roques
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND25SW 67.00
HER Number	MHG19994
Status	Non-designated Heritage Asset
Section:	N/A
Easting	321200
Northing	953300
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/96450/ ND25SW 67 2120 5330 Longhouse (ND 2117 5330). Dimensions: 14 x 5m. Rectangular structure, the N end of which is reduced to a rubble spread, the S end containing a fireplace. Orientation N-S. R J Mercer, NMRS MS/828/19, 1995 One roofed and one partially roofed building are depicted on the first edition of the OS 6-inch map (Caithness 1877, sheet xviii). One unroofed building is shown on the current edition of the OS 1:10,000 map (1994). Information from RCAHMS (FO) 26 March 1996
Asset/Event Number	158
Asset/Event Name	Viewfield
Type of Asset/Event	Structure(s) (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND25SW 68.00
HER Number	MHG20025
Status	Non-designated Heritage Asset
Section:	N/A
Easting	321490
Northing	953120
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/96451/ ND25SW 68 2149 5312 Structure (ND 2149 5315), Viewfield. Dimensions: 6.6 x 5m. Rectangular structure, probably a small croft containing a fireplace. Orientation E-W. R J Mercer, NMRS MS/828/19, 1995 Two unroofed structures are depicted on the first edition of the OS 6-inch map (Caithness 1877, sheet xviii) and on the current edition of the OS 1:10,000 map (1994). Information from RCAHMS (FO) 26 March 1996
Asset/Event Number	159
Asset/Event Name	Caen
Type of Asset/Event	Head Dyke (Post Medieval), Township (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND01NW 72.00
HER Number	MHG20250
Status	Non-designated Heritage Asset
Section:	N/A
Easting	301700
Northing	917700
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/97764/ ND01NW 72 centred on 017 177 A township comprising two roofed and sixteen unroofed buildings, nine enclosures, a field and a head-dyke is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet lxxix). Four roofed and ten unroofed buildings, eight enclosures, one of four compartments, some field walls and a head-dyke are shown on the current edition of the OS 1:10560 map (1964). Information from RCAHMS (SAH) 13 October 1995.
Asset/Event Number	160
Asset/Event Name	Druim Dubh
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND25SW 60.00
HER Number	MHG19814
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	320600
Northing	952200
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/96100/ ND25SW 60 206 522 Longhouse (ND 2066 5225). Dimensions: 22.5 x 5m. Rectangular tripartite structure. Orientation E-W. Longhouse (ND 2064 5223), 'Druim Dubh'. Dimensions: 36 x 5m. Rectangular structure divided into five compartments. The E two units contain opposing fireplaces, the central unit possesses byre slots. Two lean-tos have been built against the N long wall. It is associated with a complex of enclosures, measuring 26 x 15m. Orientation E-W. R J Mercer, NMRS MS/828/19, 1995 Three roofed buildings are depicted on the first edition of the OS 6-inch map (Caithness 1877, sheet xxiii). One unroofed building is shown on the current edition of the OS 1:10,000 map (1994). Information from RCAHMS (FO) 20 March 1996

Asset/Event Number	161
Asset/Event Name	Cnoc Na Maranaich
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND13SW 45.00
HER Number	MHG20290
Status	Non-designated Heritage Asset
Section:	N/A
Easting	313320
Northing	932820
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/97726/ RCAHMS First Edition Survey Project A single unroofed building is depicted on the 1st edition of OS 6-inch map (Caithness 1877, sheet xxxviii) and on the current edition of the OS 1:10560 map (1962). Information from RCAHMS (AKK), 5 January 1996

Asset/Event Number	162
Asset/Event Name	Borgue, Longall, Croft
Type of Asset/Event	Croft (Period Unassigned), Cruck Framed Cottage (Post Medieval)

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Post-medieval
Listing No./NRHE Number	ND12NW 60.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	312800
Northing	926230
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/101425/ No description. https://her.highland.gov.uk/Monument/MHG24189 No description.
Asset/Event Number	163
Asset/Event Name	Rogie
Type of Asset/Event	Enclosure (Period Unassigned), Head Dyke (Post Medieval), Township (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG24412
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243900
Northing	860000
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/103155/ NH46SW 3 centred on 439 600 A township comprising three roofed, one partially roofed and thirteen unroofed buildings, eight enclosures and two short lengths of head-dyke is depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartyshire 1881, sheet lxxv). Ten unroofed buildings and four enclosures are shown on the current edition of the OS 1:10000 map (1989). Information from RCAHMS (SAH) 28 February 1996 Activities Field Visit (February 2008 - May 2009) Publication Account (2009) Forest Heritage Scotland The website text produced for Rogie webpages on the Forest Heritage Scotland website

(www.forestheritagescotland.com).

Introduction: A lovely little world of its own

This is how Nan Bray, from New Zealand, recalls growing up on Rogie farm during the Second World War.

Rogie farm lies close to the abandoned township of Rogie. In the 1940s only the McQueens still lived there; they were Nan's only neighbour. As a young girl Nan often felt isolated. Rogie was not easy to travel to, so few people visited. They did not even have electricity or a telephone.

In the past, however, Rogie had been a thriving farming community. Historical records show that in 1792 at least twelve families were living and paying rent at the township of Rogie.

At this time the township was part of the Coul Estate owned by the MacKenzies. In 1795 George MacKenzie inherited his father's land, fortune and title and, soon after, began to evict farming tenants from his land.

Mackenzie cleared Rogie in 1808. Shepherds moved in to the area instead to work on the new sheep farms. Nan Bray's memoirs tell us that over the following century many families, including her own, moved to New Zealand and Canada to find a new life.

The remains of the township are still visible spread across the Torrachilty forest clearing. Yet evidence of more may still be hidden within the trees and grassland surrounding them. Why not explore it for yourself?

People Story: The plan of mice and men....

Sir George McKenzie's obituary in the local newspaper described him as a landlord who was....

[i]

"substantially kind and liberal and disposed towards improvements", [i]
Inverness Courier, November 9, 1848

Today it is difficult to see how he could be both.

Sir George MacKenzie held strong views about the need to improve the way that land was farmed in the Highlands. He did not believe that his small farm tenants had the money or capability to adapt to new ways of farming. These tenants, like the families at Rogie, were removed and replaced with large sheep farms.

Yet Mackenzie recognised that the people he moved would not like his actions. He even invested in a wool factory to create more jobs for those who lost their farms, but it was unsuccessful and closed.

Sir George MacKenzie believed that these changes would make more money and help the economy of the Highlands.

Ironically, Dr John MacKenzie noted that Sir George's tenants were hard workers, who always paid their rents. This MacKenzie believed that Sir George made more money with the old tenant system than he did from his so called [i]"improvements"/[i], the sheep farms.

If this was true it would seem that all Sir George's grand plans were for little gain, but caused a lot of people's lives to change completely. It is only fair to note, however, that Dr John MacKenzie went bankrupt trying to keep the old tenant system on his own land.

Srp Note (12 April 2012) Scotland's Rural Past (SRP)

In an area of perhaps half a square kilometre and centred on a rounded hill to the north of Rogie Farm and the railway line there are the remains of a large enclosure and 5 discrete

settlements. The composition of the settlements is variable, some have just 1 building and 1 enclosure, others have several buildings with up to 2 enclosures. The central focus is the hill, around which there are the remains of a discontinuous stone and turf wall, several clearance cairns lie within the enclosure particularly in the NW part. The settlements are contiguous with the enclosure wall at varying intervals. The whole area has been grossly disturbed by forestry, having been planted with trees, felled, ploughed and replanted again. In addition the drainage has been substantially disturbed by forest roads and tracks - many areas, which would in the past have been well drained, are now marshy. The township is shown on the 1st edition OS map as 1 partially roofed building, 14 unroofed buildings, 6 enclosures and a head dyke. The enclosure and surrounding wall with a few associated features are described first followed by each settlement the structures of which have been grouped together. The individual settlements/farmsteads are described from the northeast working in an anticlockwise direction and are numbered A to F - see plan.

Enclosures (NOSAS survey site nos 54, 49 and 50)

54 Enclosure/Wall - NH 43746 59852 (SW corner/junction) A discontinuous wall defines an enclosure some 400m x 200m in size, it is now mostly planted with young trees but in the north part there are some open grassy ploughed areas. In the SW and W the wasted dry stone wall is clearly defined and 0.5m in height. To the north it is ploughed out and barely discernable. The east and south part appears to have been destroyed by the forest roads. To the south of the area and just SW of a prominent crossroads there are two features:

49 Clearance cairn - NH 44063 59918 A large cairn piled up against a prominent boulder.

50 Possible enclosure - NH 44046 59910 Two parallel stone and turf banks running parallel and 7m apart may be the remains of an enclosure. They are 0.7m height, have a spread of 2m and length of 12m. The whole area was overgrown with bracken at time of recording.

A. North-East settlement (NOSAS survey site nos 32 - 39) centred on NH 4416 6007 - comprises 4 buildings and 2 enclosures. The drainage of the settlement has been grossly affected by the construction of the road, it is now very marshy. Known as MacQueens Croft.

32 Building - NH 44253 60095 An L-shaped building with an outshot close to and on the west side of a small burn. The main compartment is rectangular and aligned NE-SW. It measures 8 x 3.5m internally and is recessed into a knoll at its SW end where the well made stone face of the gable is 1.5m high. The remaining stone wall footings are 0.5 - 1m high and 0.8m thick. There is an entrance in the centre of the SE wall.

The outshot to the SE is 4 x 4m and the walls are very wasted being 0.3m high with a spread of 1.5m. The structure is overhung with trees.

33 Building - NH 44209 60062 This rectangular structure on a slight knoll is aligned NE-SW and measures 6 x 2.5m internally. The remains of the substantial dry stone walls are 0.5 - 1m in height, the gable to the west is 1m high, and have a spread of 1.5m. Planted with trees. There may be an outshot to the SW indicated by truncated walls at the corners and a grassy platform c4.5 x 3m.

34 Enclosure - NH 44196 60045 An irregular shaped enclosure roughly 14 x 11m in the centre of an overgrown marshy area. There are substantial stone walls up to 1m height with a spread of 2m. The whole is overgrown with reeds and brambles. There is a possible entrance in the west of 2m width.

35 Building (alternative name - MacQueens croft) (figures 6 and 7) - NH 44165 60069 The main building of this settlement. It is the westernmost of 2 with an enclosure, 37, to the rear. The building has 2 compartments and an outshot to the SW. It has an internal measurement of 11m x 3.5m, with the main compartment to the west being 6m in length. The tumbled dividing wall is 0.5m high and has a spread of 1m. The walls are of dry stone construction, double faced and 0.7m in thickness. The rear wall is generally 1m in height and turfed up on the outside. The NE gable is 1.5m high and the SW 1.2m. The front wall is tumbled for the main part, 0.5m high and with a spread of 1.5m, although the eastern area is better preserved and there is an entrance into the NE compartment.

The outshot to the SW is more roughly constructed with walls to a height generally of 1m, it measures 3m x 2m and has an entrance in the E corner next to the main building.

This building is thought to be MacQueens croft. A photograph taken in the 1920s, is attached.

36 Building - NH 44169 60078 Immediately to the north of 35 this building on the same NE-SW alignment has 2 compartments and an overall internal measurement of 13m x 3.5m. The west compartment is better preserved and measures 5m x 3.5m. The walls are of dry stone construction, double faced and 0.7m in thickness. The SW gable is 2m in height, the rear NW

wall 1 - 1.2m high, the SE wall 0.8m high and the dividing wall is 0.5m high. There is an entrance 0.7m wide at the E end of the SE wall. The NE compartment is 7m x 3.5m and much more wasted, although the rear wall is 1m in height and the NE end has an external height of 1m. Otherwise it is generally 0.3m high. A large part of the SE wall is missing (alternatively this may have been a wide entrance).

37 Enclosure - centred on NH 44157 60079 An irregular enclosure to the rear/northwest of buildings 35 and 36. It is roughly 25m x 15m and is bounded by the remains of a stone wall, 0.5 - 0.8m high in the NE part but much more wasted in its SW part. A line of trees are growing along the wall. The internal area is grassy and deeply ploughed but not planted

38 Clearance cairn - NH 44126 60107

39 Cup marked stone - NH 44057 60095 details of this feature are included with the main group of cup marked stones 350m to the SW

B. Middle North settlement (NOSAS survey site nos 40 - 44) - centred on NH 4400 6012. Comprises 4 buildings, one corn drying kiln and 1 enclosure. Much of the area is marshy, the drainage having been affected by the construction of forest roads.

40A Enclosure - centred on NH 44004 60103 A rectangular enclosure aligned NNW-SSE is 18m x 13m. It is surrounded by a moss covered wall which is, for the most part, of stone. The general level of the enclosure is raised above that of the surrounding ground which is marshy. The height of the wall is generally 1m on the outside and 0.5m on the inside. A number of trees are growing along the line of the wall. This is most probably a garden. To the south of the enclosure there are two lengths of wall within a plantation of young trees, it is difficult to determine their extent, but they are probably associated with this settlement:

B Wall - centred on NH 44068 60084 This curvilinear wall is 23m in length and aligned NW-SE, it is 0.3-0.5m in height, and has a 2m spread.

C Wall - centred on NH 44046 60070 and at right angles to 40B this wall has been greatly disturbed by forest ploughing.

41 Building - NH 43998 60114 A rectangular building, aligned ENE-WSW, with 2 compartments. The east compartment is better preserved and has internal dimensions of 5.5 x 3m. The dry stone walls are double faced, 0.8m thick, and generally 1m in height, although the east gable is 2m high. There is an entrance at the west end of the south wall and a nice pair of cruck slots, opposite one another in the long walls. The west compartment is much more wasted with the walls being 0.3-0.5m height, although at the west end, where it is recessed into the bank, the stone face is 0.8m high.

There are two lengths of wall abutting; the one to the north stretches for 7.5m in a NNW direction and is of stone and turf construction, 0.5m high, the one to the south is of turf, it is 7m long and 1m in height. Both of these walls may be all that remains of an enclosure shown on the 1st edition OS map, the rest of it having been destroyed by the construction of the forest road nearby.

42 Building - NH 44001 60120 This is the main building of the settlement, it is aligned E-W and has internal dimensions of 16m x 4m. The internal area is raised above that of the surrounding land and is divided into 2 equally sized compartments by a setting of upright slabs 0.4m in height. The west compartment appears to be the main one, the walls here are generally 0.8-1m height (1-1.5m outside) but the west gable is 1.6m. On the outside this gable is 2m high and has complex buttressing, with a stone plinth 4m x 1.5m x c1.5m height covered by tumble.

The east compartment walls are generally 0.5m high (0.8m outside) although the east gable is 1m high (1.3m outside), and here again there appears to have been a form of "buttressing" supporting the gable. Internally there is an obvious drain, 0.4m deep, down the centre of the compartment and an entrance at the west end of the south wall.

An outshot to the east, in the form of a level platform, 2.5m x 2.5m, with a stone edge of 0.3m height may be a former building on this site. It is set at a slight angle to the main building and may indicate the line of an earlier building.

42A Building - Immediately to the north of 42, turf footings of what may be small building can be seen. It has the form of an L shaped turf bank, 0.3-0.5m in height with a spread of 1.5m.

43 Kiln and barn - NH 44009 60135 Aligned E-W this structure has an overall measurement of 7m x 3m. The kiln is of dry stone construction and well preserved, it is generally 1.6m high. The bowl has a diameter of 1.8m and it is 0.5-1m deep although although there is tumbled material inside. Unusually there are two flues in the straight west face which is

1.1m in height. The south one appears blocked although it can be probed to a depth of 0.9m, it has an aperture of 1m width x 0.3m height externally, narrowing to 0.3m width x 0.1m height. The north flue is 0.5m wide, 0.2-0.4m depth and 1m in length. Externally there is an abutting feature on the SE side of the structure, this has the form of a rising ramp of large stones and may have been steps up to the top of the kiln.

The internal area of the barn to the east is raised above the level of the surrounding ground. It is 6m x 2.5m internally and the remains of the walls are 0.3-0.5m height inside (0.6-1m outside). There is an entrance 0.7m in width at the east end of the south wall.

44 Building - NH 44021 60123 A few metres to the SE of the kiln the very wasted remains of this structure appear as a rectangular marshy depression. The structure is aligned ENE-WSW and has an overall measurement of 9m x 4m. Several large moss covered boulders outline the walls of the structure; the rest of the walls may have been robbed. The walls have a height of 0.5-0.6m inside (0.2-0.5m outside). There may be an entrance in the south wall.

C. NW Settlement (NOSAS survey site nos 59 - 65) centred on NH 438 601- Comprises two farmsteads within 100m of each other. The NE farmstead has 2 buildings, a corn-drying kiln, an enclosure and a small pen (61 – 65). The SW farmstead has 1 building and 1 enclosure (59 – 60). The remains of the dry stone walls of both farmsteads are in the main, quite low and between 0.8-1m in thickness, they are moss covered and possibly robbed of their stone. The NE farmstead is on a level shelf which slopes off to the north and west. The SW farmstead is on level ground within the forested area close to a small burn

61 Building/Possible Byre - NH 43796 60120 An L-shaped building, on a ENE-WSW alignment, comprising 3 compartments:

- The main, largest compartment, to the west, measures 7.8m x 3.8m internally, with the extension to the NW of an additional 4.4m x 3m. The dry stone walls in the south and west part are 0.2-0.3m high whilst those to the north are 0.6m high externally and that at the north end of the extension is 1.2m. A few features were noted - 1. An entrance in the SE wall possibly 1m in width, although the surviving aperture suggested 1.8m in width. 2. A stone edged drain in the E part of the compartment is 0.3m wide x 2m length x 0.2m deep. A possible further one is seen in the west part, see plan. 3. A regular moss covered stone plinth to the rear/N of the building. It measured 2m length x 0.6m width x 0.5m height. It may have been buttressing for the wall.

- The central compartment measures 1.8m x 3.8m and has an entrance of 1.2m in width in the south wall. The walls are very variable in height from 0.2-0.7m.

- the east compartment is 4.4m x 3.6m internally and the walls are 0.3-0.5m high. A stone edged drain 0.4m wide x 1.8m length x 0.3m deep occupies a central position. Adjacent to the east a roughly circular depression 1.6m diameter x 0.4m deep may be a stank or a sump. To the SE of the building a terrace runs along the length of the building. It is 2m width in the west part and 1.2m in the east part. It is bounded by large boulders with a drop 0.3-0.5m to a marshy depression which appears to be man-made. The marshy depression is 8m N-S x 16m SW-NE narrowing at the NE end. It has steep banks to the south and east.

At the SE corner of the building a stone lined void, 0.2 x 0.2m x 0.8m depth may be the socket for a timber post. At the NE corner, the wasted turf and stone wall of enclosure 54 abuts 62.

62 Building - NH 43787 60116 A rectangular building on a NNW-SSE alignment, probably the main dwelling house of the farmstead. It measures 13.8m x 3.4m internally. The remains of the dry-stone walls are 0.4-0.5m high in the south part but 1-1.2m at the north end. There are two entrances, both 1m in width, in the east wall

63 Corn-drying kiln and barn - NH 43778 60124 A rectangular structure on a sloping E-W alignment comprising two parts - the bowl and the barn:

- the bowl at the east end is recessed into the slope. It is c 0.5m deep but filled with tumble. A defining edge of stonework is seen in places and possibly a scarcement, 0.5m in width, around the upper edge.

- the barn is 9m x 3.2m internally and recessed at its east end where the face of the kiln is 0.8m high, tumble obscured any flue that might exist. The stone walls at the east end were 1m in height internally but barely discernable externally. At the west end they were 0.6-0.8m high, both internally and externally. An obvious entrance, 0.7m in width, existed at the west end of the south wall and a possible drain was 0.3m deep.

64 Enclosure - NH 43783 60108 A rectangular enclosure on a NNW-SSW alignment measures 11m x 6m internally. The remains of crudely built stone walls on three sides are largely

tumbled but generally 0.5m high and with a spread of 1.5m. There is no evidence of a wall on the east side but this may have been provided by the west wall of building 62. To the west a possible track ran up the hill along the outside of the enclosure and at the north end the wall of enclosure 54 curves off in a southerly direction.

65 Pen - NH 43770 60102 Situated in an angle of wall 54 a few metres to the west of the settlement. This small pen is aligned N-S and measures 3m x 1m. The walls are of single stone thickness and are 0.6-0.7m high.

59 Building - NH 43731 60050 A rectangular structure on a NE-SW alignment measures c7.5m x 2.5m internally. The remains of the dry stone walls are generally 0.5-0.6m high and have a spread of 0.8m. There is a considerable amount of tumble in the NE end of the building and an entrance, 0.7m wide in the SE wall. The building is grass and moss covered and has been planted with trees

60 Enclosure - NH 43742 60042 A few metres to the south of 59, this enclosure is in a sheltered position close to a small burn. It abuts the wall of the main enclosure 54 and is D shaped, on a WSW-ENE alignment and measure 13m x 12m internally. The remains of the dry stone walls which are 0.3-0.7m high and have a 1-1.5m spread are more substantial in the north and east parts.

D. Middle west settlement (NOSAS survey site nos 55 - 58) - centred on NH 4375 5992 This settlement comprises 3, possibly 4 buildings, and an enclosure.

55 Building - NH 43737 59878 This small rectangular building, 40m to the south of the main group, abuts the wall of enclosure 54 and is grossly overgrown with trees, heather and moss. It is roughly square and measures c4m x 4m internally. The walls have been crudely constructed of stone and are better preserved on the west side where they are 0.5m high. This building is marked on the FES.

56 Building - NH 43745 59917 A small rectangular building a few metres to the south of the main building 57. It is aligned WNW-ESE and measures c4m x 3m internally. The dry stone walls are of rough construction, generally 0.5m high and 0.6m thick. There is a possible entrance, 0.8m in width, at the east end of the S wall.

57 Building - NH 43742 59919 This the main building is just 1.5m to the north of 56 and on the same alignment. It measures c6.5m x 3.2m internally. The remains of the dry-stone walls are 0.6m in height and 0.7m thick, but the west gable which appears to be largely intact and is 1.4m high and the east gable is 0.8m high. There is an entrance, 0.6m width, in the centre of the S wall.

57A Possible building - NH 43756 59921 This may be an outshot to the east of 57. Circa 11 metres to the east of 57 and slightly offset there is evidence of a further building in the form of a well built dry stone "end" wall. It is 0.7m high, with 1m spread and is 4m in length. In between this and 57 there is a slight rectangular depression, c 6m x 3m with a barely discernible low turf wall to the north. The extent of the building is difficult to make out because of forest ploughing and planted trees.

58 Enclosure - NH 43773 59920 A roughly square enclosure to the east of 57 and 56 measures c14m x 14m. It is surrounded by a substantial dry stone wall which in all probability has clearance material dumped in it. The wall is generally 0.4-0.5m high and has a spread of 1.5m but the west wall is 0.6m high. The enclosure is grassy, has been ploughed but not planted with trees

76 Enclosure - NH 43976 59607 Situated on the south side of a bracken covered knoll to the south of the railway and just 120m to the SW of the level crossing, the very wasted remains of the stone walls of this enclosure are seen. It appears to be roughly rectangular although its extent at the west side is uncertain. It is on an ENE-WSW alignment and c15m x 9m. The walls are obvious on the E and S side and are roughly 0.3m high, less obvious to the west and north. The whole area is significantly disrupted by forest operations with deep pits, brashings and newly planted trees overall.

E. SW settlement and quarry (NOSAS survey site nos 51 - 53 also 47 and 48) Centred on NH 4373 5977 This settlement of one building and one enclosure occupy a broad wooded knoll to the SW of the main enclosure, 54, a further small enclosure and a stretch of wall on a nearby knoll to the east has been included. A quarry, possibly associated with the railway, has also been included.

51 Quarry - NH 43742 59806 Probably associated with the railway and of more recent origin than the settlement which is situated immediately to the SW

52 Building - NH 43733 59777 The rectangular building aligned N-S and measuring 8m x 3m

Appendix 1: Gazetteer of Heritage Assets and Events

internally. The dry stone walls are double faced, 0.8m thick and generally 0.6m in height. Although the north gable, which is almost intact, is 1.6m high - it has a large alcove, 0.5m width x 0.6m height x 0.6m depth. There is an entrance of 0.7m width in the east wall. The building was very much overgrown with bracken at time of recording.

53 Enclosure - centred on NH 43687 59760 A large rectangular enclosure aligned ENE-WSW is roughly 100m x 50m and occupies a large undulating knoll. The surrounding stone wall is most evident in the west and north where it is generally bracken covered and c0.3-0.5m in height. It is not evident in the south part although there is a short turf stretch to the south of building 52

47 Wall - NH 43783 59756 (S end) A 28m length of wall crosses a west facing slope on the opposite side of the forest track to the east of building 52. It is 0.4m high, has a spread of 0.6m and is generally very wasted. It may have been part of an enclosure. The wall may continue to the south around the hill on the north side of the road, but the rest of the wall has been destroyed by forestry tracks and the railway.

48 Enclosure - centred on NH 43800 59736 A few metres to the south of 47 this square enclosure is was greatly overgrown with bracken at the time of recording. It is 11m x 11m internally and the wasted stone walls which are quite evident are up to 0.4m in height.

Asset/Event Number	164
Asset/Event Name	Enclosure, Cnoc an Fasgnaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 30.00
HER Number	MHG20086
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256051
Northing	868713
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Low stone and turf covered mound surviving to less than 0.5m in height. Appears to be square or sub circular in shape, but only survives at SW end, other end presumably destroyed by planting of forestry. Cse NW oriented, however it is slightly curved. https://canmore.org.uk/site/103699/ RCAHMS First Edition Survey Project An enclosure is depicted on the 1st edition of the OS 6-inch map (Ross-shire & Cromartyshire 1881, sheet lxiv) and on the current edition of the OS 1:10000 map (1992). Information from RCAHMS (AKK) 29 February 1996.

Asset/Event Number	165
Asset/Event Name	Boath
Type of Asset/Event	Farmstead (Period Unassigned), Lime Kiln (Period Unassigned)
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	NH57SE 24.00
HER Number	MHG20469
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256910
Northing	873491
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/103738/ RCAHMS First Edition Survey Project A farmstead comprising one unroofed building attached to a field wall, and a limekiln are depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartysire 1880, sheet lii). A field wall is shown on the current edition of the OS 1:10000 map (1990). Information from RCAHMS (SAH) 23 February 1996
Asset/Event Number	166
Asset/Event Name	Farmstead, Boathmore
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 25.00
HER Number	MHG20470
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256710
Northing	873650
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular building under grass and heather, measuring c35m by 5.5m over walls. At least one central partition, forming two room with the NW measuring 7m internally by 4, the SE c23m long. Very degraded walls that stand up to 0.3m tall and 0,65m wide except at the partition wall, which stands 0.9m tall in parts. Entrances not discernible and stone spread extends from the SW elevation. Depicted on the 1st edition OS map as an unroofed building. https://canmore.org.uk/site/103739/ RCAHMS First Edition Survey Project A farmstead comprising one unroofed long building lying adjacent to an area of cultivation is depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartysire 1880, sheet lii), but it is not shown on the current edition of the OS 1:10000 map (1990). Information from RCAHMS (SAH) 23 February 1996

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	167
Asset/Event Name	Boath
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27.00
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256390
Northing	873770
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 167 for details. https://canmore.org.uk/site/103741/ RCAHMS First Edition Survey Project NH57SE 27 5639 7377 Glack: "...the most westerly farm in Boath..." Name book 1881 A farmstead comprising one unroofed and four roofed buildings and an enclosure is depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartysire 1880, sheet lii). One unroofed building and two enclosures are shown on the current edition of the OS 1:10000 map (1990). Information from RCAHMS (SAH) 23 February 1996 References Ordnance Survey (Name Book. (1848-1878) Object Name Books of the Ordnance Survey (6 inch and 1/2500 scale). Page(s): Book No. 38, 165 RCAHMS Shelf Number: Ref
Asset/Event Number	168
Asset/Event Name	Ruigh Na Meinne
Type of Asset/Event	Head Dyke (Post Medieval), Township (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH58NE 12.00
HER Number	MHG20630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256000
Northing	889100
Council	Highland
Condition:	N/A
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	N/A
Description	https://canmore.org.uk/site/103752/ RCAHMS First Edition Survey Project A township comprising five unroofed buildings, two enclosures and a head-dyke is depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartyshire 1881, sheet xxvi). Three unroofed buildings, three enclosures and a head-dyke are shown on the current edition of the OS 1:10000 map (1992). Information from RCAHMS (SAH) 16 February 1996

Asset/Event Number	169
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	
Status	
Section:	N/A
Easting	
Northing	
Council	
Condition:	
Alignment:	
Importance:	
Description	VOID - number not assigned

Asset/Event Number	170
Asset/Event Name	Aultgowrie Bridge
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 9.00
HER Number	MHG24740
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247600
Northing	850700
Council	Highland
Condition:	Various
Alignment:	Various
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 170 for details. https://canmore.org.uk/site/103414/

Appendix 1: Gazetteer of Heritage Assets and Events

RCAHMS First Edition Survey Project

A farmstead comprising one unroofed long building, two unroofed structures, an enclosure and a length of field wall is depicted on the 1st edition of the OS 6-inch map (Ross-shire 1875-81, sheet xcviij), but it is not shown on the current edition of the OS 1:10000 map (1992).

Information from RCAHMS (SAH), 7 March 1996.

Asset/Event Number	171
Asset/Event Name	Strathan
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 15.00
HER Number	MHG24713
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245470
Northing	852520
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/103417/ RCAHMS First Edition Survey Project An unroofed building is depicted on the 1st edition of the OS 6-inch map (Ross-shire 1875-81, sheet xcviij), but it is not shown on the current edition of the OS 1:10000 map (1992). Information from RCAHMS (SAH) 7 March 1996

Asset/Event Number	172
Asset/Event Name	Seileach Mor
Type of Asset/Event	Building (Period Unassigned), Enclosure (Period Unassigned), Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SW 2.00
HER Number	MHG24680
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242220
Northing	854690
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/103371/

Appendix 1: Gazetteer of Heritage Assets and Events

NH45SW 2 4222 5469

A single unroofed building is depicted on the 1st edition of the OS 6-inch map (Ross-shire 1881, sheet lxxxvii). One unroofed building of two compartments is shown on the current edition of the OS 1:10000 map (1971).

Information from RCAHMS (AKK) 7 March 1996.

Activities

Field Visit (22 March 2007 - 22 March 2007)

Scotland's Rural Past (SRP)

Srp Note (10 January 2011) Scotland's Rural Past (SRP)

A farmstead (NOSAS site survey Nos 205) and associated enclosures (206, 207 & 208) centred on NH 4223 5467 are located in an elevated position above the N bank of the Allt na Fainich. The area surrounding the farmstead is has been improved and there are open birch woods further E.

Further details of these and other associated sites can be found in the Strathconon Phase 1 Report (pages 33-35) produced by the North of Scotland Archaeology Society and appended to this record.

Asset/Event Number	173
Asset/Event Name	Seileach Mor
Type of Asset/Event	Enclosure (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SW 3.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241590
Northing	854250
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/103372/ NH45SW 3 4160 5427 An enclosure is depicted on the 1st edition of the OS 6-inch map (Ross-shire 1881, sheet lxxxvii), but it is not shown on the current edition of the OS 1:10000 map (1971). Information from RCAHMS (AKK) 7 March 1996. https://her.highland.gov.uk/Monument/MHG24681 This enclosure (210) was recorded by NOSAS in 2007 as part of the Scotland's Rural Past Project - NH 41591 54247 - and is also immediately adjacent to and on the north bank of the Allt na Fainich in a sheltered position. A sub-square enclosure measuring roughly 26m x 26m is surrounded on 3 sides by a low stone wall 0.5m in height. The south side is formed by the stream which at this point runs in a gully. Majority heather covered. Roughly halfway between 210 at NH 41705 54366 and 209 enclosures, also on the north bank of the stream, there is an area of improved ground in a sheltered re-entrant, with several clearance cairns. Both the enclosures may be associated with farmstead 205, to the NE or farmstead 217 to the SW. <1> Sources/Archives (1)

Appendix 1: Gazetteer of Heritage Assets and Events

<1> SHG24094 Text/Report/Fieldwork Report: Marshall, M.. 2009. A Project to Identify, Survey and Record Archaeological Remains in Strathconon, Ross-shire: Report of Phase One Scatwell and Lower Strathconon. North of Scotland Archaeological Society. 23/01/2009. Digital. p.34 Site 210.

Asset/Event Number	174
Asset/Event Name	Loch An Uird
Type of Asset/Event	Farmstead (Period Unassigned)(Possible)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 46.00
HER Number	MHG23319
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246700
Northing	843100
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Low
Description	*Observation by AOC Archaeology during 2024 walkover survey. No upstanding remains related to this asset were identified during the walkover survey, the locale of which was under long pasture, however elements may survive sub-surface. https://canmore.org.uk/site/110009/ RCAHMS First Edition Survey Project What may be a farmstead comprising an unroofed building is depicted on the 1st edition of the OS 6-inch map (Inverness-shire 1876, sheet x), but it is not shown on the current edition of the OS 1:10000 map (1975). Information from RCAHMS (SAH) 15 May 1996 Field Visit (9 May 2023) NH 4645 4305 (centred) A desktop and walkover survey was conducted in May 2023 for an area of proposed woodland of 16 hectares, the area encompassing a number of recorded sites. Work revealed an unrecorded trackway. Information from Stuart Farrell.

Asset/Event Number	175
Asset/Event Name	Breakachy Burn
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44NE 31.00
HER Number	MHG23303
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245640

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	845480
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/109993/ RCAHMS First Edition Survey Project A farmstead comprising two unroofed buildings, one of which has an attached enclosure, and a short length of wall is depicted on the 1st edition of the OS 6-inch map (Inverness-shire 1876, sheet x). An unroofed circular structure attached to the building may be a horse-gang. The building, the enclosure and further lengths of wall are shown on the current edition of the OS 1:10000 map (1975). Information from RCAHMS (SAH) 14 May 1996 https://her.highland.gov.uk/Monument/MHG23303 The North of Scotland Archaeological Society (NoSAS) undertook an archaeological survey of Urchany in 2015. Site V60; Allt na Criche settlement. The C19th settlement west of the Allt na Criche consists of extensive enclosure walls, a building, and a sunken area with perhaps a pond. On the estate maps covering this area there is no settlement shown until 1838. In the 1841 census there are three people living at "Aultnacrich": Donald Mackay, agricultural labourer, Mary Mackay, and a 14 year old boy Finlay, presumably their son. We know from newspaper adverts that Urchany was used for sheep farming at this time. The settlement of two, possibly three, buildings lies at the northern upper end of a large enclosure bordered to the west by a stone dyke. A kiln, presumably corn-drying, lies just to the south of building A, with evidence of raised ground and walls between the two, suggesting that the kiln may have been part of a barn contiguous with the other buildings. <1> 1st Edition OS 6" <2> NGR adjusted based on 2009 aerial photographs. <3> Sources/Archives (3) <1> SHG28596 Text/Report/Fieldwork Report: Spencer-Jones, R.. 2020. A NoSAS Survey of the Lands of Urchany: A Multi-period Settlement on the Braes West of Beaulay: 6th-10th April 2015. North of Scotland Archaeological Society. Digital. P.17-20, Site V60, Figures 18-28. XY <2> SHG23411 Image/Map: Ordnance Survey. 1881. Ordnance Survey 1st edition 6 inch map: Ross-shire. Digital. <3> SHG27382 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2009. Getmapping aerial photography 2009.
Asset/Event Number	176
Asset/Event Name	Farmstead, Ardochy
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 40.00
HER Number	MHG23330
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246160
Northings	843480
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/110003/ RCAHMS First Edition Survey Project A farmstead comprising an unroofed building attached to an enclosure is depicted on the 1st edition of the OS 6-inch map (Inverness-shire 1876, sheet x). The building is shown on the current edition of the OS 1:10000 map (1975). Information from RCAHMS (SAH) 14 May 1996

Asset/Event Number	177
Asset/Event Name	Ardochy
Type of Asset/Event	Farmstead (Period Unassigned)(Possible)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 41.00
HER Number	MHG23314
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246090
Northing	843330
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 177 for details. https://canmore.org.uk/site/110004/ RCAHMS First Edition Survey Project What may be a farmstead comprising an unroofed long building is depicted on the 1st edition of the OS 6-inch map (Inverness-shire 1876, sheet x) and on the current edition of the OS 1:10000 map (1975). Information from RCAHMS (SAH) 14 May 1996

Asset/Event Number	178
Asset/Event Name	Ardochy
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 42.00
HER Number	MHG23301
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246400
Northing	843200

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible/Low
Description	*Observation by AOC Archaeology during 2024 walkover survey. This building recorded on the NRHE/HER appears to be mis-placed, and likely relates to a structure visible on the 1st edition OS map situated along the extent of the N side of the survey corridor, and for which no upstanding remains could be discerned. HER Description: NH44SE 42 464 432An small unroofed building is depicted on the 1st edition of the OS 6-inch map (Inverness-shire 1876, sheet x), but it is not shown on the current edition of the OS 1:10000 map (1975).Information from RCAHMS (SAH) 14 May 1999. https://canmore.org.uk/site/110005/ RCAHMS First Edition Survey Project An small unroofed building is depicted on the 1st edition of the OS 6-inch map (Inverness-shire 1876, sheet x), but it is not shown on the current edition of the OS 1:10000 map (1975). Information from RCAHMS (SAH) 14 May 1996 Field Visit (9 May 2023) NH 4645 4305 (centred) A desktop and walkover survey was conducted in May 2023 for an area of proposed woodland of 16 hectares, the area encompassing a number of recorded sites. Work revealed an unrecorded trackway. Information from Stuart Farrell.
Asset/Event Number	179
Asset/Event Name	Cnoc A' Leacachan
Type of Asset/Event	Clearance Cairn(s) (Period Unassigned), Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH57SE 34.00
HER Number	MHG41365
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257600
Northing	872600
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 177 for details. https://canmore.org.uk/site/123544/ NH57SE 34 576 726 NH 576 726 A previously unrecorded roundhouse settlement already cut by the existing estate road was also clipped by the new windfarm access road. The remains of three roundhouses and associated clearance cairns survive on the E side of Cnoc a' Leacachan covering an area of c 2ha. The best-preserved is oval, 11 x 8m internally with a probable entrance to the SE. One roundhouse, 10m in internal diameter, was partially exposed during the construction work. It had already been damaged by the existing road. The exposed section was drawn and a radiocarbon sample (2400±60 BP) taken from a possible wattle fence lining the inner face of a ?turf bank 2m wide. The interior of the house was not excavated and was sealed by terram matting before the road metalling was laid. One worked quartz flake was found outside the structure. About half of the building remains

Appendix 1: Gazetteer of Heritage Assets and Events

undisturbed.

Sponsor: National Power.

J Wordsworth 1997

Activities

Field Visit (1997) NH 576 726

A previously unrecorded roundhouse settlement already cut by the existing estate road was also clipped by the new windfarm access road. The remains of three roundhouses and associated clearance cairns survive on the E side of Cnoc a'Leacachan covering an area of c 2ha. The best-preserved is oval, 11 x 8m internally with a probable entrance to the SE. One roundhouse, 10m in internal diameter, was partially exposed during the construction work. It had already been damaged by the existing road. The exposed section was drawn and a radiocarbon sample (2400±60 BP) taken from a possible wattle fence lining the inner face of a ?turf bank 2m wide. The interior of the house was not excavated and was sealed by terram matting before the road metalling was laid. One worked quartz flake was found outside the structure. About half of the building remains undisturbed.

J Wordsworth 1997.

References

Wordsworth, J. (1997ab) 'Novar Windfarm (Rosskeen parish), Bronze Age, modern settlement', *Discovery Excav Scot*, 1997. Page(s): 5

Asset/Event Number	180
Asset/Event Name	Upper Garvary, Sheep Fank
Type of Asset/Event	Sheepfold (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH58NE 18.00
HER Number	MHG28358
Status	Non-designated Heritage Asset
Section:	N/A
Easting	259100
Northing	885680
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone constructed sheepfold, Z-shaped in plan measuring 40m by 30m. Walls stand to a height of 1.3m but some breaches have reduced it to ground level in parts. Constructed of roughly dressed stone and with three sheep creeps in the NW elevation and several internal compartments. Depicted on the 1st edition OS map. https://canmore.org.uk/site/125428/ NH58NE 18 5910 8568 This sheepfold or fank is constructed of river washed dry stone rubble masonry and consists of four compartments. The walls are 1.4m to 1.5m in height by 0.9m in width at groundlevel, tapering to 0.5m in width at the wall head. There is a post with a clip for a 'mineral lick' on the extreme NW elevation, W end. For details on the sheepfold construction see NMRS MS 744/146 and DC 33190 Visited by RCAHMS (GJD), April 1987.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	181
Asset/Event Name	Allt Bad A' Chrasgaidh
Type of Asset/Event	Burnt Mound (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 71.00
HER Number	MHG28233
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274730
Northing	902210
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible location of burnt mound. The area was under tall grass and the burnt mound could not be confidently identified. https://canmore.org.uk/site/123952/ Field Visit (26 April 1995) RCAHMS Afforestation Land Survey, Rogart NC70SW 71 7473 0221 This oval burnt mound is situated on the NE bank of the Allt Bad a' Chrasgaidh and measures 8.1m from NW to SE by 3.4m transversely and 0.4m in height. The SW side of the mound has been cut by the burn, exposing cracked stone, charcoal and black soil. (ROG95 134) Visited by RCAHMS (DCC) 26 April 1995

Asset/Event Number	182
Asset/Event Name	Allt Bad A' Chrasgaidh
Type of Asset/Event	Burial Cairn (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 103.00
HER Number	MHG28244
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274900
Northing	902840
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low/Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A kerb cairn as described by RCAHMS, though appears much diminished. The asset comprises a small low mound under heather 0.3m tall and 4m NW/SE by 3m, with occasional boulders (or exposed portions of bedrock) set in an intermittent kerb around this, some 2-4m from the mound. Situated on a

Appendix 1: Gazetteer of Heritage Assets and Events

low knoll with good views to the E.

<https://canmore.org.uk/site/124375/>

Field Visit (27 April 1995)

NC70SW 103 7490 0284

This cairn, which stands on a rise to the N of the Allt Bad a' Chrasgaidh, is oval on plan, measures 3.8m from NE to SW by 3.5m transversely, stands 0.35m high, and is edged with a kerb of boulders.

(ROG95 243)

Visited RCAHMS (PJD) 27 April 1995 A kerb cairn as described by RCAHMS, though appears much diminished. The asset comprises a small low mound under heather 0.3m tall and 4m NW/SE by 3m, with occasional boulders (or exposed portions of bedrock) set in an intermittent kerb around this, some 2-4m from the mound. Situated on a low knoll with good views to the E. <https://canmore.org.uk/site/124375/>

Field Visit (27 April 1995)

NC70SW 103 7490 0284

This cairn, which stands on a rise to the N of the Allt Bad a' Chrasgaidh, is oval on plan, measures 3.8m from NE to SW by 3.5m transversely, stands 0.35m high, and is edged with a kerb of boulders.

(ROG95 243)

Visited RCAHMS (PJD) 27 April 1995

Asset/Event Number	183
Asset/Event Name	Allt Bad A' Chrasgaidh
Type of Asset/Event	Township (Post Medieval)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 55.00
HER Number	MHG28537
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275000
Northing	902000
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 183 for details. https://canmore.org.uk/site/130414/ Field Visit (24 April 1995) RCAHMS Afforestation Land Survey, Rogart NC70SE 55 7500 0200 This township is situated in the valley of the Allt Bad a' Chrasgaidh and lies within a head-dyke which encloses an area of about 500m from E to W by up to 250m. Patches of rough grassland within the head-dyke bear faint traces of ridging and lazy-beds. There are two loose groupings of buildings and enclosures situated on either side of the burn and, except for one structure (ROG95 125, NC 7497 0216), they all lie within the head-dyke. Four buildings (ROG95 126-8, 540) stand to the W of the burn, one of which (ROG95 127) is very much larger than the others and is attached to an enclosure. To the E of the burn there are eight buildings (ROG95 117-20, 122-5) - two of which are very much larger than the others, a kiln (ROG95 121) and six enclosures. All the buildings have faced-rubble footings. There is no depiction of the township on either the 1st or 2nd edition of the OS 6-inch map (Sutherland 1879, 1907, sheet civ). The three largest buildings measure respectively 16.1m by 2.5m (ROG95 124), 16.6m by

3.2m (ROG95 127) and 19.8m by 3.2m (ROG95 120), with two compartments in each of the two shorter structures and three in the longest. Two of these buildings (ROG95 120, 124) have two bedneuks opening out of a side wall, while another (ROG95 128) has a dished interior to one compartment suggesting that it may have been a byre house. The two largest buildings to the E of the burn are situated relatively discreetly of each other, and all three large buildings may have formed a focus for a family unit.

The other buildings can be broken down into two broad size ranges: those measuring from 8.7m by 2.9m to 9.9m by 2.3m internally (ROG95 122, 127, 129); and a series of huts measuring from 4.1m by 1.7m to 5.8m by 2.7m internally (ROG95 117-9, 123, 125, 126, 540). These smaller buildings all have a single compartment.

A kiln (ROG95 121, NC 7506 0212) is situated in a discrete cluster of structures on the E of the burn and comprises a bowl measuring 1.8m in diameter within a faced rubble bank 1.2m in thickness and 1m in height. The flue is on the SSW, opening out into a barn which measures 3.8m from NNE to SSW by 2.8m internally. The kiln bowl has been built onto the leading edge of a terrace and is set well above the level of the barn.

(ROG95 117-29)

Visited by RCAHMS (DCC) 24 April 1995

Asset/Event Number	184
Asset/Event Name	Dalnamein
Type of Asset/Event	Dyke (Period Unassigned), Enclosure(s) (Period Unassigned), Hut Circle (Prehistoric)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 46.00
HER Number	MHG28660; MHG44738; MHG14569
Status	Non-designated Heritage Asset
Section:	N/A
Easting	272130
Northing	898540
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/134181/ Dyke (Period Unassigned), Enclosure(s) (Period Unassigned), Hut Circle (Prehistoric) NH79NW 46 Centred on 7213 9854 NH 7213 9854 Drystone dyke/land boundary. Over 150m. NH 7245 9850 Slag deposits in mole upcast. NH 7213 9859 Hut circle associated with. NH 7212 9857 Sub-rectangular enclosures. Tain Archaeological Group 1995. References TAG. (1995i) 'Dalnamein (Dornoch parish)', <i>Discovery Excav Scot</i>, 1995, Tain Archaeological Group. Page(s): 47

Asset/Event Number	185
Asset/Event Name	Minera
Type of Asset/Event	Hut circle (Period Unassigned)

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Prehistoric
Listing No./NRHE Number	ND13SE 119.00
HER Number	MHG28696
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315540
Northing	934900
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Observation by AOC Archaeology during 2024 walkover survey.*The duplication mentioned and then queried below in the HER MHG28696 entry (https://her.highland.gov.uk/Monument/MHG28696) relate to the duplication of ND13SE 119.00 (https://canmore.org.uk/site/135143/minera) and ND13SE 112.00 (http://canmore.org.uk/site/135090), which are located at the same NGR and bear the same description. https://canmore.org.uk/site/135143/ ND13SE 119 1554 3490 This small hut is situated on a terrace some 50m E and above the public road immediately S of a deeply cut burn channel and just N of a modern fence line. Measuring 8.3m in diameter over a bank about 2.5m in thickness and 0.2m in height. The interior is slightly dishd and it is possible that this is a small hut-circle similar in size to that discovered to the S (ND13SE 115). Visited by RCAHMS (DE, IP) August 1997 https://her.highland.gov.uk/Monument/MHG28696 These two NMRS records appear to be duplicates of each other. Jhooper, 17/9/2002 It is not apparent on what basis J Hooper made the comment about this site record being a duplicate of another. However, this site is not readily apparent on any vertical aerial photographs until those taken in 2023 when a circular feature of around the right size is just about visible. There is also no modern fence line visible (as mentioned by RCAHMS) either. <1> Sources/Archives (1) <1> SHG29455 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2023. Getmapping aerial photograph 2023. XY
Asset/Event Number	186
Asset/Event Name	Minera
Type of Asset/Event	Burnt Mound (Prehistoric)(Possible), Field Boundary (Period Unassigned)(Possible)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND13SE 109.00
HER Number	MHG45469
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315690

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	934750
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/135083/ ND13SE 1569 3475 A possible grass-grown burnt mound is situated some 100m NE of the abandoned farmstead of Minera, about 10m S of the fence bounding the public road. The adjacent burn has now been recut as a ditch. Oval on plan, with shallow hollows in its SW side and its centre, the mound measures 10.1m from N to S by 8.7m transversely and stands up to 0.6m in height. No evidence of burnt stone could be seen at the date of visit. A possible field bank runs on to the S side of the mound. Visited by RCAHMS (DE, IP) August 1997 Field Visit (August 1997) A possible grass-grown burnt mound is situated some 100m NE of the abandoned farmstead of Minera, about 10m S of the fence bounding the public road. The adjacent burn has now been recut as a ditch. Oval on plan, with shallow hollows in its SW side and its centre, the mound measures 10.1m from N to S by 8.7m transversely and stands up to 0.6m in height. No evidence of burnt stone could be seen at the date of visit. A possible field bank runs on to the S side of the mound. Visited by RCAHMS (DE, IP) August 1997
Asset/Event Number	187
Asset/Event Name	Minera
Type of Asset/Event	Hut circle (Period Unassigned), Structure (Period Unassigned)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND13SE 110.00
HER Number	MHG28693
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315640
Northings	934730
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/135084/ ND13SE 110 1564 3473 A small structure is visible in an improved field to the NE of the broch (ND13SE 19[Asset 56/SM568]) and immediately NE of the farmstead of Minera (ND13SE110.00). Roughly triangular on plan, the structure measures 7.5m from NE to SW by 6.6m within a bank spread to 1.9m in thickness and up to 0.3m in height. There is a possible entrance on the NE with appears to be a slight ramp at its SW end. The date and purpose of this structure are not known, but it may be connected with the use of the adjacent farmstead of Minera. Visited by RCAHMS (DE, IP) August 1997

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	188
Asset/Event Name	Minera
Type of Asset/Event	Cruck Framed Building (Post Medieval), Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND13SE 111.00
HER Number	MHG28694
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315540
Northing	934700
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/135088/ ND13SE 111.00 1554 3470 ND13SE 111.01 ND 1554 3468 Buildings The farmstead of Minera is situated immediately to the N of the broch ND13SE 13 and comprises a main range of buildings running E and W, with several outbuildings immediately S of its W end, and at least two, and possibly three, other buildings to the SE of the E end (ND13SE 111.01). The buildings, that are still roofed are presently covered with sheets of corrugated iron, but they have been thatched at some point. The roofless building at the E end of the main range has cruck-slots visible, and there is evidence of rebuilding in at least two parts of the range. Minera is described in the OS Name Book as a "small " Hamlet" in Houstry: the property of Mrs B J Sinclair of Freswick? (Name Book 1870) and is depicted as partly roofed on the 1st edition of the OS 6-inch map (Caithness 1870-2, sheet xxxiii). Visited by RCAHMS (SPH, DE) August 1997

Asset/Event Number	189
Asset/Event Name	Minera
Type of Asset/Event	Building(s) (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND13SE 111.01
HER Number	MHG28695
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315540
Northing	934680
Council	Highland
Condition:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/135089/ ND13SE 111.01 1554 3468 In the area between the broch (ND13SE 19) and the farmstead of Minera (ND13SE 111.00) there are three buildings that have been robbed to their stone footings. The southernmost has opposing entrances and may be a threshing barn, while one of the others displays evidence of two phases of construction and has the possible remains of a kiln at its NE end. Visited by RCAHMS (DE, IP) August 1997
Asset/Event Number	190
Asset/Event Name	Minera
Type of Asset/Event	Hut circle (Period Unassigned)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND13SE 112.00
HER Number	MHG28696
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315540
Northing	934900
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Observation by AOC Archaeology during 2024 walkover survey. *The duplication mentioned and then queried below in the HER MHG28696 entry (https://her.highland.gov.uk/Monument/MHG28696) relate to the duplication of ND13SE 119.00 (https://canmore.org.uk/site/135143/minera) and ND13SE 112.00 (http://canmore.org.uk/site/135090), which are located at the same NGR and bear the same description. https://canmore.org.uk/site/135090/ ND13SE 112 1554 3490 This small hut is situated on a terrace some 50m E and above the public road immediately S of a deeply cut burn channel and just N of a modern fence line. Measuring 8.3m in diameter over a bank about 2.5m in thickness and 0.2m in height. The interior is slightly dished and it is possible that this is a small hut-circle similar in size to that discovered to the S (new). Visited by RCAHMS (DE, IP) August 1997 https://her.highland.gov.uk/Monument/MHG28696 These two NMRS records appear to be duplicates of each other. Jhooper, 17/9/2002 It is not apparent on what basis J Hooper made the comment about this site record being a duplicate of another. However, this site is not readily apparent on any vertical aerial photographs until those taken in 2023 when a circular feature of around the right size is just about visible. There is also no modern fence line visible (as mentioned by RCAHMS) either. <1> Sources/Archives (1) <1> SHG29455 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2023.

Appendix 1: Gazetteer of Heritage Assets and Events

Getmapping aerial photography 2023. XY

Asset/Event Number	191
Asset/Event Name	Burn Of Houstry
Type of Asset/Event	Cairn (Period Unassigned), Cairnfield (Period Unassigned)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND13SE 113.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	315150
Northing	932980
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/135092/ ND13SE 113 1552 3298 This heather-covered cairn is situated 210m SW of the chambered cairn ND13SE 1 and ND13SE 50 m W of a track that extends from SE to NW up the hill from the Burn of Houstry. Measuring 13m in diameter and up to 1m in height, the cairn has been severely disturbed by the removal of stone from a wedge-shaped quarry-pit into its W segment; what may be a small pen, measuring 1.7m by 1.1m and 0.2m in depth, has been sunk into the E side of the cairn. At least one small cairn is visible in the peat and deep heather to the W. Visited by RCAHMS (DE) August 1997
Asset/Event Number	192
Asset/Event Name	Fairburn House, Kennels
Type of Asset/Event	Kennels (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 21.11
HER Number	MHG32439
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245430
Northing	852580
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/139361/ Architecture Notes

Appendix 1: Gazetteer of Heritage Assets and Events

see NH45SE 21.00 [Asset 97/LB14031] Fairburn House (Archaeology Notes) for full list of related sites

Asset/Event Number	193
Asset/Event Name	Dunrobin Glen
Type of Asset/Event	Building (Period Unassigned), Corn Drying Kiln (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 67.00
HER Number	MHG35870
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279600
Northing	904900
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/157733/ NC70SE 67 796 049 NC 796 049 A longhouse and associated remains including a corn-drier were identified during planting operations. The site lies at c 270m OD. The area was excluded from planting. J Wordsworth 1999 References Wordsworth, J. (1999e) 'Dunrobin Glen (Golspie parish), deserted settlement', Discovery Excav Scot, 1999. Page(s): 54

Asset/Event Number	194
Asset/Event Name	Fairburn House, Gardener'S Cottage
Type of Asset/Event	Cottage (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 21.14
HER Number	MHG36036
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245250
Northing	852710
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/161151/

Appendix 1: Gazetteer of Heritage Assets and Events

Architecture Notes

see NH45SE 21.00 [Asset 97/LB14031] Fairburn House (Archaeology Notes) for full list of related sites

Asset/Event Number	195
Asset/Event Name	Aultgowrie Mill
Type of Asset/Event	Watermill (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 25.00
HER Number	MHG37361
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247767
Northing	851355
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/192757/ NH45SE 25 47767 51355 Aultgowrie Mill [NAT] OS 1:10,000 map, 1992.

Asset/Event Number	196
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	
Status	
Section:	N/A
Easting	
Northing	
Council	
Condition:	
Alignment:	
Importance:	
Description	VOID - number not assigned

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	197
Asset/Event Name	Contin Mains
Type of Asset/Event	Geological Cropmark(s) (Period Unknown)
Date and/or Period	Unknown
Listing No./NRHE Number	NH45NE 146.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246530
Northing	855010
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/262691/ NH45NE 146 4653 5501 These indeterminate cropmarks have been recorded on oblique aerial photography (RCAHMSAP 2000) lying on level ground on the N bank of the Black Water, about 230m SE of Contin Mains, and are probably produced by previous courses of the Black Water. Information from RCAHMS (KMM) 16 July 2004

Asset/Event Number	198
Asset/Event Name	Fairburn House, Strathan
Type of Asset/Event	Estate Building (Period Unassigned), Policies (Post Medieval)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 21.16
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245272
Northing	852540
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272118/ Architecture Notes see NH45SE 21.00 [Asset 97/LB14031] Fairburn House (Archaeology Notes) for full list of related sites

Asset/Event Number	199

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Fairburn House, Estate Footbridge
Type of Asset/Event	Footbridge (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 21.18
HER Number	MHG48426
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245401
Northing	852476
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272120/ NH45SE 21.18 45401 52476 This footbridge apparently carries an estate track or path over the River Orrin. Information from RCAHMS (RJCM), 4 May 2005.

Asset/Event Number	200
Asset/Event Name	Fairburn House, Estate Burial Ground
Type of Asset/Event	Burial Ground (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 21.19
HER Number	MHG48428
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247318
Northing	851764
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272122/ NH45SE 21.19 47318 51764 Burial Ground [NAT] OS 1:10,000 map, 1992. NMRS Report: (04/05/2005) NH45SE 21.19 47318 51764 https://her.highland.gov.uk/monument/MHG48428 NMRS Report: (04/05/2005) NH45SE 21.19 47318 51764 Burial Ground [NAT] OS 1:10,000 map, 1992. <1>

Appendix 1: Gazetteer of Heritage Assets and Events

Visited during the Highland Kirkyards project, run by Highland Buildings Preservation Trust. Rural private burial ground in woods to the north of the River Orrin. There are only around ten burials in total. The gravestones all face east and are all uprights of various designs.

<2><3>

Sources/Archives (3)

<1> SHG24123 Dataset: RCAHMS. 02/2008. Annual update from Canmore. Digital. 272122.

<2> SHG25133 Collection/Project Archive: Robinson, B; Scott, M; Wright, A. 03/2010.

Highland Kirkyards: Ross and Cromarty. Highland Buildings Preservation Trust. 29/07/2010. Paper (Original).

<3> SHG25134 Image/Photograph(s): Highlands Buildings Preservation Trust. 2009. Photographs of Ross and Cromarty Kirkyards. Colour. . Digital.

Asset/Event Number	201
Asset/Event Name	Aultgowrie
Type of Asset/Event	Farmhouse (19Th Century), Farmstead (19Th Century)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 35.00
HER Number	MHG48429
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247685
Northing	851465
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272123/ Archaeology Notes NH45SE 35.00 47685 51465 NH45SE 35.01 NH 47495 51505 Bridge Cottage

Asset/Event Number	202
Asset/Event Name	Aultgowrie, Bridge Cottage
Type of Asset/Event	Cottage (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 35.01
HER Number	MHG48430
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247495
Northing	851505
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272124/ Archaeology Notes NH45SE 35.01 47495 51505
Asset/Event Number	203
Asset/Event Name	Aultgowrie Bridge
Type of Asset/Event	Road Bridge (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 36.00
HER Number	MHG48431
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247772
Northing	850933
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272125/ NH45SE 36 47772 50933 Aultgowrie Bridge [NAT] OS 1:10,000 map, 1992. Not to be confused with Aultgowrie, bridge over River Orrin (NH 47642 51570), for which see NH45SE 26 [Asset 100/LB14020]. This bridge carries an unclassified public road over the Allt Goibhre to the S of Aultgowrie Mill (NH45SE 25). Information from RCAHMS (RJCM), 4 May 2005.
Asset/Event Number	204
Asset/Event Name	Coul Of Fairburn Farm
Type of Asset/Event	Farmhouse (19Th Century), Farmstead (19Th Century)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 38.00
HER Number	MHG48412
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247609
Northing	853549

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272105/ No description.
	https://her.highland.gov.uk/Monument/MHG48412 No description.

Asset/Event Number	205
Asset/Event Name	Wester Balloan Cottage
Type of Asset/Event	Cottage (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 41.01
HER Number	MHG48435
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247409
Northing	853840
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/272129/ NH45SE 41.01 47409 53840
	https://her.highland.gov.uk/Monument/MHG48435 No description.

Asset/Event Number	206
Asset/Event Name	Langergill
Type of Asset/Event	Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15NE 80.00
HER Number	MHG49292
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318540
Northing	955010
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	Ruinous
Alignment:	ENE/WSW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remains of a ruinous rectangular stone structure c40m by 5m over walls, which stand up to 1.7m tall and 0.6m wide. These are composed of randomly coursed stone slabs and roughly squared stones, neatly capped with concrete. Window apertures and entrances have been infilled with concrete blocks. The ESE end appears likely to have been an older structure, and the entirety has been much modified for use as livestock pens. The 1st edition OS map shows a small farmstead comprising an L-shaped roofed building with an enclosure to the N, and with an annex extending SE from ENE end of the building. Although the building is shown as still roofed by the time of the 2nd edition OS map, this annex has disappeared and could not be identified during the walkover survey. There is no HER description for this asset. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907. https://canmore.org.uk/site/278271/ No description. https://her.hIGHLAND.gov.uk/Monument/MHG49292 No description.
Asset/Event Number	207
Asset/Event Name	Strath Sgitheach
Type of Asset/Event	Sheepfold(s) (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56SW 54.00
HER Number	MHG50763
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252657
Northing	863403
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A broadly L-shaped sheepfold measuring c70m by 50m and comprising several compartments, some of which are constructed with drystone walling which stands 1.5m tall and 0.7m wide, and appears to incorporate the remains of a building wall in the NW side where the remains of a fireplace can be seen, with other pens defined by post-and-wire fences and corrugated iron. A sheepfold is depicted on the 1st edition OS map with an adjacent building on the NW side. OS. 1875-6. Ross-shire & Cromartyshire (Mainland) LXXVI, Surveyed: 1875-6, Published: 1880. https://canmore.org.uk/site/288767/ No description. https://her.hIGHLAND.gov.uk/Monument/MHG50763 The Strath Sgitheach area was surveyed by Meryl Marshall in 2020. NGR adjusted based on 2009 aerial photographs. <2> Sources/Archives (1) <1> SHG24123 Dataset: RCAHMS. 02/2008. Annual update from Canmore. Digital. 288767.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	208
Asset/Event Name	Loch Achonachie
Type of Asset/Event	Farmstead (Period Unassigned), Head Dyke (Post Medieval), Road (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SW 9.00
HER Number	MHG54447
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242640
Northing	854870
Council	Highland
Condition:	Ruinous
Alignment:	ENE/WSW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular structure under dense bracken, measuring c19m by 6m over walls. Wall survives in good condition in ENE extent to c.0.5m tall and 0.5m wide. Elsewhere walls are collapsed, with stone tumble spread widely. Not depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII, Surveyed: 1876, Published: 1881. https://canmore.org.uk/site/304821/ Field Visit (22 March 2007 - 22 March 2007) Scotland's Rural Past (SRP) Farmstead and enclosure walls (NOSAS Site Survey Nos 211-212, 226, 232-234) at NH 42642 54876 within a shallow saddle on a broad N facing spur amid birch woodland. Improved ground lies to the NE under the route taken by the power lines. The site comprises a main building, a further possible building and a series of discontinuous earth and stone dykes. See plan. The ruined walls of a rectangular building (211) at NH 42642 54876 measuring 12m x 3.5m internally on a NE-SW axis and originally of two compartments. Stone walls stand to a maximum 0.5m high and 0.5m thick with evidence for entrances at intervals in the long axis. Some 70m NW are the remains of a small building (226) at NH 42577 54913 located in a shallow angular depression on a steep E facing slope. It measures 3m x 1.5m internally on a NW-SE axis and is scarped into the slope at the rear. Sections of stone and earth dyke which still stand up to 0.5m high in places may have once formed part of the head dyke for the settlement. The two principal sections are over 200m in length; (212/232) contours the slope and (233) runs downslope toward Loch Achonachie and has been bisected by the modern road. Below the modern road is a substantial earth bank 1m high with a spread of 2m bordering an overgrown track(234)on its S side which was traced for some 250m and may be a spur road accessing the farmstead and is not depicted on the 1st edition of the OS 6-inch map (Ross-shire 1881, sheet lxxxvii). Information from the North of Scotland Archaeological Society The site of the farmstead was visited during a walkover survey by Wardell and Armstrong in 2011 in advance of the proposed replacement Beaully-Mossford OHL project by SSE. Although it lay directly in the path of the new power line it was considered that the impact on the site would be negligible. <2> https://her.highland.gov.uk/Monument/MHG54447 [As above with the addition of the below] The site of the farmstead was visited during a walkover survey by Wardell and Armstrong in 2011 in advance of the proposed replacement Beaully-Mossford OHL project by SSE.

Appendix 1: Gazetteer of Heritage Assets and Events

Although it lay directly in the path of the new power line it was considered that the impact on the site would be negligible. <2>

Sources/Archives (2)

<1> SHG24094 Text/Report/Fieldwork Report: Marshall, M.. 2009. A Project to Identify, Survey and Record Archaeological Remains in Strathconon, Ross-shire: Report of Phase One Scatwell and Lower Strathconon. North of Scotland Archaeological Society. 23/01/2009. Digital. P.33 Sites 211-212, 226, 232-234.

<2> SHG25772 Text/Report/Fieldwork Report: Wardell Armstrong. 2012. Beaully Mossford 132kV Transmission Line Replacement Environmental Statement. Wardell Armstrong. Digital.

Asset/Event Number	209
Asset/Event Name	Loch Achonachie
Type of Asset/Event	Building (Period Unassigned), Distilling Site (Period Unassigned), Wall (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45NW 33.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241810
Northing	855080
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/305900/

Asset/Event Number	210
Asset/Event Name	Black Water
Type of Asset/Event	House (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45NW 35.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242522
Northing	859243
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/306290/

Appendix 1: Gazetteer of Heritage Assets and Events

Field Visit (2009)

The following features were recorded during a landscape management survey of the 18th-century military road network. [...]

NH 4248 5920 - Rogie - The remains of a longhouse with garden and at least one other building sitting in an extensive system of enclosure, presumably part of the dispersed settlement of Rogie (NH46SW 3). NH004

References

Shepherd, C. (2009z) 'Survey of the 18th-century Military Road Network - North Highlands, Highland (Contin / Fodderty parishes), landscape assessment', Discovery Excav Scot, New, vol. 10, 2009. Cathedral Communications Limited, Wiltshire, England. Page(s): 95

<https://her.highland.gov.uk/Monument/MHG54627>

In 2009 Forestry Commission Scotland commissioned C Shepherd to undertake a survey and assessment of those parts of the 18th century Military Road network crossing the National Forest Estate in Inverness, Ross & Skye, Lochaber and North Highland Forest Districts. During the survey of Contin, the remains of a longhouse with garden and at least one other building sitting in an extensive system of enclosure, presumably part of the dispersed settlement of Rogie (NH46SW 3), was recorded. <1>

Sources/Archives (1)

<1> SHG24589 Text/Report/Fieldwork Report: Shepherd, C.. 12/2009. The 18th Century Military Road Network on the Forestry Commission National Forest Estate in the Highlands: Inverness, Ross & Skye, Lochaber and North Highland Districts. Forestry Commission Scotland. . Paper and Digital. NH004. XY

Asset/Event Number	211
Asset/Event Name	Uaigh Bheag
Type of Asset/Event	Farm (Period Unassigned), Farmhouse (Period Unassigned), Farmstead (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293607
Northing	913859
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 211 for details. https://canmore.org.uk/site/307721/ Survey Stuart Farrell NC 938 148 (centred on) A desktop survey was undertaken for an area of proposed new woodland in August 2009. Work revealed the following unrecorded archaeological sites: NC 93607 13859 Farmstead [Asset 211] NC 93729 13950 Building NC 93542 13710 Building NC 9350 1380 Boundary marker

Appendix 1: Gazetteer of Heritage Assets and Events

NC 93987 14204 Building
NC 93562 14607 Sheepfold
NC 94172 14110 Sheepfold
NC 93414 14603 Farmstead
NC 93408 14545 Enclosure
NC 9363 1482 Building
NC 9388 1491 Building
NC 94175 15446 Field system

Report: HSMR and RCAHMS
Funder: UPM Tilhill

References

Farrell, S. (2009q) 'Glen Loth, Highland (Loth parish), survey', Discovery Excav Scot, New, vol. 10, 2009. Cathedral Communications Limited, Wiltshire, England. Page(s): 111

Asset/Event Number	212
Asset/Event Name	Uaigh Bheag
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 51.00; NC91SW 52.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293729
Northing	913950
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular enclosure c16m by 14m composed of a stone and turf dyke under dense tall bracken. Dyke stands 0.7m tall and spread 1.5m wide. Very obscured by bracken and adjacent to access track. Note that NC91SW 51.00 and NC91SW 52.00 appear to be duplicate records utilising an identical grid reference. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907. https://canmore.org.uk/site/307722/ Survey Stuart Farrell NC 938 148 (centred on) A desktop survey was undertaken for an area of proposed new woodland in August 2009. Work revealed the following unrecorded archaeological sites: NC 93607 13859 Farmstead NC 93729 13950 Building [Assets 212/213] NC 93542 13710 Building NC 9350 1380 Boundary marker NC 93987 14204 Building NC 93562 14607 Sheepfold NC 94172 14110 Sheepfold NC 93414 14603 Farmstead NC 93408 14545 Enclosure

Appendix 1: Gazetteer of Heritage Assets and Events



NC 9363 1482 Building
NC 9388 1491 Building
NC 94175 15446 Field system

Report: HSMR and RCAHMS
Funder: UPM Tilhill

References

Farrell, S. (2009q) 'Glen Loth, Highland (Loth parish), survey', Discovery Excav Scot, New, vol. 10, 2009. Cathedral Communications Limited, Wiltshire, England. Page(s): 111

Asset/Event Number	213
Asset/Event Name	Uaigh Bheag
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 52.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293729
Northing	913950
Council	Highland
Condition:	N/A
Alignment:	Unknown
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Building locale under dense bracken, possibly within or adjacent to enclosure Asset 212, not definitively identified on the ground. Very obscured by bracken and adjacent to access track. Note that NC91SW 51.00 and NC91SW 52.00 appear to be duplicate records utilising an identical grid reference. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907. https://canmore.org.uk/site/307723/ https://canmore.org.uk/site/307722/ Survey Stuart Farrell NC 938 148 (centred on) A desktop survey was undertaken for an area of proposed new woodland in August 2009. Work revealed the following unrecorded archaeological sites: NC 93607 13859 Farmstead NC 93729 13950 Building [Assets 212/213] NC 93542 13710 Building NC 9350 1380 Boundary marker NC 93987 14204 Building NC 93562 14607 Sheepfold NC 94172 14110 Sheepfold NC 93414 14603 Farmstead NC 93408 14545 Enclosure NC 9363 1482 Building NC 9388 1491 Building NC 94175 15446 Field system

Appendix 1: Gazetteer of Heritage Assets and Events

Report: HSMR and RCAHMS
Funder: UPM Tilhill

References
Farrell, S. (2009q) 'Glen Loth, Highland (Loth parish), survey', Discovery Excav Scot, New, vol. 10, 2009. Cathedral Communications Limited, Wiltshire, England. Page(s): 111

Asset/Event Number	214
Asset/Event Name	Uaigh Bheag
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293987
Northing	914204
Council	Highland
Condition:	Various
Alignment:	NE/SW
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 214 for details. https://canmore.org.uk/site/307725/ Survey Stuart Farrell NC 938 148 (centred on) A desktop survey was undertaken for an area of proposed new woodland in August 2009. Work revealed the following unrecorded archaeological sites: NC 93607 13859 Farmstead NC 93729 13950 Building NC 93542 13710 Building NC 9350 1380 Boundary marker NC 93987 14204 Building [Asset 214] NC 93562 14607 Sheepfold NC 94172 14110 Sheepfold NC 93414 14603 Farmstead NC 93408 14545 Enclosure NC 9363 1482 Building NC 9388 1491 Building NC 94175 15446 Field system Report: HSMR and RCAHMS Funder: UPM Tilhill

References
Farrell, S. (2009q) 'Glen Loth, Highland (Loth parish), survey', Discovery Excav Scot, New, vol. 10, 2009. Cathedral Communications Limited, Wiltshire, England. Page(s): 111

Asset/Event Number	215

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Houstry
Type of Asset/Event	Hut Circle(s) (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND13SW 52.00
HER Number	MHG13583
Status	Non-designated Heritage Asset
Section:	N/A
Easting	314864
Northing	934910
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/307710/ Ground Survey (July 2009) Survey Stuart Farrell ND 164 339 (centred on) A desktop and walkover survey were undertaken for an area of proposed new forestry in July 2009. Work revealed a number of unrecorded archaeological sites including: ND 14890 34914 Hut circle – Houstry [Asset 215] ND 14837 34906 Hut circle – Houstry [Asset 215] ND 1677 3387 Buildings ND 16718 33606 Building ND 16974 33947 Building ND 16963 33669 Farmstead ND 17077 33972 Building with enclosure ND 17001 33315 Building ND 17143 33584 Building ND 16781 34008 Building ND 1716 3316 Farmstead – Upper Smerral ND 16037 34689 Building – Newlands of Houstry Report: HSMR and RCAHMS Funder: UPM Tilhill
Asset/Event Number	216
Asset/Event Name	Newlands Of Houstry
Type of Asset/Event	Building(s) (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND13SE 153.00
HER Number	n/a
Status	Non-designated Heritage Asset
Section:	N/A
Easting	316037
Northing	934689
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/307720/ Ground Survey (July 2009) Survey Stuart Farrell ND 164 339 (centred on) A desktop and walkover survey were undertaken for an area of proposed new forestry in July 2009. Work revealed a number of unrecorded archaeological sites including: ND 14890 34914 Hut circle – Houstry ND 14837 34906 Hut circle – Houstry ND 1677 3387 Buildings ND 16718 33606 Building ND 16974 33947 Building ND 16963 33669 Farmstead ND 17077 33972 Building with enclosure ND 17001 33315 Building ND 17143 33584 Building ND 16781 34008 Building ND 1716 3316 Farmstead – Upper Smerral ND 16037 34689 Building – Newlands of Houstry [Asset 216] Report: HSMR and RCAHMS Funder: UPM Tilhill
Asset/Event Number	217
Asset/Event Name	Garrimatic
Type of Asset/Event	Building (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45NW 40.00
HER Number	MHG39287
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241420
Northing	855400
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/308492/ Field Visit (19 May 2007 - 19 May 2007) Scotland's Rural Past (SRP) A ruined building and dam [Asset X] (NOSAS site survey numbers 274 & 275) are located on a N facing slope on the S side of the River Conon above the road, among birch woods centred on NH 4142 5540. A small settlement [Asset 217] comprising at least three roofed buildings is depicted on the 1st edition OS map (Ross-shire 1881, sheet lxxxvii) and 3 households are recorded in the census records between 1841 and 1881. The remains of the recorded building (274) are located to the SE of the principal building of

the modern settlement. The dam and pond (275) are fed by the Allt na Talchainn which borders the E side of the settlement.

Further details of these and other associated sites can be found in the Strathconon Phase 1 Report (page 41) produced by the North of Scotland Archaeology Society and appended to this record.

Asset/Event Number	218
Asset/Event Name	Orrin Portal Valve
Type of Asset/Event	Valve House (Period Unassigned)
Date and/or Period	Modern
Listing No./NRHE Number	NH45SW 14.00
HER Number	MHG58728
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243591
Northing	854211
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/312899/ Field Visit (2010) The Hydro-Electric Digitisation Project This valve house contains the large butterfly valve which allows for the isolation of the penstock carrying water out of the tunnel from Orrin Dam and down to Orrin Power Station. This valve house echoes the functional style of the powerhouses on the Conon scheme and exhibits a similarly restrained use of architectural detailing, predominantly limited to some plain detailing to the door surround. In line with the wishes of James Shearer the buildings is constructed from local stone some of which may have been reclaimed from the excavation of the tunnel through to Orrin Dam as was the case with other underground structures such as Deanie and Cuilligran Power Stations (see separate items on Affric scheme). PL Payne, 1988, 5; E Wood, 2002, 38; J Miller, 2002. Note (25 October 2023) The Conon scheme This project involves three separate stages: the Fannich scheme, the Glascarnoch-Luichart-Torr Achilty scheme and the Orrin scheme. The first of these involved tunnels and aqueducts to increase the flow into Loch Fannich, and a tunnel from the bed of Loch Fannich to the Grudie Bridge power station at the west end of Loch Luichart. This involved a severe problem at the Loch Fannich end. Work began in 1946 and a dam was built later, completing the section in 1951. Work began on the second stage in 1951., producing two artificial lochs Vaich and Glascarnoch by damming the respective rivers, using the earth and rockfill method. Tunnels were excavated between these lochs and from Loch Glascarnoch to Mossford power station on Loch Luichart. A dam at the east end of Loch Achanalt allows loch to supply the Achanalt power station near Grudie Bridge. Two artificial lochs Meig and Achonachie were produced by dams on the rivers Meig and Conon to supply power stations at Luichart and Torr Achilty respectively. Work on this section was completed in 1957. The Orrin scheme was started in 1955 and involved the building of a mass gravity dam 1000 feet long and an earth embankment also 1000 feet in length to seal off a branch valley, thus forming the Orrin Reservoir. The outflow is through a concrete -lined tunnel to a steel

Appendix 1: Gazetteer of Heritage Assets and Events

pipeline supplying the Orrin power station at Loch Achonachie. Four Borland fish lifts had been installed at Luichart, Meig, Achanalt and Torr Achilty. The scheme was completed in 1961, the six power stations producing an output well over 100,000 kW. Information from NRHE catalogue record WP007424, compiled by George Walker, 2005.

References

Miller, J. (2002) The dam builders: power from the glens. Edinburgh. RCAHMS Shelf Number: J.5.14.MIL

Payne, P L. (1988) The hydro: a study of the development of the major hydro-electric schemes undertaken by the North of Scotland Hydro-Electric Board. Aberdeen. RCAHMS Shelf Number: J.5.14.PAY

Wood, E. (2002) The Hydro Boys.

Asset/Event Number	219
Asset/Event Name	Orrin Portal Valve, Air Shaft
Type of Asset/Event	Air Shaft (Period Unassigned)
Date and/or Period	Modern
Listing No./NRHE Number	NH45SW 14.01
HER Number	MHG58729
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243579
Northing	853963
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/312900/ Note (25 October 2023) The Conon scheme This project involves three separate stages: the Fannich scheme, the Glascarnoch-Luichart-Torr Achilty scheme and the Orrin scheme. The first of these involved tunnels and aqueducts to increase the flow into Loch Fannich, and a tunnel from the bed of Loch Fannich to the Grudie Bridge power station at the west end of Loch Luichart. This involved a severe problem at the Loch Fannich end. Work began in 1946 and a dam was built later, completing the section in 1951. Work began on the second stage in 1951., producing two artificial lochs Vaich and Glascarnoch by damming the respective rivers, using the earth and rockfill method. Tunnels were excavated between these lochs and from Loch Glascarnoch to Mossford power station on Loch Luichart. A dam at the east end of Loch Achanalt allows loch to supply the Achanalt power station near Grudie Bridge. Two artificial lochs Meig and Achonachie were produced by dams on the rivers Meig and Conon to supply power stations at Luichart and Torr Achilty respectively. Work on this section was completed in 1957. The Orrin scheme was started in 1955 and involved the building of a mass gravity dam 1000 feet long and an earth embankment also 1000 feet in length to seal off a branch valley, thus forming the Orrin Reservoir. The outflow is through a concrete -lined tunnel to a steel pipeline supplying the Orrin power station at Loch Achonachie. Four Borland fish lifts had been installed at Luichart, Meig, Achanalt and Torr Achilty. The scheme was completed in 1961, the six power stations producing an output well over 100,000 kW. Information from NRHE catalogue record WP007424, compiled by George Walker, 2005.

Appendix 1: Gazetteer of Heritage Assets and Events

References

Payne, P L. (1988) The hydro: a study of the development of the major hydro-electric schemes undertaken by the North of Scotland Hydro-Electric Board. Aberdeen. RCAHMS Shelf Number: J.5.14.PAY

Asset/Event Number	220
Asset/Event Name	Orrin Power Station
Type of Asset/Event	Hydroelectric Power Station (Modern)
Date and/or Period	Modern
Listing No./NRHE Number	NH45SW 15.00
HER Number	MHG58730
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243603
Northing	854571
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/312902/ Field Visit (2010) The Hydro-Electric Digitisation Project

Orrin power station receives water via tunnel and pipe from Orrin dam some 5KM to the South East. The station houses a single 18MW turbine. It is located on a steeply sloping site, the turbine hall oversails the tailrace and is built into the hillside with a single storey section to the rear adjacent to a large transformer station connecting the station to the grid. This is a good example of a smaller power station forming a component of a larger scheme. The design of the station is characteristic of this period with large windows to the turbine hall and relatively limited architectural detailing. The site is narrow and steeply sloping which has resulted in some changes from the characteristic design features. The turbine hall is very tall and narrow and has a shallow pitched roof with a recessed ashlar panel and small windows to the centre of the gable end over a large teak vehicular access door. The advanced flat roofed block built into the hillside to the rear of the turbine hall has a panel of ashlar with relief carving of the name of the station. PL Payne, 1988, 5; E Wood, 2002, 38; J Miller, 2002.

Asset/Event Number	221
Asset/Event Name	Loch Achonachie
Type of Asset/Event	Enclosure (Period Unassigned), Farmstead (Period Unassigned), Milestone (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45NW 37.00
HER Number	MHG39288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242300

Appendix 1: Gazetteer of Heritage Assets and Events

Northings	855240
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/308440/ Enclosure (Period Unassigned), Farmstead (Period Unassigned), Milestone (Period Unassigned), Township (Period Unassigned) Field Visit (15 March 2007 - 24 March 2007) Scotland's Rural Past (SRP) The former township of Drumandarach, farmstead buildings, enclosures, dykes, associated features and a milestone (NOSAS site survey numbers 170 -196 & 235-238) are located on the S side of the River Conon. The site extends across an area some 400m x 120m along an E facing ridge. The majority of the features included within the site record are contained within a large enclosure (170) that is shown on 1st edition of the OS 6-inch map (Ross-shire 1881, sheet lxxxvii) as is the remains of a farmstead (172 & 173) that is located outside and to the W of the enclosure. The S side of the site is bounded by a small stream and a rising craggy slope. The enclosure is grassy with some bracken and there is much evidence of recent sheep management. Birch woods and heather surround the settlement and a major power line traverses the site. The site comprises the remains of at least five buildings, a possible kiln, and there several clearance cairns which may conceal traces of earlier buildings. Further details of these and other associated sites can be found in the Strathconon Phase 1 Report (pages 38 - 40) produced by the North of Scotland Archaeology Society and appended to this record.
Asset/Event Number	222
Asset/Event Name	Loch An Uird
Type of Asset/Event	Track
Date and/or Period	Post-medieval; Modern
Listing No./NRHE Number	NH44SE 94.00
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.3
Easting	246539
Northings	842941
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A track, bare earth in some places and grass in others, measuring c2m wide. Some segments of which appear consistent with tracks shown on the 1st and 2nd edition OS maps. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876. OS. 1906. Inverness-shire (Mainland) X, Surveyed: 1902, Published: 1906. https://canmore.org.uk/site/377270/

Appendix 1: Gazetteer of Heritage Assets and Events

Field Visit (9 May 2023)

NH 4645 4305 (centred) A desktop and walkover survey was conducted in May 2023 for an area of proposed woodland of 16 hectares, the area encompassing a number of recorded sites. Work revealed an unrecorded trackway.

Information from Stuart Farrell.

Asset/Event Number	223
Asset/Event Name	Lower Caen
Type of Asset/Event	Township (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND01NW 117.00
HER Number	n/a
Status	Non-designated Heritage Asset
Section:	N/A
Easting	301359
Northing	917834
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/348637/ Excavation (8 June 2013 - 23 June 2013) ND 01359 17834 A community excavation, planned to commemorate the bicentenary of the Kildonan Clearances, was undertaken 8–23 June 2013. The deserted township of Caen is located in the Strath of Kildonan, c2 miles upstream from the village of Helmsdale. Lower Caen is located on a river terrace above the Caen Burn. It is distinct from Upper Caen, which comprises a collection of ruins that extend N, up Caen Burn. A programme of topographical mapping and geophysical survey was carried out. As the structural remains were clearly visible the fluxgate gradiometer survey aimed to identify the location of hearths, middens and other possible internal features. Unfortunately, the underlying granite masked not only more subtle responses but even that from a large corn-drying kiln. As a result it was only possible to identify features already visible, such as extant walls and 'potato' pits. Meanwhile, topographic information was shared with a team from the University of St Andrews 'Virtual Worlds' group in order to develop an immersive 'Virtual Caen' (now available at: http://openvirtualworlds.org/unity-static/web-Timespan/web-Timespan.html). The first season of excavations at Lower Caen focused upon the final phase of occupation and subsequent abandonment of a single longhouse (Structure 1) and its associated outbuilding (Structure 2). Two L-shaped trenches were laid out to provide a half-section across both structures along the N–S (Trench B) and E–W (Trench A) axes. The removal of turf exposed rubble spreads across Structure 1 and across the E half of Structure 2. At the W end of Structure 2, removal of the turf exposed a compressed earth surface. Removal of the rubble across Structure 1 (the longhouse) exposed a high quality cobbled surface in the S end of the longhouse (upslope and upwind). This surface was constructed of rounded river pebbles and had been finished with a concreted lime treatment. At the N end of Trench A (within Structure 1) the end of a sub-rectangular void was found in this flooring, and was interpreted as potentially representing the laying of the flooring around a large rectangular item of furniture – such as a box-bed or similar. We

recovered a significant number of sherds of post-medieval glazed wares (18th- and early 19th-century in date, predominantly local wares but including some English wares) lying directly on top of this floor surface. This included one low profile bowl which had clearly shattered in situ with a complete half of the vessel recovered (the other half appears to lie under the baulk). In addition to the ceramics a considerable number of fragments of glass, iron objects (all badly corroded) and two fragments of leather were recovered.

Near the centre of Structure 1, at the S end of Trench B, a hearth was uncovered. Lying within a beaten earth floor, the hearth was made up of flat stones with a shallow depression at its centre. No accompanying features were identified, the central baulk ran immediately to the W and S of the hearth.

A single doorway was identified in the E-facing wall of the longhouse, with an accompanying internal and external area of rough paving. No threshold stone was present, although remains of a timber beam running across the entry at floor level were recovered from sockets on either side of the doorway, along with a substantial iron bolt and badly corroded iron object which may have been a door hinge. The stone-footing of an internal dividing wall was identified at the N of the internal paved area, along with a fragmented iron cauldron that had been deliberately incorporated into the paving during its construction.

The final northern third of Structure 1 represented the byre end of the longhouse, with an uneven and sloping surface of exposed natural. No drain was identified within this surface, although it is possible that it lay off-centre in the unexcavated W half of the structure.

In the space to the E of Structure 1, between the eastern flank of the longhouse and the gable end of two other (unexcavated) structures a metallated yard surface was exposed directly beneath the turf. Lying upon this, and butting against the E wall of Structure 1, we identified a stack of cut peat bricks.

The walls of Structure 1 consisted of a single skin of dry stone walling, using locally available and unfinished granite. The quality of construction was notably higher in the southern 'domestic' end of the building.

The excavations in Structure 2 revealed a very different structure. Here, removal of the rubble collapse spread revealed an uneven beaten earth floor across the interior of the structure. The construction of the walls varied significantly from E to W. The E gable end of the structure (separated from Structure 1 by a gap of c0.5m) was constructed of substantial dry stone walling, very similar in construction to that of Structure 1. However, the W wall was completely different in form, consisting of banked turf and rubble butting between two large granite boulders at the NW and SW corners of the structure. Meanwhile the N and S walls were thick double skinned turf and stone constructions.

Although removal of the collapse material produced finds including ceramic sherds, iron objects and sherds of glass, the density of finds from Structure 2 was far lower than in Structure 1. However, in the E end of the structure, the removal of the rubble collapse material revealed the presence of five fragments of riveted copper sheeting, almost certainly representing a fragmented copper pot-still, of the type used in 18th-century whisky distillation across the Highlands.

Archive: Timespan Museum (Helmsdale). Report: Highland HER and RCAHMS

References

Strickland, K. (2014) Kildonan, Lower Caen, Excavation, Discovery Excav Scot, New, vol. 14, 2013. Cathedral Communications Limited, Wiltshire, England. Page(s): 106-107

Asset/Event Number	224
Asset/Event Name	Strath Sgitheach Allt Na Criche 1

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Cup Marked Rock (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 65.00
HER Number	MHG8926
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252223
Northing	862909
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/368635/ Note (7 August 2018) Scotland's Rock Art Project Date Fieldwork Started: 07/08/2018 Compiled by: NOSAS

Location Notes: The panel lies on the lower slopes of Cioch Mhor to the N and overlooking the Abhainn Sgitheach to the S and views to the Cromarty Firth to the S. This cup marked rock is an outcrop and one of several scattered around a small knoll with the remains of a dry river bed to the NE. The river bed may have been part of the Allt an Criche which still flows to the NE. The knoll is to the NE of a much braided track from the Sgitheach in the SE to Cioch and Mhor and Ben Wyvis to the NW.

There are a group of cup marked rocks and outcrops around the knoll, the majority to the N and W of the Scots pines. Strath Sgitheach has many prehistoric monuments, hut circles, chambered cairns and more groups of rock art. There are also signs of continuous cultivation into recent times with rig and furrow near the knoll. The area is presently rough grazing used by a few sheep and deer and it is likely that there is some game shooting. The knoll has a scatter of very old Scots pines and is partly grass and heather with some bracken around the outcrop.

Panel Notes: The panel is an outcrop measuring 3.10m E-W by 2.10m and up to 0.70m high, sloping to the SE. There are 18 cupmarks scattered across the upper surface of the outcrop, mainly on the N section with a single cupmark on the SE edge.

<https://her.highland.gov.uk/Monument/MHG8926>
NH56SW 13 522 630.

Centred around NH 522630 are 8 cup marked rocks ('A' - 'H').

'A' is a boulder measuring 3.1m x 1.9m x 0.6 m high with at least fifteen shallow cup marks on its upper surface. NH 5220 6292 [possibly Asset 224]

'B' a large block 3.6m x 1.8m x 1m maximum height. It is largely earth-covered. It has 23 cup marks on its two outer edges. NH 5213 6298

'C' a boulder 1.8m x 1.2m x 0.6m high with six cup marks. NH 5212 6297

'D' boulder 2.4m x 1m x 0.6m high with 7 small shallow cup marks. NH 5126 6296

'E' small boulder 1.1m x 0.7m x 0.3m high with 2 probable cup marks. NH 5201 6298

'F' a boulder lying close by has 7 shallow cup marks upon it. NH 5201 6301

'G', a boulder, 2.8m x 1.5m x 0.6m, lying on bank of a stream, has probably slipped from its original position due to erosion. It has 6 extremely shallow cup marks on its upper surface. NH 6196 6324

'H' is a slab 2.2m x 1.3m lying flush with ground; it has 3 probable cup marks on its surface. NH 5247 6295

Surveyed at 1:10 000. Visited by OS (J B) 16 November 1976

8 outcrops of rock with shallow cup-marks.

RCAHMS 1979, visited September 1978

This panel was recorded as part of the ScRAP (Scotland's Rock Art project) by members of NoSAS in August 2018. The panel lies on the lower slopes of Cioch Mhor to the north and overlooking the Abhainn Sgitheach to the south and views to the Cromarty Firth to the south. This cup marked rock is an outcrop and one of several scattered around a small knoll with the remains of a dry river bed to the northeast. The river bed may have been part of the Allt an Criche which still flows to the northeast. The knoll is to the northeast of a much braided track from the Sgitheach in the southeast to Cioch and Mhor and Ben Wyvis to the northwest. There are a group of cup marked rocks and outcrops around the knoll, the majority to the north and west of the Scots pines. Strath Sgitheach has many prehistoric monuments, hut circles, chambered cairns and more groups of rock art. There are also signs of continuous cultivation into recent times with rig and furrow near the knoll. The area is presently rough grazing used by a few sheep and deer and it is likely that there is some game shooting. The knoll has a scatter of very old Scots pines and is partly grass and heather with some bracken around the outcrop.

The panel is an outcrop measuring 3.10m east-west by 2.10m and up to 0.70m high, sloping to the southeast. There are 18 cupmarks scattered across the upper surface of the outcrop, mainly on the north section with a single cupmark on the southeast edge. <1>

Sources/Archives (3)

--- SHG2670 Text/Report: RCAHMS. 1979. The Royal Commission on the Ancient and Historical Monuments of Scotland. The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region. . 18, No. 133.

<1> SHG28055 Interactive Resource/Online Database: Historic Environment Scotland. 2017-. Scotland's Rock Art (ScRAP). ScRAP ID 3319.

<2> SHG29107 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2021. Getmapping aerial photography 2021. XY

Asset/Event Number	225
Asset/Event Name	Strath Sgitheach Allt Na Criche 3
Type of Asset/Event	Cup Marked Rock (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 66.00
HER Number	MHG63161
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252123
Northing	862974
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/368636/ Note (8 July 2018) Scotland's Rock Art Project Date Fieldwork Started: 08/07/2018 Compiled by: NOSAS Location Notes: This panel is recorded on Canmore 12923 as panel C.

The panel is located on the lower S facing open slopes of Meall a'Ghuail, overlooking the river Sgitheach. It is one of a group of 8 panels (7 located at the time of writing) close to the

Allt an Criche, in rough gazing interspersed with pine trees and patches of heath. A track crosses the river Sgitheach (ford and stepping stones) and heads NW and passes 60m W of the panel. Panel 2 (B in Canmore) is 5m to the E and is part of the same rock outcrop. There is a large broken down pine tree 7m E of the panel. Rigg is visible in the ground immediately S of the panel. The area generally has a number of hut circles, field systems and burnt mounds, including those identified in Canmore 12921 about 0.6km to the SW.

Panel Notes: The panel is a low domed roughly triangular outcrop of schist, about 2.1m by 1.5m rising to about 0.6m in height. The carved surface is on a slightly sloping (10 degrees W) flatter section in the NW part of the panel. There are 5 distinct and 3 indistinct cups in a group.

<https://her.hIGHLAND.gov.uk/Monument/MHG63161>
NH56SW 13 522 630.

Centred around NH 522630 are 8 cup marked rocks ('A' - 'H').

'A' is a boulder measuring 3.1m x 1.9m x 0.6 m high with at least fifteen shallow cup marks on its upper surface. NH 5220 6292

'B' a large block 3.6m x 1.8m x 1m maximum height. It is largely earth-covered. It has 23 cup marks on its two outer edges. NH 5213 6298

'C' a boulder 1.8m x 1.2m x 0.6m high with six cup marks. NH 5212 6297

'D' boulder 2.4m x 1m x 0.6m high with 7 small shallow cup marks. NH 5126 6296

'E' small boulder 1.1m x 0.7m x 0.3m high with 2 probable cup marks. NH 5201 6298

'F' a boulder lying close by has 7 shallow cup marks upon it. NH 5201 6301

'G', a boulder, 2.8m x 1.5m x 0.6m, lying on bank of a stream, has probably slipped from its original position due to erosion. It has 6 extremely shallow cup marks on its upper surface. NH 6196 6324

'H' is a slab 2.2m x 1.3m lying flush with ground; it has 3 probable cup marks on its surface. NH 5247 6295

Surveyed at 1:10 000. Visited by OS (J B) 16 November 1976

8 outcrops of rock with shallow cup-marks.

RCAHMS 1979, visited September 1978

This panel was recorded as part of the ScRAP (Scotland's Rock Art project) by members of NoSAS in July 2018. This panel is recorded on Canmore 12923 as panel C. The panel is located on the lower south facing open slopes of Meall a'Ghuail, overlooking the river Sgitheach. It is one of a group of 8 panels (7 located at the time of writing) close to the Allt an Criche, in rough gazing interspersed with pine trees and patches of heath. A track crosses the river Sgitheach (ford and stepping stones) and heads NW and passes 60m west of the panel. Panel 2 (B in Canmore) is 5m to the east and is part of the same rock outcrop. There is a large broken down pine tree 7m E of the panel. Rigg is visible in the ground immediately south of the panel. The area generally has a number of hut circles, field systems and burnt mounds, including those identified in Canmore 12921 about 0.6km to the southwest.

The panel is a low domed roughly triangular outcrop of schist, about 2.1m by 1.5m rising to about 0.6m in height. The carved surface is on a slightly sloping (10 degrees west) flatter section in the northwest part of the panel. There are 5 distinct and 3 indistinct cups in a group. <1>

NGR adjusted based on 2021 vertical aerial photographs. <2>

Sources/Archives (3)

--- SHG2670 Text/Report: RCAHMS. 1979. The Royal Commission on the Ancient and Historical Monuments of Scotland. The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region. . 18, No. 133.

<1> SHG28055 Interactive Resource/Online Database: Historic Environment Scotland. 2017-. Scotland's Rock Art (ScRAP). ScRAP ID 3006.

<2> SHG29107 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2021. Getmapping aerial photography 2021. XY

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	226
Asset/Event Name	Strath Sgitheach Allt Na Criche 8
Type of Asset/Event	Cup Marked Rock (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 70.00
HER Number	MHG63187
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252483
Northing	862943
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/368640/ Note (7 August 2018) Scotland's Rock Art Project Date Fieldwork Started: 07/08/2018 Compiled by: NOSAS Location Notes: The panel located in a low-lying flat area of rough grazing, generally in the bottom of Strath Sgitheach. The Allt an Criche passes about 15m to the W. A vehicle track (not marked on the OS 1:25k map) crosses the Allt an Criche at a ford which is filled with large boulders. The panel is almost completely overgrown and located about 20m S of the ford. Panel Notes: The panel is a large flat slab of schist. The overall size and shape is uncertain, the edges were not exposed. There are 3 shallow cups together and a further (unlikely) indentation about 1m away. https://her.highland.gov.uk/Monument/MHG63187 NH56SW 13 522 630. Centred around NH 522630 are 8 cup marked rocks ('A' - 'H'). 'A' is a boulder measuring 3.1m x 1.9m x 0.6 m high with at least fifteen shallow cup marks on its upper surface. NH 5220 6292 'B' a large block 3.6m x 1.8m x 1m maximum height. It is largely earth-covered. It has 23 cup marks on its two outer edges. NH 5213 6298 'C' a boulder 1.8m x 1.2m x 0.6m high with six cup marks. NH 5212 6297 'D' boulder 2.4m x 1m x 0.6m high with 7 small shallow cup marks. NH 5126 6296 'E' small boulder 1.1m x 0.7m x 0.3m high with 2 probable cup marks. NH 5201 6298 'F' a boulder lying close by has 7 shallow cup marks upon it. NH 5201 6301 'G', a boulder, 2.8m x 1.5m x 0.6m, lying on bank of a stream, has probably slipped from its original position due to erosion. It has 6 extremely shallow cup marks on its upper surface. NH 6196 6324 'H' is a slab 2.2m x 1.3m lying flush with ground; it has 3 probable cup marks on its surface. NH 5247 6295 Surveyed at 1:10 000. Visited by OS (J B) 16 November 1976 8 outcrops of rock with shallow cup-marks. RCAHMS 1979, visited September 1978 This panel was recorded as part of the ScRAP (Scotland's Rock Art project) by members of NoSAS in August 2018. The panel located in a low-lying flat area of rough grazing, generally in the bottom of Strath Sgitheach. The Allt an Criche passes about 15m to the west. A vehicle track (not marked on the OS 1:25k map) crosses the Allt an Criche at a ford which is filled with large boulders. The panel is almost completely overgrown and located about 20m

Appendix 1: Gazetteer of Heritage Assets and Events



south of the ford.

The panel is a large flat slab of schist. The overall size and shape is uncertain, the edges were not exposed. There are 3 shallow cups together and a further (unlikely) indentation about 1m away. <1>

Note: Site not visible on aerial photographs so location based on grid coordinates. (T. Blackie 18/03/24)

Sources/Archives (2)

--- SHG2670 Text/Report: RCAHMS. 1979. The Royal Commission on the Ancient and Historical Monuments of Scotland. The archaeological sites and monuments of Easter Ross, Ross and Cromarty District, Highland Region. . 18, No. 133.

<1> SHG28055 Interactive Resource/Online Database: Historic Environment Scotland. 2017-. Scotland's Rock Art (ScRAP). ScRAP ID 3023. XY

Asset/Event Number	227
Asset/Event Name	Cup-marked stone, Strath Sgitheach Cnoc A' Mhuilinn 4
Type of Asset/Event	Cup Marked Stone (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 79.00
HER Number	MHG14146; MHG8928
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251456
Northing	862474
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A cup-marked stone measuring 1m by 1m and standing 0.6m tall. Appears as a free standing boulder with some moss growing atop it. Bears 5 cup marks on the N edge, looking uphill, but the stone commands good views along the strath to the S and SE. https://canmore.org.uk/site/368649/ Field Visit (13 September 1973) Ordnance Survey Archaeology Division Revision Programme Within the settlement [NH56SW 11] and centred at NH 5150 6255 are six cup marked rocks (marked 1 - 6 on 6" plan) 1: Has 1 good cup mark and 2 possible cup marks. [see NH56SW 73] 2: Has 2 good cup marks and 2 possible cup marks. [see NH56SW 77] 3: At least 6 cup marks, but there is the slight possibility that they could be due to weathering. [see NH56SW 78] 4: Has 14 good cup marks. [see NH56SW 79] 5: Has 8 good cup marks. [see NH56SW 80] 6: Has 4 good, and 1 probable, cup marks. [see NH56SW 81] Surveyed at 1:10560. Visited by OS (I S S) 13 September 1973. Field Visit (September 1978)

Appendix 1: Gazetteer of Heritage Assets and Events



RCAHMS: The Archaeological Sites and Monuments of Easter Ross

Strath Sgitheach 1 NH 515 625 NH56SW 11

This group of six cup-marked boulders stands within an area of unenclosed settlement [see NH56SW 11].

RCAHMS 1979, visited September 1978

Note (29 March 2019) Scotland's Rock Art Project

[Formerly recorded under NH56SW 11, discovered by OS (ISS) 1973]

Date Fieldwork Started: 29/03/2019

Compiled by: NOSAS

Location Notes: The site lies within a conifer and deciduous plantation planted about 20 years ago on the S facing slope of Cioch Mhor overlooking Strath Sgitheach and the Cromarty Firth. The area immediately around the panel has been planted with deciduous trees just S (20m) of a block of conifer trees. There is an open area to the S and E and a high (1m) bank to the W. To the N of the plantation there is a Scheduled Monument (SM 10495 Strath Sgitheach, Settlement), NW of Cnoc A'Mhuilinn. The SM includes a number of cup marked panels and hut circles and field systems. The site is recorded on the HER along with the other rock art and hut circles in the area as MHG 8928.

Panel Notes: The panel was covered with moss which was replaced after recording the panel. This is a free standing boulder 1.2m by 1m and 0.4m high located immediately beside an alder tree. The panel has a N facing slope of 25 degrees and is schist with some natural hollows. There are 14 cup marks scattered across the upper face of the boulder with the S-most and NW-most cups on the edge of the top of the boulder.

Asset/Event Number	228
Asset/Event Name	Cup-marked stone, Strath Sgitheach Cnoc A' Mhuilinn 5
Type of Asset/Event	Cup Marked Stone (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 80.00
HER Number	MHG14146; MHG8928
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251590
Northing	862591
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A cup-marked stone visible as a flattish slab surrounded by heather. Contains 4 visible cup marks aligned NW/SE that 'face' towards the prehistoric settlement areas to the NW, while the stone's location offers good views over the strath to the east. https://canmore.org.uk/site/368650/ Field Visit (13 September 1973) Ordnance Survey Archaeology Division Revision Programme Within the settlement [NH56SW 11] and centred at NH 5150 6255 are six cup marked rocks (marked 1 - 6 on 6" plan) 1: Has 1 good cup mark and 2 possible cup marks. [see NH56SW 73] 2: Has 2 good cup marks and 2 possible cup marks. [see NH56SW 77] 3: At least 6 cup marks, but there is the slight possibility that they could be due to weathering. [see NH56SW 78]

Appendix 1: Gazetteer of Heritage Assets and Events



- 4: Has 14 good cup marks. [see NH56SW 79]
5: Has 8 good cup marks. [see NH56SW 80]
6: Has 4 good, and 1 probable, cup marks. [see NH56SW 81]

Surveyed at 1:10560.
Visited by OS (I S S) 13 September 1973.

Field visit (September 1978)
RCAHMS: The Archaeological Sites and Monuments of Easter Ross
Strath Sgitheach 1 NH 515 625 NH56SW 11
This group of six cup-marked boulders stands within an area of unenclosed settlement [see NH56SW 11].
RCAHMS 1979, visited September 1978

Note (29 March 2019) Scotland's Rock Art Project
[Formerly recorded under NH56SW 11, first noted by OS (ISS) in 1973].
Date Fieldwork Started: 29/03/2019
Compiled by: NOSAS
Location Notes: The panel is located on a south facing slope at an altitude of 250m above and to the north of the shallow upland valley of Strath Sgitheach. In the immediate vicinity there is heathery moorland with some self seeded fir trees, but also close by there are discrete patches of forest plantation. Also nearby are some deeply ploughed furrows which have not been planted. There are good wide views to south and east.

Panel Notes: This flat slab has 7 definite cups and 1 possible cup. The panel is in an area of wet but not boggy ground, an area of poor drainage; the panel is being overwhelmed by heather and peat. The full extent of the panel was not explored because of this but it was believed that the full extent of the carved surface was identified.

Asset/Event Number	229
Asset/Event Name	Cup-marked stone, Strath Sgitheach Cnoc A' Mhuilinn 6
Type of Asset/Event	Cup Marked Stone (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 81.00
HER Number	MHG14146; MHG8928
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251649
Northing	862542
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A cup-marked stone measuring 1.5m by 1.5m and standing 0.5m tall, surrounded by bracken and partly overlaid by turf and moss. 2-3 cupmarks along the top of the panel. The stone overlooks the strath to the southeast. https://canmore.org.uk/site/368651/ Field Visit (13 September 1973) Ordnance Survey Archaeology Division Revision Programme Within the settlement [NH56SW 11] and centred at NH 5150 6255 are six cup marked rocks (marked 1 - 6 on 6" plan)

- 1: Has 1 good cup mark and 2 possible cup marks. [see NH56SW 73]
- 2: Has 2 good cup marks and 2 possible cup marks. [see NH56SW 77]
- 3: At least 6 cup marks, but there is the slight possibility that they could be due to weathering. [see NH56SW 78]
- 4: Has 14 good cup marks. [see NH56SW 79]
- 5: Has 8 good cup marks. [see NH56SW 80]
- 6: Has 4 good, and 1 probable, cup marks. [see NH56SW 81]

Surveyed at 1:10560.

Visited by OS (I S S) 13 September 1973.

Field Visit (September 1978) RCAHMS: The Archaeological Sites and Monuments of Easter Ross

Strath Sgitheach 1 NH 515 625 NH56SW 11

This group of six cup-marked boulders stands within an area of unenclosed settlement [see NH56SW 11].

RCAHMS 1979, visited September 1978

Note (29 March 2019) Scotland's Rock Art Project

[Formerly recorded under NH56SW 11, discovered by OS (ISS) 1973]

Date Fieldwork Started: 29/03/2019

Compiled by: NOSAS

Location Notes: The panel lies about 100m N of panel 7 and 100m SE of panel 5, on a slight ridge in generally SE sloping ground. It overlooks Strath Sgitheach, where the river runs W to E. To the NW the ground rises gently and then increasingly steeply to Cnoc Mhor (482m).

The immediate area is heather covered with self seeded trees and patches of ridged ground with planted trees.

Panel Notes: The panel is a 2.1m long ridge of schist, set E-W, with flat faces sloping to the N and S. The N face has no carvings. The S face has 6 cups, 3 of which are less distinct than the others.

Asset/Event Number	230
Asset/Event Name	Cup-marked stone, Strath Sgitheach Cnoc A' Mhuilinn 9
Type of Asset/Event	Cup Marked Stone (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 83.00
HER Number	MHG8928
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251310
Northing	862480
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Low
Description	*Observation by AOC Archaeology during 2024 walkover survey. This asset could not be identified within a stand of commercial forestry, possibly displaced due to forestry operations. https://canmore.org.uk/site/368653/ Note (29 March 2019) Scotland's Rock Art Project [Formerly recorded under NH56SW 11, discovered by Driscoll and Foster 1989]

Appendix 1: Gazetteer of Heritage Assets and Events

Date Fieldwork Started: 29/03/2019

Compiled by: NOSAS

Location Notes: This is cup-marked rock no. 9 in the record for Canmore 12921. The area has been visited and searched on two occasions and this particular panel has not been located. The area has been ploughed and forested and the ground under the trees is thickly carpeted with moss and pine needles.

Asset/Event Number	231
Asset/Event Name	Heights Of Fodderty (Duplicate) 1
Type of Asset/Event	Natural Feature (Period Unassigned)
Date and/or Period	N/A
Listing No./NRHE Number	NH56SW 56.00
HER Number	MHG58957
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251984
Northing	861042
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	*Recorded by AOC Archaeology during 2024 walkover survey. https://canmore.org.uk/site/350592/ Desk Based Assessment (6 May 2016) This cup-and-ring marked boulder, heavily-decorated on both sides, was found in a field of rough pasture (NH 5106 6071) in 2006 Highland Council HER (MHG 55106). It has since been moved to a new location - The Heights of Brae Neil Gunn Viewpoint. The boulder was Scheduled at its new location by Historic Environment Scotland in March 2016. Information from HES Survey and Recording (JRS) 6 May 2016.

Note (16 May 2019) Scotland's Rock Art Project

Date Fieldwork Started: 16/05/2019

Compiled by: NOSAS

Location Notes: This panel is displayed at the Neil Gunn Viewpoint, Heights of Brae. There is car parking and an interpretation board. It was moved there for safekeeping on 16 January 2014 from NH 5106 6071. It has previously been recorded as Clash Vaan ScRAP 1349 Canmore 351657 (at its old location), and HEIGHTS OF BRAE, NEIL GUNN VIEWPOINT ScRAP 2234 Canmore 350592 (at its new location). As there are three records of the same panel, two of the records have been reclassified as natural features.

Asset/Event Number	232
Asset/Event Name	Strath Sgitheach (East) Ss8
Type of Asset/Event	Roundhouse (Period Unknown)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 95.00
HER Number	MHG8925

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Non-designated Heritage Asset
Section:	N/A
Easting	252416
Northing	863233
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and grass with a diameter of c10m. Banks are spread up to 3m wide and stand 0.15m tall, with a possible entrance in the SE quarter. https://canmore.org.uk/site/369792/ Field Visit (May 2020 - June 2020) NH 524 633 (roughly centred) This group of 12 roundhouses in the upper part of Strath Sgitheach is NE of the track from the bridge/stepping stones. The roundhouses are on a SE-facing slope in heathery ground at an altitude of c250m and on both sides of a small burn. Just four roundhouses have been previously recorded although more than this are seen on snowy aerial photographs taken by Jim Bone in February 2010 (see JSB collection). They were surveyed in May and June 2020. The majority of the roundhouses are circular and have internal diameters of between 6m and 9m. The surrounding banks are up to 0.5m height and are often damaged or incomplete. One of the roundhouses, SS5, has more substantial remains which are 0.6m high and have a spread of 2m. Only a few of the roundhouses have evidence of entrances. NH 52545 63270 Roundhouse (SS1) NH 52569 63323 Roundhouse (SS2) NH 52533 63331 Roundhouse (SS3) NH 52473 63284 Roundhouse (SS4) NH 52418 63278 Roundhouse (SS5) (previously recorded as "B") NH 52396 63297 Roundhouse (SS6) (previously recorded as "D") NH 52385 63289 Roundhouse (SS7) (previously recorded as "C") NH 52416 63233 Roundhouse (SS8) NH 52303 63332 Roundhouse (SS12) (previously recorded as "A") NH 52107 63397 Roundhouse (SS14) NH 52297 63481. Roundhouse (SS15) NH 52458 63350 Roundhouse (SS17) Archive: Highland Council HER and NRHE Meryl Marshall – NOSAS (Source: DES Vol 21) References Marshall, M. (2021) Strath Sgitheach (East), Walkover survey and recording, in Jennifer Thoms, Discovery Excav Scot, New, vol. 21, 2020. Cathedral Communications Ltd, Wiltshire, England. Page(s): 67-68
Asset/Event Number	233
Asset/Event Name	Coul Woods
Type of Asset/Event	Cup And Ring Marked Stone (Neolithic) - (Bronze Age), Gate Post (19Th Century) - (20Th Cent
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH45NE 166.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	n/a
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247166
Northing	856282
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An ex-situ cup-marked stone, re-used at some point as a gate-post stone. The stone lies beside trees that form the beech avenue along the road. https://canmore.org.uk/site/368435/ Note (11 November 2019) Scotland's Rock Art Project Date Fieldwork Started: 11/11/2019 Compiled by: NOSAS Location Notes: The panel lies within the area now called Coul Woods but which would have originally formed part of an avenue of planted beech trees leading to Coul House. The trees are over 100 years old and appear on the 1st Edition Ordnance Survey map but may date from the building of Coul House in 1821 by the Mackenzies of Coul or the improvements to the house in 1860. The cup marked stone lies beside a beech tree at present but has been reused as a support for a metal post which may have formed a gate post or fence post dating from the time of the planting of the trees or slightly later. The metal post has been cut off near to the surface of the stone, although there is a second stone nearby with its metal post intact. Both stones are not even in their original fence line but lying roughly on the line of the trees. To the N there are more trees, beech and birch, recently planted (c.20-30 years old) on the edge of cultivated ground further to the N. To the S the cultivated ground slopes down to the confluence of the Black Water and the Conon River. There is another cup marked stone at Preas Mairi (ScRAP 403, Canmore 12447) to the W and there are chambered cairns, a henge and a crannog in the area. Panel Notes: The panel is a block of stone measuring 1.1m N-S by 0.7m and 0.3m high. It is roughly rectangular with no signs of being shaped, however it has been reused as a base for a gate post or fence post in the past. At the N end of the stone there is the bottom section of a square metal post secured with lead into the stone and a small drill hole to the S of the metal post. There are 2 cups with single rings at the N end of the stone with another 5 cups and a possible very small cup. A natural fissure crosses the stone E-W. The stone is covered with lichen
Asset/Event Number	234
Asset/Event Name	Clyne
Type of Asset/Event	Cup Marked Rock (Neolithic) - (Bronze Age)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC80NE 62.00
HER Number	MHG30343
Status	Non-designated Heritage Asset
Section:	N/A
Easting	286830
Northing	907706
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events

Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/368452/ Note (21 July 2019) Scotland's Rock Art Project Date Fieldwork Started: 21/07/2019 Compiled by: NOSAS Location Notes: The rock art panel is on a small outcrop in open heather and grassy moorland on a hillside terrace at about 210m above sea level, above and to the W of Loch Brora. The outcrop is about 130m NE of a ruined broch (MGH 10805 broch Killin) and 50m SW of a 19th century sheep fank. A small group of visible outcrops are scattered across an undulating area of moorland with this carved outcrop lying on a very slight rise. A small standing stone (MHG39347) lies about 50m to the NW. Three brochs and a crannog in Loch Brora can be seen from the outcrop. There are also a number of cairns on the lower ground and many hut circles in the area. Panel Notes: The panel is on an almost circular outcrop 2.8 x 2.8m and a maximum height of 0.6m. The outcrop has a flat top with a very slight slope to the W. The edges of the outcrop are covered with heather and the visible surface of the outcrop is completely covered with a variety of lichens and a little moss. There are 5 cup marks scattered over the surface in no particular obvious pattern. https://her.highland.gov.uk/Monument/MHG30343 This panel was recorded as part of the ScRAP (Scotland's Rock Art project) by members of NoSAS in July 2019. The rock art panel is on a small outcrop in open heather and grassy moorland on a hillside terrace at about 210m above sea level, above and to the west of Loch Brora. The outcrop is about 130m northeast of a ruined broch (MGH 10805 broch Killin [Asset 121]) and 50m southwest of a 19th century sheep fank. A small group of visible outcrops are scattered across an undulating area of moorland with this carved outcrop lying on a very slight rise. A small standing stone (MHG39347) lies about 50m to the northwest. Three brochs and a crannog in Loch Brora can be seen from the outcrop. There are also a number of cairns on the lower ground and many hut circles in the area. The panel is on an almost circular outcrop 2.8 x 2.8m and a maximum height of 0.6m. The outcrop has a flat top with a very slight slope to the west. The edges of the outcrop are covered with heather and the visible surface of the outcrop is completely covered with a variety of lichens and a little moss. There are 5 cup marks scattered over the surface in no particular obvious pattern. <1> NGR adjusted based on 2020 vertical aerial photographs. <2> Sources/Archives (2) <1> SHG28055 Interactive Resource/Online Database: Historic Environment Scotland. 2017-. Scotland's Rock Art (ScRAP). ScRAP ID 333. <2> SHG28725 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2020. Getmapping aerial photography 2020. XY
Asset/Event Number	235
Asset/Event Name	Strath Sgitheach (East) Ss2
Type of Asset/Event	Roundhouse (Period Unknown)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 89.00
HER Number	MHG62694

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	N/A
Easting	252569
Northing	863331
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and moss, measuring 11m by 8m over somewhat poorly defined banks which stand 0.2m tall and are spread up to 2.5m wide. Entrance not discernible. https://canmore.org.uk/site/369785/ Field Visit (May 2020 - June 2020) NH 524 633 (roughly centred) This group of 12 roundhouses in the upper part of Strath Sgitheach is NE of the track from the bridge/stepping stones. The roundhouses are on a SE-facing slope in heathery ground at an altitude of c250m and on both sides of a small burn. Just four roundhouses have been previously recorded although more than this are seen on snowy aerial photographs taken by Jim Bone in February 2010 (see JSB collection). They were surveyed in May and June 2020. The majority of the roundhouses are circular and have internal diameters of between 6m and 9m. The surrounding banks are up to 0.5m height and are often damaged or incomplete. One of the roundhouses, SS5, has more substantial remains which are 0.6m high and have a spread of 2m. Only a few of the roundhouses have evidence of entrances. NH 52545 63270 Roundhouse (SS1) NH 52569 63323 Roundhouse (SS2) [Asset 235] NH 52533 63331 Roundhouse (SS3) NH 52473 63284 Roundhouse (SS4) NH 52418 63278 Roundhouse (SS5) (previously recorded as "B") NH 52396 63297 Roundhouse (SS6) (previously recorded as "D") NH 52385 63289 Roundhouse (SS7) (previously recorded as "C") NH 52416 63233 Roundhouse (SS8) NH 52303 63332 Roundhouse (SS12) (previously recorded as "A") NH 52107 63397 Roundhouse (SS14) NH 52297 63481. Roundhouse (SS15) NH 52458 63350 Roundhouse (SS17) Archive: Highland Council HER and NRHE Meryl Marshall – NOSAS (Source: DES Vol 21) References Marshall, M. (2021) Strath Sgitheach (East), Walkover survey and recording, in Jennifer Thoms, Discovery Excav Scot, New, vol. 21, 2020. Cathedral Communications Ltd, Wiltshire, England. Page(s): 67-68
Asset/Event Number	236
Asset/Event Name	Strath Sgitheach (East) Ss3
Type of Asset/Event	Roundhouse (Period Unknown)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 90.00

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG62695
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252533
Northing	863331
Council	Highland
Condition:	Very degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under tall heather, measuring c10 in diameter over poorly defined banks that stand c 0.3m tall and spread up to 2m wide. No discernible entrance. https://canmore.org.uk/site/369786/ Field Visit (May 2020 - June 2020) NH 524 633 (roughly centred) This group of 12 roundhouses in the upper part of Strath Sgitheach is NE of the track from the bridge/stepping stones. The roundhouses are on a SE-facing slope in heathery ground at an altitude of c250m and on both sides of a small burn. Just four roundhouses have been previously recorded although more than this are seen on snowy aerial photographs taken by Jim Bone in February 2010 (see JSB collection). They were surveyed in May and June 2020. The majority of the roundhouses are circular and have internal diameters of between 6m and 9m. The surrounding banks are up to 0.5m height and are often damaged or incomplete. One of the roundhouses, SS5, has more substantial remains which are 0.6m high and have a spread of 2m. Only a few of the roundhouses have evidence of entrances. NH 52545 63270 Roundhouse (SS1) NH 52569 63323 Roundhouse (SS2) [Asset 235] NH 52533 63331 Roundhouse (SS3) [Asset 236] NH 52473 63284 Roundhouse (SS4) NH 52418 63278 Roundhouse (SS5) (previously recorded as "B") NH 52396 63297 Roundhouse (SS6) (previously recorded as "D") NH 52385 63289 Roundhouse (SS7) (previously recorded as "C") NH 52416 63233 Roundhouse (SS8) NH 52303 63332 Roundhouse (SS12) (previously recorded as "A") NH 52107 63397 Roundhouse (SS14) NH 52297 63481. Roundhouse (SS15) NH 52458 63350 Roundhouse (SS17) Archive: Highland Council HER and NRHE Meryl Marshall – NOSAS (Source: DES Vol 21) References Marshall, M. (2021) Strath Sgitheach (East), Walkover survey and recording, in Jennifer Thoms, Discovery Excav Scot, New, vol. 21, 2020. Cathedral Communications Ltd, Wiltshire, England. Page(s): 67-68
Asset/Event Number	237
Asset/Event Name	Dunrobin Glen
Type of Asset/Event	Dyke (Period Unassigned)
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 69.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	279348
Northing	904912
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/371095/ Desk Based Assessment (1 April 2014) An archaeological desk-based assessment and walkover survey was carried out on 1 April 2014 on behalf of Scottish Water from Loch Farlary to Bridge of Horn, Golspie in advance of the proposed construction of a new water main. The work was undertaken to assess the nature and extent of any archaeology likely to be directly affected by the proposed development in order to inform recommendations for the protection and management of any sites identified. Seven archaeological sites, two of which will be directly impacted by the current development layout, were recorded. These included a burnt mound, hut circles and Post Medieval structures. Information from OASIS ID: rosscrom1-177267 (L Fraser and M Peteranna) 2014 Field Visit (1 April 2014) An archaeological desk-based assessment and walkover survey was carried out on 1 April 2014 on behalf of Scottish Water from Loch Farlary to Bridge of Horn, Golspie in advance of the proposed construction of a new water main. The work was undertaken to assess the nature and extent of any archaeology likely to be directly affected by the proposed development in order to inform recommendations for the protection and management of any sites identified. Seven archaeological sites, two of which will be directly impacted by the current development layout, were recorded. These included a burnt mound, hut circles and Post Medieval structures. Information from OASIS ID: rosscrom1-177267 (L Fraser and M Peteranna) 2014 Field Visit (1 April 2014) Turf-covered stone dyke that may have formed part of the Post Medieval cultivation and animal husbandry practices in the area. Information from OASIS ID: rosscrom1-177267 (L Fraser and L Peteranna) 2014
Asset/Event Number	238
Asset/Event Name	An Dun, Cornhill Wood
Type of Asset/Event	Promontory Fort (Prehistoric)
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH45SE 57.00
HER Number	MHG60939
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245840
Northing	851960
Council	Highland

Condition:	Degraded
Alignment:	N/A
Importance:	Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Asset 238 for details. https://canmore.org.uk/site/339438/ Field Visit (3 September 1943) RCAHMS Emergency Survey (Archaeology) This fort, which is simply indicated on the 6 in. OS map by the place-name 'An Dun', in Roman type, is situated on a ridge-like summit about 600 ft. high which rises from the right bank of the Orrin about half a mile NNW of Cornhill. The highest point of the ridge is at its W end, and from here it descends E for about 400 ft., with precipitous sides on the N and S, to the lip of the steep slope that falls in that direction towards the valley. About 100 ft. W of this lip the ridge is traversed by the innermost rampart of a system of defences which faces W towards the summit. The ridge here is about 90 ft. broad, and the rampart, which now consists of a mere rickle of stony debris with some traces of a built face showing on its W side, is 15 ft. thick on the axis of the ridge and markedly convex towards the W. Eleven feet outside the face of the first rampart the ground begins to slope upwards to the second, evidently another construction of stonework but largely overgrown; the actual inner edge of the rampart is 19 ft. outside the face of the first, while its crest, which is 5 ft. high, and its outer edge are, respectively, 7 ft. and 15 ft. further W. The crest of the second rampart is 3 ft. high. The second rampart crosses the ridge in the same manner as the first, and on the S side connects with another defensive bank which returns E to connect with the first rampart towards its S end. A third rampart, 9 ft. thick and 2 ft. 6 in. high, is met 11 ft. W of the outer edge of the second; this likewise spans the ridge, which is here narrowing, and returns E at its S end. In the returned portion two very large blocks of stone appear, one of them 5 ft. in length, and the outer face of the rampart is defined by a row of large rounded boulders. The extreme W end of the defensive system consists of a D-shaped enclosure which projects 16 ft. along the axial line beyond the W face of the third rampart. This is of slighter construction than the rest of the works, and is the only part of them in which any wall appears along the lip of the precipitous N slope. A local tradition states that this enclosure has been used as a burying ground. The foregoing account was prepared after an unavoidably hurried visit when the site was largely obscured by bracken; while it is probably correct in the main, many details may be wrong and a definitive description should be based on a proper survey. The general similarity of this fort to the one on Craig Dhu, Kilmorack Parish, should be noted. Visited by RCAHMS (AG) 3 September 1943. Field Visit (28 February 2014) This fort, which was first recorded by Angus Graham (RCAHMS) during the Emergency Surveys of 1943, occupies a promontory 80m E of the summit of An Dùn, where it lies within the southern part of Cornhill Wood at a height of about 230m OD. The promontory is defined by cliffs on the N and S and a steep slope on the E; on the W, where approach is easiest, three parallel walls have been drawn across the neck of the promontory, thus enclosing a roughly rectangular area measuring 52m from E to W by 29m transversely. The innermost wall measures about 20m in length and has collapsed to form a rubble spread up to 7m in thickness and 1.8m in height in which a line of outer facing-stones is visible 2m from the outer edge. This wall also appears to turn to the E at both ends, although it does not extend along either the N or S side. The second wall lies 4m from the first and comprises a grass-grown spread of rubble 5m in thickness and 1.2m in height, though the original thickness was probably nearer 2m. The third wall, which is situated 3m from the second, measures about 2.5m in thickness and 1m in height. The entrance to the fort may have been on the S, where the second and third walls stop short of the cliff-edge. No internal features were noted on the date of visit. Visited by RCAHMS (GFG, JRS, IP) 28 February 2014. Note (16 March 2017 - 16 March 2017) Atlas of Hillforts of Britain and Ireland This fort lies 80m E of the summit of An Dun, where cliffs on the N and S, and a steep slope falling away to the E form a promontory. Internally it measures about 52m from E to W by 29m transversely (0.15ha) and is defended by a band of three walls some 20m long by

21.5m deep barring access from the W. The innermost turns back briefly onto the N and S sides before disappearing, but the flanks are otherwise undefended. The walls are all reduced to mounds of rubble, but a line of outer facing-stones can be seen within the margin of the innermost, which rises 1.8m high and is spread 7m thick. The second wall lies 4m outside the first and is spread 5m in thickness by 1.2m in height, while the third, a further 3m to the exterior, about 2.5m in thickness by 1m in height. The two outer walls stop short of the cliff-edge on the S, possibly indicating the position of an entrance. The interior is featureless.

Information from An Atlas of Hillforts of Great Britain and Ireland – 16 March 2017. Atlas of Hillforts SC4381

References

RCAHMS. (1942-3) Emergency Survey of archaeological monuments in military training areas, 1981, 2v. Typescripts. Page(s): Ross 48 RCAHMS Shelf Number: A.1.1.SUR

Asset/Event Number	239
Asset/Event Name	Strath Sgitheach (East) Ss4
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 91.00
HER Number	MHG8925; MHG62696
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252473
Northing	863284
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded hut circle under heather, measures c12m in diameter over walls. Walls spread to 1.5m and stand to 0.3m tall. Entrance not discernible. https://canmore.org.uk/site/369778/ https://canmore.org.uk/site/369786/ Field Visit (May 2020 - June 2020) NH 524 633 (roughly centred) This group of 12 roundhouses in the upper part of Strath Sgitheach is NE of the track from the bridge/stepping stones. The roundhouses are on a SE-facing slope in heathery ground at an altitude of c250m and on both sides of a small burn. Just four roundhouses have been previously recorded although more than this are seen on snowy aerial photographs taken by Jim Bone in February 2010 (see JSB collection). They were surveyed in May and June 2020. The majority of the roundhouses are circular and have internal diameters of between 6m and 9m. The surrounding banks are up to 0.5m height and are often damaged or incomplete. One of the roundhouses, SS5, has more substantial remains which are 0.6m high and have a spread of 2m. Only a few of the roundhouses have evidence of entrances. NH 52545 63270 Roundhouse (SS1) NH 52569 63323 Roundhouse (SS2) [Asset 235] NH 52533 63331 Roundhouse (SS3) [Asset 236] NH 52473 63284 Roundhouse (SS4) [Asset 239] NH 52418 63278 Roundhouse (SS5) (previously recorded as "B") NH 52396 63297 Roundhouse (SS6) (previously recorded as "D")

Appendix 1: Gazetteer of Heritage Assets and Events

NH 52385 63289 Roundhouse (SS7) (previously recorded as "C")
NH 52416 63233 Roundhouse (SS8)
NH 52303 63332 Roundhouse (SS12) (previously recorded as "A")
NH 52107 63397 Roundhouse (SS14)
NH 52297 63481. Roundhouse (SS15)
NH 52458 63350 Roundhouse (SS17)

Archive: Highland Council HER and NRHE
Meryl Marshall – NOSAS
(Source: DES Vol 21)

References

Marshall, M. (2021) Strath Sgitheach (East), Walkover survey and recording, in Jennifer Thoms, Discovery Excav Scot, New, vol. 21, 2020. Cathedral Communications Ltd, Wiltshire, England. Page(s): 67-68

Asset/Event Number	240
Asset/Event Name	Muir Of Fairburn
Type of Asset/Event	Cross Incised Stone (Early Medieval)
Date and/or Period	Early Historic
Listing No./NRHE Number	NH45SE 59.00
HER Number	MHG60932
Status	Non-designated Heritage Asset
Section:	N/A
Easting	248250
Northing	852990
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/345694/ Field Visit (3 September 1943) RCAHMS Emergency Survey (Archaeology) This is a boulder incised with a consecration-cross only 6 1/2 inches in diameter. It forms part of the coping of the wall on the E side of the high-road just S of the entrance to the E avenue of Fairburn House, at the fence dividing the house called Cabar Feidh and the next to the N. The suggestion has been made to take it to Fairburn House for preservation indoors. Visited by RCAHMS (AG) 3 September 1943. References RCAHMS. (1942-3) Emergency Survey of archaeological monuments in military training areas, 1981, 2v. Typescripts. Page(s): Ross 52 RCAHMS Shelf Number: A.1.1.SUR

Asset/Event Number	241
Asset/Event Name	Arcan Muir
Type of Asset/Event	Cairn(s) (Period Unassigned)
Date and/or Period	Unknown
Listing No./NRHE Number	NH45SE 60.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	n/a
Status	Non-designated Heritage Asset
Section:	N/A
Easting	248000
Northing	852000
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	https://canmore.org.uk/site/345696/ Field Visit (3 September 1943) RCAHMS Emergency Survey (Archaeology) An area densely overgrown with bracken extends W from a point about 100 yds S of the front of the house called Arcan Croft, No. 2. It is said to contain an unstated number of cairns, and should be examined at a season when the bracken is not an obstacle. Visited by RCAHMS (AG) 3 September 1943. References RCAHMS. (1942-3) Emergency Survey of archaeological monuments in military training areas, 1981, 2v. Typescripts. Page(s): Ross 50 RCAHMS Shelf Number: A.1.1.SUR

Asset/Event Number	37.1
Asset/Event Name	Hut circle, Cnoc na h-Uamha
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 10
HER Number	MHG8929
Status	Non-designated Heritage Asset
Section:	N/A
Easting	250751
Northing	862241
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle within the Scheduled Area for SM4728, survives as a fairly poorly defined hut circle c10m in diameter over banks which appear to spread c1.5m wide and stand 0.4m tall. A modern track has cut over the centre, with modern signage erected to dissuade this. See SM description under Asset 37.

Asset/Event Number	37.2
Asset/Event Name	Hut circle, Cnoc na h-Uamha
Type of Asset/Event	Hut circle

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 10.00
HER Number	MHG8929
Status	Non-designated Heritage Asset
Section:	N/A
Easting	250900
Northing	862351
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Hut circle under heather, measures c15m by 12m over banks which stand 0.4 tall and spread c2 .5m wide. Entrance in the SSE.

Asset/Event Number	37.3
Asset/Event Name	Hut circle, Cnoc na h-Uamha
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 10.00
HER Number	MHG8929
Status	Non-designated Heritage Asset
Section:	N/A
Easting	250914
Northing	862361
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Hut circle under heather, c23m by 19m NW/SE over banks, which stand c0.4 tall and spread c2.5m wide. Entrance in SE.

Asset/Event Number	37.4
Asset/Event Name	Hut circle, Cnoc na h-Uamha
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 10.00
HER Number	MHG8929
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	250773
Northing	862349
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Hut circle under heather, c16m diameter over banks c2-3m wide and 0.2-0.5m tall, poorly defined on S side. Entrance not discerned.

Asset/Event Number	44
Asset/Event Name	Achorn Bridge, prehistoric and post medieval settlement 400m ENE of
Type of Asset/Event	Prehistoric settlement
Date and/or Period	Prehistoric/Post-medieval
Listing No./NRHE Number	
HER Number	MHG1263; MHG38949
Status	Scheduled Monument
Section:	A1.4
Easting	313757
Northing	930605
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	High
Description	*Observed by AOC Archaeology during 2024 walkover survey. Scheduled prehistoric hut circles and post-medieval settlement remains along the Achorn burn, under dense bracken and grasses. https://portal.historicenvironment.scot/designation/SM512 This site consists of a prehistoric settlement which is overlain to the W by a post medieval settlement. The prehistoric site is on 2 main levels on the SE flank of a rise protected on the S by the gorge of the Achorn Burn. The site is difficult to interpret, but appears to consist of at least 4 hut circles from 10 to 12m in diameter and an oblong structure. The settlement has been robbed of stone, probably to build the sheepfold and post medieval settlement immediately to the W. The walls are generally reduced to a scatter of turf-covered rubble stone. A number of 'box-like' compartments formed of slabs on edge occur within the walls of the houses. The post medieval settlement contains several phases of occupation including a long house with a later house built over the top. The long house was at least 36 by 5m and appears to have had 5 rooms. The later house is about 15 by 5m and has 2 rooms. The walls of this house survive to the gable, but the roof has fallen. The walls are partly mortared and partly dry-stone built and the date 1832 is carved to the left of the doorway. Traces of another rectangular building are visible between this building and a circular sheepfold to the E and there is a second rectangular sheepfold to the WSW of the house. The area to be scheduled measures 230m WSW-ENE by a maximum of 75m NNW-SSE, to include the prehistoric and post medieval settlements, as shown in red on the attached map.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	108.1
Asset/Event Name	Hut circle, Ousdale Burn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	306651
Northing	920611
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under grass and bracken, measuring 8m in diameter over banks c0.5-0.7m in width and 0.5m tall. A 1.5m wide entrance is visible in the SE side. A significant portion of stonework is exposed in the N of the bank. See Asset 108 for full HER description.

Asset/Event Number	108.2
Asset/Event Name	Dyke, Ousdale Burn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	306658
Northing	920583
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke partially under grass. Stands as only some intermittent boulders up to 1.5m long and likely once built up with turf that has since degraded. Partially encloses the hut circles Assets 108.1 and 108.3, but very ephemeral in parts. This portion measures c88m in length. Less uniform than the nearby dyke Asset 108.6, but the date is still uncertain. See Asset 108 for full HER description.

Asset/Event Number	108.2

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Dyke, Ousdale Burn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	306746
Northing	920605
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke partially under grass. Stands as only some intermittent boulders up to 1.5m long and likely once built up with turf that has since degraded. Partially encloses the hut circles Assets 108.1 and 108.3, but very ephemeral in parts. This portion measures c40m in length. See Asset 108 for full HER description.

Asset/Event Number	108.3
Asset/Event Name	Possible hut circle, Ousdale Burn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814; MHG39434
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	306706
Northing	920595
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible small hut circle or oval-shaped structure under heather and grass. Measures c6m in diameter with a bank c1m wide and up to 0.2m tall. A possible 1m-wide entrance visible in the SE. A deer/sheep path has eroded the N side. See Asset 108 for full HER description.

Asset/Event Number	108.4
Asset/Event Name	Hut circle, Ousdale Burn
Type of Asset/Event	Hut circle

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Prehistoric
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	306774
Northing	920643
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible small hut circle under heather and grass. Measures c8m in diameter over banks, which stand 0.4m tall and spread up to 1.5m wide. A c1m wide entrance is visible in the SE portion of the bank. See Asset 108 for full HER description.

Asset/Event Number	108.5
Asset/Event Name	Clearance cairn, Ousdale Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	306785
Northing	920659
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under heather, measuring 4m in diameter and standing 0.5m tall. Cairn is bisected by a deer/sheep path 0.3m wide. See Asset 108 for full HER description.

Asset/Event Number	108.6
Asset/Event Name	Dyke, Ousdale Burn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND02SE 16
HER Number	MHG814
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.4
Easting	306657
Northing	920596
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke mostly under grass, c60m long and standing to 0.3m tall, spread up to 2m wide. Predominantly composed of intermittent large stones that may have formed the foundation of the dyke, with the turf degraded away. Somewhat more uniform than the nearby dyke Asset 108.2, and may of later date. Not depicted on historic mapping. See Asset 108.2 for HER description.

Asset/Event Number	110
Asset/Event Name	Hut circle, Morvich Burn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 25.00
HER Number	MHG10648
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275545
Northing	902080
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under grass, somewhat oval in plan and measuring 12m by 10m over walls, which are visible as stoney banks spread 1.7m wide and standing 0.7m tall. Entrance visible as a depression in the SE quarter. Situated on a small terrace. Description from HER: https://canmore.org.uk/site/5934/ A hut circle measuring 11.5m in diameter within a wall composed of an inner face of contiguous slabs on edge backed by rubble. In the main a wall thickness of 2m is indicated except around an entrance gap in S, where it is 3m. The entrance displays two outer portal slabs 1.5m apart (OS {RDL}). Contemporary cultivation is marked by a scattering of stone clearance heaps in the immediate vicinity. Visited by OS (R D L) 15 April 1964 and (J M) 31 July 1975.

Asset/Event Number	115.1
Asset/Event Name	Hut circle, Allt nan Sgeith

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279517
Northing	904548
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle and heather under grass and heather, measuring c11m internally in diameter with banks spread up to 2m and standing 1m tall in some places. A possible entrance in the SE side with a collapsed orthostat visible. See Asset 115 for HER description.

Asset/Event Number	115.2
Asset/Event Name	Hut circle, Allt nan Sgeith
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279512
Northing	904519
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle and heather under grass and heather, measuring c11m internally in diameter with banks spread up to 2m and standing 1m tall on the downslope side and partly revetted. No discernible entrance. See Asset 115 for HER description.

Asset/Event Number	115.3
Asset/Event Name	Hut circle, Allt nan Sgeith
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279551
Northing	904508
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle and heather under grass and heather, measuring c16m in diameter over banks which are spread up to 2m and standing 1.4m tall. A possible entrance in the form of a c1.5m wide depression in the SW side is visible. The hut circle occupies a slight terrace above the burn to the west with views over the wider strath and the rest of the prehistoric settlement and agricultural remains to the NW. See Asset 115 for HER description.
Asset/Event Number	115.4
Asset/Event Name	Hut circle, Bridge of Horn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279526
Northing	904474
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An arc of turf and stone bank under heather and grass, likely the remains of a robbed-out hut circle. Measures c15m long with the bank spread up to c2m and standing 0.3m tall, forming a possible diameter of c10m internally. Likely robbed out for nearby hut circles. See Asset 115 for HER description.
Asset/Event Number	115.5
Asset/Event Name	Hut circle, Allt nan Sgeith
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279493
Northing	904566
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and grass with poorly defined banks. Measures c17m in diameter over banks, which stand 0.7m tall and are spread up to 2m wide. Best preserved along the NE and SW sides. Some boulder visible along the N edge. Possibly robbed out on the SE side for the adjacent hut circles, as this is very poorly defined in comparison to it and the other two well-preserved hut circles Assets 115.2 and 115.3. Entrance not discernible. See Asset 115 for HER description.
Asset/Event Number	115.6
Asset/Event Name	Dyke, Allt nan Sgeith
Type of Asset/Event	Dyke
Date and/or Period	Unknown
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279481
Northing	904530
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a dyke or possible lynchet under grass and heather, visible as a slight ledge aligned NW/SE and standing 0.7m tall, with 2-3 stones visible protruding from edge. It is only a short segment of c25m, appearing to join a natural small hillock to the NW. See Asset 115 for HER description.
Asset/Event Number	115.7
Asset/Event Name	Clearance cairn, Allt nan Sgeith
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	B1.1
Easting	279556
Northing	904415
Council	Highland
Condition:	Very Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable prehistoric clearance cairn measuring c7m in diameter and standing 1.2m tall under grass and bracken. The cairn is situated above the stream course and a deer trail through it has revealed several large stones. See Asset 115 for HER description.

Asset/Event Number	115.8
Asset/Event Name	Clearance cairn, Allt nan Sgeith
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279500
Northing	904501
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Stands 0.7m tall and spread 5m by 4m. See Asset 115 for HER description.

Asset/Event Number	115.9
Asset/Event Name	Clearance cairn, Allt nan Sgeith
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279485
Northing	904503

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under grass and moss, some stone visible. Stands 0.6m tall and spread 7m by 4.5m. See Asset 115 for HER description.

Asset/Event Number	115.10
Asset/Event Name	Clearance cairn, Allt nan Sgeith
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 40.00
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279487
Northing	904491
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Stands 0.6m tall and spread 7m by 4m. See Asset 115 for HER description.

Asset/Event Number	116.1
Asset/Event Name	Hut circle, Allt Bad A Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274995
Northing	902458
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under grass and

Appendix 1: Gazetteer of Heritage Assets and Events



heather with poorly defined banks, c7-8m in diameter. Banks stand 0.4m tall and spread 2m wide. Entrance not discernible. See Asset 116 for HER description.

Asset/Event Number	116.2
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274971
Northing	902451
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5m in diameter and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.3
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274977
Northing	902455
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 2m in diameter and stands 0.5m tall. See Asset 116 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	116.4
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274987
Northing	902450
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 6m in diameter and stands 0.7m tall. See Asset 116 for HER description.

Asset/Event Number	116.5
Asset/Event Name	Clearance cairn, Morvaich Estate
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274837
Northing	902592
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small clearance cairn measuring 2.5m in diameter and standing 0.9m tall, deposited against a small natural boulder. May be prehistoric given its proximity/location to the hut circles and field systems to the SW, but is also adjacent to an area of post-medieval peat cutting (Asset 416). See Asset 116 for HER description.

Asset/Event Number	116.6
Asset/Event Name	Clearance cairn, Morvaich Estate
Type of Asset/Event	Clearance cairn

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274832
Northing	902619
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small clearance cairn measuring 6m by 4.5m and standing 0.9m tall. May be prehistoric given its proximity/location to the hut circles and field systems to the SW, but is located within an area of shallow post-medieval peat cutting (Asset 416). See Asset 116 for HER description.

Asset/Event Number	116.7
Asset/Event Name	Structure, Allt Bad A Chrasgaidh
Type of Asset/Event	Structure
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274992
Northing	902444
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A heather and grass-covered bank c3m in diameter internally with banks that stand 0.3m tall and spread up to 1.5m wide, with a possible entrance to the NE. Possibly an augmented prehistoric clearance cairn. Function uncertain. See Asset 116 for HER description.

Asset/Event Number	116.8
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	N/A
Easting	274983
Northing	902444
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5m in diameter and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.9
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274988
Northing	902436
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 4m in diameter and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.10
Asset/Event Name	Prehistoric clearance cairn, Morvaich Estate
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274850
Northing	902569

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable prehistoric clearance cairn under grass, stands 0.8m tall and 6m in diameter. See Asset 116 for HER description.
Asset/Event Number	116.11
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274985
Northing	902420
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 6m in diameter and stands 1m tall. See Asset 116 for HER description.
Asset/Event Number	116.12
Asset/Event Name	Prehistoric clearance cairn, Morvaich Estate
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274863
Northing	902562
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small prehistoric clearance cairn under grass and heather, stands 0.7m tall and 6m in diameter. See Asset 116 for HER description.

Asset/Event Number	116.13
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274967
Northing	902443
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5.5m in diameter and stands 1m tall. See Asset 116 for HER description.

Asset/Event Number	116.14
Asset/Event Name	Prehistoric clearance cairn, Morvaich Estate
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274837
Northing	902548
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 8m by 4m and stands 1m tall. See Asset 116 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	116.15
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274865
Northing	902531
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, measures c5m in diameter and stands 0.7m tall. See Asset 116 for HER description.

Asset/Event Number	116.16
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274962
Northing	902425
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5.5m in diameter and stands 1.1m tall. See Asset 116 for HER description.

Asset/Event Number	116.17
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274970
Northing	902420
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 7m by 0.4m and stands 0.8m tall. See Asset 116 for HER description.
Asset/Event Number	116.18
Asset/Event Name	Hut circle, Allt Bad a' Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274926
Northing	902527
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather, c10m in diameter. Extent and form difficult to discern as a result of the vegetation but banks appear 0.7m tall and spread up to 2m wide. Entrance not discernible. See Asset 116 for HER description.
Asset/Event Number	116.19
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	274928
Northing	902508
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, measures c5m in diameter and stands 0.9m tall. See Asset 116 for HER description.

Asset/Event Number	116.2
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - asset number not used

Asset/Event Number	116.21
Asset/Event Name	Hut circle, Allt Bad a' Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274888
Northing	902494
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather, c12m in diameter over banks, with prominent banks that stand 1m tall externally and internally, with the interior of the hut circle a pronounced dish. Banks are spread 3m wide and bare stone visible in parts. The banks have been breached in several places and a true entrance is not confidently discernible. See Asset 116 for HER description.

Asset/Event Number	116.22
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274948
Northing	902468
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measuring 7m long and 1.5m wide and standing 0.3m tall. See Asset 116 for HER description.

Asset/Event Number	116.23
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274839
Northing	902435
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



clearance cairn under grass, much disturbed by rabbit burrowing. Stands c. 0.4m tall and spread up to 6m in diameter. See Asset 116 for HER description.

Asset/Event Number	116.24
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274971
Northing	902381
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 2.5m by 1.5m and stands 0.7m tall. See Asset 116 for HER description.

Asset/Event Number	116.25
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274975
Northing	902377
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 6m in diameter and stands 1m tall. See Asset 116 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	116.26
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274958
Northing	902372
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 4m in diameter and stands 1m tall. See Asset 116 for HER description.

Asset/Event Number	116.27
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274976
Northing	902367
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 4m by 3.5m and stands 0.8m tall. See Asset 116 for HER description.

Asset/Event Number	116.28
Asset/Event Name	Hut circle, Allt Bad A Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275003
Northing	902366
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather measuring 8m in diameter internally with banks that stand 1m tall and spread 1.5m wide. Possible entrance in the SW quarter. See Asset 116 for HER description.

Asset/Event Number	116.29
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274983
Northing	902368
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 2m in diameter and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.30
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	274803
Northing	902608
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible prehistoric clearance cairn under grass and heather. Stands 4m in diameter and stands 0.3m tall. The cairn is within an area of post-medieval peat cutting (Asset 416). See Asset 116 for HER description.

Asset/Event Number	116.31
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274810
Northing	902575
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 6m by 4m and stands 0.5m tall. See Asset 116 for HER description.

Asset/Event Number	116.32
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274818
Northing	902561
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 6m in diameter and stands 0.3m tall. See Asset 116 for HER description.

Asset/Event Number	116.34
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274982
Northing	902350
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5m in diameter and stands 0.7m tall. See Asset 116 for HER description.

Asset/Event Number	116.35
Asset/Event Name	Hut circle, Allt Bad A Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275012
Northing	902349
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under grass and

Appendix 1: Gazetteer of Heritage Assets and Events



heather measuring 8m in diameter over banks that are poorly defined, perhaps 0.6m tall and spread up to 2m wide. Entrance not discernible. See Asset 116 for HER description.

Asset/Event Number	116.36
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275032
Northing	902329
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 6m in diameter and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.37
Asset/Event Name	Hut circle, Allt Bad A Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274956
Northing	902323
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and grass measuring 12.5m by 10m. Poorly defined banks and possibly partially constructed on boulder outcrop on S side. Set on a slight shelf of the S facing hill slope. Banks stand 0.3m tall and spread 1.5m wide. Entrance not discernible. See Asset 116 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	116.38
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274964
Northing	902311
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small prehistoric clearance cairn under heather and grass. Measures 5m in diameter and stands 0.3m tall. See Asset 116 for HER description.

Asset/Event Number	116.39
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274986
Northing	902306
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 6m in diameter and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.40
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274973
Northing	902291
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, possibly built onto an exposed protrusion of bedrock. Measures 7m by 5m and stands 0.4m.tall. See Asset 116 for HER description.

Asset/Event Number	116.41
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274995
Northing	902379
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 8m in diameter and stands 1.5m tall. See Asset 116 for HER description.

Asset/Event Number	116.42
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	275012
Northing	902403
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 7m by 5m and 1m tall. See Asset 116 for HER description.

Asset/Event Number	116.43
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274999
Northing	902394
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 6m by 3m and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	116.44
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275030
Northing	902287
Council	Highland
Condition:	Degraded
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 5m in diameter and stands 0.4m tall. See Asset 116 for HER description.
Asset/Event Number	116.45
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275053
Northing	902288
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 7m in diameter and stands 0.7m tall. See Asset 116 for HER description.
Asset/Event Number	116.46
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275078
Northing	902268
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 8m by 5m and stands 1m tall. See Asset 116 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	116.47
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275062
Northing	902237
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5m in diameter and stands 0.3m tall. See Asset 116 for HER description.

Asset/Event Number	116.48
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275059
Northing	902219
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 4m in diameter and stands 0.5m tall. See Asset 116 for HER description.

Asset/Event Number	116.49
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274992
Northing	902355
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 3m in diameter and stands 0.5m tall. See Asset 116 for HER description.

Asset/Event Number	116.50
Asset/Event Name	Clearance cairn, Allt Bad a' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SW 34
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274901
Northing	902500
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, measures 5m by 3m and stands 0.6m tall. See Asset 116 for HER description.

Asset/Event Number	117.1
Asset/Event Name	Enclosure, Allt Bad A Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SW 35
HER Number	MHG10631
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	274683
Northing	902037
Council	Highland
Condition:	Very degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dykes under tall heather forming a small enclosure c16m by 6m over banks, c10m to the SE of homestead Asset 117.2. Difficult to trace extent in the vegetation, but banks stand c 0.6-0.9m tall. Not depicted on historic mapping. See Asset 117 for HER description.

Asset/Event Number	117.2
Asset/Event Name	Homestead, Allt Bad A Chrasgaidh
Type of Asset/Event	Structure
Date and/or Period	Prehistoric/Early Historic
Listing No./NRHE Number	NC70SW 35
HER Number	MHG10631
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274671
Northing	902056
Council	Highland
Condition:	Very degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A homestead under tall heather, slightly bare along the internal N side of the inner ring of orthostats. On the whole the asset is under tall heather which obscures its definition, but appears much as described in the HER/Canmore as principally two rings of boulders. Not depicted on historic mapping. See Asset 117 for HER description.

Asset/Event Number	117.3
Asset/Event Name	Enclosure, Allt Bad A Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SW 35
HER Number	MHG10631
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274655
Northing	902019

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under tall heather forming a U-shaped enclosure c12m by 6m open banks, open to the NE, and located c30m SW of homestead Asset 117.2. Banks poorly defined due to vegetation, perhaps 0.4m tall and spread up to 1.5m wide. Not depicted on historic mapping. See Asset 117 for HER description.

Asset/Event Number	119.1
Asset/Event Name	Clearance cairn, Glen Sletdale
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 7.00
HER Number	MHG10027
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292948
Northing	912692
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under bracken and grass, measures 7m by 6m and stands 1m tall. See Asset 120 for HER description.

Asset/Event Number	119.2
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 7.00
HER Number	MHG10027
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292935
Northing	912690
Council	Highland
Condition:	Very Degraded
Alignment:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and bracken, truncated by the adjacent track on its N side, and the large associated dyke (Asset 448). The surviving remains of the hut circle are banks that extend c18m by 14m and c0.5m tall. Difficult to discern due to the vegetation. See Asset 120 for HER description.
Asset/Event Number	119.3
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	N/A
Easting	292878
Northing	912790
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under bracken and heather, measuring c13m over banks which survive best along the W extent where they stand 0.7m tall and spread 3m wide. The hut circle has been constructed on a small terrace, which appears to be an artificial platform (Asset 119.7). Entrance not discernible but likely in the SE portion that overlooks the lower terrace of the strath in this direction. See Asset 119 for HER description.
Asset/Event Number	119.4
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292875
Northing	912762
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under tall

Appendix 1: Gazetteer of Heritage Assets and Events



bracken. Extent difficult to discern due to vegetation. Measures 14m in diameter over banks, which stand to a height of c1m and spread perhaps 4m. Interior is depressed. Entrance not discernible. See Asset 119 for HER description.

Asset/Event Number	119.5
Asset/Event Name	Clearance cairn, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292857
Northing	912713
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, measures 6.6m by 3.4m and 1.2m tall. See Asset 119 for HER description.

Asset/Event Number	119.6
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292862
Northing	912735
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle and bracken and heather, measures c16m in diameter over banks which are spread up to 1.5m and stand 1m tall. Entrance is a visible depression in the bank in the SE. See Asset 119 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	119.7
Asset/Event Name	Platform, Glen Sletdale
Type of Asset/Event	Platform
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	N/A
Easting	292886
Northing	912779
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible platform of earth and stone platform or slightly augmented slope for the hut circle Asset 119.3 to occupy. Appears incongruous with the natural hope slope angle. Forms a small platform for the S and SE edge of the hut circle to occupy, measuring c20m by 15m and raised c0.7-1m above ground level. See Asset 119 for HER description.

Asset/Event Number	119.8
Asset/Event Name	Clearance cairn, Glen Sletdale
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	N/A
Easting	292898
Northing	912775
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under bracken and grass. Measures 7m in diameter and stands 0.9m tall. See Asset 119 for HER description.

Asset/Event Number	119.9
Asset/Event Name	Lynchet, Glen Sletdale
Type of Asset/Event	Lynchet

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292847
Northing	912713
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A lynchet forming a 34m by 24m earth platform on S-facing slope. Bank on southern end measures 3m wide and 0.6m tall, extends for c35m. See Asset 119 for HER description.

Asset/Event Number	119.10
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	N/A
Easting	292847
Northing	912767
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under dense bracken, measure c13m in diameter over banks which stand 0.7m tall externally and 0.4m internally. A possible entrance in the form of a slight depression in the bank was felt underfoot in the E side. See Asset 119 for HER description.

Asset/Event Number	119.11
Asset/Event Name	Hut circle, Glen Sletdale
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.5
Easting	292892
Northing	912749
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under grass and bracken, c17 m in diameter. The banks are not as pronounced as the other four nearby hut circles (Assets 19.3, 19.4, 19.6 and 19.10), standing to a height of 0.6m tall and spread up to 4m, possibly robbed for the nearby structures. Slightly depressed in centre. Entrance not discernible. See Asset 119 for HER description.

Asset/Event Number	119.11
Asset/Event Name	Ditch, Glen Sletdale
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 19.00
HER Number	MHG10048
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292890
Northing	912759
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A c7m long curvilinear ditch c1m wide and 0.4m deep forming the drip gully of hut circle 119.11, visible along its NW side. See Asset 119 for HER description.

Asset/Event Number	122
Asset/Event Name	Morvich Burn
Type of Asset/Event	Settlement
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275680
Northing	901760

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey - see sub-elements of Assets 122.1-122.26; Assets 382.1-382.8, 397, 398, and 399 for details. A post-medieval township comprising several buildings and structures and for which there is no trace recorded on the 1st or 2nd edition OS maps. Roy's map of 1747-1752 is not particularly well-illustrated between Rogart Loch Fleet, and it does not appear to show any settlements in the vicinity (but also fails to depict the moderately large Loch Salachaidh to the NW, comparable in size to Loch Horn). The elements that were surveyed (Assets 122.1-122.26; Assets 382.1-382.8, 397, 398, and 399) comprise several buildings, a corn-drying or lime kiln, enclosures, pens, dykes and clearance cairns. The area is recorded in the OS Name Book records for Sutherland as belonging to the Duke of Sutherland, and Clearances are known to have occurred within the Rogart areas in the early part of the 19th century, and so this potentially too may represent Cleared settlement, though further archival research is needed to support this theory. 'Cnoc Bad a' Chrasgaidh' OS1/33/24/1/2 OS Name Books. OS. 1879. Sutherland CIV, Surveyed: 1873-74, Published: 1879. OS Name Book 1871-1775. Sutherland, Volume 24, p2. Roy, W. 1747-1752. Highland.* https://her.highland.gov.uk/monument/MHG11267 Centred NC 756 017 The footings or remains of at least eighteen dwellings ranging from 9m by 3m to 24m by 4.5m and from 0.4m to 1.2m in height, together with numerous associated enclosures. Visited by OS (R D L) 15 April 1964. A township, comprising thirty-one unroofed structures, of which sixteen are enclosures and fifteen are unroofed buildings, is depicted on the current edition of the OS 1:10,000 map (1970). Nothing is shown on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet civ). Information from RCAHMS (AKK) 21 November 1995. A DBA and walkover survey was carried out by Wordsworth Archaeological Services in 1997 advance of a proposed woodland grant scheme at Morvich, Sutherland. 1/14; This rectangular structure on the S side of the burn and N of the track forms an isolated element of the settlement at Site 1/16. Its function is not known. 1/15; A substantial corn-drying kiln, not shown on the 1:2,500 map lies to the E of the path and the main settlement at Site 1/16. This is a well preserved feature. 1/16; The footings of at least 6 rectangular buildings and their associated enclosures survive here. They form part of a small post-medieval farm complex in fairly good preservation, apart from rabbit damage. Stone clearance lines to the W mark the area of former fields. 1/17; An irregular enclosure some 9m in diameter is based on substantial upright boulders and is similar to the ?earlier enclosures at Sites 1/11 & the earlier version of 1/19. It sites on a slight knoll and may well be based on an earlier site. A dyke runs between Sites 1/17 & 1/18 S to the main complex at Site 1/16. 1/18; An irregular enclosure some 9m in diameter is based on substantial upright boulders and is similar to the ?earlier enclosures at Sites 1/11 & the earlier version of 1/19. It sites on a slight knoll and may well be based on an earlier site. A dyke runs between Sites 1/17 & 1/18 S to the main complex at Site 1/16. 1/19; The enclosure drawn here lies on the site of an earlier one as shown. An irregular boulder links to this and then continues to the W almost to Site 1/18 as drawn. The earlier enclosure may be medieval in date. 1/20; 33m to the N of the enclosure at Site 1/19 is a line of stones 4m by 1m sited on a slight

Appendix 1: Gazetteer of Heritage Assets and Events



hill. This might be the remains of a robbed out cairn. There are no clearance cairns in the vicinity. <1>

Asset/Event Number	122.1
Asset/Event Name	Dyke. Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275678
Northing	901799
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke partially under grass and heather with only intermittent stone remaining, the likely foundation courses for a turf dyke. Breached by existing track. Coursed base of boulders perhaps two stones high up to 0.5m.tall. Spread up to 1.5m wide and c20m 40m long, with enclosure (Asset 122.2) constructed on S side. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.2
Asset/Event Name	Pen, Bad A' Chrasgaidh
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275697
Northing	901802
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remains of a possible degraded pen built onto E face of dyke Asset 122.1, measuring c11m NE/SW by 7m and standing 0.45m tall. Open to the E but possibly due to robbing. Founds appear as small boulders indicating possibly a turf element once atop, since degraded. Not depicted on

Appendix 1: Gazetteer of Heritage Assets and Events



historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.3
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275678
Northing	901775
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under grass, measuring 8m by 4m and with boulder walls that stand 0.4m tall and spread 0.5m wide, potentially facilitating a turf upper wall since degraded. No discernible entrance. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.4
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275669
Northing	901765
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under grass, measuring 8m by 4m and with boulder walls that stand 0.4m tall and spread 0.5m wide, potentially facilitating a turf upper wall since degraded. No discernible entrance. Not depicted on historic mapping. See Asset 122 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	122.5
Asset/Event Name	Enclosure, Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275712
Northing	901776
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An irregularly shaped enclosure c20m by 20m, constructed from a drystone wall with large boulders at base course and smaller stones atop that stands tallest at the corners up to 1m, and spread up to 1.5m. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.6
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275691
Northing	901759
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small rectangular building with drystone walls, measures c8m by 4m over walls and walls stand to 0.8m tall. No internal partitions visible, entrance possibly in the SW elevation but difficult to discern. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.7
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275673
Northing	901742
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under grass, measuring 7m by 4m over walls that stand 0.5m tall and spread 0.7m wide. Entrance in the N elevation and situated on E side of enclosure Asset 122.9. Not depicted on historic mapping. See Asset 122 for HER description.
Asset/Event Number	122.8
Asset/Event Name	Kiln, Bad A' Chrasgaidh
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275681
Northing	901725
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A kiln built along side the track into the slight slope of a hill, aligned N/S and measuring c12m long by 6m wide, with a small platform of stone to the S in front of the flue, which has collapsed. Possibly a lime kiln rather than corn-drying kiln considering the easily accessible roadside location but this is not definitive. Stands taller at the E side whereas the W is partially revetted into track edge. Not depicted on historic mapping. See Asset 122 for HER description.
Asset/Event Number	122.9
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275658
Northing	901730
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under grass and moss, spread up to 2m wide and stands to 0.5m tall, c20m long, encloses nearby structures. Not depicted on historic mapping. See Asset 122 for HER description.
Asset/Event Number	122.10
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275688
Northing	901709
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under grass and moss, spread up to 2.5m wide and stands to 0.6m tall, c50 m long where recorded within the survey corridor. Breached by existing track to the SW and continues out of the survey corridor to the NE. Not depicted on historic mapping. See Asset 122 for HER description.
Asset/Event Number	122.11
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	275664
Northing	901653
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Very degraded stone and turf dyke under grass, stands 0.8m tall and spread up to 2m wide, extending c20m within survey corridor but continues beyond. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.12
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275691
Northing	901690
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands up to 1m tall and spread up to 2.5m wide, extending c20m within survey corridor but continues beyond. Mostly represented by intermittent boulders that likely formed the foundations of a dyke constructed with turf. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.13
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275679

Appendix 1: Gazetteer of Heritage Assets and Events

Northing	901635
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small clearance cairn under grass, measuring c1.5m in diameter and standing 0.7m tall. See Asset 122 for HER description.

Asset/Event Number	122.14
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275685
Northing	901632
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under grass and moss, measures 4.5m by 2m and stands 0.4m tall. See Asset 122 for HER description.

Asset/Event Number	122.15
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275676
Northing	901615
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A field clearance cairn partially under grass, deposited at slight base of slope, measures 6m by 2m and stands up to 1m tall due to slope. See Asset 122 for HER description.
Asset/Event Number	122.16
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275656
Northing	901607
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular building under grass measuring 6m by 6m with walls that stand up to 1m tall and 0.5m wide, with much stone rubble filled or placed in the interior. Not depicted on historic mapping. See Asset 122 for HER description.
Asset/Event Number	122.17
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275679
Northing	901588
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn of boulders and smaller stones, measuring 33m by 10m and stands 1.6m tall. Has been deposited atop a natural rocky outcrop. See Asset 122 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	122.18
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275646
Northing	901597
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Dyke composed mainly of stones but does contain turf and covered in tall grass. Measures c20m long, 0.6m wide with 1m spread on S side and up to 0.5m tall. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.19
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275690
Northing	901567
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn, partially under grass, of boulders and smaller stones measuring 13m by 6.5m and standing 1.5m tall. It has been deposited against a natural rock outcrop. See Asset 122 for HER description.

Asset/Event Number	122.20
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275674
Northing	901551
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A linear spread of clearance material bisected by both existing tracks. The cairn is visible as some boulders and stone partially under grass, extending 20m by 5m and standing 1m tall on the NE side of the track, and 8m by 5m and 1m tall on the SW side of the track. See Asset 122 for HER description.

Asset/Event Number	122.21
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275648
Northing	901566
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a square building or pen measuring 6m by 6m and with drystone walls that stand up to 0.7m tall and spread 1m wide. A possible S entrance, but this may just be a robbed-out elevation. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	122.22
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	N/A
Easting	275653
Northing	901534
Council	Highland
Condition:	Degraded
Alignment:	NNE/SSW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A linear spread of field clearance material partially under grass, measuring 20m by 20m and standing 1m tall. It has been deposited against a small bare section of natural bedrock outcrop. See Asset 122 for HER description.

Asset/Event Number	122.23
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275661
Northing	901557
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn measuring 5m by 3.5m and standing 1m tall. See Asset 122 for HER description.

Asset/Event Number	122.24
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275651
Northing	901552

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn measuring 10m by 3m and standing 0.4m tall. See Asset 122 for HER description.

Asset/Event Number	122.25
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275645
Northing	901517
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn measuring 10m by 10m and standing 2m tall (mounded atop natural ridge of bedrock). See Asset 122 for HER description.

Asset/Event Number	122.26
Asset/Event Name	Enclosure, Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275701
Northing	901751
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An irregularly shaped

Appendix 1: Gazetteer of Heritage Assets and Events

enclosure, possibly turf and stone but the turf has degraded substantially and only some boulders are visible under grass and moss. The wall spread is up to 2m wide and stands to 0.6m tall. Large gaps adjacent to building Asset 122.6. Not depicted on historic mapping. See Asset 122 for HER description.

Asset/Event Number	130
Asset/Event Name	Polished Axe, Blar Nan Ceann
Type of Asset/Event	Findspot
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH45NE 10.00
HER Number	MHG7898
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247000
Northing	857000
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Negligible
Description	https://her.highland.gov.uk/monument/MHG7898 A large, Neolithic, polished stone axe of Cumbrian type, 11.6" long, was found c1860 near Blar na Ceann (Blar nan Ceann: NH 476 577) Strathpeffer, and was donated to the NMA by Alex Walker, FSA Scot, in 1948-9 (Acc No: AF 898). Probably originating in Lake District, it is thought to have reached this area by trade. Proc Soc Antiq Soc 1951; C L Fell 1964

Asset/Event Number	134.1
Asset/Event Name	Corn drying kiln, Strath Sgitheach
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56SW 31.00
HER Number	MHG8906
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253456
Northing	864079
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A corn-drying kiln under grass, measuring 5m in diameter and standing 0.6m tall with a bowl only slightly visible. Flue

Appendix 1: Gazetteer of Heritage Assets and Events



extends to the SE. Very degraded. Not depicted on the historic maps. See Asset 134 for HER description.

Asset/Event Number	134.2
Asset/Event Name	Building, Strath Sgitheach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56SW 31
HER Number	MHG8906
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253470
Northing	864086
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone footings for a rectangular building under moss and grass, measuring 14m by 6m over walls which stand up to 1m tall and spread 1.5m wide. Some large boulders visible, suggesting the walls had a turf component which has since degraded. The building has been constructed on a small area of raised ground that stands above the surrounding boggy ground. No discernible entrance. Not depicted on historic mapping. See Asset 134 for HER description.

Asset/Event Number	134.3
Asset/Event Name	Building, Strath Sgitheach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56SW 31.00
HER Number	MHG8906
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253487
Northing	864097
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone footings for a rectangular building under moss and grass, measuring 40m by 6m over walls which stand up to 0.6m tall and spread 1.5m wide. Some large boulders visible, suggesting the walls had a turf component which has since degraded. The building has been constructed on a small

Appendix 1: Gazetteer of Heritage Assets and Events



area of raised ground that stands above the surrounding boggier ground. No discernible entrances. Not depicted on historic mapping. See Asset 134 for HER description.

Asset/Event Number	136.1
Asset/Event Name	Building, Alltan Riabhach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NE 24.00
HER Number	MHG10342
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	267477
Northing	898023
Council	Highland
Condition:	Fair
Alignment:	NNE/WSW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A single-storey building roofed in slate, chimneys at each gable end. C12m by 5m over walls. Single central window in the NNW elevation and flanking windows and central doorway in the SSE elevation. Depicted on 1st edition OS map. See Asset 136 for HER description. OS. 1879. Sutherland, Sheet CVIII, Survey date: 1874, Publication date: 1879.

Asset/Event Number	136.2
Asset/Event Name	Building, Alltan Riabhach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NE 24.00
HER Number	MHG10342
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	267499
Northing	898018
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. The stone footings of a rectangular building under grass measuring 10m by 5m over walls. Walls survive to a height of 0.5m and are 0.8m wide. Depicted on 1st edition OS map. See Asset 136 for HER description. OS. 1879. Sutherland, Sheet CVIII, Survey date: 1874, Publication date: 1879.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	136.3
Asset/Event Name	Enclosure, Alltan Riabhach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NE 24.00
HER Number	MHG10342
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	267477
Northing	898107
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass and bracken, stands up to 0.8m tall and spread up to 1.5m wide. Forms an enclosure to the NW of the farmstead buildings Assets 136.1 and 136.2. Depicted on 1st edition OS map. See Asset 136 for HER description. OS. 1879. Sutherland, Sheet CVIII, Survey date: 1874, Publication date: 1879.

Asset/Event Number	138.1
Asset/Event Name	Enclosure, Allt Cnoc na Gamhna
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 50.00
HER Number	MHG10395
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278960
Northing	903909
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure under dense bracken, measuring c18m by 8m. Composed of a drystone dyke with double-faced rubble, standing 0.8m tall and 0.6m wide but difficult to see in the bracken. The N compartment measures c7m by 5m while the S widens out and measures c10m by 7m. Entrances not discerned. Not depicted on historic mapping. See Asset 138 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	138.2
Asset/Event Name	Enclosure, Allt Cnoc na Gamhna
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 50.00
HER Number	MHG10395
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279035
Northing	903940
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke enclosure under grass and bracken c40m by 16m, the dyke stands up to 1.2m tall in some areas and spread up to 1.5m wide, while in the E segment along the burn it has been revetted into the slope. No clearly discernible entrance but the entirety was very obscured by bracken. Not depicted on historic mapping. See Asset 138 for HER description.

Asset/Event Number	138.3
Asset/Event Name	Enclosure, Allt Cnoc na Gamhna
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 50.00
HER Number	MHG10395
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279016
Northing	903918
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone enclosure under moss and bracken. D shaped in plan and c9m by 7m, stands 1m tall in places, with a double skinned wall 1m wide and rounded corners. A 3m-wide entrance defined by an orthostat and large boulders is present in the straight section of wall on the N side. Not depicted on historic mapping. See Asset 138 for HER description.

Asset/Event Number	138.4

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Enclosure, Allt Cnoc na Gamhna
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 50.00
HER Number	MHG10395
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278977
Northing	903912
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure under dense bracken, c11m by 11m and composed of drystone wall standing c0.8m tall and 0.6m wide. Corners are rounded. No discernible entrances. Not depicted on historic mapping. See Asset 138 for HER description.

Asset/Event Number	138.5
Asset/Event Name	Dyke, Allt Cnoc na Gamhna
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 50.00
HER Number	MHG10395
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278995
Northing	903925
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large stone dyke under dense bracken, stands c0.8m tall and spread up to 1m wide, c35m long, and appears to join two enclosures (Assets 138.4 and 138.2), stopping just short of the E Asset 138.2 at a large boulder, allowing for a small entranceway. Not depicted on historic mapping. See Asset 138 for HER description.

Asset/Event Number	139.1
Asset/Event Name	Building, Allt Cnoc na Gamhna
Type of Asset/Event	Building

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 49.00
HER Number	MHG10398
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279077
Northing	904023
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings of a long rectangular building under bracken, measures c20m by 5m over walls. Possible internal partitions but not readily visible due to vegetation. Walls stand 0.5m tall and spread up to 0.8m wide. Not depicted on historic mapping. See Asset 139 for HER description.

Asset/Event Number	139.2
Asset/Event Name	Building, Allt Cnoc na Gamhna
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 49.00
HER Number	MHG10398
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279059
Northing	904039
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under grass measuring 15m by 4.5m wide. Walls measure 0.6m wide and stand 0.3m tall. Entrances or partitions not discernible. Not depicted on historic mapping. See Asset 139 for HER description.

Asset/Event Number	139.3
Asset/Event Name	Dyke, Allt Cnoc na Gamhna
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 49.00
HER Number	MHG10398

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279047
Northing	904029
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under bracken, spread extends along to the S gable end of building 139-2. Possible forming a kale yard or similar, c20m by 6m. Stands 0.6m tall and spread up to 1.5m. Not depicted on historic mapping. See Asset 139 for HER description.
Asset/Event Number	139.4
Asset/Event Name	Lazy beds, Allt Cnoc na Gamhna
Type of Asset/Event	Field system
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 49.00
HER Number	MHG10398
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279059
Northing	904051
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of lazy bed cultivation recorded by the HER but barely discernible during the walkover survey. Likely extends into the surrounds to the E, S and W of the building remains but the areas was under tall bracken that screened visibility. Not depicted on historic mapping. See Asset 139 for HER description.
Asset/Event Number	147.1
Asset/Event Name	Corn Kiln, Innis Aonar
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272488

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	899065
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular roofless kiln under heather, measuring 11m by 5m, with walls to SE 0.6m tall and spread up to 0.7m wide and walls to N 1m tall. Possible flue to SE but internal collapse is obscuring the structure. Not depicted on historic mapping. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.2
Asset/Event Name	Structure, Innis Aonar
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272489
Northings	899091
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular building, built into the side of dyke Asset 471 and partly under grass, measures 11m by 7m with 0.7m wall spread and 0.4m tall. Possibly a storage area or cart shed with wide open side entrance to the E. Not depicted on historic mapping.. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.3
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272541
Northings	899012

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, c0.4m tall and spread up to 1m wide, extends c190m to attach to the head dyke Asset 471. Not depicted on historic mapping. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.4
Asset/Event Name	Pen, Innis Aonar
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272486
Northing	898975
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small section of degraded stone and turf dyke under heather and grass, constructed adjacent to existing dyke Asset 471 atop a small little hillock. Defined by very small bank and some bare stones, standing 0.3m tall and spread up to 1m wide, forming a small pen. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.5
Asset/Event Name	Clearance cairn, Innis Aonar
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272539
Northing	899031
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A spread of field clearance stones partially under grass, deposited on a SE facing slope. Measures c13m by 6m and stands 0.7m tall, situated within the improved ground area associated with farmstead, but tall bracken and grass limit visibility. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.
Asset/Event Number	147.6
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272573
Northing	899024
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A length of possible stone and turf dyke, substantially robbed, under grass and bracken. All that remains are several visible boulders generally 1m long with a large protruding face of bedrock at the SE end 4m by 3m and standing 1m tall, along a length c25m long. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.
Asset/Event Number	147.7
Asset/Event Name	Clearance cairn, Innis Aonar
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272618
Northing	899075
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A spread of clearance material under grass, stands 0.8m tall and spread 5m by 3m. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.8
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272499
Northing	899115
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands 0.6m tall and spread up to 1m. C55m long. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.9
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272647
Northing	899086
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone and turf dyke under grass along the S side of the stream, reduced to ground level in parts. The dyke stands to 0.4m tall and spread up to 2m wide. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.
Asset/Event Number	147.9
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272588
Northing	899141
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone and turf dyke under grass along the S side of the stream, reduced to ground level in parts. The dyke stands to 0.4m tall and spread up to 2m wide. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.
Asset/Event Number	147.10
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272665
Northing	899055
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone and turf dyke under grass along the S side of the stream, reduced to ground level in parts. This

Appendix 1: Gazetteer of Heritage Assets and Events



portion ends at the stream as depicted. C0.6m tall and spread up to 1m wide. Not depicted on the 1st edition OS map. See Asset 147 for HER description.
OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.11
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272658
Northing	899087
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone dyke under grass on the N side of the stream, possibly reworked from the adjacent dyke Asset 147.10. c10m long and 0.6m tall, spread up to 1.5m wide. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.11
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272620
Northing	899139
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A c30m long portion of stone and turf dyke, part of the overall Asset 147.11 dyke that extends intermittently along the stream. Stands 0.5m tall and spread up to 1.5m wide. Not depicted on the 1st edition OS map. See Asset 147 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.12
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272499
Northing	899125
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands 0.5m tall and spread 1m wide, forming a small pen c11m by 6m adjoined to the inside of head dyke Asset 471. Possibly part of this is depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.13
Asset/Event Name	Enclosure, Innis Aonar
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272531
Northing	899101
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. L-shaped enclosure under bracken, measuring 21m by 13m over dykes. Composed of degraded stone and turf dyke that primarily is now represented by boulders standing up to 0.7m tall and spread 1m wide. Possibly part of this is depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	147.14
Asset/Event Name	Building, Innis Aonar
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272544
Northing	899101
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular building partially under heather, measures 11m by 5m. NW side is 0.5m tall and SE is up to 1m tall. 1m spread wall. See Asset 147 for HER description. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Asset/Event Number	147.15
Asset/Event Name	Clearance cairn, Innis Aonar
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272668
Northing	899066
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large spread of clearance over dyke Asset 147.10/471. Measures c40m long by c 8m wide and stands 1m tall. Comprises large boulders up to 1.2m long. Not depicted on the 1st edition OS map. See Asset 147 for HER description. OS. 1879. Sutherland, Sheet CIV, Survey date: 1873-74, Publication date: 1879.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	150.1
Asset/Event Name	Structure, Loch of Toftingall
Type of Asset/Event	Farmstead
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 16.00
HER Number	MHG18918
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	319604
Northing	952237
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An abandoned farmstead is depicted on the 1st edition OS map as comprising three unroofed rectangular buildings or pens within and adjacent to an L-shaped enclosure in improved ground. By the time of 2nd edition OS map, the pens have disappeared but the L-shaped enclosure and circular sheep stell are depicted. The area has since been extensively planted with commercial forestry and a mature plantation stands across the locations. The assets were not identified during the walkover survey. OS. 1877. Caithness XXIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXIII. Surveyed: 1905, Published: 1907. See Asset 150 for HER description.

Asset/Event Number	150.2
Asset/Event Name	Structure, Loch of Toftingall
Type of Asset/Event	Farmstead
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 16.00
HER Number	MHG18918
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	319605
Northing	952405
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An abandoned farmstead is depicted on the 1st edition OS map as comprising three unroofed rectangular buildings or pens within and adjacent to an L-shaped enclosure in improved ground. By the time of 2nd edition OS map, the pens have disappeared but the L-shaped enclosure and circular sheep stell are depicted. The area has since been extensively planted with commercial forestry and a mature plantation stands across the locations. The assets were not identified during the walkover survey. OS. 1877. Caithness XXIII Surveyed: 1871, Published: 1877. OS. 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Caithness-shire XXIII. Surveyed: 1905, Published: 1907. See Asset 150 for HER description.

Asset/Event Number	154.1
Asset/Event Name	Enclosure, Garabil
Type of Asset/Event	Enclosure
Date and/or Period	Unknown
Listing No./NRHE Number	NH56NE 26.00
HER Number	MHG14142
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256063
Northing	869026
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under moss and grass, extending 130m long, standing 0.6m tall and spread up to 1m wide. Consistent with field boundary on the 1st edition OS map.

Asset/Event Number	154.2
Asset/Event Name	Structure, Garabil
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 26.00
HER Number	MHG14142; MHG19702
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256092
Northing	868992
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone walled rectangular structure surviving to approx. 0.5m height. Not possible to survey in detail as largely overgrown with gorse, but appears to be 2-4m SW-NE and 1-2m SE-NW.

Asset/Event Number	154.3

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Clearance cairn, Garabil
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 26.00
HER Number	MHG14142; MHG19702
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256103
Northing	869002
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Roughly circular mound under grass, c1m in diameter and stands 0.25-5m tall.

Asset/Event Number	154.4
Asset/Event Name	Structure, Garabil
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 26.00
HER Number	MHG14142; MHG19702
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256143
Northing	869026
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular stone structure measuring 6m by 3m over walls, which stand 0.6m tall and spread 0.8m wide. A possible entrance sits in the SW elevation.. An unroofed structure or pen is depicted in the vicinity of this asset on the 1st edition OS map.

Asset/Event Number	155.1
Asset/Event Name	Building, Langergill
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318820
Northing	954778
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular unroofed stone building measuring c11m by 5m over walls. Adjoins building Asset 155.2 to the NE, but these are not exactly contemporary as this asset is slightly recessed from the build level that 155.2 presents. Separated by a single partition into two compartments. Walls survive largely to 0.5-1m height, but in places fully reduced to ground level. Depicted on the 1st edition OS map as a single roofed building alongside 155.2. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. Description from the HER: Longhouse farm (ND 1882 5477), comprising;A: Longhouse. Dimensions: 23 x 6m. Tripartite rectangular structure with a fireplace in the ESE unit. Orientation ESE-WNW.B: Longhouse/ outhouse. Dimensions: 7 x 5m. Bipartite rectangular structure following the same line as A. Orientation ESE-WNW.C: Mill. Dimensions: 7 x 5m. Rectangular structure associated with mill machinery and a lade running N lying 24m N of A. Orientation N-S.D: Dam. Diameter: 18m. Circular grassy bank 1.5m high at the other end of the lade.R J Mercer, NMRS MS/828/19, 1995A farmstead comprising one roofed long building, one unroofed building and three enclosures is depicted on the 1st edition of the 6-inch map (Caithness 1877, sheet xviii). An unroofed building is shown on the current edition of the OS 1:10000 map (1976).Information from RCAHMS (SAH) 6 December 1995
Asset/Event Number	155.2
Asset/Event Name	Structure, Langergill
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318832
Northing	954780
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ruinous roofless rectangular stone building measuring c15m by 5m over walls which stand between 0.5-1m tall and 0.25m wide along the long elevations, and up to 2m tall at the E gable end which also contains a fireplace. The building adjoins building Asset 155.1 to the W but is slightly wider, with masonry of a slightly higher quality, and so not a continuous building. Depicted on the 1st edition OS map as a single roofed building alongside 155.1. See Asset 115.1 for HER

Appendix 1: Gazetteer of Heritage Assets and Events



description. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	155.3
Asset/Event Name	Building, Langergill
Type of Asset/Event	Mill
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318790
Northing	954792
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular unroofed watermill building measuring c7m by 5m with walls c0.6m wide, composed of randomly coursed sandstone slabs that stand to 0.7m tall. Upright flagstones set along the SE wall. An external wheel pit measuring c4m long and 1m wide and 1m deep under grass extends along the external side of the NE elevation, and the metal drive shaft is still in situ. A lade system is evident on the 1st edition OS map but this does not depict the mill building itself (but it is depicted on the 2nd edition OS map), and the lades appear silted up and under grass today. See Asset 115.1 for HER description. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907.

Asset/Event Number	155.4
Asset/Event Name	Structure, Langergill
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318831
Northing	954767
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Concrete and stone block associated with the nearby buildings Assets 155.1 and 155.2, measuring c1m by 0.8m,

Appendix 1: Gazetteer of Heritage Assets and Events



drainage protrusion or similar embedded. See Asset 115.1 for HER description.

Asset/Event Number	155.5
Asset/Event Name	Structure, Langergill
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	N/A
Easting	318844
Northing	954782
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A square-shaped stone-built structure under tall vegetation, measuring 5m by 4m over walls, which are reduced to ground level and measure 0.25m wide. A possible pen or small structure. Does not appear to be depicted on either the 1st or 2nd edition OS maps. See Asset 115.1 for HER description. S

Asset/Event Number	155.6
Asset/Event Name	Enclosure, Langergill
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318826
Northing	954768
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under dense vegetation, forming a three-sided enclosure or possible kale yard measuring c4m by 3m over dykes. One upright flagstone against northern wall on inside. Appears to comprise the N end of an enclosure depicted on the 1st edition OS map. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. See Asset 115.1 for HER description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	155.7
Asset/Event Name	Hollow, Langergill
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	ND15SE 20.00
HER Number	MHG19047
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318816
Northing	954773
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small SW to NE oriented (1mx0.25m) hollow with a few slabs defining the NW side, and an upright Caithness flag embedded in the ground at the NW end, which has a hole seemingly drilled into the face. Possibly a storage pit or feed pit. See Asset 115.1 for HER description.

Asset/Event Number	167.1
Asset/Event Name	Building, Glack
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256382
Northing	873797
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A long linear stone building measuring 25m by 5.5m over walls, with at least two internal walls forming three rooms measuring internally 7m by 4m (S) 9m by 4m (central) and 3m by 3m (N). The N extent has been truncated by the adjacent track. Entrances and/or windows in E elevation only; N room the entrance is central, S room appears to have two at either end of the elevation. Walls are 0.6m wide and stand between 0.2-1m tall. It is depicted as a roofed building on the 1st edition OS map as part of the township of Glack.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	167.2
Asset/Event Name	Enclosure, Glack
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256397
Northing	873807
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small drystone enclosure measuring c15m by 15m, with walls standing up to 1.2 m tall and 1m wide. Pen 167.3 built onto the SE external corner. It is depicted on the 1st edition OS map as part of the township of Glack.

Asset/Event Number	167.3
Asset/Event Name	Pen, Glack
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256404
Northing	873801
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small stone- built pen abutting enclosure Asset 167.2. Measuring's 5m by 2.5m wide over walls that stand 0.7m tall and are 0.6m wide. A single partition evident. Possibly used as twinning pens. It is depicted on the 1st edition OS map as part of the township of Glack.

Asset/Event Number	167.4
Asset/Event Name	Kiln barn, Glack
Type of Asset/Event	Kiln barn

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256416
Northing	873807
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone building with a large kiln under grass erected in the SW end, measures 11m by 5m over walls which stand up to 1.2m tall and 0.6m wide, with the kiln standing to a height of 1.5m tall. The entrance to the building lies in the SW elevation towards the NE end of the building. The kiln box is still visible within the building but the bowl itself has infilled. It is depicted as a roofed building on the 1st edition OS map as part of the township of Glack.

Asset/Event Number	167.5
Asset/Event Name	Building, Glack
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256417
Northing	873757
Council	Highland
Condition:	Ruinous
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular building measuring c12m by 5m over walls, with a single partition wall delineating a SW room 3m by 3m internally and a NE room 6m by 3m internally; the latter room is much more poorly preserved with walls obscured by grass. The SW room walls measure 1.5m tall and 0.7m wide. Entrances not discernible. It is depicted as a roofed building on the 1st edition OS map as part of the township of Glack.

Asset/Event Number	167.6
Asset/Event Name	Building, Glack
Type of Asset/Event	Building

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256389
Northing	873773
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a terrace of stone buildings and further buildings or ancillary /pens extending from it. Broadly T-shaped arrangement with the principle NW/SE terraced buildings (possibly three, constructed end to end) measuring c30m by 5m over walls which stand to 1.2m tall and 0.5m wide in parts, but reduced to ground level in areas. The ancillary pens and structures to the NW measure 11m by 9m and are similar in form. Entrances not discernible. A roofed complex of this form is depicted on the 1st edition OS map as part of the township of Glack.

Asset/Event Number	167.7
Asset/Event Name	Enclosure, Glack
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27.00
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256353
Northing	873794
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure c60m by 40m, comprising a drystone dyke which stand to c0.8m tall and are 0.5-0.7m wide.

Asset/Event Number	167.8
Asset/Event Name	Enclosure, Glack
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27.00

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256469
Northing	873757
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure c110m by 65m composed of a drystone dyke that stands up to 0.5m tall and 0.5m wide, spread up to 1.2m wide.

Asset/Event Number	167.9
Asset/Event Name	Enclosure, Glack
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27.00
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256390
Northing	873707
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small enclosure c15m by 10m constructed along the drystone dyke Asset 360, and also composed of a drystone dyke that stands up to 0.7m tall and 0.6m wide.

Asset/Event Number	170.1
Asset/Event Name	Dyke, Fairburn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 9.00
HER Number	MHG24740
Status	Non-designated Heritage Asset
Section:	E1.1, E1.2
Easting	247602

Appendix 1: Gazetteer of Heritage Assets and Events



Northing	850664
Council	Highland
Condition:	Very degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under dense bracken, stands c0.5m tall and spread up to 1m wide.

Asset/Event Number	170.2
Asset/Event Name	Enclosure, Aultgowrie Bridge
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 9.00
HER Number	MHG24740
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247633
Northing	850753
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A square-shaped enclosure measuring 10m by 10m and defined by a stone and turf dyke under dense bracken and moss. Dyke stands 0.2-0.4m tall and spread up to 2m wide.

Asset/Event Number	170.3
Asset/Event Name	Structure, Aultgowrie Bridge
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 9.00
HER Number	MHG24740
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247616
Northing	850756
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Low

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A structure measuring c3m by 3m under dense bracken and moss, constructed from rubble drystone standing 0.5m tall and spread 1.2m wide. Possible pen or structure.
Asset/Event Number	170.4
Asset/Event Name	Farmstead, Aultgowrie Bridge
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45SE 9.00
HER Number	MHG24740
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247573
Northing	850777
Council	Highland
Condition:	Unknown
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An unroofed farmstead or pens are depicted on the 1st edition OS map. This area was under dense bracken at the time of survey, no structural remains were observed.
Asset/Event Number	177.1
Asset/Event Name	Building, Ardochy
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 41.00
HER Number	MHG23314
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	246093
Northing	843338
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Grass covered footings for a rectangular building measuring 16.5m by 5m over walls with a single internal partition. The NE partition forms the smaller of the two, measuring 4m by 4m internally, while the SW measures 15m by 4m internally. Walls spread up to 1m wide and stand up to 0.8m tall. A spread of field clearance (Asset 305) overlies the SW end and obscures the remains. Building is consistent with an unroofed structure depicted on the 1st edition OS map.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	177.2
Asset/Event Name	Enclosure, Ardochy
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 41.00
HER Number	MHG23314
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	246107
Northing	843331
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke extending to SE of building Asset 177.1, with the dyke under grass and standing to a height of 0.8m tall and spread up to 1.4m wide. Forms a small enclosure c15m by 13m to the SE side of the building, and is open to the SW end. Not depicted on the 1st edition OS map.

Asset/Event Number	179.1
Asset/Event Name	Hut circle, Cnoc a' Leacachan
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH57SE 34.00
HER Number	MHG28205
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257565
Northing	872571
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable hut circle under heather, measures c. 10m in diameter over banks, which stand to a height of 0.7m and are spread up to 1.5-2m wide.

Asset/Event Number	179.2

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Prehistoric clearance cairn, Cnoc a' Leacachan
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH57SE 34.00
HER Number	MHG28205
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257578
Northing	872620
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather measuring c6m by 4m and standing to a height of 0.6m.
Asset/Event Number	179.3
Asset/Event Name	Hut circle, Cnoc a' Leacachan
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH57SE 34.00
HER Number	MHG28205
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257565
Northing	872607
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under tall heather, somewhat difficult to discern dimensions as a result. Appears to measure c. 12m in diameter over banks, which stand to a height of 0.8m and are spread up to 2m wide.
Asset/Event Number	179.4
Asset/Event Name	Prehistoric clearance cairn, Cnoc a' Leacachan
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH57SE 34.00
HER Number	MHG56490

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257411
Northing	872634
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather measuring c7m by 4m and standing to a height of 0.7m.

Asset/Event Number	183.1
Asset/Event Name	Enclosure, Allt Bad a' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 55.00
HER Number	MHG28537
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274991
Northing	901974
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A diamond-shaped enclosure measuring 35m by 25m and composed of a drystone wall standing 0.7m tall and 0.7m wide. Not depicted on the 1st edition OS map.

Asset/Event Number	211.1
Asset/Event Name	Farmstead, Uaigh Bheag
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293603
Northing	913851
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Fair
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An unroofed single-storey stone cottage, measuring 13m by 8 over walls which stand to full height and relatively well-preserved, composed of mortared square-snecked rubble. The long elevations stand 2.5m tall and 0.7m wide, and the gable ends stand 4m tall and 0.75m wide. The S elevation contains a centrally situated entrance with flanking windows either side, and the N elevation contains a central entrance but no windows. Chimneys and associated fireplaces are present in each gable. The wooden roof rafters have collapsed into the building interior, prohibiting access. Some stone slates still visible along the gable end. Forms the main farmstead building for the complex. Depicted on the 1st and 2nd edition OS maps as roofed, although it appears as an L-shaped building with an extension to the SW at the SE corner. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	211.2
Asset/Event Name	Enclosure, Uaigh Bheag
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293621
Northing	913839
Council	Highland
Condition:	Fair
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Square drystone enclosure measuring 16m 16m, with the drystone wall standing 0.8m tall and 0.6m wide. Depicted on the 1st and 2nd edition OS maps, but appears more rounded in these. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	211.3
Asset/Event Name	Building, Uaigh Bheag
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	293618
Northing	913865
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An unroofed stone storage building, forming part of the outbuildings associated with the main farmstead building Asset 211.1. Measures c9m long by 5m wide over walls, attached to building Asset 211.4. Contains exterior small rectangular storage building, and an internal L shaped corridor. Walls stand c1.3m tall and measurs 0.5m wide, access gained from the S elevation. Depicted on the 1st and 2nd edition OS maps. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	211.4
Asset/Event Name	Building, Uaigh Bheag
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293607
Northing	913871
Council	Highland
Condition:	Fair
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Outbuildings located to the rear (N) of the main farmstead building (Asset 211.1), comprising a somewhat sprawling range with four partitions delinieating five rooms, access to which is gained from the S elevation. Walls survive best at the E, W and N sides, up to 2m in height and measuring 0.6m wide, with the S elevation partially robbed and reduced to a low level. Building Asset 211.3 stands to the immediate E of these. Depicted on the 1st and 2nd edition OS maps. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	211.5
Asset/Event Name	Corn drying kiln, Uaigh Bheag
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293592
Northing	913859
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Within the SW end of a length of drystone wall (Asset 211.6) is an odd portion of drystone wall with a square shaped opening overlain by long flat lintels on either side, continuing through the wall. The opening is 0.5m tall and 0.4m wide, with the SE side flush with the wall face but the NW side bulging out from the wall to 1.4m wide (wall is 0.6m wide) and 2.5m long until it narrows to the wall width as it continues to the NE. The opening continues through the entirety of the block of wall, and is reminiscent of the flue/heat box of a corn-drying kiln. Although no stone is obvious beyond it, there is a prominent mound dipping away to the NW. It is possible that this represents the remnants of an old kiln, mostly robbed away, with only a small portion retained where it could be incorporated into the drystone wall. Not depicted on the 1st and 2nd edition OS maps. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.
Asset/Event Number	211.6
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293591
Northing	913866
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke, breached in places, adjoining the buildings Asset 211.1 and 211.4, and incorporating possible kiln remnants Asset 211.5. Dyke is c16m long and 0.6m wide and stands to c0.7m tall at tallest point. Not depicted on the 1st and 2nd edition OS maps. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	211.7
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293635
Northing	913861
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under grass and bracken, measuring c290m long and stands 0.5m tall and spread up to 1.5m wide. Continues to the SW as Asset 425. Depicted on the 1st and 2nd edition OS maps, but there is an extension (c55m long) to the SE that then turns S that although extant is not present on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	211.8
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293684
Northing	913909
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible length of very degraded dyke under bracken. Stone visible and spread up to 4m wide but no real height to the feature. Runs along N side of Glen Loth burn so possibly just a rough shoring/stream augmentation, but does appear to joining to the more defined dyke 211.7 that continues around to the SW. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	211.9
Asset/Event Name	Clearance cairn, Uaigh Bheag
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293608
Northing	913860
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under moss and grass, measuring 11m by 5m and standing 1m tall. May conceal structural remains below.

Asset/Event Number	211.10
Asset/Event Name	Structure, Uaigh Bheag
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293615
Northing	913816
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible structure under dense, tall bracken, very difficult to determine the nature of it due to the vegetation. Appears as a mound c13m by 5m, potentially rectangular, some 0.6m tall. Extent broadly estimated from walking over it. Potentially a very degraded long house/similar. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	214.1

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Building, Uaigh Bheag
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293986
Northing	914210
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under bracken and grass, 20m by 5m over walls with one internal partition. Both compartments measures 9m by 3m internally. Entrances to both possibly in the NW elevation but walls degraded to ground level in parts and difficult to tell. Walls stand 1m tall at tallest point and spread up to 1.2m wide. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	214.2
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293991
Northing	914204
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible stone and turf dyke under bracken, very degraded and stands to 0.3m tall and spread up to 1.5m wide, measuring c12m by 5m. Possibly a kale yard/garden for the adjacent building Asset 214.1 to N. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	238.1
Asset/Event Name	An Dun fort, Cornhill Wood
Type of Asset/Event	Fort
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH45SE 57.00
HER Number	MHG60939
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245841
Northing	851962
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Inner wall of promontory fort Asset 238. The wall core can no longer be seen, and w consists of a wide spread of stones (c4m wide and 1.5m tall) aligned roughly N/S. The continuation of the inner wall face beyond the extent surveyed could not be identified.

Asset/Event Number	238.2
Asset/Event Name	An Dun fort, Cornhill Wood
Type of Asset/Event	Fort
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH45SE 57.00
HER Number	MHG60939
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245839
Northing	851955
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey. First line of outer defences of fort Asset 238/MHG60939, a defensive bank under dense bracken and trees.

Asset/Event Number	238.3
Asset/Event Name	An Dun fort, Cornhill Wood
Type of Asset/Event	Fort
Date and/or Period	Prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	NH45SE 57.00
HER Number	MHG60939
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245824
Northing	851956
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Outer (third) wall of fort Asset 238/MHG60939, a defensive bank/wall under dense bracken and trees.

Asset/Event Number	242
Asset/Event Name	Clearance cairn, Breakachy
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	245682
Northing	844276
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn under moss, measuring 4m by 3m and standing 0.8m tall. Comprises large angular stones. Not depicted on the 1st or 2nd edition OS maps.

Asset/Event Number	243.1
Asset/Event Name	Dyke, Breakachy
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 37
HER Number	MHG23310
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245613

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	844217
Council	Highland
Condition:	Very degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Lengths of stone and turf dyke under heather and grass, stands up to 0.3m tall and spread up to 3m wide, some stone visible in places. Associated with the Break achy farmstead MHG23310. Not depicted on either the 1st or 2nd edition OS maps.

Asset/Event Number	243.2
Asset/Event Name	Building, Breakachy
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 37
HER Number	MHG23310
Status	Non-designated Heritage Asset
Section:	
Easting	245566
Northings	844215
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous remains of a rectangular building under bracken, partially revetted into the NE-facing slope. Measures 17m by 4.5m over 0.8m wide walls that stand up to 1.2m tall at SW end and 0.4m tall at NE end. Has a central partition but poorly defined due to vegetation. Possible entrances uncertain. Consistent with a roofless building depicted on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876

Asset/Event Number	243.4
Asset/Event Name	Clearance cairn, Breakachy
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 37
HER Number	MHG23310
Status	Non-designated Heritage Asset
Section:	
Easting	245575
Northings	844227

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn of large boulders under bracken. Measures by 13m by 8m and stands 0.8m tall. May conceal structural remains though none specifically depicted on the 1st or 2nd edition OS map in the vicinity.

Asset/Event Number	243.5
Asset/Event Name	Corn drying kiln, Breakachy
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 37
HER Number	MHG23310
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245584
Northing	844190
Council	Highland
Condition:	Ruinous
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large spread of field clearance c8m in diameter and standing 0.7m tall situate don the NE-facing slope. Likely obscures a corn-drying kiln considering the density of stone and slope location, but no internal features such as the bowl or flue could be discerned. No structures depicted in this locale on the 1st or 2nd edition OS maps.

Asset/Event Number	244
Asset/Event Name	Enclosure, Breakachy
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245519
Northing	844399
Council	Highland
Condition:	Very degraded

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub-circular enclosure under tall heather, constructed from a turf and stone dyke standing to 1.2m tall and spread up to 2m, irregularly-shaped in plan and measuring c50m by 40m over banks. Interior is obscured by heather and grass and no clear entrances discernible. Not depicted on historic maps.

Asset/Event Number	245
Asset/Event Name	Clearance cairn, Breakachy
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	245594
Northing	844465
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn under moss, measuring 8m by 3m and standing 0.6m tall. Comprises large angular stones.

Asset/Event Number	246
Asset/Event Name	Track, Breakachy
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	245211
Northing	844962
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track under heather and grass, measures 2m wide and extends NW/SE across the survey corridor. The track is

Appendix 1: Gazetteer of Heritage Assets and Events



still in use. Depicted as a track on the 1st edition OS map.
OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876

Asset/Event Number	247
Asset/Event Name	
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - Number not assigned

Asset/Event Number	248.1
Asset/Event Name	Dun, Auchmore Wood
Type of Asset/Event	Dun
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247852
Northing	850577
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remains of a probable dun under dense bracken, moss and mature coniferous trees, somewhat disturbed by commercial forestry operations which have impacted the SW half of the structure. The structure appears oval-shaped in plan, c18m by 10m over walls, but it is difficult to discern its form given the overlying forestry and disturbance. It is best preserved along the NW side where the wall stands to an internal height of c1.4m, and as much as 2m tall externally and up to 2m wide, with rubble/wall core also visible spilling over the edge of the ravine downhill. Within the interior was recorded spreads of stone which may be internal features or material redeposited related to the forestry operations. Not depicted on any historic

Appendix 1: Gazetteer of Heritage Assets and Events



mapping, but the area is shown under dense woodland (Auchmore Wood) on the 1st edition OS map, and thus likely why the asset was not recorded previously.
OS. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	248.2
Asset/Event Name	Dun, Auchmore Wood
Type of Asset/Event	Structure
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247853
Northing	850574
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Medium
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Mounded piles of angular stone within the interior of the probable dun, the extent and dimensions difficult to determine due to the bracken and trees. Possibly internal features related to the dun, or redeposited material from forestry operations. See 248.1 for full description.

Asset/Event Number	249
Asset/Event Name	
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - Number not assigned

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	250
Asset/Event Name	
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - Number not assigned

Asset/Event Number	251
Asset/Event Name	Dyke, Strath Sgitheach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252214
Northing	862809
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under moss, measures 0.5m tall and spread 1m wide, extends c520m. This is shown on the 1st edition OS map as a parish boundary between Dingwall parish to the E and Fodderty parish to the W. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survved: 1875-6, Published: 1880

Asset/Event Number	252
Asset/Event Name	Ditch, Strath Sgitheach
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252326
Northing	862676
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch under grass 0.5m wide and 0.5-0.8m deep, extends down the strath c210m. Runs parallel with the degraded dyke Asset 251 which likely was sourced from this. Not depicted on historic mapping.
Asset/Event Number	253
Asset/Event Name	Shieling, Strath Sgitheach
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 31
HER Number	MHG62708
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252344
Northing	863140
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable shieling measuring c5m by 5m under grass with poorly defined banks spread c1m wide and 0.3m tall. Situated on a small knoll overlooking Strath Sgitheach. Not depicted on historic mapping.
Asset/Event Number	254
Asset/Event Name	Borrow pit, Strath Sgitheach
Type of Asset/Event	Quarry
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	252519
Northing	863208
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An open, kidney shaped borrow pit under grass, measures 12m long by 7m wide and 1.5m deep. Not depicted on historic mapping.

Asset/Event Number	255
Asset/Event Name	Bridge, Strath Sgitheach
Type of Asset/Event	Bridge
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252600
Northing	863300
Council	Highland
Condition:	Good
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small stone-built culvert/bridge formed by a rubble spread 3m by 2m wide, constructed over a small unnamed watercourse, along the Strath Sgitheach access track. Not depicted on historic mapping.

Asset/Event Number	256
Asset/Event Name	Hut circle, Strath Sgitheach
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH56SW 91.00
HER Number	MHG8925; MHG62693
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252544
Northing	863276
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Very Degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded hut circle under grass and heather, measures c13m in diameter over walls. Two large stones on SE side may represent the remains of a porch. Walls spread up to 2m wide and stand to 0.3m tall.

Asset/Event Number	257
Asset/Event Name	Culvert, Strath Sgitheach
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252599
Northing	863346
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rubble culvert extending below the track, c3m, with an augmented stream course either side, and a plastic pipe. Not depicted on historic mapping.

Asset/Event Number	258
Asset/Event Name	Dyke, Strath Sgitheach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252712
Northing	863367
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone boundary dyke

Appendix 1: Gazetteer of Heritage Assets and Events



standing 0.6m tall and spread 0.6m wide, extends across the survey corridor from sheep fold Asset 207 and outwith the corridor to the SE. Depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Surveyed: 1875-6, Published: 1880

Asset/Event Number	259
Asset/Event Name	Culvert, Strath Sgitheach
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	252608
Northing	863389
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rubble culvert extending below the track with an augmented stream course either side, and a plastic pipe.

Asset/Event Number	260.1
Asset/Event Name	Farmstead, Strath Sgitheach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253105
Northing	863778
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ruinous rectangular farmstead with an ancillary building or pen extending from the NW end. The main building is constructed from roughly dressed stone and natural boulders and measures 20m by 5m over walls, which stand 1.8m tall and measure 0.8m wide, and contains a central partition delineating two rooms (S: 7m by 4m, N: 12m by 4m) with entrances to each in the SW elevation. The ancillary structure in the NW appears later in date, constructed of mortared red brick and measuring c3m by 4m. The building is depicted as one of two roofed buildings

Appendix 1: Gazetteer of Heritage Assets and Events



on the 1st edition OS map, and by the time of the 2nd edition only a single roofed building (this asset) is depicted.

OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survied: 1875-6, Published: 1880

OS. 1907. Ross and Cromarty LXXVI, Survied: 1904, Published: 1880

Asset/Event Number	260.2
Asset/Event Name	Enclosure, Strath Sgitheach
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253206
Northing	863735
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A trapezoidal shaped enclosure measuring c150m by 120m, formed by a drystone dyke under moss and grass that stands 0.6m tall in some places, though reduced to ground level in others and spread up to 2m wide. Entrance in the SW corner. The enclosure forms part of the farmstead remains associated with the building it encloses (Asset 260.1), and is depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survied: 1875-6, Published: 1880
Asset/Event Number	260.3
Asset/Event Name	Clearance cairn, Sgitheach
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	253203
Northing	863804
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A spread of field clearance

Appendix 1: Gazetteer of Heritage Assets and Events



c6m in diameter, deposited atop a small natural knoll containing the cup-marked stone Asset 135, and within enclosure Asset 260.2.

Asset/Event Number	261
Asset/Event Name	Dyke, Strath Sgitheach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	253578
Northing	864585
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded drystone dyke measuring c100m long and 0.8m tall and 0.6m wide composed of a double-skin of roughly dressed stone with smaller hearting material between. Extends along the edge of a commercial forestry plantation and beyond the survey corridor to the NW and SE. This is shown on the 1st edition OS map as a parish boundary between Dingwall parish to the W and Kiltarn parish to the E. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survied: 1875-6, Published: 1880

Asset/Event Number	262
Asset/Event Name	Building, Sgitheach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251947
Northing	862895
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Poorly defined turf and stone footings for a rectangular structure under moss and grass measuring c6.5m by 4m over walls, which are spread up to 1m wide and stand to a height of 0.3m, with no easily

Appendix 1: Gazetteer of Heritage Assets and Events

discernible entrance. It has been constructed against the NE face of dyke Asset 263. No structures are depicted on the 1st edition OS map and the complex therefore predates the late 19th century.

OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survied: 1875-6, Published: 1880

Asset/Event Number	263
Asset/Event Name	Dyke, Strath Sgitheach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	NA
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251932
Northing	862832
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass barely visible as very-poorly preserved bank spread up to 1m wide and standing 0.2m tall, extending c160m, and sometimes represented only by very intermittent boulders, suggesting a possible turf component that has substantially degraded away. A structure (Asset 262) has been constructed against the NW elevation, with a another probable building (Asset 264) lying slightly further SE. No structures depicted here on the 1st edition OS map and so it predates the late 19th century. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survied: 1875-6, Published: 1880

Asset/Event Number	264
Asset/Event Name	Building, Strath Sgitheach
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	251940
Northing	862834
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low

Appendix 1: Gazetteer of Heritage Assets and Events

Description	*Recorded by AOC Archaeology during 2024 walkover survey. Poorly defined stone and turf footings for a rectangular building measuring 8m by 4m over wall spread. The walls survive as low banks spread 1.5m wide and standing 0.2m tall. No discernible entrances. It lies just to the SE of a similarly degraded dyke (Asset 263) and S of another poorly preserved building (Asset 262). No structures are depicted on the 1st edition OS map and the complex therefore predates the late 19th century. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI, Survyed: 1875-6, Published: 1880
Asset/Event Number	265
Asset/Event Name	Gravel bund, Muir of Fairburn
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247918
Northing	852023
Council	Highland
Condition:	Good
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A modern gravel bund c2m tall and extending c12m, situated to the north of the existing access track.
Asset/Event Number	267
Asset/Event Name	Dyke, Fairburn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247489
Northing	851927
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke measuring c250m long, and standing 1m wide at base and tapering to 0.7m, does not survive to full height. Double-skinned with roughly dressed rubble and a core of smaller hearting stones.

Appendix 1: Gazetteer of Heritage Assets and Events



Depicted on the 1st edition OS map.

OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	268
Asset/Event Name	Dyke, Fairburn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247589
Northing	852492
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke field boundary extending c115m around field, well-preserved along the N side but very degraded along the W and S sides, breached by gate in the SE corner. Where degraded the spread is up to 3m wide under grass, standing c0.5m tall. In well preserved section it stands 1-1.3m tall with a splayed rubble profile with a rough coping of edge-set roughly shaped stones. Depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	269
Asset/Event Name	Clearance cairn, Fairburn
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247465
Northing	852357
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Spread of post-medieval field clearance partially under grass at edge of agricultural field, stands 0.2-0.6m tall and composed of large boulders and smaller stones.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	270
Asset/Event Name	Bank, Muir of Fairburn
Type of Asset/Event	Bank
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247614
Northing	852868
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Linear stone and turf bank under moss running along edge of field, 300m long and 4m wide with 1.5m wide drainage ditch running along W side. Depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	271
Asset/Event Name	Dyke, East Mains of Fairburn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247643
Northing	853038
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A pair of drystone dykes flanking the road at East Mains of Fairburn. The dykes are partially revetted into the earth on the S sides, with the N of the pair situated at a lower elevation to the S. Both measure c0.4-0.6m tall and c1m wide, tapering to 0.3-4m wide at the top, with dressed boulders as coping stones. The N dyke has a hedge planted over the top of it. Both dykes are edged by mature deciduous trees. The dykes are depicted as field boundaries on both the 1st and 2nd edition OS maps, but only the 1st edition map shows some trees. OS. 1881. Ross-shire & Cromarty shire (Mainland XCVIII), Surveyed: 1876, Published: 1881.

Appendix 1: Gazetteer of Heritage Assets and Events

OS. 1907. Ross & Cromarty XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	273
Asset/Event Name	Dyke, Fairburn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247427
Northing	853176
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke extending through fields, constructed from roughly dressed stone. Measures 0.8m wide at base and tapers to 0.3m at top, standing c1-1.3m tall. C210m long. Depicted on the 1st and 2nd edition OS maps. OS. 1881. Ross-shire & Cromarty shire (Mainland XCVIII), Surveyed: 1876, Published: 1881. OS. 1907. Ross & Cromarty XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	274
Asset/Event Name	Dyke, Fairburn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247245
Northing	853703
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a drystone dyke enclosing a field, breached in several areas and reduced to ground height. Generally of rubble construction, stands between 0.4-0.8m tall and spread up to 1.5m wide and extended outwith the survey corridor to the E and W. Some rubble coping in parts. Depicted on the 1st and 2nd edition OS maps.

Appendix 1: Gazetteer of Heritage Assets and Events



OS. 1881. Ross-shire & Cromarty shire (Mainland XCVIII), Surveyed: 1876, Published: 1881.
OS. 1907. Ross & Cromarty XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	275
Asset/Event Name	Dyke, Wester Balloch
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247551
Northing	853800
Council	Highland
Condition:	Degraded
Alignment:	WNW/ESE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Pair of drystone dykes extending along the road edge on the approach to Marybank, measuring c1m tall and 0.5m wide. Mature deciduous trees planted alongside these. Consistent with field boundaries depicted on the 1st and 2nd edition OS maps, but trees are shown only on the 1st edition OS map. OS. 1881. Ross-shire & Cromarty shire (Mainland XCVIII), Surveyed: 1876, Published: 1881. OS. 1907. Ross & Cromarty XCVIII, Surveyed: 1876, Published: 1881.
Asset/Event Number	276
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247521
Northing	850677
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable clearance cairn c5m by 3m and 1m tall, under dense bracken which made determining extents difficult.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	277
Asset/Event Name	Building, Aultgowrie Bridge
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	247672
Northing	850631
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible footings for a building, under bracken and moss and difficult to discern form and extent. Possibly rectangular and 5.5m by 2.5m wide over walls, which are spread up to 1.5m wide and 0.4m tall. Not depicted on historic mapping.

Asset/Event Number	279
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	247595
Northing	850587
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A field clearance cairn under moss and trees, measures 4m in diameter and stands 0.75m tall.

Asset/Event Number	280
Asset/Event Name	Dyke, Fairburn

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1, E1.2
Easting	247418
Northing	850706
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, standing 0.2m tall and spread up to 1.5m wide, very degraded.

Asset/Event Number	281
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62286
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247450
Northing	850639
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn/spread of stones under grass, measuring 30m by 5m and 0.1m tall.

Asset/Event Number	282
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62286
Status	Non-designated Heritage Asset
Section:	E1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	247470
Northing	850674
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn of stones under grass, measuring 2m in diameter and 0.3m tall.

Asset/Event Number	283
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62286
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247454
Northing	850683
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn of stones under moss, measuring 1m in diameter and 0.1m tall.

Asset/Event Number	284
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62286
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247453
Northing	850734
Council	Highland
Condition:	Degraded
Alignment:	N/S

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn/spread of stones under grass, measuring 40m by 8m and 0.1m tall.
Asset/Event Number	285
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62286
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247390
Northing	850735
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn/spread of stones under grass at field edge, measuring 22m by 12m by 5m and 0.3m tall.
Asset/Event Number	286.1
Asset/Event Name	Farmstead, Aultgowrie Bridge
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247611
Northing	850944
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone walls of a rectangular building c10m by 6m over walls which stand up between 0.5-1.2m tall, entrance possibly in E end of structure. Enclosed by dyke 286.2. Consistent with building depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875 https://her.highland.gov.uk/Monument/MHG62288

Appendix 1: Gazetteer of Heritage Assets and Events

Remains of a farmstead near Aultgowrie Bridge.
A farmstead comprising one roofed long building with an attached yard or enclosure is depicted on the 1st edition of the OS 25-inch map. <1>
<1> SHG23422 Image/Map: Ordnance Survey. 1871-76. Ordnance Survey 1st edition 25 inch map: Ross-shire. Digital. XY

Asset/Event Number	286.2
Asset/Event Name	Dyke, Aultgowrie Bridge
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247614
Northing	850946
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under bracken and moss extending to the north of building Asset 286.1. Measures c25m long and stands 0.3m tall and spread up to 1m. Depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875 https://her.highland.gov.uk/Monument/MHG62288 Remains of a farmstead near Aultgowrie Bridge. A farmstead comprising one roofed long building with an attached yard or enclosure is depicted on the 1st edition of the OS 25-inch map. <1> Sources/Archives (1) <1> SHG23422 Image/Map: Ordnance Survey. 1871-76. Ordnance Survey 1st edition 25 inch map: Ross-shire. Digital. XY

Asset/Event Number	287
Asset/Event Name	Dyke, Canreavan
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	247683
Northing	850562
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke under moss and grass, appeared c0.3m tall and spread perhaps 1m wide, extending along the S bank of the Allt Goibhre - length unknown. Viewed from N side of the river as not directly accessible due to land access permissions. Consistent with field boundary depicted on the 2nd edition OS map. OS. 1907. Inverness-shire - Mainland II, Surveyed: 1902, Published: 1907

Asset/Event Number	288.1
Asset/Event Name	Building, Aultgowrie Bridge
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62289
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247536
Northing	851065
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular building with drystone walls, measuring 16m 4m over walls with single internal partition. Walls stand 1m tall and 0.7m wide. Entrance in W half of the N side. Potentially correlates with a building depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875 https://her.highland.gov.uk/Monument/MHG62289 Remains of a farmstead to the northwest of Aultgowrie Bridge. A farmstead comprising one roofed long building with an attached yard or enclosure with two smaller huts to the south is depicted on the 1st edition of the OS 25-inch map. <1> Earthworks of the farmstead are visible on vertical aerial photographs taken in 2020. <2> <1> SHG23422 Image/Map: Ordnance Survey. 1871-76. Ordnance Survey 1st edition 25 inch map: Ross-shire. Digital. <2> SHG28725 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2020. Getmapping aerial photography 2020. XY

Asset/Event Number	288.2
Asset/Event Name	Enclosure, Aultgowrie Bridge
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	MHG62289
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247536
Northing	851078
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular enclosure measuring c20m by 10m and composed of a drystone dyke under dense bracken and moss, standing 0.3m tall and spread up to 1.5m wide. Enclosure stands on the NW side of the farmstead Asset 288.1, possibly a kale yard. Depicted on the 1st edition OS map. For HER description see Asset 288.1. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	288.3
Asset/Event Name	Enclosure, Aultgowrie Bridge
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62289
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247533
Northing	851089
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke under bracken and moss, spread 2m wide and standing 1m tall. Forms enclosure 14m by 10m in size. Potentially correlates with a boundary depicted on the 1st edition OS map. For HER description see Asset 288.1. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	289
Asset/Event Name	Building, Bridgepark
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247411
Northing	851389
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf footings for rectangular building under thick broom vegetation, 15.8m by 4.5m over walls, which are spread 1m wide and stand 0.8m tall. Consistent with a structure depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	290
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairns
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247475
Northing	851093
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of field clearance under moss and tall bracken so single large polygon recorded 40m by 25m. Clearance material stands to 0.7m tall. Could obscure underlying structural remains.

Asset/Event Number	291
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	247352
Northing	851322
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass and broom, stands 0.5m tall and spread up to 3m wide. Reduced to ground level in parts. Consistent with field boundary depicted on the 1st edition OS map. OS. 1875. Inverness-shire (Mainland) II, Surveyed: 1872, Published: 1875

Asset/Event Number	292
Asset/Event Name	Clearance cairn, Aultgowrie Bridge
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247447
Northing	851059
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of field clearance under moss and tall bracken so single large polygon recorded c16m by 8m. Clearance material stands to 0.7m tall. Could obscure underlying structural remains.

Asset/Event Number	293
Asset/Event Name	Enclosure, Aultgowrie Bridge
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247415
Northing	851091
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular enclosure measuring c30m by 10m, composed of a drystone dyke under dense bracken and grass. The dyke stands 0.5m tall and spread up to 2m wide. Not depicted on historic mapping.

Asset/Event Number	294
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247429
Northing	851280
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands up to 0.5m tall and spread up to 3m wide and extends c190m long. This is consistent with a boundary shown on the 1st edition OS map, which dissipates similarly to the W, but appears to have once formed an enclosure delineating an area of improved ground. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	295
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247455
Northing	851164
Council	Highland
Condition:	Degraded
Alignment:	ENE/WSW

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke standing up to 1.6m tall and 0.7m wide, extending c170m long, constructed from rounded stones. Appears to be continued by Asset 516, and is consistent with a boundary shown on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	296
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247532
Northing	851282
Council	Highland
Condition:	Fair
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke, standing to full height of 1m tall and measuring 1m wide at base, tapering to 0.2m at top. Boulder construction and well-preserved. Depicted on 1st edition OS map as a field boundary. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	297
Asset/Event Name	Clearance cairn, Bridgepark
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247493
Northing	851376
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of field clearance under moss and tall bracken so single large polygon recorded 50m by 30m. Clearance

Appendix 1: Gazetteer of Heritage Assets and Events



material stands to 1m tall in places. Could obscure underlying structural remains.

Asset/Event Number	298
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247394
Northing	851447
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass and trees, stands up to 0.4m tall and spread up to 2m wide, c50m long and very poorly preserved in parts. Broadly correlated with a degraded boundary shown on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII, Surveyed: 1876, Published: 1881.

Asset/Event Number	299
Asset/Event Name	Dyke, Ruttie Wood
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.3
Easting	247788
Northing	842785
Council	Highland
Condition:	Degraded
Alignment:	NNE/SSW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass and trees, reduced to ground level in parts and difficult to discern to the S. Stands up to 0.6m tall and spread up to 2m wide, c90m long. Consistent with a boundary depicted on the 1st edition OS map. Truncated to the N by the existing track and not discerned in the commercial forestry beyond this. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	300
Asset/Event Name	Dyke, Ruttle Wood
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.3
Easting	247927
Northing	842806
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands up to 1.2m tall and spread 2.5m wide. Consistent with field boundary depicted on the 1st edition OS map. Continues outwith the survey corridor to the NE and SW. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Asset/Event Number	301
Asset/Event Name	Dyke, Ardochy
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	246311
Northing	843948
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under grass, visible for c120m along field edge. Stands up to 0.5m tall and spread up to 2.5m wide. Consistent with field boundary depicted on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Asset/Event Number	302

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Clearance cairn, Ardochy
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.2 (in access track corridor to section)
Easting	246317
Northing	843952
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of field clearance under moss and field edge measuring 20m by 4m and standing 0.6m tall.

Asset/Event Number	303
Asset/Event Name	Culvert, Ardochy
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246165
Northing	843392
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A grass covered stone-built culvert forming a crossing point over a field ditch. Plastic pipe inserted through with stone lintels atop. At least 4m wide but grass obscures dimensions. Consistent with a field boundary depicted on the 2nd edition OS map onwards. OS. 1906. Inverness-shire Mainland X, Surveyed: 1902, Published: 1906.

Asset/Event Number	304
Asset/Event Name	Clearance cairn, Torr a' Bhealaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.3 (in access track corridor to section)
Easting	246534
Northing	842990
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn of large boulders measuring 6m by 4m adjacent to track Asset 222.
Asset/Event Number	305
Asset/Event Name	Clearance cairn, Ardochy
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH44SE 41.00
HER Number	MHG23314
Status	Non-designated Heritage Asset
Section:	E1.2
Easting	246087
Northing	843331
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under moss and grass, measuring 8m by 6m and 0.5m tall.
Asset/Event Number	306
Asset/Event Name	Clearance cairn, Cnocnagrashaig
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.2, E1.3
Easting	246185

Appendix 1: Gazetteer of Heritage Assets and Events



Northing	843246
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn of stones under moss, measuring 13m in diameter and 0.5m tall.

Asset/Event Number	307
Asset/Event Name	Dyke, Strathconon
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240809
Northing	856103
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass and standing up to 1m tall spread up to 2m, c125m long. It continues to the W in the form of a drystone dyke (Asset 308). Consistent with a field boundary on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Asset/Event Number	308
Asset/Event Name	Dyke, Strathconon
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240629
Northing	856137
Council	Highland
Condition:	Fair

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke c300m long and standing up to 1.6m tall and 0.6m wide top and 0.8m wide at base, slightly splayed and double faced wall with large roughly dressed blocks and a core of rubble. Coping stones set edge ways across the top. It continues to the E in the form of a degraded stone and turf dyke (Asset 307). Consistent with a field boundary on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Asset/Event Number	309
Asset/Event Name	Flood defence, River Conon
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240836
Northing	855659
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large flood embankment under bracken, gorse and trees, extending along the N side of the River Conon. Stands between 1.5-2m tall and spread up to 5m wide with a rounded profile. Extends beyond the survey corridor to the E and W. Depicted on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Asset/Event Number	310
Asset/Event Name	Dyke, Comrie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240769
Northing	855802
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shallow linear ditch under grass, measures c470m long, c1m wide and 0.3m deep. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.
Asset/Event Number	311
Asset/Event Name	Ditch, Comrie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	240991
Northing	855826
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shallow linear ditch under grass, measures c470m long, c1.8m wide and 0.6m deep. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.
Asset/Event Number	312
Asset/Event Name	Culvert, Comrie
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	240963
Northing	855950
Council	Highland
Condition:	Good
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone-built culvert, measuring 3m wide and 4m long and stands c1m deep, situated over field ditch Asset 311, with a farm track running over the top of it. The ditch is depicted on the 1st edition OS map,

Appendix 1: Gazetteer of Heritage Assets and Events



but the culvert is not identified.
OS. 1876. Inverness-shire (Mainland) X, Surveyed: 1872, Published: 1876.

Asset/Event Number	313.1
Asset/Event Name	Peat cutting, Carn an Daraich
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240998
Northing	857820
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under heather and grass with banks up to 0.4m deep. Disu-used.

Asset/Event Number	313.2
Asset/Event Name	Peat cutting, Carn an Daraich
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240985
Northing	857813
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under heather and grass with banks up to 0.4m deep. Disu-used.

Asset/Event Number	313.3
Asset/Event Name	Peat cutting, Carn an Daraich

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240998
Northing	857791
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under heather and grass with banks up to 0.4m deep. Dis-used.

Asset/Event Number	313.4
Asset/Event Name	Peat cutting, Carn an Daraich
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241025
Northing	857774
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under heather and grass with banks up to 0.4m deep. Dis-used.

Asset/Event Number	314
Asset/Event Name	Pen, Loch Ruith a' Phuill
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	241390
Northing	858327
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone wall constructed into a circular pen c16m in diameter, under bracken and grass. Walls stand 0.6m tall at their tallest and spread up to 1.5m wide. Not depicted on historic mapping.

Asset/Event Number	315
Asset/Event Name	Hut circle, Strathconon
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	240666
Northing	856268
Council	Highland
Condition:	Unknown
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable hut circle is visible on phase 1 LiDAR imagery immediately N of an existing pylon. Could not be surveyed/ground/-proofed due to dense gorse.

Asset/Event Number	316
Asset/Event Name	Ditch, Loch Ruith a' Phuill
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	241569
Northing	858281
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch c45m long, c0.2m wide and 0.4m deep, leading from relict track (Asset 307) to water course to the S. Not depicted on historic maps.
Asset/Event Number	317
Asset/Event Name	Track, Loch Ruith a' Phuill
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	241549
Northing	858296
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track under grass, c3m wide, along the W side of Loch a Phuill. Under grass and slightly raised up from the boggier ground, leading N to Druim-cruaidh and Cadha-fliuch farmsteads. Not depicted on historic mapping.
Asset/Event Number	318.1
Asset/Event Name	Peat cutting, Carn an Daraich
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241533
Northing	857936
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under grass, 30m by 10m and 0.3m deep, along the flat terrace of Cairn an Daraich. Dis-used.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	318.2
Asset/Event Name	Peat cutting, Carn an Daraich
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241457
Northing	857887
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under grass, 30m by 20m and 0.3m deep, along the flat terrace of Cairn an Daraich. Dis-used.

Asset/Event Number	318.3
Asset/Event Name	Peat cutting, Carn an Daraich
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241508
Northing	857920
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under grass, 40m by 20m and 0.3m deep, with a projecting arm to the W, and along the flat terrace of Cairn an Daraich. Dis-used.

Asset/Event Number	319
Asset/Event Name	Peat Stack, Carn an Daraich
Type of Asset/Event	Other

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241432
Northing	857889
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A mound under heather and grass measuring 12m by 4m and standing 1m tall, adjacent to peat cutting bank Asset 318.2 and likely the degraded remains of an old peat stack.

Asset/Event Number	320.1
Asset/Event Name	Clearance cairn, Carn an Daraich
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241028
Northing	857703
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible clearance cairn of stones under heather, measuring 2m in diameter and 0.75m tall. May be natural formations within the localised glen.

Asset/Event Number	320.2
Asset/Event Name	Clearance cairn, Carn an Daraich
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	241030
Northing	857696
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible clearance cairn of stones under heather, measuring 3m in diameter and 0.6m tall. May be natural formations within the localised glen.

Asset/Event Number	321
Asset/Event Name	Memorial, Lubnaceardaich
Type of Asset/Event	Memorial
Date and/or Period	Post-medieval/Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	259553
Northing	886053
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small granite boulder adjacent to the track with an inscription, under somewhat heavy lichen and moss, can just read 'Ander_T'. Stands 0.9m tall. Possible memorial stone.

Asset/Event Number	322.1
Asset/Event Name	Dyke, Upper Garvary
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	258991
Northing	885589
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A pair of degraded stone and turf dykes under moss, grass and heather, standing either side of the track that extends along the Wester Fearn burn . The dykes vary in preservation and extent, reduced to ground level in some places but generally stand c0.4m tall and 1m wide. Not depicted on historic mapping, but a track is delineated in varying proportions along the route.

Asset/Event Number	322.2
Asset/Event Name	Dyke, Upper Garvary
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	258963
Northing	885521
Council	Highland
Condition:	Various
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A pair of degraded stone and turf dykes under moss, grass and heather, standing either side of the track that extends along the Wester Fearn burn . The dykes vary in preservation and extent, reduced to ground level in some places but generally stand c0.4m tall and 1m wide. Not depicted on historic mapping, but a track is delineated in varying proportions along the route.

Asset/Event Number	323
Asset/Event Name	Earthwork, Upper Garvary
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	259244
Northing	885776
Council	Highland
Condition:	Good

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large L-shaped laydown area/compound area measuring c40m by 40m and adjacent to the existing track, constructed of Type 1 material with a river-side embankment to the N constructed of large pebbles.
Asset/Event Number	324
Asset/Event Name	Structure, Allt a' Chuillin
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	258795
Northing	885333
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible footings for a rectangular structure measuring 4.5m by 2m, much obscured by overlying field clearance. Possibly a small pen. Not depicted on historic mapping.
Asset/Event Number	325
Asset/Event Name	Kerb, Garbhairidh
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	257652
Northing	884074
Council	Highland
Condition:	Good
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A row of large boulders c0.8m tall, set on the W side of the track alongside the stream, part of modern track upgrade.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	326
Asset/Event Name	Culvert, Garbhairidh
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	257663
Northing	884094
Council	Highland
Condition:	Good
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rubble stone culvert c4m wide with plastic pipe underneath the access track, part of the modern track upgrade.
Asset/Event Number	327
Asset/Event Name	Ford and culvert, Garbhairidh
Type of Asset/Event	Structure
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257626
Northing	884028
Council	Highland
Condition:	Good
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A built up stone ford over a small un-named watercourse that leads into the Allt Coire Bhenneit to the NW. A stone-built culvert contains a plastic pipe to channel the flow. Appears to be a modern track upgrade.
Asset/Event Number	328
Asset/Event Name	Ford, Garbhairidh
Type of Asset/Event	Other

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	257564
Northing	883913
Council	Highland
Condition:	Good
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A fording point over a burn that feeds the Allt Choire Bhenneit. No structural elements visible, but identified as a ford on the 2nd edition OS map.
Asset/Event Number	330
Asset/Event Name	Track, Càrn na h-Uigeig
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256980
Northing	885118
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track at least 470m long extending along the E side of the Carn na h-Uigeig hill, visible in places as a slight holloway under and through the heather measuring between 1-1.5m wide. Would appear to lead towards Garvary bothy (Asset 143), though it was not discernible in that vicinity. Potentially part of a longer-ranging route between Strathrusdale to the S and the Kyle of Sutherland to the N. Not depicted on historic mapping.
Asset/Event Number	331
Asset/Event Name	Sheepfold, Càrn na h-Uigeig
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257021
Northing	885085
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A circular drystone sheepfold c12m in diameter with walls standing 0.5m tall and 0.75m wide. Situated close to track Asset 330. Depicted on the 1st edition OS map and labelled as a 'stell'. OS. 1881. Ross-shire & Cromartyshire (Mainland) XXVI, Surveyed: 1875, Published: 1881.

Asset/Event Number	332
Asset/Event Name	Dyke, Allt na Moine
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256215
Northing	869821
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf dyke under heather, standing 1.3m tall and spread 2m wide. Runs along the NW side of the relict track Asset 333 and is likely contemporary. Traced for c200m. The track is depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV, Surveyed: 1875, Published: 1881.

Asset/Event Number	333
Asset/Event Name	Track, Allt na Moine
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events

Section:	N/A
Easting	256295
Northing	869884
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A track c2-2.5m wide, slightly overgrown with grass and gorse but with a visible metallised surface in places. Extends along the NW side of the Allt na Moine burn before crossing it to the E, towards the peat cutting areas (Asset 335.1 and 335.2) atop the Cnoc na Moine hill. The track is depicted on the 1st edition OS map, and may be an old peat transportation road considering the intensive peat cutting on the hill nearby, named Cnoc na Moine (Hill of the Peat) and the fact that it runs alongside the 'Allt na Moine' (Stream of the Peat). OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV, Surveyed: 1875, Published: 1881.

Asset/Event Number	334
Asset/Event Name	Culvert, Torran an Sporain
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256454
Northing	870100
Council	Highland
Condition:	Good
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A concrete culvert pipe c0.5m diameter, below the track Asset 333 where it crosses the Allt na Moine burn. Very obscured below moss and close growing trees, could not ascertain if there is a further stone structure or bridge the track is supported by. The track is depicted on the 1st edition OS map, but there is no indication of a bridge/similar structure. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV, Surveyed: 1875, Published: 1881.

Asset/Event Number	335.1
Asset/Event Name	Peat cutting, Torran an Sporain
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256599
Northing	870056
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large area of intensive peat cutting c120m by 80m under heather and grass on the N facing slope of the Torr na Sporain hill. The track Asset 333 passes close by and likely formed the old peat road for the collection of peats. Also too likely why the Allt na Moine (Stream of the Peat) is named such.

Asset/Event Number	335.2
Asset/Event Name	Peat cutting, Cnoc na Moine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256463
Northing	869673
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under heather and grass measuring 120m by 20m and up to 0.6m deep on Torr na Sporain hill. The track Asset 333 passes close by and likely formed the old peat road for the collection of peats. Also too likely why the Allt na Moine (Stream of the Peat) is named such.

Asset/Event Number	336.1
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256706

Appendix 1: Gazetteer of Heritage Assets and Events

Northing	870281
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A narrow ditch under heather, less than 1m wide and 0.4m deep with a slight bank adjacent to the W that stands 0.3m tall and spread perhaps 1m wide. A peat grip to drain the peat into the Allt Buidheanach to the north. One of several peat grips on the S side of the water course with fairly wavering forms that suggest they have been hand-excavated, unlike the regular ditches visible on the N side (Asset 955 group) which appear to have been mechanically excavated. Not depicted on historic mapping.

Asset/Event Number	336.2
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256675
Northing	870255
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat creep (drainage ditch) 0.5m wide and 0.8m deep with associated bank on W side 0.25m tall and spread up to 1m wide, N/S aligned, used for draining the peat on the Torrain an Sporain hill into the Allt Buidheaneach to the N. Not depicted on historic mapping.

Asset/Event Number	336.3
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256739
Northing	870258

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Fair
Alignment:	NNE/SSW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat creep (drainage ditch) 0.5m wide and 0.8m deep with associated bank on W side 0.25m tall and spread up to 1m wide, NNE/SSW aligned, used for draining the peat on the Torrain an Sporain hill into the Allt Buidheaneach to the N. Not depicted on historic mapping.

Asset/Event Number	336.4
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256786
Northing	870346
Council	Highland
Condition:	Fair
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat creep (drainage ditch) 0.5m wide and 0.8m deep with associated bank on W side 0.25m tall and spread up to 1m wide, NNW/SSE aligned, used for draining the peat on the Torrain an Sporain hill into the Allt Buidheaneach to the N. Not depicted on historic mapping.

Asset/Event Number	336.5
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256802
Northing	870363
Council	Highland
Condition:	Fair
Alignment:	NNW/SSE

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat creep (drainage ditch) 0.5m wide and 0.8m deep with associated bank on W side 0.25m tall and spread up to 1m wide, NNW/SSE aligned, used for draining the peat on the Torrain an Sporain hill into the Allt Buidheaneach to the N. Not depicted on historic mapping.
Asset/Event Number	336.6
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	256815
Northing	870378
Council	Highland
Condition:	Fair
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat creep (drainage ditch) 0.5m wide and 0.8m deep with associated bank on W side 0.25m tall and spread up to 1m wide, NNW/SSE aligned, used for draining the peat on the Torrain an Sporain hill into the Allt Buidheaneach to the N. Not depicted on historic mapping.
Asset/Event Number	336.7
Asset/Event Name	Ditch, Torrain an Sporain
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256629
Northing	870257
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat creep (drainage ditch) 0.5m wide and 0.8m deep with associated bank on W side 0.25m tall and spread up to 1m wide, N/S aligned, used for draining the peat on the Torrain an Sporain hill into the Allt

Appendix 1: Gazetteer of Heritage Assets and Events



Buidheaneach to the N. Not depicted on historic mapping.

Asset/Event Number	337.1
Asset/Event Name	Shooting butt, Allt Buidheachean
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256815
Northing	870605
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable shooting butt under heather, excavated into a small natural mound rather than the typical built up bank. Internal cavity measures c.4m by 1.5m wide, 1m deep, and access to NE. Not depicted on historic mapping.

Asset/Event Number	337.2
Asset/Event Name	Shooting butt, Allt Buidheachean
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256814
Northing	870610
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt under heather, cut into natural mound and adjacent to Asset 337.1. Internal cavity measures c.4m by 1.5m wide 1m deep, access to NE. Not depicted on historic mapping.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	338.1
Asset/Event Name	Shooting butt, Torr Dearg
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG56494
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256844
Northing	870832
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt under heather, 1.1m tall and c5m in diameter, cut into the S-facing slope of a hill, with the entrance leading in from S. Not depicted on historic mapping. https://her.highland.gov.uk/Monument/MHG56494 A line of shooting butts at Cnoc Gille Mo Bhrianaig, noted during a walkover survey by RoCAS in 2013 in advance of a proposed woodland creation scheme on the Novar Estate. They are not shown on the 1st and 2nd Edition OS maps, which would indicate that they post-date 1902. <1> <1> SHG25865 Text/Report/Fieldwork Report: Fraser, L.. 2013. Novar Woodland Creation: Archaeological Desk-based Assessment and Walkover Survey. Ross & Cromarty Archaeological Services. Digital. Features 5a-5i.
Asset/Event Number	338.2
Asset/Event Name	Shooting butt, Torr Dearg
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG56494
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256827
Northing	870877
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt under heather measuring c4.5m in diameter over banks which stand c1.2m tall. Entrance leading in from the S. The structure is partially revetted into the S-facing hill slope and stands within a line of previously recorded shooting butts (MHG56494) extending NW/SE. Not depicted on historic

Appendix 1: Gazetteer of Heritage Assets and Events



mapping. For HER description see Asset 338.1.

Asset/Event Number	338.3
Asset/Event Name	Shooting butt, Torr Dearg
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG56494
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256810
Northing	870928
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt under heather and moss, same as the one to the SE (Asset 338.2). Open to the SE. Not depicted on historic mapping. Not depicted on historic mapping. For HER description see Asset 338.1.

Asset/Event Number	338.4
Asset/Event Name	Shooting butt, Torr Dearg
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG56494
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256794
Northing	870975
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt under heather with banks standing 1.2m tall and entrance leading in from SE, measures c4.5 by 3.5m over banks. Not depicted on historic mapping. For HER description see Asset 338.1.

Asset/Event Number	338.5

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Shooting butt, Torr Dearg
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG56494
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256774
Northing	871028
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt under heather with banks standing 1.1m tall and entrance leading in from SE, measures c4.5 by 3.5m over banks. Not depicted on historic mapping. For HER description see Asset 338.1.

Asset/Event Number	339.1
Asset/Event Name	Deer salt lick, Torr Dearg
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257018
Northing	871162
Council	Highland
Condition:	Good
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A deer salt lick, constructed by cutting a section of peat and creating a mound adjacent to the cut area, salt visible on the mound. Mound stands 0.7m tall and measures c.2m in diameter. Will likely grow over with heather at a later date and appear similar to a prehistoric clearance cairn and so recorded for posterity.

Asset/Event Number	339.2
Asset/Event Name	Deer salt lick, Torr a' Mhulcan
Type of Asset/Event	Other
Date and/or Period	Modern

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257060
Northing	871296
Council	Highland
Condition:	Good
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A deer salt lick, constructed by cutting a section of peat and creating a mound adjacent to the cut area, salt visible on the mound. Mound stands 0.7m tall and measures c.2m in diameter. Will likely grow over with heather at a later date and appear similar to a prehistoric clearance cairn and so recorded for posterity.

Asset/Event Number	339.3
Asset/Event Name	Deer salt lick, Torr a' Mhulcan
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	257093
Northing	871430
Council	Highland
Condition:	Good
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A deer salt lick, constructed by cutting a section of peat and creating a mound adjacent to the cut area, salt visible on the mound. Mound stands 0.7m tall and measures c.2m in diameter. Will likely grow over with heather at a later date and appear similar to a prehistoric clearance cairn and so recorded for posterity.

Asset/Event Number	340
Asset/Event Name	Track, Cnoc Liath na h-Acain
Type of Asset/Event	Track
Date and/or Period	Modern
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257231
Northing	873204
Council	Highland
Condition:	Good
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A track measuring 2-2.5m wide, extending outwith the survey corridor to the NW. Appears to be modern in date.
Asset/Event Number	341.1
Asset/Event Name	Soil bund, Allt a' Ghreaich
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257347
Northing	873053
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A bund of soil and gravel under grass measuring 9m by 3m and standing 0.6m tall, adjacent to modern track and likely related to its construction.
Asset/Event Number	341.2
Asset/Event Name	Soil bund, Allt a' Ghreaich
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257353
Northing	873055

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Good
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A bund of soil partially under grass, c3m in diameter and standing to 0.5m tall, adjacent to modern track and likely related to its construction.

Asset/Event Number	341.3
Asset/Event Name	Soil bund, Allt a' Ghreach
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257378
Northing	873036
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An L shape bund of soil and gravel under grass, extends c21m NE/SW and 35m NW/SE, c5-7m wide and c1m tall. Adjacent to modern track and likely related to its construction.

Asset/Event Number	342
Asset/Event Name	Dyke, Cnoc Liath na h-Acain
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257422
Northing	873054
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events

Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under moss and heather, stands between 0.4- 1.1m tall and spread up to 1.5m wide. Surveyed extent measures c330m, but continues beyond survey corridor to the W. The SW portion is consistent with a field boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880
Asset/Event Number	343
Asset/Event Name	Possible structure, Novar
Type of Asset/Event	Structure
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257144
Northing	873117
Council	Highland
Condition:	Unknown
Alignment:	NE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An unroofed structure or pen open to the SE is depicted on the 1st edition os map but no trace could be discerned during the survey. May lie below commercial forestry. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880
Asset/Event Number	344
Asset/Event Name	Dyke, Cnoc Liath na h-Acain
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	257464
Northing	873071
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke under tall grass and heather, stands 0.8m tall and 0.6m wide, c100m length recorded but may continue to the W on the opposite side of the modern track that truncates it. Not depicted on historic

Appendix 1: Gazetteer of Heritage Assets and Events

mapping.

Asset/Event Number	345
Asset/Event Name	Dyke, Boathvic
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	257030
Northing	874205
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone wall standing to 1.3m tall but degraded in parts to 0.4m, breached by access track and continues beyond survey corridor to NW and SE. Roughly dressed stones with slightly splayed faces, line of coping stones set across top. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	346
Asset/Event Name	Dyke, Boathvic
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256919
Northing	874121
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under moss and grass, stands to 0.6m tall and spread to 2m wide. As it continues to the SW it has been improved and built up with stone, including a neat rectangular pen c20m long by 7m wide. As depicted on the 2nd edition OS map. OS. 1907. Ross and Cromarty LII, Surveyed: 1902, Published: 1907

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	347
Asset/Event Name	Dyke, Boathvic
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256943
Northing	874149
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke, just base stones remaining, stands 0.3m tall and spread up to 1.5m wide. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	348.1
Asset/Event Name	Clearance cairn, Boathvic
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256858
Northing	874130
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn partially under grass, measures 4m by 0.7m and stands 0.3m tall.

Asset/Event Number	348.2
Asset/Event Name	Clearance cairn, Boathvic

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256820
Northing	874154
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn partially under grass, measures 4m by 0.7m and stands 0.3m tall.

Asset/Event Number	348.3
Asset/Event Name	Clearance cairn, Boathvic
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256817
Northing	874158
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn partially under grass, measures c3m in diameter and 0.5m tall.

Asset/Event Number	348.4
Asset/Event Name	Clearance cairn, Boathvic
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	256790
Northing	874162
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn partially under grass, measures c1.5 by 1m and stands 0.8m tall.

Asset/Event Number	349
Asset/Event Name	Enclosure, Boathvic
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256739
Northing	874128
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A D-shaped enclosure measuring c25m by 18m, composed of a drystone dyke standing 0.6m at its tallest, and spread 1.2m wide. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	350
Asset/Event Name	Building, Boathvic
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256773
Northing	874135
Council	Highland
Condition:	Very Degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings of a rectangular building under grass and moss and field clearance are visible with the walls surviving best on the W side, visible as large boulders up to 0.6m long and standing c1m tall, with structure measures c6m by 4m. Consistent with the S portion of a roofed building depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	351.1
Asset/Event Name	Building, Boathvic
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256749
Northing	874159
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular single-storey building measuring 18m by 5.5m over walls, roofed in corrugated iron sheets over old wood slates; roof is collapsed to the W. Wall heads stand 2m tall and gable ends stand 4m tall, with walls measuring 0.5m wide. Corners have quoins and walls are constructed with large roughly dressed rectangular stones and smaller chinking stones in mortar. Slight projecting base stones suggest a likely older underlying building; these are more visible along the W side of the building, where a more roughly constructed building (Asset 351.2) extends, slightly set back from the building face of Asset 351.1, and the discordant base stones of Asset 351.1 appear to better match the alignment of this second building. Two entrances in S elevation 1.9m tall and 1.4m wide, and a similar proportioned entrance in the N elevation. One window in S elevation, W of W entrance. Depicted as a roofed building on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	351.2
Asset/Event Name	Building, Boathvic
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	256738
Northing	874161
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular building measuring 7m by 5m over walls, abutted by building Asset 351.1 to the E which appears to overlie possible foundations associated with this building that are set on a slightly different alignment. The walls stand 1.5m tall and measures 0.75m wide at base, tapering somewhat towards the top. An entrance is not readily discernible but collapsed wall on N side offers access. A roofed building is depicted here on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	352
Asset/Event Name	Dyke, Boathvic
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256786
Northing	874158
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke, very degraded and represented by intermittent boulders. Stands 0.5m tall and spread up to 3m wide, c70m long. Depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	353
Asset/Event Name	Clearance cairn, Boathvic
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256756

Appendix 1: Gazetteer of Heritage Assets and Events

Northing	874167
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A single large field-cleared stone measuring 1.6m × 1.6m × 0.9m.

Asset/Event Number	354
Asset/Event Name	Shed, Boathvic
Type of Asset/Event	Building
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256737
Northing	874165
Council	Highland
Condition:	Good
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Modern wooden shed c4m by 4m and 3m tall with entrance in W elevation. In use for storage.

Asset/Event Number	355
Asset/Event Name	Dyke, Boathvic
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256679
Northing	874180
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke, very degraded and represented by intermittent boulders. Stands 0.5m tall and spread up to 3m wide. Depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880
Asset/Event Number	356
Asset/Event Name	Dyke, Boathvic
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256646
Northing	874133
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke, represented solely by intermittent boulders under grass, standing less than 0.4m tall and spread up to 1.5m wide, c80m long. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880
Asset/Event Number	357
Asset/Event Name	Dyke, Glack
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256241
Northing	873899
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, standing to a height of 0.8m tall and spread up to 4m wide in parts, c70m long. Consistent with field boundaries depicted on the 1st edition OS map.

Appendix 1: Gazetteer of Heritage Assets and Events



OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	358
Asset/Event Name	Bridge, Glack
Type of Asset/Event	Bridge
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256208
Northing	873875
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A simple bridge of slab stones set over narrow stream course, measures 3m by 1.5m (stream runs along the 3m alignment, NW/SE). Associated with the nearby settlement of Glack. Not on historic mapping.

Asset/Event Number	359
Asset/Event Name	Dyke, Glack
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256283
Northing	873816
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under heather, stands 1.4m tall and spread 1.5m wide and runs broadly parallel with Dyke Asset 360. c150m long. Consistent with field boundaries depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	360
Asset/Event Name	Dyke, Glack
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256642
Northing	873579
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass and heather, stands 1m tall and spread to 1.8m wide, runs broadly parallel with dyke Asset 359 on the W side, extends c1.1km. Consistent with head dyke depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	361
Asset/Event Name	Dyke, Glack
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH57SE 27
HER Number	MHG20472
Status	Non-designated Heritage Asset
Section:	D1.1 (in access track corridor to section)
Easting	256518
Northing	873977
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke standing 0.6m and 0.4m wide, spread up to 1.5m in the S extent. c50m long. Consistent with field boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	362
Asset/Event Name	Track, Boath

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256692
Northing	873593
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A track measuring 2.5-3m wide under grass. C590m long, continues S beyond survey corridor extent. Depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	363
Asset/Event Name	Dyke, Boathmore
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256795
Northing	873521
Council	Highland
Condition:	Very degraded
Alignment:	NNE/SSW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under grass and moss, stands 0.4m tall and spread 1.5m wide, c90m long and continues outwith survey corridor to the NE and SW. Depicted on 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LII, Surveyed: 1875, Published: 1880

Asset/Event Number	364
Asset/Event Name	Cistern, Boathmore
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.1
Easting	256649
Northing	873678
Council	Highland
Condition:	Good
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A water cistern visible as a concrete slab atop a brick base, measuring 2m by 1.5m and 0.3m tall.

Asset/Event Number	365
Asset/Event Name	Memorial stone, Sgitheach
Type of Asset/Event	Memorial
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	252135
Northing	862926
Council	Highland
Condition:	GHood
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A modern memorial in the form of a standing stone overlooking Strath Sgiathach. The inscription reads "we are all part of the river of life" followed by the name "Kerr Yule", and a salmon is depicted below. The stone stands to a height of 1.5m.

Asset/Event Number	366
Asset/Event Name	Bank, Allt na Ciste Duibhe
Type of Asset/Event	Bank
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	258646

Appendix 1: Gazetteer of Heritage Assets and Events



Northing	897132
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A bank under grass and trees standing up to 1.2m tall and spread 3m wide, extends along the edge of a forestry plantation and track and likely related to this. C540m long. Not on historic maps.

Asset/Event Number	367
Asset/Event Name	Peat cutting, Clais na Sinneig
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263995
Northing	897302
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting c300m by 300m under heather with peat banks standing to a height of between 0.2-0.6m deep.

Asset/Event Number	367.1
Asset/Event Name	Shooting butt, Clais na Sinneig
Type of Asset/Event	Shooting butt
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	263490
Northing	897758
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt, one of three set out in a line to overlook the shallow valley formed by the Allt Clais na Faire burn. Butt comprises a pile of pallet wood indicating a simple screen set up for the butt that has since collapsed.
Asset/Event Number	367.2
Asset/Event Name	Shooting butt, Clais na Sinneig
Type of Asset/Event	Shooting butt
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	263495
Northing	897765
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt, one of three set out in a line to overlook the shallow valley formed by the Allt Clais na Faire burn. Butt comprises a pile of pallet wood indicating a simple screen set up for the butt that has since collapsed.
Asset/Event Number	367.3
Asset/Event Name	Shooting butt, Clais na Sinneig
Type of Asset/Event	Shooting butt
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	263498
Northing	897771
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A shooting butt, one of three set out in a line to overlook the shallow valley formed by the Allt Clais na Faire burn. Butt comprises a pile of pallet wood indicating a simple screen set up for the butt that has since collapsed.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	368
Asset/Event Name	Building, Sithean Mor
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263954
Northing	897330
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a possible rectangular building under grass and heather measuring c4.5m by 2.5m over banks that stand 0.3m tall and spread up to 0.6m wide. Very ephemeral. Situated on a slight hill overlooking peat cutting Asset 367, which surrounds it. Possibly a shieling/similar more ephemeral structure. Not depicted on historic mapping.

Asset/Event Number	369
Asset/Event Name	Peat Stack, Sithean Mor
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263935
Northing	897335
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small heather covered mound measuring 2m in diameter and standing 0.2m tall, a probable degraded peat stack or navigation mound.

Asset/Event Number	371

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Track, Clais na Sinneig
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263410
Northing	897246
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Relict track under heather and grass, c3m wide, only visible along the extent recorded c150m long within the survey corridor. Not depicted on historic mapping, but likely the old access to the settlement remains to the NE (Asset 372 group).

Asset/Event Number	372.1
Asset/Event Name	Structure, Clais na Sinneig
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263199
Northing	897297
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular building under grass and heather measuring 8m by 4.5m over walls. An internal partition defines two rooms, with the E side, internally measuring 4m by 1.8m, more poorly preserved with walls showing only as turf banks, while the W compartment, internally measuring 3m by 1.8m, has walls of visible stone spread 1m wide and standing 0.4m tall. A depression in the S elevation of this compartment may be its entrance. Not depicted on historic maps.

Asset/Event Number	372.2
Asset/Event Name	Building, Clais-na-sinneig

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263177
Northing	897283
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular building measuring internally 4.2m by 3m, cut into the SW-facing slope of a hill. The back (NE) wall has been revetted into the hill slope, with the SW wall constructed of stone and turf and measuring 1m wide and standing 0.3m tall. Entrance is 1.5m wide and in the SW corner. Not depicted on historic maps.
Asset/Event Number	372.4
Asset/Event Name	Building, Clais na Sinneig
Type of Asset/Event	Building
Date and/or Period	
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263118
Northing	897297
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular building under grass and heather measuring 10.5m by 5m over walls which stand 0.8m tall and spread 1m wide. Single portion wall measuring 0.6m wide and 0.2m tall separates the building into two rooms, the NW compartment measuring 3m by 2.5m a internally and SE compartment measuring 4m by 2.5m internally. Entrances not discernible. This likely is a small roofed building depicted on the 1st edition OS map related to the Clais-na-Sinneig township, and unroofed by the 2nd edition OS map. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879. OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907.
Asset/Event Number	372.5

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Dyke, Clais na Sinneig
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263054
Northing	897300
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone enclosure to NW of Asset 372.4, comprised of angular stone, surviving to one course. The wall is 0.50m wide and 0.40m in height, there is no evidence of bonding material. L-shaped and c130m long, consistent with enclosure depicted on 1st edition SO map. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879.

Asset/Event Number	372.6
Asset/Event Name	Pen, Clais na Sinneig
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263052
Northing	897372
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small enclosure or potential sheep pen, c10m by c10m, comprised of angular unbonded stone surviving to 5 courses or 1.2m in elevation. Possibly remnants of a building depicted on the 1st edition OS map related to the Clais-na-Sinneig township, and unroofed by the 2nd edition OS map. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879. OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907.

Asset/Event Number	372.7
Asset/Event Name	Building, Clais na Sinneig

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263108
Northing	897390
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A linear stone building under heather and moss, abutting the adjacent building Asset 372.8 to the NW, but set on a slightly higher elevation. The building measures 10m by 6m over walls which stand to 1.2m tall and 0.7m wide, best preserved along the gable ends. The internal space measures 5m by 3m with no partitions discernible but much stone tumble. Entrances are not discernible. This likely is a small roofed building depicted on the 1st edition OS map related to the Clais-na-Sinneig township, and unroofed by the 2nd edition OS map. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879. OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907.
Asset/Event Number	372.8
Asset/Event Name	Building, Clais na Sinneig
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263098
Northing	897393
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A linear stone building under heather and moss, abutting the adjacent building Asset 372.7 to the NW, but set on a slightly lower elevation. The building measures 7m by 6m over walls which stand to 1m tall and 0.7m wide, best preserved along the gable ends. The internal space measures 5m by 3m with no partitions discernible but much stone tumble. Entrances are not discernible. This likely is a small roofed building depicted on the 1st edition OS map related to the Clais-na-Sinneig township, and unroofed by the 2nd edition OS map. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879. OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	372.9
Asset/Event Name	Enclosure, Clais na Sinneig
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263108
Northing	897374
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf embankments under grass, enclosing a rectangular space to S of buildings Asset 372.7 and 372.8, c1m wide and 0.3m tall embankments, c40m length with entrance possibly on E elevation. Not depicted on historic maps.

Asset/Event Number	372.10
Asset/Event Name	Track, Clais na Sinneig
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263158
Northing	897242
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Linear embankment of stone and turf to W of trackway, 1m in width and 38m long, 0.40m height. Not depicted on historic maps.

Asset/Event Number	373.1

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Prehistoric clearance cairn, Clais na Sinneig
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NW 7
HER Number	MHG10097
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263181
Northing	897201
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measures 4m in diameter and 1m tall.

Asset/Event Number	373.2
Asset/Event Name	Prehistoric clearance cairn, Clais na Sinneig
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH69NW 7
HER Number	MHG10097
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263196
Northing	897194
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measures 6.5m in diameter and 1m tall.

Asset/Event Number	373.3
Asset/Event Name	Prehistoric clearance cairn, Clais na Sinneig
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH69NW 7
HER Number	MHG10097
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	263211
Northing	897194
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measures 4m in diameter and 1m tall.

Asset/Event Number	373.4
Asset/Event Name	Prehistoric clearance cairn, Clais na Sinneig
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH69NW 7
HER Number	MHG10097
Status	Non-designated Heritage Asset
Section:	N/A
Easting	263205
Northing	897182
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measures 4m in diameter and 1m tall.

Asset/Event Number	374.1
Asset/Event Name	Dyke, Carrol
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NW 24
HER Number	MHG19558
Status	Non-designated Heritage Asset
Section:	N/A
Easting	284817
Northing	907087
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, between 0.2 and 0.7m tall and spread up to 2m, mostly visible as bare stone, c110m long. Consistent with boundary depicted on 1st edition OS map. OS. 1879. Sutherland XCVII, Surveyed: 1872, Published: 1879 https://her.hIGHLAND.gov.uk/monument/MHG19558 A township comprising eight roofed and one unroofed building, five enclosures, and a head-dyke is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet xcvi). One roofed and one unroofed building, four enclosures, some sheep pens and part of a head-dyke are shown on the current edition of the OS 1:10560 map (1969). Information from RCAHMS (SAH) 1 November 1995 NGR adjusted based on 1999-2001 vertical aerial photographs. <1> --- SHG8579 Image/Photograph(s): Carrol, township. Colour Print. . XY <1> SHG27491 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 1999-2001. Get Mapping colour vertical aerial photography 1999-2001 (The Millennium Map). XY
Asset/Event Number	374.2
Asset/Event Name	Dyke, Carrol
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NW 24
HER Number	MHG53871
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284832
Northing	907227
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, between 0.2 and 0.7m tall and spread up to 2m, c175, long. Consistent with boundary depicted on 1st edition OS map. For HER asset description see Asset 374.1. OS. 1879. Sutherland XCVII, Surveyed: 1872, Published: 1879
Asset/Event Number	374.3
Asset/Event Name	Pen, Carrol
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NW 24
HER Number	MHG19558
Status	Non-designated Heritage Asset
Section:	B1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	284841
Northing	907246
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, between 0.2 and 0.7m tall and spread up to 2m. Forms an enclosure against dyke Asset 374.2, measuring c25m by 25m. Consistent with boundary depicted on 1st edition OS map. For HER asset description see Asset 374.1. OS. 1879. Sutherland XCVII, Surveyed: 1872, Published: 1879

Asset/Event Number	374.4
Asset/Event Name	Dyke, Carrol
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NW 24
HER Number	MHG19558
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284862
Northing	907156
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, between 0.2 and 0.7m tall and spread up to 2m, c80m long. Consistent with boundary depicted on 1st edition OS map. For HER asset description see Asset 374.1. OS. 1879. Sutherland XCVII, Surveyed: 1872, Published: 1879

Asset/Event Number	375
Asset/Event Name	Clearance cairn, Carrol
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284973
Northing	907189

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn measuring approximately 6m by 3m and up to 0.5m tall. Not accessed directly as in field with calving cows but visible from afar.

Asset/Event Number	376
Asset/Event Name	Structure, Carrol
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NW 24
HER Number	MHG53871
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284871
Northing	907273
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular pen measuring 2m by 8m over walls. Walls stand up to 0.7m tall and spread up to 1.2m wide. Degraded in parts to ground level, entrance not discernible. Depicted as an unroofed building or pen on the 1st edition OS map. For HER asset description see Asset 374.1. OS. 1879. Sutherland XCVII, Surveyed: 1872, Published: 1879

Asset/Event Number	377
Asset/Event Name	Ditch, Carrol
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284576
Northing	907152
Council	Highland
Condition:	Degraded
Alignment:	E/W

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Grass covered ditch, 3m wide used for water drainage running down to burn with small Embankment at either side measuring 0.6m wide and up to 0.4 tall.
Asset/Event Number	378.1
Asset/Event Name	Peat stack, Carrol
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284542
Northing	907036
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible degraded peat stack or navigation marker visible as a small mound under heather, 1m tall and spread 6m by 3m. Situated at the edge of an area of peat cutting (Asset 378.2).
Asset/Event Number	378.2
Asset/Event Name	Peat cutting, Carrol
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284526
Northing	907059
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A poorly defined area of peat cutting c40m by 20m under heather and grass, barely visible by eye but felt underfoot.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	379.1
Asset/Event Name	Peat cutting, Coire an Uisgeachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	283706
Northing	906726
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Very degraded Peat Cutting, up to 0.4m tall and c12m long.

Asset/Event Number	379.2
Asset/Event Name	Peat cutting, Coire an Uisgeachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	283691
Northing	906712
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Very degraded Peat Cutting, up to 0.4m tall and c12m long.

Asset/Event Number	380
Asset/Event Name	Bridge, Carrol
Type of Asset/Event	Bridge
Date and/or Period	Modern
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	284580
Northing	907188
Council	Highland
Condition:	Good
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A bridge over the Carrol burn measuring 5m by 3.2m. The bridge has stepped concrete foundations either side of the bank with a flat wooden super structure across the top composed of large square beams, a single beam at either side delineating the course. No bridges are annotated here on the 1st or 2nd edition OS maps.

Asset/Event Number	381
Asset/Event Name	Peat cutting, Coire an Uisgeachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	283630
Northing	906482
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under heather measuring 30m by 15m with banks 0.15m deep.

Asset/Event Number	382.1
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	275615
Northing	901386
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A field clearance cairn partially under grass, measures 8.5m by 5m and stands 1m tall.

Asset/Event Number	382.2
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275648
Northing	901383
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A field clearance cairn partially under grass, measures 2m by 1m and stands 1m tall.

Asset/Event Number	382.3
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275638
Northing	901418
Council	Highland
Condition:	Degraded
Alignment:	NW/SE

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A field clearance cairn partially under grass, measures 20m by 4m and stands 1m tall, situated against natural ridge of bedrock.
Asset/Event Number	382.4
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275656
Northing	901408
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A field clearance cairn partially under grass, measures 4.5m by 1m and stands 1m tall, situated against natural ridge of bedrock.
Asset/Event Number	382.5
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275645
Northing	901446
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A linear spread of field clearance material partially under grass, measuring 30m by 3.5m and standing 1m tall. It has been deposited against a small bare section of natural bedrock outcrop.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	382.6
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275625
Northing	901476
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn partially under grass, measuring 7m by 3m and stands 1.1m tall.

Asset/Event Number	382.7
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275625
Northing	901500
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible rectangular stone building measuring c20m 4.5m, much obscured by overlying clearance material. Possible walls stand 0.6m tall, spread 1.5m wide. Appears to be constructed onto a slight terrace of a small slope. Not depicted on historic mapping. See Asset 120 overall description.

Asset/Event Number	382.8
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275629
Northing	901488
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under moss, measuring 4m by 3m and standing 1.1m tall.

Asset/Event Number	383.1
Asset/Event Name	Clearance cairn, Morvich Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275463
Northing	902064
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable prehistoric clearance cairn under grass and heather, measures 6m by 4m and stands 0.4m tall.

Asset/Event Number	383.2
Asset/Event Name	Clearance cairn, Morvich Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275467

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	902050
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable prehistoric clearance cairn under grass and heather, measures 5 by 3m and stands 0.3m tall.
Asset/Event Number	384
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275353
Northings	902136
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn partially under grass, measures 2m by 1.7m and stands 1m tall.
Asset/Event Number	385.1
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275325
Northings	902018
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable prehistoric clearance cairn under heather, measures 4m in diameter and 1m tall.
Asset/Event Number	385.2
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275318
Northing	902052
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, appearing as a prominent conical mound 6m in diameter and 1.2m tall.
Asset/Event Number	385.3
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275194
Northing	902141
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under grass, measures 3m by 2m and stands 0.5m tall.
Asset/Event Number	385.4
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275345
Northing	902062
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible prehistoric clearance cairn under heather. This possible cairn is not as prominent as its neighbours Assets 385.1 and 385.2, but is visible as a low mound measuring c5m in diameter and 0.4m tall.

Asset/Event Number	385.5
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC70SE 24
HER Number	MHG11115
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275309
Northing	902084
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, measuring 5m by 3m and standing 0.8m tall.

Asset/Event Number	386
Asset/Event Name	Building, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275272
Northing	902057
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under grass and heather. Measures c11m by 5m over walls. Walls themselves are a course of undressed boulders, likely forming the lower course of turf walls. Spread up to 2m. One possible internal partition and no discernible entrances. Not depicted on the 1st edition OS map. Situated in a slight saddle with hills rising to the N and S, overlooking the post-medieval settlement remains to the W.

Asset/Event Number	387.1
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275200
Northing	902003
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke , 0.4m wide and 140m in length, up to 0.5m tall with 0.3m spread on either side

Asset/Event Number	387.2
Asset/Event Name	Enclosure, Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 2; NC70SE 14
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275202

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	901951
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible turf and stone enclosure, the turf having degraded fully away leaving only a loose setting of intermittent boulders delineating an irregular enclosure. Measures c. 15m by 7m and extends broadly NW/SE on a slight NW facing slope. Not depicted on the 1st edition OS map.

Asset/Event Number	387.3
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275162
Northings	902070
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for long rectangular building measuring 22m by 5m over walls that stand 0.6m tall and spread up to 1.5m wide. Single partition within forming two internal compartments, both with entrance in the SW elevation. Situated on a raised terrace overlooking the broader terrace above the burn to the W. An enclosure (Asset 387.5) adjoins the NE elevation. Not depicted on the 1st edition OS map.

Asset/Event Number	387.4
Asset/Event Name	Structure, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275157
Northings	902071

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very Degraded
Alignment:	ENE/WSW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A square drystone pen of structure extending off the SW elevation of building Asset 387.3, measuring 3m 4m with walls that stand 0.5m wide and 0.4m tall.
Asset/Event Number	387.5
Asset/Event Name	Enclosure, Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275162
Northing	902081
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Semi rectangular enclosure, Asset 387-5 attached on the northern side of main farmstead building 387-3. Walls measuring 0.5m wide and 0.4m tall
Asset/Event Number	387.6
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Description	VOID - number not assigned
Asset/Event Number	387.7
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 2; NC70SE 14
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275209
Northing	901942
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small spread of field clearance next to enclosure (Asset 387.2). The stone has been mounded on a natural outcrop of stone and stands 1.3m tall and extends somewhat in an arc of 5m.
Asset/Event Number	387.8
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 2; NC70SE 14
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275185
Northing	901942
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small clearance cairn with bare stone visible under grass, measures 4m by 3m and stands 1m tall.
Asset/Event Number	387.9
Asset/Event Name	Enclosure, Bad A' Chrasgaidh

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275142
Northing	901988
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible very degraded turf and stone enclosure under grass, turfs have fully degraded leaving only some stone boulders forming a rough setting, with clusters at corners where the turf would be weaker. Encloses a small area 11m by 6m over walls. Not depicted on the 1st edition OS map.

Asset/Event Number	387.10
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275118
Northing	902030
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Very degraded series of what were likely stone and turf dykes with the turf element now very degraded so only a line of intermittent boulders is visible. Situated near the structures adjacent to Tower 260. Extends on the E side of the low drumlin the tow

Asset/Event Number	387.11
Asset/Event Name	Structure, Bad A' Chrasgaidh
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275165
Northing	902060
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible entranceway for the enclosure dyke (Asset 387.10), formed by a setting of stones revetted into the ground and defining a passage c1m wide and 4m long through the dyke and towards the building (Asset 387.3).

Asset/Event Number	387.12
Asset/Event Name	Clearance cairn, Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275118
Northing	901971
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large probable prehistoric clearance cairn under heather. Stands as a prominent mound measuring 10m by 5m and 0.9m tall.

Asset/Event Number	387.13
Asset/Event Name	Enclosure, Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	275123
Northing	901934
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A square shaped enclosure c14m by 14m with drystone walls that stand 0.6m tall and 0.8m wide. Not depicted on the 1st edition OS map.

Asset/Event Number	387.14
Asset/Event Name	Track, Bad A' Chrasgaidh
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 14.00; NC70SE 55.00
HER Number	MHG11267; MHG28537
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275063
Northing	901962
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A reluctant track under grass, visible as a depression and heading SW up hill to Asset 387. c3m wide.

Asset/Event Number	387.15
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275152
Northing	902023
Council	Highland
Condition:	Degraded
Alignment:	NE/SW

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building measuring c21m by 4-6m under grass and bracken with boulder-defined walls that stand 0.6m wide and 0.7m tall. Two possible internal partitions forming three compartments, but difficult to discern in the vegetation. Possible entranceway on NE side. Not depicted on the 1st edition OS map.
Asset/Event Number	387.16
Asset/Event Name	Building, Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275048
Northing	902111
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under tall bracken and grass, measuring 12m by 4m with walls generally measuring 0.5m wide and 0.4m tall, but the SW end wall measures 0.8m wide and 1.1m tall. Possible entrance in the NW and SE elevations. No internal partitions visible. Not depicted on the 1st edition OS map.
Asset/Event Number	387.17
Asset/Event Name	Enclosure, Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275041
Northing	902121
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular Enclosure

Appendix 1: Gazetteer of Heritage Assets and Events



attached onto associated farmstead 287-16. 0.8m wide and 0.6m tall.

Asset/Event Number	388.1
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274895
Northing	901957
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under grass, extending c20m long, stands c0.6m tall and spread 1m wide. Not depicted on historic maps.

Asset/Event Number	388.2
Asset/Event Name	Structure, Allt Bad a' Chrasgaidh
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274890
Northing	901936
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a possible rectangular building under tall bracken and grass, measuring 18m by 4m. Walls not easily discernible but vegetation change suggests the structure's presence. Not depicted on the 1st edition OS map.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	388.3
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274840
Northing	902019
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small spread of stone c2m by 2m and 0.3m tall.

Asset/Event Number	388.5
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - number not assigned

Asset/Event Number	388.6
Asset/Event Name	Enclosure, Allt Bad a' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274825
Northing	902075
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular building under tall heather and grass, measuring 8m by 4m over walls. Walls stand 0.6m tall and spread 1m wide and are composed of larger boulders as lower courses, suggesting a turf component may have been used above. Not depicted on the 1st edition OS map.

Asset/Event Number	388.7
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274846
Northing	902056
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke, a small length extending between correlate with aerial borders only possible for a turf and stone wall. Meets building and continues

Asset/Event Number	388.8
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274811

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	902075
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under heather and grass, c21m long. Up to 0.6m tall, spread 0.7m wide. Not depicted on historic maps.
Asset/Event Number	388.9
Asset/Event Name	Enclosure, Allt Bad A Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274788
Northings	901941
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke partly under grass, stands to 0.5m tall and spread up to 2m wide, forming an irregularly-shaped enclosure. A smaller rectangular pen is located in the SW corner, measuring 10m by 4m over walls.
Asset/Event Number	388.10
Asset/Event Name	Building, Allt Bad a' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274735
Northings	902005
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a T-shaped building, measuring c10m by 4m E/W with a central projection measuring c5m by 5m on the S elevation. Walls spread c0.8m wide and stand 0.4m tall. Not depicted on historic maps.

Asset/Event Number	388.11
Asset/Event Name	Building, Allt Bad A Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274718
Northing	901984
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular building under grass, some stone evident. Measures 5m by 2.5m over walls with walls 0.4m tall. Entrance not discernible. Not depicted on the 1st edition OS map.

Asset/Event Number	389
Asset/Event Name	Hut circle, Morvich burn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG9440
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275682
Northing	901909
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather measuring c10m in diameter over banks which are spread up to 1m wide and standing 0.6m tall. A possible entrance lies in the S quarter.

Appendix 1: Gazetteer of Heritage Assets and Events

<https://her.hIGHLAND.gov.uk/Monument/MHG9440>

On the W edge of a small contemporary field system, well marked by stone clearance heaps, and contained in the E by a field wall, is a hut circle. There is a later deserted settlement just to the S [Asset 122 group], see NC70SE 2.

The hut measures 7.5m in diameter within a wall composed of an inner face of contiguous slabs on edge, backed by rubble, with intermittent outer facing stones indicating a wall thickness of 1.4m widening to 2.0m at the entrance, 0.6m wide, in the S.

Visited by OS (J M) 31 July 1975.

Asset/Event Number	390.1
Asset/Event Name	Peat cutting, Allt Strath Lunndaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	276924
Northing	902251
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small area of peat cutting under grass and moss and heather. the banks are 0.3m deep. Disused.

Asset/Event Number	390.2
Asset/Event Name	Peat cutting, Allt Strath Lunndaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277005
Northing	902346
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under

Appendix 1: Gazetteer of Heritage Assets and Events

heather and grass measuring 30m by 20m and 0.3m deep banks.

Asset/Event Number	390.3
Asset/Event Name	Peat cutting, Allt Strath Lunndaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277135
Northing	902376
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large area of shallow peat cutting has been undertaken along a broad flat area between hillocks but looks like it may be related to drainage activity rather than the recovery of peat as the stream in the centre has been augmented by metal slides. Corre

Asset/Event Number	391.1
Asset/Event Name	Enclosure, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59240
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277454
Northing	902481
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A circular enclosure under heather and grass of c45m diameter and comprising a stone and turf dyke measuring 0.5m tall and spread up to 1m wide, but poorly preserved along the S side where a small stream runs through the interior. Not depicted on the 1st edition OS map.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	391.2
Asset/Event Name	Track, Coire Cnoc na Gamhna
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59242
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277460
Northing	902527
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under heather and moss. Dyke stands up to 0.5m tall and spread up to 2m wide. Forms a large enclosure around the settlement remains on a SE facing slope, the dyke has been revetted into the slope on its SE most side.

Asset/Event Number	391.3
Asset/Event Name	Dyke, Coire Cnoc na Gamhna
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59242
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277553
Northing	902539
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under heather and moss. Dyke stands up to 0.5m tall and spread up to 2m wide. Forms a large enclosure around the settlement remains on a SE facing slope, the dyke has been revetted into the slope on its SE most side.

Asset/Event Number	391.4
Asset/Event Name	Building, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Building

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59240
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277549
Northing	902549
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular building under heather and grass which obscured visibility. No visible internal partitions. Walls spread 0.5m wide and stand 0.3m tall and a possible entrance in the NW and NE corners. Not depicted on the 1st edition OS map.

Asset/Event Number	391.5
Asset/Event Name	Building, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59240
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277565
Northing	902560
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular building under grass which obscured visibility. Walls spread 0.6m wideband stand 0.5m tall, with the NW end standing 0.9m tall. No internal partitions visible due to vegetation. Not depicted on the 1st edition OS map.

Asset/Event Number	391.6
Asset/Event Name	Kiln, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59240

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277574
Northing	902581
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible degraded kiln visible as a drystone circular structure c3m in diameter under moss and grass set against the SW-facing slope. Walls stand 0.7m tall and spread perhaps 0.7m wide and flue channel extends NW . Not depicted on the 1st edition OS map.

Asset/Event Number	391.7
Asset/Event Name	Platform, Coire Cnoc na Gamhna
Type of Asset/Event	Platform
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	MHG59242
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277588
Northing	902663
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small slightly projecting terrace or partially revetted structure footing of likely stone and turf, but all under grass and no turf visible, occupying the slope above the post-medieval settlement remains for the rest of Asset 390. The flat area of the platform forms a rectangular shape some 6m by 3.5m, with the build up fanning around this. Uncertain function.

Asset/Event Number	391.7
Asset/Event Name	Platform, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Platform
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59242
Status	Non-designated Heritage Asset
Section:	B1.2

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	277589
Northing	902663
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small slightly projecting terrace or partially revetted structure footing of likely stone and turf, but all under grass and no turf visible, occupying the slope above the post-medieval settlement remains for the rest of Asset 390. The flat area of the platform forms a rectangular shape some 6m by 3.5m, with the build up fanning around this. Uncertain function.

Asset/Event Number	391.8
Asset/Event Name	Building, Coire Cnoc na Gamhna
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59242
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277556
Northing	902571
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible footings for a building, heavily obscured by dense heather but some stone and turf bank visible under grass at the NW end. Dimensions are difficult to discern as a result, but potentially somewhat rectangular in form with the visible bank standi

Asset/Event Number	391.9
Asset/Event Name	Building, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG59240
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277595
Northing	902578

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a stone square building or structure under tall heather and grass, measuring 10m by 10m with walls that stand 0.6m wide and between 0.2-0.4m tall. Possible entrance on the W side.
Asset/Event Number	392
Asset/Event Name	Peat cutting, SW of Coire Cnoc na Gamhna
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	277697
Northing	902753
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An L-shaped area of peat cutting 25m by 25m under grass with depths generally c0.3m, but a large peat crevice has formed on the SE side over 1.5m deep and may represent an area where peat was quarried. Likely related to the settlement Asset 391 to the S.
Asset/Event Number	393.1
Asset/Event Name	Clearance cairn, Cnoc an t-Salachaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	276636
Northing	902383
Council	Highland
Condition:	Degraded
Alignment:	NW/SE

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 7m by 5m and stands 1.3m tall on the down slope side to the SW.
Asset/Event Number	393.2
Asset/Event Name	Clearance cairn, Cnoc an t-Salachaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	276624
Northing	902392
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible prehistoric clearance cairn under heather, measures c3m in diameter and stands 0.7m tall.
Asset/Event Number	394
Asset/Event Name	Mill (possible), Morvich Burn
Type of Asset/Event	Mill
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275953
Northing	902067
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A Z-shaped stone building under moss and heather, measuring c10m by 6m and situated over the Morvich burn. The building is composed of drystone walls standing up to 1.2m tall and 0.6m wide along N and W sides, and 0.6m tall and wide on the S and E side. Incorporates a large bare rock into the wall at the NW corner and an inlet in the N wall to allow the water to flow through. The stream, labelled as the Morvich Burn on OS mapping, diverges from a larger stream to the north. It is abnormally straight and may be an augmented lade though no stone was

Appendix 1: Gazetteer of Heritage Assets and Events



observed due to dense heather vegetation. A probable mill. The building is not depicted on historic mapping.

Asset/Event Number	395.1
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	276087
Northing	902272
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under heather and grass and bracken. Difficult to follow on the ground. Where visible the bank stands about 0.4m tall and spread up to 1m wide. Possibly forming a small network of dykes set in a small floodplain around the Morvich burn. Not on historic mapping.

Asset/Event Number	395.2
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	276034
Northing	902239
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under heather and grass and bracken. Difficult to follow on the ground. Where visible the bank stands about 0.4m tall and spread up to 1m wide. This length abuts a natural rock face on its SE side which forms the natural continuation of the boundary to Asset 395.1. Not on historic mapping.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	396
Asset/Event Name	Structure, Bad A' Chrasgaidh
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275804
Northing	902194
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular shaped possible pen or small building, only the ephemeral footings of a few intermittent boulders remain under heather and grass. Measures 7m by 5m over the boulder line. Not on historic mapping.

Asset/Event Number	397
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 56
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275655
Northing	902215
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass and heather. Dyke stands to a height of 0.7m and spread up to 1.5m wide, c75m long but continues outwith survey corridor to the NE and NW and has been breached by the existing track. Not depicted on historic OS maps. See Asset 122 for HER description.

Asset/Event Number	398

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 56
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275655
Northing	902116
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A revetment dyke of stone and turf for the existing track, built up on the W side. Stands up to 1.3m tall. See Asset 120 overall description. Not depicted on historic mapping.

Asset/Event Number	399
Asset/Event Name	Dyke, Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SE 56
HER Number	MHG11267
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275654
Northing	901463
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a possible stone and turf dyke standing 1m tall and spread up to 1.2m wide, consisting of a dyke element of stone along the NW/SE extent, and a cut/revetted area along the NE/SW, and petering out as indicated in the survey at a length of c39m. The dyke element appears to be stone and turf and may augment a ridge of natural bedrock where clearance has been deliberately deposited in some areas but on the whole it appears to have a more earthen component. More of a revetment along the NE extent. Also see Asset 120 overall description. Not depicted on historic mapping.

Asset/Event Number	402
Asset/Event Name	Dyke, Loch Salachaidh

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275483
Northing	903668
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Dyke composed mainly of turf and occasional large stones, c100m long, 1m Wide and 0.4m tall. Degraded with many stones robbed.

Asset/Event Number	403.1
Asset/Event Name	Peat cutting, Loch Salachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275204
Northing	903527
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of shallow peat cutting under grass and dis-used. 0.3m deep.

Asset/Event Number	403.2
Asset/Event Name	Peat cutting, Loch Salachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	275204
Northing	903565
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small area of shallow peat cutting under grass and dis-used, 0.3m deep. No photo.

Asset/Event Number	403.3
Asset/Event Name	Peat cutting, Loch Salachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275251
Northing	903573
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of shallow peat cutting under grass and dis-used. 0.3m deep. No photo.

Asset/Event Number	404
Asset/Event Name	Waymarker cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Cairn
Date and/or Period	Post-medieval/Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275268
Northing	903417
Council	Highland
Condition:	Fair

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A triangular boulder 0.6m tall and 1m long, 0.4m wide, has been set upright on a small stone outcrop forming a very visible waymarker on the crest of the hill when approached from the west. Boulder is otherwise natural and not dressed in any fashion.

Asset/Event Number	405
Asset/Event Name	Clearance cairn, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275220
Northing	903110
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 3m by 2.5m and stands 0.6m tall.

Asset/Event Number	406
Asset/Event Name	Peat cutting, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275035
Northing	902946
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large area of peat cutting under grass and heather, c300m by 300m but extends beyond limit of the survey corridor, with banks 0.3m deep. Extends across a broad low valley. Dis-used.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	408
Asset/Event Name	Dyke Cnoc Bad a' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275179
Northing	903068
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under grass, measuring c20m long, 0.5m wide with 1m spread and composed of mainly turf and occasional large stone, appeared to peter out to the NW and SE. May have been constructed as a flood-defence or augmentation to the small watercourse to the SW. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1907. Sutherland CIV, Surveyed: 1904, Published: 1907.
Asset/Event Number	409
Asset/Event Name	Hut circle, Cnoc Bad A' Chrasgaidh
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275114
Northing	903305
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. The possible very ephemeral remains of a hut circle under grass, c10m in diameter. The banks are very poorly defined and stand no taller than 0.2m tall and the spread is perhaps 1 5m. Some stones visible in a small portion. Entrance not discernible.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	410
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275337
Northing	902885
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible prehistoric clearance cairn visible as a mound under heather and grass, measures 4m by 3m and stands 0.7m tall.

Asset/Event Number	411
Asset/Event Name	Enclosure, Allt Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274801
Northing	902688
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small turf and stone enclosure measuring 14m NE/SW by 12m over banks, irregular in plan, with a smaller rectangular pen measuring c8m NW/SE by 4m within the NW corner. The banks stands to 0.8m tall and spread up to 1m wide. Situated on a slight NW-facing slope. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	411
Asset/Event Name	Peat cutting. Allt Bad A Chrasgaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	275070
Northing	902602
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting measuring 40m by 30m and with banks 0.3m deep. Dis-used.
Asset/Event Number	413.1
Asset/Event Name	Enclosure, Allt Bad A' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274765
Northing	902712
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded turf and stone dyke under heather and grass, forming a large enclosure c110m wide and at least c180m long NE/SW, but continues beyond the survey corridor to the SW. Stands up to 0.5m tall and spread up to 1.5m wide. Encloses an area of broadly improved ground containing building Asset 414, a structure Asset 415, an enclosure Asset 412, and an additional segment of dyke Asset 413.2. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.
Asset/Event Number	413.2

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Dyke, Allt Bad A' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274769
Northing	902700
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small section of stone and turf dyke under heather and grass, the extent of which is difficult to determine due to the vegetation. The dyke stands 0.5m at its tallest and spread up to 2m wide, possibly c17m long. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Asset/Event Number	414
Asset/Event Name	Building, Allt Bad A' Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274833
Northing	902685
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. The degraded stone footings of a long rectangular building appearing as drystone walls under moss and grass. Measures 14m by 4m over walls, which stand tallest at the corners to a height of 0.9m but have been robbed to the ground in some sections. No partitions visible and an entrance is not clearly discernible. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	415
Asset/Event Name	Structure, Allt Bad A' Chrasgaidh
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	274791
Northing	902680
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a structure under bracken and grass, measuring 4.5m by 2.5m. Difficult to discern form due to vegetation, but may be a small pen considering the proximity to the enclosure (Asset 411). Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Asset/Event Number	416
Asset/Event Name	Peat cutting, Allt Bad A' Chrasgaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274811
Northing	902613
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of shallow peat cutting 50m by 30m, with a peat bank between the two segments measuring less than 1m wide and 0.5m tall an. The entirety is dis-used and under grass. Likely associated with the small settlement to the NW (Assets 412-414). Two little clearance cairns Assets 116.30 and 116.6 stand within this but are likely prehistoric in date, associated with the cairn field further SE.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	417
Asset/Event Name	Sheepfold, Allt Bad a' Chrasgaidh
Type of Asset/Event	Sheepfold
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274747
Northing	902469
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A circular enclosure 19m in diameter and constructed from a drystone wall. The wall is degraded in parts but original height is retained in others as 1.6m, with a cap of turf, and 0.75m thick. The walls are double-skinned with large subrounded stones. The entrance measures 1.5m wide and is located in the SW quarter. The sheepfold is depicted on the 1st and 2 edition OS maps and labelled as such. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.
Asset/Event Number	418.1
Asset/Event Name	Building, Allt Bad A Chrasgaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275029
Northing	902117
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under grass and bracken. Measures c17m long and 5m wide over walls, which stand to a height of 0.4m tall. Stone concentrated at the ends of the building, suggesting a turf component likely sat atop this. Entrances and partitions not discernible. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	418.2
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - number not assigned

Asset/Event Number	418.3
Asset/Event Name	Dyke, Allt Bad a' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274829
Northing	902135
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass and bracken, the main portion of which extends some c350m long in a curvilinear fashion from E to W, with smaller branches extending to the NW and SE. Dyke stands c0.3-0.7m tall and spread up to 2m wide. Connects the corn-drying kiln Asset 418.5 and building Asset 387.6, and then continues from the building Asset 418.1 to enclosure 418.6, and then proceeds SW. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	418.4
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	
Date and/or Period	
Listing No./NRHE Number	
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	N/A
Alignment:	N/A
Importance:	N/A
Description	VOID - number not assigned

Asset/Event Number	418.5
Asset/Event Name	Corn drying kiln, Allt Bad A Chrasgaidh
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	275069
Northing	902119
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A corn drying kiln partially under grass and bracken, partially built into the S-facing slope of the hill. Measures 5m in diameter over walls which stand to a height of c1m, with a bowl measuring 3m in diameter. A small squarish platform extending 4m out from the kiln wall and 2.5m wide. The flue opens to the SSW, with the lintel visible, but has been infilled with stone. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Asset/Event Number	418.6
Asset/Event Name	Enclosure, Allt Bad A Chrasgaidh

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC70SW 34.00
HER Number	MHG10630
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274988
Northing	902126
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure under grass and bracken constructed from a stone and turf dyke, measuring 18m by 12m with the dyke itself standing 0.5m tall and spread 1m wide. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Asset/Event Number	419
Asset/Event Name	Dyke, Allt Bad a' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274758
Northing	902109
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands 0.4m tall and spread up to 1m wide, measuring c150m long. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.

Asset/Event Number	420
Asset/Event Name	Dyke, Allt Bad a' Chrasgaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274849
Northing	902079
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under grass, forming somewhat of an L-shape in plan, open to the SW. The E-W aligned portion comprises predominantly stone and stands 0.4m tall and 0.6m wide, while the N-S aligned portion is appears mostly as a turf bank, 0.5m tall and spread 0.7m wide. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.
Asset/Event Number	421
Asset/Event Name	Enclosure, Allt Bad a' Chrasgaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	274846
Northing	902086
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable enclosure or pen of stone partially under grass, measuring c10m by 4m. Walls stand c0.3-0.6m tall and spread c0.7m wide, composed of large drystone boulders that may be the sole remnants of a turf and stone wall. Not depicted on historic mapping. OS. 1879. Sutherland CIV, Surveyed: 1873-4, Published: 1879. OS. 1904. Sutherland CIV, Surveyed: 1904, Published: 1907.
Asset/Event Number	422
Asset/Event Name	Clearance cairn, Allt Bad A Chrasgaidh
Type of Asset/Event	Clearance cairn

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	274840
Northing	902056
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and moss. Measures 6m by 3m and stands 0.7m tall.

Asset/Event Number	423
Asset/Event Name	Track, Glen Loth
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293534
Northing	913664
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Relict track under grass, c400m long and c2.5m wide, and forming slight holloway. Leads to farmstead Asset 211 from the Glen Loth road to the SW. Depicted on the 1st and 2nd edition OS maps. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	424
Asset/Event Name	Dyke, Glen Loth
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.5
Easting	293474
Northing	913549
Council	Highland
Condition:	Fair
Alignment:	WNW/ESE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under moss, stands 0.7m tall and spread 1.1m wide. C70m long. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	425
Asset/Event Name	Dyke, Glen Loth
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 50.00
HER Number	MHG54757
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293590
Northing	913763
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under grass and bracken, measuring c170m long and stands 0.5-7m tall and spread up to 2m wide. Continues to the NE as Asset 211.7. Depicted on the 1st and 2nd edition OS maps, but there is an extension (c55m long) to the SE that then turns S that although extant is not present on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	426
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	293768
Northing	913928
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A length of stone and turf dyke under grass standing 0.7m tall and spread up to 2m wide and 10m long. Peters out at either end. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	427
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293841
Northing	913970
Council	Highland
Condition:	Very degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under bracken, c65m long, stands 0.6m tall and spread c2m wide, extent difficult to determine due to vegetation. Appears to possibly be flooding-related as it respects a lower shelf above the river and diminishes where the ground rises uphill. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	428.1
Asset/Event Name	Building, Uaigh Bheag
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293904

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	914169
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a building under grass and bracken, measures c8m by 6m. Walls stand 0.6m tall and spread up to 1m wide. Entrance in NW elevation, centrally situated. Enclosure Asset 428.2 joins at the SW and NE corners. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	428.2
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293908
Northings	914159
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass, measuring c35m long, 0.6m tall and spread up to 1.5m wide, adjoining building 428.1 and a small branch of which likely formed a kale yard/garden. The dyke is partially revetted into the top of the NE break of slope on the terrace the building Asset 428.1 is situated on. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	428.3
Asset/Event Name	Corn drying kiln, Uaigh Bheag
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	293926
Northing	914168
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A corn-drying kiln under grass and bracken, visible as stone with a slight depression. The kiln bowl measures 1.5m in diameter, and although vegetation conceals the heat box, slightly projecting walls suggest the flue is aligned to the SE. The kiln has been constructed into the SE-facing hill slope overlooking the Loth Burn, SE of building Asset 428.1. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	428.4
Asset/Event Name	Corn drying kiln, Uaigh Bheag
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293940
Northing	914175
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable corn-drying kiln under grass and bracken, revetted into the SE facing slope overlooking the Glen Loth Burn, very degraded and likely robbed out to construct the nearby better-preserved kiln (Asset 428.3). Similarly constructed into the SE facing hill slope and appears as a mound of stone some 4m by 4m with little other structural elements apparent but the SE wall. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	428.5
Asset/Event Name	Clearance cairn, Uaigh Bheag
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293961
Northing	914168
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large mound of clearance material extending 7m by 9m and 1.3m tall, under grass and bracken, presumed clearance cairn. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.
Asset/Event Number	428.6
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293935
Northing	914144
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A 22m long length of stone and turf dyke under grass and bracken. Dyke stands 0.7m tall and spread up to 1.5m.wide, possibly used as a flood-defence or augmentation for the Loth Burn, along which it runs. The S end potentially continues into tall bracken and Could not be discerned fully. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.
Asset/Event Number	430
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293877
Northing	914211
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under bracken and heather, c60m long. Stands 0.5m tall and spread up to 1m wide, respecting the base of the hill on its N side. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.
Asset/Event Number	431
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294044
Northing	914328
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under bracken and grass, enclosing a slope, stands 0.3-0.5m tall and spread up to 1m wide. C115m long. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.
Asset/Event Number	432
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13174
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.5
Easting	293944
Northing	914366
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under bracken and grass. C195m long. Stands 0.5m tall and spread up to 1m. Crosses dyke Asset 433. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	433
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293928
Northing	914350
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under bracken and grass, at least c200m long, stands 0.4m tall and spread 1m wide. Not depicted on historic mapping. Continues N outwith survey corridor but diminishes as shown at its S extent. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	434
Asset/Event Name	Clearance cairn, Uaigh Bheag
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	293924
Northing	914306
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under moss and bracken, measures 6m in diameter and stands 0.8m tall.

Asset/Event Number	435
Asset/Event Name	Hut circle, Uaigh Bheag
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293913
Northing	914317
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small hut circle or enclosure under grass and bracken, measures c7m in diameter over banks which stand 0.7m tall and spread up to 2.5m. A possible entrance in the SW quarter.

Asset/Event Number	436
Asset/Event Name	Clearance cairn, Uaigh Bheag
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293933
Northing	914330
Council	Highland
Condition:	Very Degraded
Alignment:	N/S

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn of possibly post-medieval date under bracken, measures 9 by 4m and stands 1m tall. Closely situated to dyke Asset 433.
Asset/Event Number	437
Asset/Event Name	Clearance cairn, Uaigh Bheag
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293938
Northing	914317
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under moss and bracken, measures 5m in diameter and stands 0.8m tall.
Asset/Event Number	438
Asset/Event Name	Dyke, Uaigh Bheag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC91SW 54.00
HER Number	MHG13174
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293934
Northing	914186
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone and turf dyke under bracken extending along the rim of the terrace between Assets 412 and 428 remains. Dyke consists of intermittent boulders, likely originally contained a turf element and now degraded away. Stands 0.4m tall and spread up to 1.5m wide, c40m long. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879.

Appendix 1: Gazetteer of Heritage Assets and Events



OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.

Asset/Event Number	439.1
Asset/Event Name	Peat cutting, Uaigh Bheag
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294109
Northing	914793
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under grass and heather, measures 17m by 15m and 0.3m deep banks.

Asset/Event Number	439.2
Asset/Event Name	Peat cutting, Uaigh Bheag
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294141
Northing	914822
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of peat cutting under grass and heather, measures 45m by 32m and 0.5m deep banks.

Asset/Event Number	440
Asset/Event Name	Clearance cairn, Uaigh Bheag

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG9934
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294035
Northing	914660
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, measures 6m by 5m and stands 0.4m tall.
Asset/Event Number	441
Asset/Event Name	Dyke, Loth Burn
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG19337
Status	Non-designated Heritage Asset
Section:	A1.5 (in access track corridor to section)
Easting	293621
Northing	912912
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable stone and turf and stone dyke c480m long, barely discernible below bracken. Stands c0.7m tall and spread up to 1m wide. No stone visible but can feel them underfoot. Breached by access track. Not depicted on historic mapping. OS. 1879. Sutherland, LXXXIX, Surveyed: 1871, Published: 1879. OS. 1907. Sutherland, LXXXIX, Surveyed: 1904, Published: 1907.
Asset/Event Number	442
Asset/Event Name	Structure, Glen Sletdale
Type of Asset/Event	Structure
Date and/or Period	Modern
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293605
Northing	912932
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible structure under grass and bracken, measuring 7m by 4.5m and appearing as a fairly level spread of stone with some corrugated iron also visible. A rectilinear building and small enclosure are depicted on the 1963 OS, but nothing is depicted on earlier historic mapping. The NRHE and HER record a township in this location based on 1st edition OS mapping, but the location appears to be wrong as there are no structures as described below in the listing present on the 1st edition OS map at this location, or on the later-mentioned 1963 OS map. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. OS. 1963. NC91 SW - A. Surveyed/Resurveyed: 1962, Published: 1963 https://highland.gov.uk/monument/MHG19337 A township comprising four unroofed buildings, a sheepfold, an enclosure, an area of cultivation, and a head dyke, is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet lxxxix). One roofed and nine unroofed buildings, two of which are marked as ruins, two enclosures, a sheepfold, field walls and a head-dyke, are shown on the current edition of the OS:10560 map (1963). Information from the RCAHMS (SAH) 16 October 1995.
Asset/Event Number	443.1
Asset/Event Name	Building, Coille Bad Mheasain
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293240
Northing	913045
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible footings of a building, heavily obscured by turf and bracken and discerned more so by feeling underfoot than visually. Rectangular in plan c18m long by 5m wide, with banks up to 0.3m tall and spread 1m wide, one possible internal partition. Situated atop a small terrace overlooking

Appendix 1: Gazetteer of Heritage Assets and Events

Glen Loth to the NE. One roofless structure or pen, on an alternate NW/SE orientation, is depicted on the 1st edition OS map, so may not relate to this structure. Falls within the HER extent for the Coille Bad Mheasain township.

OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.

<https://highland.gov.uk/monument/MHG13173>

No description.

Asset/Event Number	443.2
Asset/Event Name	Corn-drying kiln, Coille Bad Mheasain
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293253
Northing	913060
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible corn-drying kiln under grass and bracken, measuring 7m in diameter and excavated into a NE-face slope with possible flue visible leading N. Drystone construction with a wall spread of c1m and standing to a height of 0.6m tall. Not depicted on the 1st edition OS map. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.

Asset/Event Number	443.3
Asset/Event Name	Kiln barn, Coille Bad Mheasain
Type of Asset/Event	Kiln barn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293237
Northing	913163
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Very degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A kiln barn under bracken and grass has been constructed on the NE facing slight slope. Measures c20m long over walls and kiln, by 5m over walls. The kiln is located at the SW end higher up the hill than the rest of the building. Only a shallow depression is visible atop the mound, c4m in diameter. Not depicted on the 1st edition OS map. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.

Asset/Event Number	443.4
Asset/Event Name	Pen, Coille Bad Mheasain
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293233
Northing	913156
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small square shaped drystone pen c6m by 6m, open on the NE side and defined by large roughly dressed boulders up to 0.8m long set in a single course, forming the stone component of what was likely a stone and turf dyke. Likely a small kale yard or pen. Not depicted on the 1st edition OS map. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.

Asset/Event Number	443.5
Asset/Event Name	Clearance cairn, Coille Bad Mheasain
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	N/A
Easting	293232
Northing	913178
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn partially under grass and bracken, extending 6m by 4m and 0.3m tall. May be obscuring footings for a structure below. Not depicted on the 1st edition OS map. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.
Asset/Event Number	443.6
Asset/Event Name	Dyke, Coille Bad Mheasain
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293222
Northing	913198
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An arrangement of a low stone and turf dykes standing 0.4m tall and spread 2.5m wide forming a D shape, set almost against the dyke Asset 453, but not quite touching it. The D-shape measures c15m long by 10m wide, with a small section in the NW forming a little pen 5.5m E/WS by 3.5m N/S. Both are open to the W. Not depicted on the 1st edition OS map. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.
Asset/Event Number	444
Asset/Event Name	Marker cairn, Coille Bad Mheasaina

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval/Modern
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293257
Northing	913049
Council	Highland
Condition:	Good
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small stone-built cairn, measuring 2m by 0.7m and standing 0.8m tall. The cairn is prominent and may be of modern date, possibly used as a marker or navigation cairn. Not depicted on the 1st edition OS map. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.
Asset/Event Number	445
Asset/Event Name	Hut circle, Gable burn
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	NC91NW 10
HER Number	MHG9981
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294575
Northing	915318
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Asset not directly accessed during the survey as situated within an area of old woodland regeneration with relict mounding and pits that could not be crossed safely. The area is fairly prominent as a patch of heather, bracken and rushes opposed to the wetland grasses the North Tower 176 is located on. https://highland.gov.uk/monument/MHG9981 (NC 9455 1531) Enclosure (NR) (now Hut 'A'). OS 6" map, (1964) An enclosure (A) was located during field investigation. Visited by OS (E G C) 4 June 1961. Situated at the foot of a W-facing hill slope are two hut circles ('A' and 'B').

Appendix 1: Gazetteer of Heritage Assets and Events

'A', positioned at NC 9457 1532, measures 11.5m SSE-NNW by 9.5m within a peat-covered wall spread to approximately 2.5m. Several inner and outer facing stones are visible in the E arc. The entrance gap is in the SSE. 'B' positioned at NC 9462 1540 has a considerable silt overlay, with the centre in a marshy condition. It measures, internally NNW-SSE, 12.0m by 11.0m. The entrance in the SSE is flanked on its W side by a possible portal stone. A few clearance heaps are scattered to the S and W of the huts, but no plots are discernible. Surveyed and revised at 1:10,560. Visited by OS (J B) 14 January 1976.

Asset/Event Number	446.1
Asset/Event Name	Possible shieling, Glen Sletdale
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293065
Northing	913020
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings of a possible shieling under grass and heather. The structure measures 6m by 4m over banks, which stand to 0.4m tall. No stone visible, and the NW side is degraded to ground level. Internally measures 4m by 1.5m. Situated on a gently declining slope. Not depicted on the 1st edition OS map. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.

Asset/Event Number	446.2
Asset/Event Name	Possible shieling, Glen Sletdale
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293060
Northing	913023
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf bank, possibly forming part of a shieling but truncated and disturbed by tree planting moulding. Bank stands 0.4m tall and spread 1.5m wide, 4m long, slight return to the NW. Not depicted on the 1st edition OS map. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.
Asset/Event Number	446.3
Asset/Event Name	Dyke, Glen Sletdale
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293054
Northing	913023
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An L-shaped segment of dyke c6m long under grass and likely disturbed by tree planting present. Dyke possibly constructed solely from turf, no stone visible. Stands 0.5m tall and spread 1.5m wide. Not depicted on the 1st edition OS map. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.
Asset/Event Number	447
Asset/Event Name	Dyke, Glen Sletdale
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293168
Northing	912887
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf and stone

Appendix 1: Gazetteer of Heritage Assets and Events



dyke under heather and grass, c40m long, and stands 0.6m tall and spread 1m wide. Not visible beyond either side of survey corridor, meets the E-W aligned modern EU-funded track on its S end. Not depicted on historic mapping.

OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.

Asset/Event Number	448
Asset/Event Name	Dyke, Glen Sletdale
Type of Asset/Event	Dyke
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	292939
Northing	912697
Council	Highland
Condition:	Fair
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large stone and turf dyke under heather, c830m long and stands 0.7-1.3m tall and spread up to 4m wide. Runs parallel with modern EU-funded track and likely related to its construction. Not depicted on historic mapping.

Asset/Event Number	449
Asset/Event Name	Borrow pit, Glen Sletdale
Type of Asset/Event	Borrow pit
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293091
Northing	912823
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Borrow pit measuring 8m in diameter and 2m deep, partially under grass, likely used for the construction of the adjacent modern EU-funded track in recent times.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	450
Asset/Event Name	Enclosure, Glen Sletdale
Type of Asset/Event	Enclosure
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293048
Northing	912813
Council	Highland
Condition:	Very degraded
Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Semi-circular enclosure, measuring 22m by 17m over the bank. Bank, likely of stone and turf construction, stands 0.4m tall and spread up to 1m wide. Enclosure banks are slight and covered in heather with west bank in particular quite ill-defined. Possible entrance on SE side. Not depicted on historic mapping. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.

Asset/Event Number	451
Asset/Event Name	Borrow pit, Glen Sletdale
Type of Asset/Event	Borrow pit
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293063
Northing	912793
Council	Highland
Condition:	Good
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Borrow pit measuring 6.6m in diameter and 2.2m deep, partially under grass and heather, likely used for the construction of the adjacent EU-funded track in recent times.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	452
Asset/Event Name	Standing stone, Glen Sletdale
Type of Asset/Event	Standing stone
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	292949
Northing	912822
Council	Highland
Condition:	Good
Alignment:	NA
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large buff coloured stone 1.1m tall, 0.5m wide and 0.5m thick, has been set upright within an area of young woodland regeneration plantation. It appears very "fresh", with no lichen or moss growth present. Recorded for posterity.
Asset/Event Number	453
Asset/Event Name	Dyke, Glen Sletdale
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293261
Northing	913045
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under heather and grass, bisected by modern track. Stands 0.8m tall and spread up to 1.5m wide, this portion measures 35m long but it extends beyond the survey corridor to the N and S. The dyke is consistent with a head dyke depicted on the 1st edition OS map, the N extent of which falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	454
Asset/Event Name	Clearance cairn, Glen Sletdale
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293343
Northing	913118
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under grass, measuring 2.5m by 1.8m and stands 0.6m tall.

Asset/Event Number	455
Asset/Event Name	Sheepfold, Coille Bad Mheasain
Type of Asset/Event	Sheepfold
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG13173
Status	Non-designated Heritage Asset
Section:	N/A
Easting	293244
Northing	913265
Council	Highland
Condition:	Fair
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large drystone sheepfold measuring 50m by 25m, two smaller pens in the N end measuring 19m by 7m and 12m by 5. Walls are drystone constructed and stand c1-1.5m tall and 0.8-1m wide. Main entrance in S end with smaller entrance in the N. The sheepfold is depicted on the 1st edition OS map and named 'Glenhouse Sheepfold'. Falls within the HER extent for the Coille Bad Mheasain township. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879. https://highland.gov.uk/monument/MHG13173 No description.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	456.1
Asset/Event Name	Borrow pit, Glen Sletdale
Type of Asset/Event	Quarry
Date and/or Period	Post-medieval/modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293477
Northing	913352
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Borrow pit c20m in diameter with mounded material (Asset 456.2) surrounding it, accessed from the Glen Loth road to the E. Appears modern in date.

Asset/Event Number	456.2
Asset/Event Name	Dyke, Glen Sletdale
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	293476
Northing	913358
Council	Highland
Condition:	Fair
Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf-covered bank/dyke 0.7m tall and 1m wide, c140m long, enclosing borrow pit (Asset 456.1) to the E, likely contemporary and of modern date.

Asset/Event Number	457
Asset/Event Name	Dyke, Beinn na Meilich
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294998
Northing	916272
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A low turf dyke under heather and grass standing 0.3m tall and spread 0.8m wide, adjacent to a small stream which might be artificial, possibly running along the former ditch used for construction. Extends c370m long and consistent with the parish boundary depicted on the 1st edition OS map between Loth and Kildonan. OS. 1879. Sutherland LXXXIX, Surveyed: 1871, Published: 1879.

Asset/Event Number	458
Asset/Event Name	Clearance cairn, Allt nan Tullachan
Type of Asset/Event	Clearance cairn
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	294820
Northing	915998
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable clearance cairn under heather and grass, measures 7m by 5m and 0.6m tall. Very isolated from post-medieval settlement remains so possibly prehistoric, date uncertain.

Asset/Event Number	459
Asset/Event Name	Mound, Garskelly
Type of Asset/Event	Mound
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.2
Easting	271214
Northing	898151
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A mound under heather, measuring 8m by 5m and standing 0.7m tall. Possibly a prehistoric clearance cairn but the asset is very isolated and only possible other asset (Asset 460) of similar appearance is over 100m S. A possible hut circle (Asset 462) lies over 300m to the E, but these are all situated on a N-facing slope that is not very conducive to agricultural activity, so there may be less remains in the vicinity as a result.
Asset/Event Number	460
Asset/Event Name	Mound, Garskelly
Type of Asset/Event	Mound
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	271195
Northing	898031
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A mound under heather, measuring 7m by 6m and standing 0.4m tall. Possibly a prehistoric clearance cairn but the asset is very isolated and only possible other asset (Asset 459) of similar appearance is over 100m N. A possible hut circle (Asset 462) lies over 300m to the E, but these are all situated on a N-facing slope that is not very conducive to agricultural activity, so there may be less remains in the vicinity as a result.
Asset/Event Number	461
Asset/Event Name	Dyke, Garskelly
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	B1.2
Easting	271430
Northing	898085
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass and heather. The dyke is much degraded, standing to a height of 0.4m and spread up to 3.5m wide, c200m long. The W extent appears to be depicted on the 1st edition OS map. OS. 1879. Sutherland CIX. Surveyed: 1874, Published: 1879.

Asset/Event Number	462
Asset/Event Name	Hut circle, Garskelly
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	271626
Northing	898087
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible hut circle under heather and grass, measuring c10m in diameter over banks where are 1m wide and stand 0.3m tall, but dimensions are difficult to determine due to vegetation. A possible entrance lies in the SE quarter.

Asset/Event Number	463.1
Asset/Event Name	Dyke, Achtaduach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	271852

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	898138
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass and heather, stands 0.4m tall and spread up to 3m wide. Dyke runs c80m long along the N side of a relict track Asset 463.2; the two are likely contemporary. Both are consistent with a boundary shown on the 1st edition OS map. OS. 1879. Sutherland CIX. Surveyed: 1874, Published: 1879.

Asset/Event Number	463.2
Asset/Event Name	Track, Achtaduach
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	271959
Northings	898257
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track under grass and heather with an adjacent dyke Asset 463.1 flanking the N side. The track has formed a very slight holloway, and measures 3m wide at the base and tapers up to 5m wide at the top. C140m long. Both are consistent with a boundary shown on the 1st edition OS map. OS. 1879. Sutherland CIX. Surveyed: 1874, Published: 1879.

Asset/Event Number	464
Asset/Event Name	Mound, Achtaduach
Type of Asset/Event	Mound
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272109
Northings	898235

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf mound or possible clearance cairn under heather. Measures c9.5m by c4.5m and stands 0.7m tall.
Asset/Event Number	465
Asset/Event Name	Dyke, Achtaduach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272206
Northing	898245
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under heather, stands 0.5m tall and spread 1m wide. C30m recorded but appears to continue to the E beyond the survey corridor. Consistent with a field boundary shown on the 1st edition OS map. OS. 1879. Sutherland CIX. Surveyed: 1874, Published: 1879.
Asset/Event Number	466.1
Asset/Event Name	Building, Dalnamain
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272122
Northing	898437
Council	Highland
Condition:	Good
Alignment:	N/S

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A timber constructed shed measuring 9m by 5m, with an open entrance 4m by 2m to the S. Walls stand c2.5m tall and gable ends c5m tall - dense surrounding vegetation prohibited direct access. The structure is roofed with corrugated iron sheets and surrounded by dense vegetation. First depicted on the 1959 OS map. OS. 1959. NH79NW - A. Surveyed / Revised: 1930 to 1959, Published: 1959
Asset/Event Number	466.2
Asset/Event Name	Pens, Dalnamain
Type of Asset/Event	Pen
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272127
Northing	898433
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A block of concrete pens measuring c8m by 5m with walls that stand up to 1.3m tall and 0.2m wide. Constructed from yellow sandstone with cement mortar and a cement harl. The side of the pens have been breached haphazardly through the wall, and the interior contains tall trees and vegetation that prohibited direct access. No structures depicted on the 1st or 2nd edition OS maps, but may form part of a series of pens first depicted on the 1969 OS map labelled as sheep pens. OS. 1969. NH79NW - A. Surveyed / Revised: 1966 to 1969, Published: 1969.
Asset/Event Number	466.3
Asset/Event Name	Structure, Dalnamain
Type of Asset/Event	Structure
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272195
Northing	898441
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small ruinous wooden structure measuring 6m by 4m, bearing a slanted flat roof of corrugated iron. The building is 2.8m tall along the N end and 2,5m tall at the S end. The building had a door in the N elevation, and inside there is a small counter against the E internal wall. Likely used as a fishing bothy or similar for the nearby river. First depicted on the 1959 OS map. OS. 1959. NH79NW - A. Surveyed / Revised: 1930 to 1959, Published: 1959

Asset/Event Number	467
Asset/Event Name	Clearance cairn, Achtaduach
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272227
Northing	898275
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under heather, measuring 2.8m by 2.5m and 0.7m tall.

Asset/Event Number	468
Asset/Event Name	Bridge, Dalnamain
Type of Asset/Event	Bridge
Date and/or Period	Post-medieval/Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272176
Northing	898458
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A bridge constructed with a

Appendix 1: Gazetteer of Heritage Assets and Events

single mortar and stone pier and mortar and stone footings either side of the Abhainn an s-Stratha Charnaig. A timber board bridge rests atop the pier and footings, measuring 7m long and 3m wide. The stone elements pre-date this. A foot bridge is identified on the 1st edition OS map at this crossing and is labelled as such until 1969, so potentially this bridge may be of mid-20th century date.

OS. 1879. Sutherland CIV. Surveyed: 1873-4, Published: 1879.

OS. 1969. NH79NW - A. Surveyed / Revised: 1966 to 1969, Published: 1969.

Asset/Event Number	469
Asset/Event Name	Dyke, Abhainn an t-Stratha Charnaig
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272156
Northing	898492
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, extends parallel with track. Stands 0.5m tall and spread 1m wide, extends c60m. Not depicted on historic mapping.

Asset/Event Number	470
Asset/Event Name	Corn drying kiln, Dalnameine
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 9
HER Number	MHG11728
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272347
Northing	898589
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A corn drying kiln under grass and heather, constructed into SE facing hill slope. Measures c5m in diameter. A small stone

Appendix 1: Gazetteer of Heritage Assets and Events

and turf dyke extends to the SW, creating a small enclosed area at the SE side of the kiln. The kiln bowl is partially visible through the vegetation with a diameter of 2m. The flue is not visible. Not depicted on historic mapping.

<https://her.hIGHLAND.gov.uk/monument/MHG11728>

There is a possible souterrain at Daneman. There appears to be the outline of a passage, and lintel stones in position can be seen.

Information contained in letter from Elizabeth R Mackay, Tigh Beag, Rearquhar, Dornoch, IV25 3NE, to OS.

This would appear to be a well-preserved kiln-barn of pre-1811 date and associated with the depopulation around.

Information contained in letter from R Mowat, RCAHMS to OS 2 October 1978.

A well-preserved corn-drying kiln with flue exposed.

Surveyed at 1:10,000.

Visited by OS (N K B) 15 October 1980.

Asset/Event Number	471
Asset/Event Name	Dyke, Innis Aonar
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH79NW 38
HER Number	MHG19237
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272482
Northing	899068
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded turf and stone dyke under tall heather, stands 0.4m tall and spread up to c3m wide, but dimensions fairly difficult to see given vegetation, but visibility improves in N extent. Disappears to the SW in a dense cluster of woodland. C480m recorded but the dyke extends outwith the survey corridor to the E. Forms the enclosure for the Innis Aohmar farmstead. Partially depicted on the 1st edition OS map. OS. 1879. Sutherland CIV. Surveyed: 1873-4, Published: 1879. https://her.hIGHLAND.gov.uk/monument/mhg19237 A farmstead, comprising one unroofed building and an enclosure within a field is depicted on the 1st edition of the OS 6-inch map (Sutherland 1879, sheet civ). One unroofed building and one enclosure are shown on the current edition of the OS 1:10560 map (1969). Information from RCAHMS (AKK) 21 November 1995. Innis Aonar. Footings of enclosures noted on the 6" OS map, and of a cruciform building and well-preserved corn-drying kiln were found (Macdonald 1995, fig 18). NH 725 992 The long axis of the cruciform building is c16.5m by 2m, with the extensions being 4m by 2m and 3m by 2m, and slightly offset. NH 725 991 Corn-drying kiln, with 1.5m bowl, flue opening to SE. NH 724 991 Oval outline of stones 4.6m by 2m. Sponsor: Tain Archaeological Group 1995. M Macdonald 1995.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	472.1
Asset/Event Name	Prehistoric clearance cairn, Allt na h-Innse Aonair
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH79NW 6
HER Number	MHG11725
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272702
Northing	899205
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measures c7m in diameter and stands 0.8m tall.

Asset/Event Number	472.2
Asset/Event Name	Prehistoric clearance cairn, Allt na h-Innse Aonair
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH79NW 6
HER Number	MHG11725
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272722
Northing	899216
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. May be built on a small protrusion of bedrock. Measures 7.5m by 5m and stands 0.6m tall

Asset/Event Number	472.3
Asset/Event Name	Prehistoric clearance cairn, Allt na h-Innse Aonair

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH79NW 6
HER Number	MHG11725
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272714
Northing	899194
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5m in diameter and stands 0.4m tall.

Asset/Event Number	472.4
Asset/Event Name	Prehistoric clearance cairn, Allt na h-Innse Aonair
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH79NW 6
HER Number	MHG11725
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272728
Northing	899198
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 5.5m in diameter and stands 0.5m tall.

Asset/Event Number	473
Asset/Event Name	Shooting butt, Allt na h-Innse Aonair
Type of Asset/Event	Shooting butt
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2

Appendix 1: Gazetteer of Heritage Assets and Events

Easting	272810
Northing	899312
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible shooting butt under heather. The structure is defined by a circular bank under heather standing between 0.5 and 1.3m tall, spread up to 2m wide. Possibly incorporated some of the surrounding bedrock formation into. Possible entrances lead out to the NW, NE and SW but these may also be sheep/deer trails.

Asset/Event Number	474
Asset/Event Name	Prehistoric clearance cairn, Allt na h-Innse Aonair
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.2
Easting	272771
Northing	899361
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable prehistoric clearance cairn under heather, measures 5.5m by 4m and stands 1.5m tall. No stone visible but suspected to be a prehistoric clearance cairn like those found c60m to the S (Asset 472), although the HER extent for MHG11725 and Asset 472 does not extend this far.

Asset/Event Number	475
Asset/Event Name	Track, Am Bru-lochan
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288988
Northing	908366

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Relict track under grass and partially sunken in places, 2.5-3m wide. Depicted on the 1st edition OS map and likely an old peat cutting road. Recorded extent is c800m long but continues outwith the survey corridor to the N and S. OS. 1872. Sutherland XCVIII (with inset of XCIX). Survey date: 1872, Publication date: 1879

Asset/Event Number	476
Asset/Event Name	Peat cutting, Creag an Lochain Deirg
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288776
Northing	908369
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of old peat cutting c40m by 30m under heather, banks are up to 0.4m deep. Dis-used.

Asset/Event Number	477
Asset/Event Name	Peat cutting, Creag an Lochain Deirg
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288894
Northing	908299
Council	Highland
Condition:	Very Degraded
Alignment:	E/W

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of extensive peat cutting under heather on the top and E-facing side of the hill Creag an Lochain Deirg. Recorded extent measures c340m by 200m but it continues outwith the survey corridor to the N and S. The banks vary in depths from over 1m to 0.2m and suggest the area has been long in-use for peat cutting.
Asset/Event Number	478
Asset/Event Name	Peat cutting, Am Bru-lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288566
Northing	908125
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of old peat cutting under heather, c70m by 70m and banks are up to 0.4m deep. Record extent measures c100m by 80m but the peat cutting continues outwith the survey corridor to the S. Dis-used.
Asset/Event Number	479
Asset/Event Name	Enclosure, Clyne
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286909
Northing	907701
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub-circular enclosure under heather, c18m in diameter over banks. The banks stand to a height of 0.4m tall and spread up to 2m wide. Likely a post-medieval drover's enclosure given the proximity to the

Appendix 1: Gazetteer of Heritage Assets and Events

old drove road Asset 485. Not depicted on historic mapping.

Asset/Event Number	480.1
Asset/Event Name	Peat cutting, An Dubh Lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288342
Northing	908068
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather, c115m by 20m and banks up to 0.3m deep. Dis-used.

Asset/Event Number	480.2
Asset/Event Name	Peat cutting, An Dubh Lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288281
Northing	908119
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather, c20m by 10m, banks up to 0.3m deep. Dis-used.

Asset/Event Number	480.3
Asset/Event Name	Peat cutting, An Dubh Lochan

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288250
Northing	908161
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather, c90m by 10m, banks up to 0.3m deep. Dis-used.

Asset/Event Number	480.4
Asset/Event Name	Peat cutting, An Dubh Lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288191
Northing	908066
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather, c220m by 110m, banks up to 0.3m deep. Dis-used.

Asset/Event Number	480.5
Asset/Event Name	Peat cutting, An Dubh Lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	288070
Northing	908104
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather, c180m by 60m, banks up to 0.3m deep. Dis-used.

Asset/Event Number	481.1
Asset/Event Name	Peat cutting, An Dubh Lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	287958
Northing	907951
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather, c340m by 200m (continues beyond survey corridor extent to N and S), around the un-named burn that runs S into the An Duch-lochan, banks up to 0.3m deep. Dis-used.

Asset/Event Number	481.2
Asset/Event Name	Peat cutting, An Dubh Lochan
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	287796
Northing	907891
Council	Highland
Condition:	Degraded
Alignment:	NW/SE

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A discrete area of peat cutting under heather, c20m by 10m, banks up to 0.3m deep. Dis-used.
Asset/Event Number	482
Asset/Event Name	Track, An Dubh-lochan
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	288110
Northing	908064
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track under heather and grass, 2m wide. Likely used for peat cutting and collection, appears to lead down to the loch An-Dubh Lochan, but is not easily visible. C35m long. Not depicted on historic mapping.
Asset/Event Number	483.1
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285568
Northing	907217
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A mound of field clearance stones, measuring 7m by 5m and standing to 0.8m tall. Appears fairly modern.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	483.2
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285584
Northing	907216
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A mound of field clearance stones, measuring 5m by 3m and standing to 0.7m tall. Appears fairly modern.

Asset/Event Number	484
Asset/Event Name	Peat cutting, Clyne
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286875
Northing	907559
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather and grass, c130m by 90m, banks are up to 0.6m deep and peter out to the N. Dis-used.

Asset/Event Number	485
Asset/Event Name	Track, Clyne
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG30283
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286551
Northing	907485
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track c3m wide under heather, the centre of which is well-worn as a bare-earth trail c1m wide. Forms an historic drove road from Oldtown to Clyne, extending outwith the 200m survey corridor to the NW and SE. Note: the HER extent for this is a small point area outwith the survey corridor. Depicted on the 1st edition OS map. OS. Sutherland XCVII. Surveyed: 1872, Published: 1879. https://her.highland.gov.uk/monument/MHG30283 The road is also known locally as the Coffin Road or Garlet Road (Garbh Leathad, Rough Slope) - stretches from Oldtown at its north-western end to Clynekirkton in the south-east. (NC 8527 0883 TO 8940 0610). From the surrounding evidence, it is easy to imagine its origins as a prehistoric track. The Oldtown section, of what is now an estate road, is still in active use. The road passes Killin and makes its way towards the ruins of Clynekirkton Church and Belfry, the road narrows to little more than a sheep track. It preserves the trailmarks of the bereaved from a not so distant age: hence, no doubt, its alternative title - 'Coffin Road'. Finally, at its south-eastern end, the ancient road meets its modern counterpart as the latter skirts the belfry, church and graveyard. Information supplied by Dr. Norman Gibson, 14.10.01 See assoc. docs. File. J Aitken : 30.10.01 The Garlat or Garlet Road is the hill track from Clynekirkton to Oldtown. In it's first mile it climbs along the rough steep slope of Socach, behind the crofts of West Clyne; and this fact leads to the supposition that the original Gaelic was Garbh Leathad, Rough Slope. Local pronunciation would be Garruh Let. A very similar sounding word is gearraidh (pronounced garry nearly) which means, according to Bain, outland beyond township ploughed land; which is what this long slope would have been. Cregan a' Chorp which may be translated body stone, is a boulder beside this track, which used to be a resting place for funerals on their way out of Strathbrora to Clynekirkton graveyard. J MacLennan, The Northern Times, 1957. J Aitken : 15/05/02.
Asset/Event Number	486
Asset/Event Name	Dyke, Clyne
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG25168
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286403
Northing	907439
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under heather, stands 0.5m tall and spread 0.8m wide. The recorded extent measures c210m long but the dyke extends beyond the survey corridor to the NW and SE. Becomes stonier where it crosses over rockier ground. Not depicted on historic mapping.

Asset/Event Number	487
Asset/Event Name	Hut circle, Killin
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286348
Northing	907406
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and bracken. The banks stand 1.1m tall and spread up to 2m wide, difficult to tell due to vegetation. Somewhat oval shaped, measuring 12.5m NW/SE by 9.5m over banks. Situated on a gently declining W facing slope overlooking loc

Asset/Event Number	488
Asset/Event Name	Possible hut circle, Killin
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	286292
Northing	907364
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible hut circle under dense heather and bog willow, very difficult to trace bank, may measure c14m by 12m. Where bank survives it appears 0.7m tall and spread up to 2m. A small streamlet bisects it. Entrance not definite.

Asset/Event Number	489
Asset/Event Name	Possible hut circle, Killin
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286155
Northing	907404
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible hut circle under heather with poorly defined banks, measuring c10m in diameter with banks spread to 2m wide and standing 0.7m tall. A depression in the SE portion is the likely entrance. Vegetation obscured this asset quite significantly.

Asset/Event Number	490.1
Asset/Event Name	Possible burnt mound, Killin
Type of Asset/Event	Burnt mound
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286101
Northing	907393
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Crescent-shaped mound under heather, measuring 11m by 9.5m and stands 1m tall. Its form is reminiscent of burnt mounds although a clear water source is not immediately evident. Interpreted as a burnt mound, but may also be a large prehistoric clearance cairn.

Asset/Event Number	490.2
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286133
Northing	907263
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under grass and heather. Measures 3m in diameter and stands 0.6m tall.

Asset/Event Number	490.3
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286102
Northing	907235
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



clearance cairn under heather and grass. Measures c3m in diameter and stands 0.8m tall, but lots of vegetation growth.

Asset/Event Number	490.4
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Mound
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285985
Northing	907358
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measuring 3m by 2.2m and standing 0.7m tall.

Asset/Event Number	490.5
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286034
Northing	907235
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measuring 10.5m by 6m and stands 0.7m tall.

Asset/Event Number	490.6
Asset/Event Name	Clearance cairn, Killin

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Mound
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285935
Northing	907327
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measuring 6m by 2m and standing 0.7m tall.

Asset/Event Number	490.7
Asset/Event Name	Clearance cairn, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285948
Northing	907187
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather. Measures 4m by 3m and stands 0.7m tall.

Asset/Event Number	490.8
Asset/Event Name	Possible burnt mound, Killin
Type of Asset/Event	Burnt mound
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	285908
Northing	907192
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible burnt mound under heather and gorse, the vegetation making it difficult to determine the extent and form. Measures at least 9m by 4.5m and stands 1.2m tall, situated on the N side of a small un-named watercourse. Alternatively this may be another prehistoric clearance cairn that is just somewhat larger than the others in the Asset 490 group.

Asset/Event Number	490.9
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	.
Date and/or Period	.
Listing No./NRHE Number	
HER Number	TBD
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	n/a
Alignment:	.
Importance:	TBD
Description	VOID - number not assigned.

Asset/Event Number	490.9
Asset/Event Name	VOID - number not assigned
Type of Asset/Event	.
Date and/or Period	.
Listing No./NRHE Number	
HER Number	TBD
Status	Non-designated Heritage Asset
Section:	N/A
Easting	
Northing	
Council	Highland
Condition:	n/a

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	.
Importance:	TBD
Description	VOID - number not assigned.
Asset/Event Number	490.10
Asset/Event Name	Clearance cairn, Clyne
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285844
Northing	907274
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather, measuring 3m by 2m and standing 0.6m tall. One very pronounced boulder at the centre.
Asset/Event Number	491
Asset/Event Name	Peat cutting, Clyne
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	286658
Northing	907399
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of old peat cutting under grass and heather. c70m by 70m. Banks 0.3-0.5m deep and edges ephemeral.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	492.1
Asset/Event Name	Cistern, Killin
Type of Asset/Event	Other
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285938
Northing	907190
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A concrete basin measuring 1.5m by 1m and 0.75m deep. Fed by a plastic pipe taking hill water in. Broken wooden door fragments around it presumably once formed a cover.

Asset/Event Number	492.2
Asset/Event Name	Mound, Killin
Type of Asset/Event	Mound
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285939
Northing	907193
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Mound of stone and earth under heather, measuring 3m in diameter and 1m tall, under heather. Spoil heap for pit the cistern structure 492.1 is in.

Asset/Event Number	493
Asset/Event Name	Dyke, Killin
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285805
Northing	907217
Council	Highland
Condition:	Degraded
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under grass and moss, stands 0.4m tall and spread up to 1m wide. Recorded extent measures c200m long but the dyke extends outwith survey corridor to the SE. Depicted on the 1st edition OS map. Forms part of Killin township MHG10799. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879 https://her.highland.gov.uk/Monument/MHG10799 (Area Centred NC 8572 0714) Killin (NAT) OS 6" map, Sutherland, 1st ed., (1907) Carrall: shown as a group of about four buildings with arable. Kulen: shown as a group of about four buildings. (Roy appears to have transposed these names as "Carroll" is shown on the E side of L Brora at Killin, and "Kulen" on the W side, near Carrol). W Roy 1747-55. Area centred NC 8572 0714. The area is, for the most part, covered in bracken and no building foundations were found. There are several enclosures in the area, all of stone. The enclosure at NC 8574 0713 is 9.0m diameter, 0.5m maximum height but having no apparent entrance. The enclosure at NC 8571 0708 is 2.0m square and is 1.0m high on the SE side; it is situated on top of a small hill. The enclosure at NC 8575 0715 is 0.8m high. The area is bounded on the E and S sides by a stone and turf bank. The area may be wrongly sited, as Carrol is on the W side of Loch Brora, see NC80NE 26. Visited by OS (E G C) 16 July 1961.
Asset/Event Number	494
Asset/Event Name	Dyke, Killin
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285776
Northing	907237

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very degraded
Alignment:	NNE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible stone and turf dyke, much degraded so that only the intermittent boulders are apparent. Stands 0.2m tall and c1m wide spread, measuring c30m long. Not depicted on historic mapping. Forms part of Killin township MHG10799. For HER description see Asset 493.
Asset/Event Number	495
Asset/Event Name	Enclosure, Killin
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285775
Northing	907151
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An irregular shaped enclosure, measuring 31m by 20m and constructed from a turf and stone dyke that stands 0.3m-0.7m tall in places with 1m spread. Entrance not discernible. Depicted on the 1st edition OS map. Forms part of Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879
Asset/Event Number	496
Asset/Event Name	Enclosure, Killin
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285750
Northing	907139
Council	Highland
Condition:	Very degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A circular enclosure under grass, c12m in diameter and constructed of a turf and stone dyke that stands 0.4m tall and spread 0.7m wide. Entrance not apparent. One of several small enclosure features in the Killin area. Not depicted on historic mapping. Forms part of Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Asset/Event Number	497
Asset/Event Name	Dyke, Killin
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285747
Northing	907164
Council	Highland
Condition:	Very degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone and turf dyke under grass, measures 0.5m tall and spread up to 1.5m wide, c55m long. Likely robbed for surrounding structures. Not depicted on historic mapping. Forms part of Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Asset/Event Number	498
Asset/Event Name	Dyke, Killin
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285726
Northing	907131
Council	Highland
Condition:	Very degraded
Alignment:	N/S

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under moss, 33m long in total, and stands 0.4m tall and spread 1m wide. Not depicted on historic mapping. Forms part of Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879
Asset/Event Number	499
Asset/Event Name	Dyke, Killin
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285716
Northing	907215
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded stone and turf dyke under grass, measures 0.5m tall and spread up to 1.5m wide, c33m long. Forms a possible small pen or enclosure but open to the W. Not depicted on historic mapping. Forms part of Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879
Asset/Event Number	500
Asset/Event Name	Building, Killin
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285681
Northing	907240
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a possible building under grass, measuring 8.5m by 6m with banks standing 0.3m tall. Situated atop a

Appendix 1: Gazetteer of Heritage Assets and Events

small grass-covered knoll with nearby mounds Assets 501.1 and 501.2 possibly representing further structures. Not depicted on historic mapping. Within HER extent for Killin township MHG10799. For HER description see Asset 493.

OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Asset/Event Number	501
Asset/Event Name	Quarry, Allt Bad na h-Achlaise
Type of Asset/Event	Quarry
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	249768
Northing	862908
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small quarry c7m in diameter, situated beside modern forestry track and likely related to its construction.

Asset/Event Number	501.1
Asset/Event Name	Mound, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285670
Northing	907240
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A grass-covered mound measuring c5.8m by 4m and standing 0.6m tall. Difficult to discern form due to the vegetation. Occupies a low hill and near to a similar mound (Asset 501.2) and building footings (Asset 500), so may be the remains of structure. Not depicted on historic mapping. Within HER extent for Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	501.2
Asset/Event Name	Mound, Killin
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285659
Northing	907244
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A grass-covered mound measuring c10m by 6m and standing 0.4m tall. Difficult to discern form due to the vegetation. Occupies a low hill and near to a similar mound (Asset 501.1) and building footings (Asset 500), so may be the remains of structure. Not depicted on historic mapping. Within HER extent for Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Asset/Event Number	502
Asset/Event Name	Corn drying kiln
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285698
Northing	907219
Council	Highland
Condition:	Very Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A corn drying kiln under bracken and grass, measuring 7m by 5m. The bowl is 2m in diameter and the flue aligned NE/SW, with opposing walls extending each side some 4m from kiln which measure 1m wide and c0.8m tall. The kiln wall stands 0.8m tall at the NE end. Not depicted on historic mapping. Within HER extent for Killin township MHG10799. For HER description see Asset 493.

Appendix 1: Gazetteer of Heritage Assets and Events



OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Asset/Event Number	503
Asset/Event Name	Enclosure, Killin
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NC80NE 20
HER Number	MHG10799
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	285594
Northing	907110
Council	Highland
Condition:	Good
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure measuring c120m by 130m and composed of a drystone dyke. The dyke stands 1.1-1.4m tall, measuring 0.8m at base and 0.4m at top with coping of small stones. Depicted on the 1st edition OS map. Forms part of the Killin township MHG10799. For HER description see Asset 493. OS. 1879. Sutherland XCVII. Survey date: 1872, Published: 1879

Asset/Event Number	504.1
Asset/Event Name	Peat cutting, Asc na Greine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	289891
Northing	908612
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of deeper peat cutting under grass, within larger overall peat area. Measures c19m by 8m and c0.3m deep.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	504.1
Asset/Event Name	Peat cutting, Asc na Greine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	289904
Northing	908639
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of extensively cut peat, now under heather and moss. C130m by 120m, the banks range in depth from 0.3-0.9m deep. Dis-used.

Asset/Event Number	504.2
Asset/Event Name	Peat cutting, Asc na Greine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5/B1.1
Easting	290113
Northing	908754
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of extensively cut peat, now under heather and moss. C240m long and extends beyond 200m survey corridor to N and S, the banks range in depth from 0.3-0.9m deep. Dis-used.

Asset/Event Number	504.3
Asset/Event Name	Peat cutting, Asc na Greine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	290341
Northing	908953
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of extensively cut peat, now under heather and moss. C400m long and extends beyond 200m survey corridor to W and E, the banks range in depth from 0.3-0.9m deep. Dis-used.

Asset/Event Number	504.4
Asset/Event Name	Peat cutting, Asc na Greine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5
Easting	290317
Northing	909114
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of extensively cut peat, now under heather and moss. C180m long and 60m wide, extends beyond 200m survey corridor to W, the banks range in depth from 0.3-0.9m deep. Dis-used.

Asset/Event Number	504.5
Asset/Event Name	Peat cutting, Asc na Greine
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.5

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	290521
Northing	909332
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large area of extensively cut peat, now under heather and moss. C270m long and extends beyond 200m survey corridor to E and W, the banks range in depth from 0.3-0.9m deep. Dis-used.

Asset/Event Number	505
Asset/Event Name	Track, Asc na Greine
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	289944
Northing	908588
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track measuring up to 2.5m wide and depressed in the peat under grass, recorded c40m length but continues beyond survey corridor to the SE. Likely an old peat road. Not depicted on historic mapping.

Asset/Event Number	506
Asset/Event Name	Dyke, Asc na Greine
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	290089
Northing	908744
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A low turf dyke standing 0.3-0.6m tall and spread up to 1m wide, extends across the peat cuttings Asset 504.2. Recorded extent measures c210m wide but the dyke extends outwith the survey corridor to the N and S. It is identified as a county boundary on the 1st edition OS map, representing the parish boundary between Loth to the NW and Clyne to the SE. OS. 1879. Sutherland XCVIII (with inset of XCIX). Survey date: 1872, Published: 1879.

Asset/Event Number	507
Asset/Event Name	Dyke, Glensgaich
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	NA
Status	Non-designated Heritage Asset
Section:	N/A
Easting	245157
Northing	860883
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone boundary dyke under bracken, stands up to 1m tall and spread c2m wide. Extends along edge of forestry plantation, recorded extent measures c500 but extends outwith survey corridor to the NW and SE. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881.

Asset/Event Number	508.1
Asset/Event Name	Structure, Middle north settlement, Upper Rogie
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG53447; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244155
Northing	860073
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW

Appendix 1: Gazetteer of Heritage Assets and Events



Importance: Low

Description

*Recorded by AOC Archaeology during 2024 walkover survey. Remains of a ruinous structure, adjacent to asset 508.2. Measures 5m x 2m and surviving to a height of 1.50m. Depicted as roofed on the 1st edition OS map within the township of Rogie. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881.

<https://her.hIGHLAND.gov.uk/Monument/MHG53447>

The main building of this settlement. It is the westmost of 2 with an enclosure, 37, to the rear. The building has 2 compartments and an outshot to the SW. It has an internal measurement of 11m x 3.5m, with the main compartment to the west being 6m in length. The tumbled dividing wall is 0.5m high and has a spread of 1m. The walls are of dry stone construction, double faced and 0.7m in thickness. The rear wall is generally 1m in height and turfed up on the outside. The NE gable is 1.5m high and the SW 1.2m. The front wall is tumbled for the main part, 0.5m high and with a spread of 1.5m, although the east part is better preserved and there is an entrance into the NE compartment.

The outshot to the SW is more roughly constructed with walls to a height generally of 1m, it measures 3m x 2m and has an entrance in the E corner next to the main building.

This building is thought to be MacQueens croft. A photograph taken in the 1920s, has been reproduced in the fieldwork report, Figure 7, page 25. <1>

<1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 43.

<https://her.hIGHLAND.gov.uk/Monument/MHG24412> (larger/more general)

A township comprising three roofed, one partially roofed and thirteen unroofed buildings, eight enclosures and two short lengths of head-dyke is depicted on the 1st edition of the OS 6-inch map (Ross-shire and Cromartyshire 1881, sheet lxxv). Ten unroofed buildings and four enclosures are shown on the current edition of the OS 1:10000 map (1989).

Information from RCAHMS (SAH) 28 February 1996

In an area of perhaps half a square kilometre and centred on a rounded hill to the north of the railway line there are the remains of a large enclosure and 5 discrete settlements. Their composition is variable, some have just 1 building and 1 enclosure, others have several buildings with up to 2 enclosures. The central focus is the hill, around which there are the remains of a discontinuous stone and turf wall, several clearance cairns lie within the enclosure particularly in the NW part. The settlements are contiguous with the enclosure wall at varying intervals. The whole area has been grossly disturbed by forestry, having been planted with trees, felled, ploughed and replanted again. In addition the drainage has been substantially disturbed by forest roads and tracks - many areas, which would in the past have been well drained, are now marshy. The surrounding wall and a few associated features are described first followed by each settlement the structures of which have then been grouped together.

The township is shown on the 1st edition OS map as 1 partially roofed building, 14 unroofed buildings, 6 enclosures and a head dyke.

The head dyke was noted during survey work in 2008-9 as a discontinuous wall. This appears to define an enclosure some 400m by 200m in size, mostly now planted with young trees but with some open grassy areas in the north part (previously ploughed). The SW corner of the enclosure was located by GPS at NH 43746 59852. In the SW and west the wasted dry stone wall is clearly defined and 0.5m in height. To the north it is ploughed out and barely discernable. The east part and south part appears to have been destroyed by the forest roads.

A small pen was noted to be situated in the angle of this wall a few metres to the west of the north-west settlement (MHG14114). The small pen is aligned north-south and measures 3m by 1m. The walls are of single stone thickness and are 0.6-0.7m high.

<1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital.

<https://her.hIGHLAND.gov.uk/Monument/MHG14115>

Information received from the Forestry Commission (date unknown) suggested that only one ruin of a square building was visible at NH 442 601. Agreed management consisted of

Appendix 1: Gazetteer of Heritage Assets and Events



scrub clearance to the roadside and 10 metres around the ruin.

The same area has subsequently been surveyed by NOSAS and found to comprise four buildings and two enclosures. The drainage of the settlement has been grossly affected by the construction of the road and is now very marshy. See individual HER records for details.

<2><3>

<1> SHG24686 Text/Record Form: Easter Ross Forest District. Unknown. Record of Scheduled or Other Ancient Monuments. Digital (scanned as PDF). Rogie Croft 3.

<2> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital.

<3> SHG23297 Verbal Communication: Tilbury, S. Comment by Sylvina Tilbury, HER Officer. 01/04/2010.

Asset/Event Number	508.2
Asset/Event Name	Structure, Middle north settlement, Upper Rogie
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG53447; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244157
Northing	860076
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous rectangular drystone structure c10m by 2.5m over walls, which stand up to 1.5m tall. Trees are growing within the interior. A smaller structure (Asset 508.1), likely a lean-to/ancillary, abuts the NW end. Depicted as roofed on the 1st edition OS map within the township of Rogie. For HER descriptions see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881.
Asset/Event Number	508.3
Asset/Event Name	Structure, Middle north settlement, Upper Rogie
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG53448; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244166
Northing	860090

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	Ruinous
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A square shaped drystone structure, roofless. Immediately to N of 508.1 and 508.2. Adjoins 508.4 to NE, separated by wall. Measures c4m NE to SW, and 3.5 SE to NW. Walls stand up to c2m at NE end. Possibly a small pen, or a more poorly preserved portion of the building Asset 508.4 as postulated below. Depicted potentially as a pen or roofless structure on the 1st edition OS map adjacent to the roofed Asset 508.4. For HER assets MHG24412 and MHG14115 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53448 Immediately to the north of 35 this building on the same NE-SW alignment has 2 compartments and an overall internal measurement of 13m x 3.5m. The west compartment is better preserved and measures 5m x 3.5m. The walls are of dry stone construction, double faced and 0.7m in thickness. The SW gable is 2m in height, the rear NW wall 1 - 1.2m high, the SE wall 0.8m high and the dividing wall is 0.5m high. There is an entrance 0.7m wide at the E end of the SE wall. The NE compartment is 7m x 3.5m and much more wasted, although the rear wall is 1m in height and the NE end has an external height of 1m. Otherwise it is generally 0.3m high. A large part of the SE wall is missing (or else it may have been a wide entrance). <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 43.
Asset/Event Number	508.4
Asset/Event Name	Structure, Middle north settlement, Upper Rogie
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG53449; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244171
Northing	860100
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remains of a ruinous structure, adjacent to the W end of Asset 508.3. Measures c6.5m x 3m, standing to a maximum height of 1.25m. Depicted as a roofed structure on the 1st edition OS map within the township of Rogie. For HER description see Asset 508.3. For HER assets MHG24412 and MHG14115 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	508.5
Asset/Event Name	Enclosure, Middle north settlement, Upper Rogie
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG53449; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244166
Northing	860096
Council	Highland
Condition:	Ruinous
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone boundary/enclosure wall immediately to NW of ruined structures and buildings at Rogie. Measures c20-25m by 10-15m. Depicted on the 1st edition OS map within the township of Rogie. For HER assets MHG24412 and MHG14115 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53449 An irregular enclosure to the rear/northwest of buildings 35 and 36. It is roughly 25m x 15m and is bounded by the remains of a stone wall, 0.5 -0.8m high in the NE part but much more wasted in its SW part. A line of trees are growing along the wall. The internal area is grassy and deeply ploughed but not planted. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 37.
Asset/Event Number	508.6
Asset/Event Name	Cultivation, Middle north settlement, Upper Rogie
Type of Asset/Event	Field system
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3.00
HER Number	MHG53449; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244161
Northing	860086
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A series of 4 linear

Appendix 1: Gazetteer of Heritage Assets and Events



banks/ditches running in a NE/SW direction within the enclosure Asset 508.5. Banks are up to 0.5m tall measured from the ditches. Features c15-20m in length. For HER description see Asset 508.5. For HER assets MHG24412 and MHG14115 see Asset 508.1.

Asset/Event Number	509.1
Asset/Event Name	Kiln barn, Upper Rogie
Type of Asset/Event	Kiln barn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53456; MHG24412; MHG14115
Status	Non-designated Heritage Asset
Section:	
Easting	244011
Northing	860153
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings for a rectangular kiln barn building under dense bracken and grass, as described below. Possibly depicted as a roofless structure on the 1st edition OS map within the township of Rogie. For HER assets MHG24412 and MHG14115 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53456 Aligned E-W this structure has an overall measurement of 7m x 3m. The kiln is well preserved and of dry stone construction, it is generally 1.6m high. The bowl has a diameter of 1.8m and it is 0.5-1m deep although there is some tumbled material inside. Unusually there are two flues in the straight west face which is 1.1m in height. The south one appears blocked although it can be probed to a depth of 0.9m, it has an aperture of 1m width x 0.3m height externally, narrowing to 0.3m width x 0.1m height. The north flue is 0.5m wide, 0.2-0.4m depth and 1m in length. Externally there is an abutting feature on the SE side of the structure, this takes the form of a rising ramp of large stones, this may have been steps up to the top of the kiln. The internal area of the barn to the east is raised above the level of the surrounding ground. It is 6m x 2.5m internally and the remains of the walls are 0.3-0.5m height inside (0.6-1m outside). There is an entrance 0.7m in width at the east end of the south wall. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 43.
Asset/Event Number	509.2
Asset/Event Name	Building, Upper Rogie
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG53457; MHG24412; MHG14113
Status	Non-designated Heritage Asset
Section:	
Easting	244020
Northing	860149
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular building with boulder-defined walls. As described below. Not depicted on historic mapping. For HER asset MHG24412 see Asset 508.1. https://her.highland.gov.uk/Monument/MHG53457 A few metres to the SE of the kiln the very wasted remains of this structure appear as a rectangular marshy depression. The structure is aligned ENE-WSW and has an overall measurement of 9m x 4m. Several large moss covered boulders outline the walls of the structure; the rest of the walls may have been robbed. The walls have a height of 0.5-0.6m inside (0.2-0.5m outside). There may be an entrance in the south wall. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 44. https://her.highland.gov.uk/Monument/MHG14113 Information received from the Forestry Commission (date unknown) described the site as consisting of a kiln, longhouse and two other ruins.. Agreed management consisted of clearance of windblow and standing conifers to 10 metres from the perimeter and the avoidance of the area by extraction machinery. <1> The same area has subsequently been surveyed by NOSAS and found to comprise four buildings, one kiln barn and one enclosure. The drainage of the settlement has been affected by the construction of the road and is now very marshy. See individual HER records for details. <2><3> <1> SHG24686 Text/Record Form: Easter Ross Forest District. Unknown. Record of Scheduled or Other Ancient Monuments. Digital (scanned as PDF). Rogie Croft 1. <2> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. <3> SHG23297 Verbal Communication: Tilbury, S. Comment by Sylvina Tilbury, HER Officer. 06/04/2010.
Asset/Event Number	509.3
Asset/Event Name	Building, Upper Rogie
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53454; MHG24412; MHG14113
Status	Non-designated Heritage Asset
Section:	
Easting	244005
Northing	860131

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular building with stone walls and raised interior, two compartments. As described below. Depicted as a roofed structure on the 1st edition OS map within the township of Rogie. For HER asset MHG24412 see Asset 509.1. For HER asset MHG24412 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53454 This is the main building of the settlement, it is aligned E-W and has internal dimensions of 16m x 4m. The internal area is raised above that of the surrounding land and is divided into 2 equally sized compartments by a setting of upright slabs 0.4m in height. The west compartment appears to be the main one, the walls here are generally 0.8-1m height (1-1.5m outside) but the west gable is 1.6m. On the outside this gable is 2m high and has complex buttressing, with a stone plinth 4m x 1.5m x c1.5m height covered by tumble. The east compartment walls are generally 0.5m high (0.8m outside) although the east gable is 1m high (1.3m outside), and here again there appears to have been a form of "buttressing" supporting the gable. Internally there is an obvious drain, 0.4m deep, down the centre of the compartment and an entrance at the west end of the south wall. An outshot to the east, in the form of a level platform, 2.5m x 2.5m, with a stone edge of 0.3m height may be a former building on this site. It is set at a slight angle to the main building and may indicate the line of an earlier building. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 42.
Asset/Event Number	509.4
Asset/Event Name	Building, Upper Rogie
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53454; MHG24412; MHG24412
Status	Non-designated Heritage Asset
Section:	
Easting	243993
Northing	860123
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a rectangular building under dense bracken and grass. As described below. Depicted as a roofed structure on the 1st edition OS map within the township of Rogie. For HER asset MHG24412 see Asset 509.1. For HER asset MHG24412 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53453 A rectangular building, aligned ENE-WSW, with 2 compartments. The east compartment is

better preserved and has internal dimensions of 5.5 x 3m. The dry stone walls are double faced, 0.8m thick and generally 1m in height, although the east gable is 2m high. There is an entrance at the west end of the south wall and a nice pair of cruck slots, opposite one another in the long walls. The west compartment is much more wasted with the walls being 0.3-0.5m height, although at the west end, where it is recessed into the bank, the stone face is 0.8m high.

There are two lengths of wall abutting; the one to the north stretches for 7.5m in a NNW direction and is of stone and turf construction, 0.5m high, the one to the south is of turf, it is 7m long and 1m in height. Both of these walls may be all that remains of an enclosure shown on the 1st edition OS map, the rest of it having been destroyed by the construction of the forest road nearby. <1>

<1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 41.

Asset/Event Number	509.5
Asset/Event Name	Enclosure, Upper Rogie
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53454; MHG24412; MHG24412
Status	Non-designated Heritage Asset
Section:	
Easting	244012
Northing	860109
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure under tall bracken and grass. As described below. Depicted on the 1st edition OS map within the township of Rogie. For HER asset MHG24412 see Asset 509.1. For HER asset MHG24412 see Asset 508.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53452 A rectangular enclosure aligned NNW-SSE is 18m x 13m. It is surrounded by a moss covered wall which is, for the most part, of stone. The general level of the enclosure is raised above that of the surrounding ground which is marshy. The height of the wall is generally 1m on the outside and 0.5m on the inside. A number of trees are growing along the line of the wall. This is most probably a garden. To the south of the enclosure there are two lengths of wall within a plantation of young trees, it is difficult to determine their extent, but they are probably associated with this settlement. Centred on NH 44068 60084 is a winding wall 23m in length and aligned NW-SE. It is 0.3-0.5m in height, and has a 2m spread. Centred on NH 44046 60070 and at right angles to 40B this wall has been grossly disturbed by forest ploughing. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 40.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	509.6
Asset/Event Name	Structure, Upper Rogie
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53455; MHG24412; MHG24412
Status	Non-designated Heritage Asset
Section:	
Easting	244003
Northing	860140
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone-built structure under tall bracken. As described below. Not depicted on historic mapping. For HER asset MHG24412 see Asset 509.1. For HER asset MHG24412 see Asset 508.1. https://her.highland.gov.uk/Monument/MHG53455 Immediately to the north of 42, the turf footings of what may be small building are seen. It has the form of an L shaped turf bank, 0.3-0.5m in height with a spread of 1.5m. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 42A.

Asset/Event Number	510
Asset/Event Name	Forestry cultivation, Upper Rogie
Type of Asset/Event	Cultivation
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243852
Northing	860152
Council	Highland
Condition:	Good
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large area of furrows formed for modern commercial forestry plantation that curves through a clearing between

Appendix 1: Gazetteer of Heritage Assets and Events

the plantations. The furrows are well-defined and under grass.

Asset/Event Number	511.2
Asset/Event Name	Building, Upper Rogie
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53458; MHG24412; MHG14114
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243798
Northing	860133
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ruinous L-shaped building of drystone wall construction. As described below. Depicted as a roofless structure on the 1st edition OS map within the township of Rogie. For HER asset MHG24412 see Asset 508.1. OS. 1881. Ross-shire & Cromartysire (Mainland) LXXV. Survey date: 1875, Published: 1881.

<https://her.hIGHLAND.gov.uk/Monument/MHG53458>

A reversed L-shaped building, on a ENE-WSW alignment, comprising 3 compartments.

- The main, largest compartment, to the west, measures 7.8m x 3.8m internally, with the extension to the NW of an additional 4.4m x 3m. The dry stone walls in the south and west part are 0.2-0.3m high whilst those to the north are 0.6m high externally and that at the north end of the extension is 1.2m. A few features were noted - 1. An entrance in the SE wall possibly 1m in width, although the surviving aperture suggested 1.8m in width. 2. A stone edged drain in the E part of the compartment is 0.3m wide x 2m length x 0.2m deep. A possible further one is seen in the west part,

see plan. 3. A regular moss covered stone plinth to the rear/N of the building. It measured 2m length x 0.6m width x 0.5m height. It may have been buttressing for the wall.

- The central compartment measures 1.8m x 3.8m and has an entrance of 1.2m in width in the south wall. The walls are very variable in height from 0.2-0.7m.

- the east compartment is 4.4m x 3.6m internally and the walls are 0.3-0.5m high. A stone edged drain 0.4m wide x 1.8m length x 0.3m deep occupies a central position. Adjacent to the east a roughly circular depression 1.6m diameter x 0.4m deep may be a stank or a sump. To the SE of the building a terrace runs along the length of the building. It is 2m width in the west part and 1.2m in the east part. It is bounded by large boulders with a drop 0.3-0.5m to a marshy depression which appears to be man-made. The marshy depression is 8m N-S x 16m SW-NE narrowing at the NE end. It has steep banks to the south and east.

At the SE corner of the building a stone lined void, 0.2 x 0.2m x 0.8m depth may be the socket for a timber post. At the NE corner, the wasted turf and stone wall of enclosure 54 abuts. <1>

<1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 61.

<https://her.hIGHLAND.gov.uk/Monument/MHG14114>

This site was visited and described by Forestry Commission staff (date unknown). It is described as comprising an L-shaped ruin, long house and two other ruins. Proposed management included clearance to within 10 metres of the remains and the avoiding the

Appendix 1: Gazetteer of Heritage Assets and Events

use of extraction machinery. <1>

The NE farmstead has 2 buildings, a corn-drying kiln, an enclosure and a small pen (61 – 65).

The SW farmstead has 1 building and 1 enclosure (59 – 60).

The remains of the dry stone walls of both farmsteads are in the main, quite low and between 0.8-1m in thickness, they are moss covered and possibly robbed of their stone. The NE farmstead is on a level shelf which slopes off to the north and west. The SW farmstead is on level ground within the forested area close to a small burn. <2>

See individual monument records for full details. <3>

<1> SHG24686 Text/Record Form: Easter Ross Forest District. Unknown. Record of Scheduled or Other Ancient Monuments. Digital (scanned as PDF). Rogie Croft 2.

<2> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Features 59-65.

<3> SHG23297 Verbal Communication: Tilbury, S. Comment by Sylvina Tilbury, HER Officer.

Asset/Event Number	511.3
Asset/Event Name	Building, Upper Rogie
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53459; MHG24412; MHG14114
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243788
Northing	860127
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ruinous rectangular building, c14.5m by 4.5m over walls which stand up to 1.2m tall. Flanking entrances in the northeast elevation. As described below. Depicted as a roofless structure on the 1st edition OS map within the township of Rogie. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53459 A rectangular building on a NNW-SSE alignment, probably the main dwelling house of the farmstead. It measures 13.8m x 3.4m internally. The remains of stone walls are 0.4-0.5m high in the south part but 1-1.2m at the north end. There are two entrances, both 1m in width, in the east wall. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 62.
Asset/Event Number	511.4
Asset/Event Name	Kiln barn Upper Rogie
Type of Asset/Event	Kiln barn

Appendix 1: Gazetteer of Heritage Assets and Events

Date and/or Period	Post-medieval
Listing No./NRHE Number	NH46SW 3
HER Number	MHG53460
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243776
Northing	860126
Council	Highland
Condition:	Degraded
Alignment:	WNW/ESE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ruinous kiln barn with corn-drying kiln in the NE end. Measures c10m by 4.5m over walls, which stand up to 0.8m tall. Entrance 1.9 m wide in S elevation. As described below. Depicted as a roofless structure on the 1st edition OS map within the township of Rogie. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53460 A rectangular structure on a sloping E-W alignment comprising two parts - the bowl and the barn: - the bowl at the east end is recessed into the slope. It is c 0.5m deep but filled with tumble. A defining edge of the stonework is seen in places and possibly a scarcement, 0.5m in width, around the upper edge. - the barn is 9m x 3.2m internally and recessed at its east end where the face of the kiln is 0.8m high, tumble obscured any flue that might exist. The stone walls at the east end were 1m in height internally but barely discernible externally. At the west end they were 0.6-0.8m high, both internally and externally. An obvious entrance, 0.7 in width, existed at the west end of the south wall and a possible drain was 0.3m deep. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 63. Map
Asset/Event Number	511.5
Asset/Event Name	Enclosure, Upper Rogie
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53461; MHG24412; MHG14114
Status	Non-designated Heritage Asset
Section:	
Easting	243780
Northing	860115
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events

Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure under tall bracken and grass c12m by 10m over walls. As described below. Not depicted on historic mapping. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2. https://her.hIGHLAND.gov.uk/Monument/MHG53461 A rectangular enclosure on a NNW-SSW alignment measures 11m x 6m internally. The remains of crudely built stone walls on three sides are largely tumbled but generally 0.5m high and with a spread of 1.5m. There is no evidence of a wall on the east side but this may have been provided by the west wall of building 62. To the west a possible track ran up the hill along the outside of the enclosure and at the north end the wall of the enclosure 54 curves off in a southerly direction. <1> <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 64.
Asset/Event Number	512
Asset/Event Name	Dyke, Upper Rogie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG14114; MHG24412; MHG14114
Status	Non-designated Heritage Asset
Section:	
Easting	243758
Northing	860098
Council	Highland
Condition:	Degraded
Alignment:	NNE/SSW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a drystone dyke under bracken, measuring c5m in length and stands 0.4m tall. Not depicted on historic mapping. Falls with HER extent for Rogie township MHG14114. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2.
Asset/Event Number	513.1
Asset/Event Name	Structure, Upper Rogie
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53462; MHG24412; MHG14114
Status	Non-designated Heritage Asset
Section:	
Easting	243728

Appendix 1: Gazetteer of Heritage Assets and Events

Northing	860063
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a building under dense bracken. As described below. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2. Depicted as a roofless structure on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. https://her.highland.gov.uk/Monument/MHG53462 A rectangular structure on a NE-SW alignment measures c7.5m x 2.5m internally. The remains of the dry stone walls are generally 0.5-0.6m high and have a spread of 0.8m. There is a considerable amount of tumble in the NE end of the building and an entrance, 0.7 m wide in the SE wall. The building is grass and moss covered and has been planted with trees. <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 59.
Asset/Event Number	513.2
Asset/Event Name	Enclosure, Upper Rogie
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53463; MHG24412; MHG14114
Status	Non-designated Heritage Asset
Section:	
Easting	243734
Northing	860057
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone enclosure under tall bracken As described below. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXV. Survey date: 1875, Published: 1881. hthttps://her.highland.gov.uk/Monument/MHG53463 A D-shaped enclosure which abuts the wall of the main enclosure described (but not mapped) under the township record MHG24412. The enclosure is on a WSW-ENE alignment and measure 13m x 12m internally. The remains of the dry stone walls which are 0.3-0.7m high and have a 1-1.5m spread are more substantial in the north and east parts. <1> SHG24685 Text/Report/Fieldwork Report: Marshall, M.. 2010. The Report of a Project to Identify, Survey and Record Archaeological Remains at Rogie, Ross-shire: February 2008 - May 2009. North of Scotland Archaeological Society. Digital. Feature 60.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	513.3
Asset/Event Name	Dyke, Upper Rogie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53463; MHG14114
Status	Non-designated Heritage Asset
Section:	
Easting	243742
Northing	860070
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a drystone dyke extending off the enclosure Asset 513.3. Under bracken and grass. Stands c0.3-0.5m tall and spread up to 1.5m wide, measures c30m long. As described below. Not depicted on historic mapping. For HER asset MHG24412 see Asset 508.1. For HER asset MHG14114 see Asset 511.2.
Asset/Event Number	515
Asset/Event Name	Mound, Bridgepark
Type of Asset/Event	Mound
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247113
Northing	850959
Council	Highland
Condition:	Very degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub-oval shaped mound 5m by 4m and c1m tall, under dense bracken. Function uncertain. Not depicted on historic mapping.
Asset/Event Number	516
Asset/Event Name	Dyke, Bridgepark

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247248
Northing	851076
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under bracken and grass, stands up to 1.2m tall and measures 1m wide, extending beyond survey corridor to NW and SE. Consistent with a boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	517
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247050
Northing	851191
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous drystone dyke stands 0.6m tall and spread up to 1m wide, measures c200m long. Full extent difficult to trace through vegetation, likely continue to join dyke Asset 516 as depicted on the historic mapping. Consistent with a boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	518
Asset/Event Name	Track, Bridgepark
Type of Asset/Event	Track
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	246980
Northing	851119
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible track, superseded by a later forestry road. Measures c2m wide and c300m long. Not depicted on historic mapping.

Asset/Event Number	519
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	246456
Northing	851578
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under grass and bracken, stands up to 1m tall and spread 1.2m wide and recorded extent of c850m. Consistent with a boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	520.1
Asset/Event Name	Enclosure, Bridgepark
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	246896
Northing	851222
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An irregularly-shaped enclosure measuring c180m by 160m, composed of a double-faced drystone dyke under bracken. Stands 0.6m tall and spread 1m wide, partially revetted on the N side. Forms the enclosure that building Asset 520.2 is situated alongside. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	520.2
Asset/Event Name	Building, Bridgepark
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	246905
Northing	851307
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone footings for a rectangular building under dense bracken. Measures c25m long and 5m wide over walls which stand c0.5m tall and c1m wide. Possibly three internal partitions and a possible corn-drying kiln stands at the NW end but the density of vegetation across the structure obscured visibility. Entrances not discernible. Depicted as a roofed building on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	520.3
Asset/Event Name	Enclosure, Bridgepark
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	246907
Northing	851300
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke forming an L-shaped enclosure 21m by 12m off the SW side of building Asset 520.2. Dyke is 1m tall and spread 1.5m wide, under turf and bracken. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	522.1
Asset/Event Name	Enclosure, Bridgepark
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62290
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	247195
Northing	851163
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A double faced drystone dyke partially under bracken and grass, stands up to 1m tall and 0.9m wide. Diminishes as it proceeds through poor ground to SE. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	522.2
Asset/Event Name	Building, Bridgepark
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62290
Status	Non-designated Heritage Asset
Section:	
Easting	247230
Northing	851154
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. The stone footings for a rectangular building under dense bracken and moss. Extends c16m by 4.5m over the walls, which stand to 0.4m tall. No entrances or internal partitions could be identified. Consistent with a roofless building or pen depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	522.2
Asset/Event Name	Structure, Bridgepark
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62290
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247237
Northing	851145
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke under bracken measuring 1m tall and 0.5m wide forming a rectangular structure 22m by 15m, with a single partition defining two compartments. Possibly pens. There are roofless structures depicted here on the 1st edition OS map and these may correlate. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	522.3
Asset/Event Name	Enclosure, Bridgepark
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62290
Status	Non-designated Heritage Asset
Section:	
Easting	247242
Northing	851148
Council	Highland
Condition:	Very degraded

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure measuring c14m by 9m, composed of a low-lying drystone dyke or boulder dyke below dense bracken and grass that stands c0.4m tall and spread 1m wide. Consistent with a small enclosure depicted on the 1st edition OS map, which appears to show a small structure present within but this could not be discerned during the survey. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	522.3
Asset/Event Name	Structure, Bridgepark
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62290
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247247
Northing	851142
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Degraded stone and turf footings under grass and bracken, for a structure, likely a small pen or enclosure. Measures 8m by 7m and banks spread 1m wide and 0.25m tall. There are roofless structures depicted here on the 1st edition OS map and these may correlate. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	523
Asset/Event Name	Dyke, Bridgepark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG62290
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247268
Northing	851137
Council	Highland
Condition:	Degraded
Alignment:	Various

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A double-faced drystone dyke, stands up to 1m tall and measures 0.6m wide, c120m long but may continue to the NW. Coping stones set vertically across top. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	524
Asset/Event Name	Enclosure, Bridgepark
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	247284
Northing	851075
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke forming an enclosure under bracken, stands 0.7m tall and spread up to 1.5m wide. Almost but not quite connected to the dyke Asset 516 to the NW, so possible entrances where these dykes do not meet. Not depicted on historic mapping.
Asset/Event Number	525
Asset/Event Name	Pond, Allt na Talchainn
Type of Asset/Event	Pond
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG54822
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241487
Northing	855384
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Artificial and augmented pond, c50m long by 30m wide, with stone augmenting the north extent and east extent. This is not depicted on historic mapping. The stone is suggested to form a dam, as described

Appendix 1: Gazetteer of Heritage Assets and Events

below.

<https://her.highland.gov.uk/Monument/MHG54822>

Garrimatic Dam - NH 41471 55382 - Encloses a small body of water at the NW side of a large marshy area. The retaining wall or embankment, which is 2 to 3m thick and 0.9m in height, forms a 2 sided "dog-leg" - that side on the north edge of the pond being 30m long and that on the west side 15m long. The outlet is part way along the N side and there is no evidence of a sluice. There was no evidence of a building which could have been a mill on the course of the stream, although any evidence may have been destroyed during the construction of the road. <1>

<1> SHG24094 Text/Report/Fieldwork Report: Marshall, M.. 2009. A Project to Identify, Survey and Record Archaeological Remains in Strathconon, Ross-shire: Report of Phase One Scatwell and Lower Strathconon. North of Scotland Archaeological Society. 23/01/2009. Digital. P.41 Site 275.

Asset/Event Number	526
Asset/Event Name	Mound, Drumandarach
Type of Asset/Event	Mound
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	241789
Northing	855369
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Flat topped mound in a burn valley just to the N of a steep slope. C6m diameter, surviving up to 1m in height. Bracken covered. No visible stone etc, but surveyed due to flatness of top and unusualness in surrounding landscape. A possible platform?

Asset/Event Number	527.1
Asset/Event Name	Structure, Drumandarach
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45NW 37.00
HER Number	MHG39288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242054
Northing	855255

Appendix 1: Gazetteer of Heritage Assets and Events

Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular structure under bracken, better preserved on the W side where walls stand 1.3m high and 1m wide, elsewhere walls are low and tumbled. Measures c16m by 6m over tumble. A possible internal partition exists but this was difficult to discern with the vegetation. Not depicted on historic mapping. Does not quite fall within the HER extent for MHG39288 but should likely be considered to be part of this township. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881. https://her.highland.gov.uk/Monument/MHG39288 Drumandaroch - 2 buildings named and marked at W end of v large enclosure within the woodland and marked on 1st ed OS. One inside wall, one outside. The enclosure walls are still in place as good quality dry stone walling, but the modern buildings are now at the E end 242416 855269 (ie beside the road). Photos from road - 07/06/2005 - HAW The former township of Drumandaroch, farmstead buildings, enclosures, dykes, associated features and a milestone are located on the south side of the River Conon and was surveyed by NOSAS in 2007 as part of the Scotland's Rural Past Project. The site extends across an area some 400m x 120m along an east facing ridge. The majority of the features included within the site record are contained within a large enclosure (170) that is shown on 1st edition of the OS 6-inch map (Ross-shire 1881, sheet lxxxvii) as is the remains of a farmstead (172 & 173) that is located outside and to the west of the enclosure. The south side of the site is bounded by a small stream and a rising craggy slope. The enclosure is grassy with some bracken and there is much evidence of recent sheep management. Birch woods and heather surround the settlement and a major power line traverses the site. The site comprises the remains of at least five buildings, a possible kiln, and there several clearance cairns which may conceal traces of earlier buildings. <1> <1> SHG24094 Text/Report/Fieldwork Report: Marshall, M.. 2009. A Project to Identify, Survey and Record Archaeological Remains in Strathconon, Ross-shire: Report of Phase One Scatwell and Lower Strathconon. North of Scotland Archaeological Society. 23/01/2009. Digital. Pp.38-40 (survey numbers 170-196 & 235-238).
Asset/Event Number	527.2
Asset/Event Name	Structure, Drumandarach
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH45NW 37.00
HER Number	MHG39288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242081
Northing	855255
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular drystone wall

Appendix 1: Gazetteer of Heritage Assets and Events

building under bracken, measure c16m by 6m over walls which stand 0.5m wide and 0.5-1m tall. Situated internally on SW side of enclosure Asset 527.3 (within which it is enclosed). No discernible entrances. Depicted on the 1st edition OS map, but as likely partially ruinous with only the NE extent shown as roofed. For HER asset description see Asset 527.1.
OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.

Asset/Event Number	527.3
Asset/Event Name	Enclosure, Drumandarach
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG39288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242097
Northing	855255
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub rectangular enclosure c50m by 15m in size, composed of a drystone dyke under tall bracken. The dyke stands up to 1m tall and between 0.5-1m wide, and has been robbed out completely in places. The S portion of this is depicted on the 1st edition OS map, to the S of the building Asset 527.2, but a degraded form likely existed as a dashed line is shown enclosing an area of pasture. Forms part of the Drumandaroch township. For HER asset description see Asset 527.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.

Asset/Event Number	527.4
Asset/Event Name	Dyke, Drumandarach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG39288
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242093
Northing	855232
Council	Highland
Condition:	Degraded
Alignment:	ENE/WSW

Appendix 1: Gazetteer of Heritage Assets and Events

Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a drystone dyke extending around an open area south of the Drumandarach buildings (Assets 527.1 and 527.2) and continuing to the E and N beyond survey corridor extent where it appears to form a large enclosure as depicted on the 1st edition OS map. The dyke stands c1.5m tall in places and spread up to 1.5m wide, the recorded extent measuring c260m. Forms part of the Drumandaroch township. For HER asset description see Asset 527.1. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.
Asset/Event Number	528
Asset/Event Name	Structure, Strathconon
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG57280
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242170
Northing	854956
Council	Highland
Condition:	Ruinous
Alignment:	Curving
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub rectangular drystone structure under bracken and trees, measuring c9m by 5m and open to the SE. Stands to c1m tall at the NW side with walls c0.25-0.5m wide. Considered to be a still bothy (MHG57280). Not depicted on historic mapping. https://her.highland.gov.uk/Monument/MHG57280 Distilling sites and potentially associated structures situated on a shoulder ground characterised by rock outcrops and dense heather ground cover above the enclosed fields at Drumindarroch farm to the NE. There are at least four probable still bothies and two other structures distributed above the N bank of the Allt na Criche (NOSAS Site Survey Nos 199 – 204 and 228). Presumably these features were associated with the production of illegal whisky. 204 Building/Still bothy (Allt na Criche) - NH 42174 54938 This structure was recorded by NOSAS in 2007 as part of the Scotland's Rural Past Project. It is secluded in a small ravine on the NW bank of the Allt na Criche and only 2.8m from it. Birch woods surround. The remains of the rectangular structure, on a NW-SE axis, measure 5.5m x 3.5m internally. The NW and SW walls are 0.5m-1m in height and 0.5m in thickness with little tumble. The NE wall is recessed into the slope and is generally 0.8m in height. Its east end extends to form part of the arc of a circle, c1.75m diameter. The structure is open at its south end and there may be an entrance at the NE corner. Heavy growth of heather. This building is almost certainly a still bothy and the other structures to be found in the surrounding landscape reinforce this interpretation. It may be significant that all these structures are to be found on the NW side of the Allt na Criche which was the former parish boundary and also the march between the two estates of Fairburn and Scatwell, perhaps the Scatwell owners may have turned a "blind eye" to the illicit activities, whereas the Fairburn landowners were less tolerant!! <1> <1> SHG24094 Text/Report/Fieldwork Report: Marshall, M.. 2009. A Project to Identify,

Appendix 1: Gazetteer of Heritage Assets and Events



Survey and Record Archaeological Remains in Strathconon, Ross-shire: Report of Phase One
Scatwell and Lower Strathconon. North of Scotland Archaeological Society. 23/01/2009.
Digital. P37 Site 204.

Asset/Event Number	529
Asset/Event Name	Dyke, Strathconon
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	242710
Northing	854725
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under dense bracken and grass, measures c50m long and stands c0.5m tall and spread up to 0.5m wide. Not depicted on historic mapping.

Asset/Event Number	530
Asset/Event Name	Quarry, Orrin
Type of Asset/Event	Quarry
Date and/or Period	Post-medieval/Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	243496
Northing	854233
Council	Highland
Condition:	Fair
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Quarry c17m in diameter, visibly extending into the N-facing rockface of hill, forming a hollow 2-3m deep and the S side where closest to the slope. Not depicted on historic mapping.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	531
Asset/Event Name	Dyke, Coille Mhor
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	244135
Northing	853889
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under dense bracken and woodland, stands up to 1m tall and spread c2m wide, c140m long, continuing outwith the survey corridor to the NE and SW. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.
Asset/Event Number	533
Asset/Event Name	Dyke, Newton
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	245272
Northing	854288
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke that extends along the S side of the road at the field edge, well-preserved towards the W side of the survey corridor and access track area, standing c1.2m tall and 0.5m wide as a neatly coursed rubble wall with boulder coping set atop it, and declining in preservation towards the E side of the survey corridor and under long grass. Extends beyond the corridor to the E and W. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	534
Asset/Event Name	Dyke, Newton
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	245278
Northing	854042
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke standing 1.2m tall, 0.8m wide at base and tapering to 0.3m wide at top, extends outwith survey corridor to S and E. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.

Asset/Event Number	535
Asset/Event Name	Possible structure, Newton
Type of Asset/Event	Unknown
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	245039
Northing	854011
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular spread of stones under grass and moss measuring 6m by 4m. Possibly a small pen or similar but too degraded to be certain. Not depicted on historic mapping.

Asset/Event Number	536.1
Asset/Event Name	Dyke, Newton

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1 (in access track corridor to section)
Easting	244892
Northing	854116
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke, measures 0.8m wide at base and tapers to c0.4m top, standing to a height of between 1- 1.5m tall but in parts robbed out to less than 0.2m in height. More degraded section (Asset 536.2) extends SE from this. Recorded extent measures c230m, but the dyke continues outwith survey corridor to NE and SW. Consistent with field boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.
Asset/Event Number	536.2
Asset/Event Name	Dyke, Newton
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	244817
Northing	854028
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A short length (c12m) of drystone dyke extending SE from the dyke Asset 536.1. Stands c1m tall and 0.8m wide, more poorly preserved in comparison to 536.1. Robbed away from the SE end. Consistent with field boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.
Asset/Event Number	537

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Track, Newton
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	244794
Northing	854005
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Track under grass measuring c3m wide, diminishes to the NW and continues beyond survey corridor to the SE. c100m long. Not depicted on historic mapping.

Asset/Event Number	538
Asset/Event Name	Bank, Newton
Type of Asset/Event	Bank
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	244764
Northing	854023
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a ditch and bank under grass and trees. Ditch measures c3m wide and the bank measures 3m wide and c1.5-2m tall, c30m long. Possibly related to drainage for the woodland. Not depicted on historic mapping.

Asset/Event Number	539
Asset/Event Name	Dyke, Coille Mhor
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	244519
Northing	853580
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under bracken and grass, very degraded and standing to a height of c0.25m and spread up to 0.5m wide, c325m long but continues outwith survey corridor to the NE and SW. Consistent with field boundary depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881.

Asset/Event Number	540.1
Asset/Event Name	Enclosure, Cnocanarve
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	246419
Northing	851741
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone dyke under bracken and grass, measures c90m long with visible extent recorded and stands 0.4m tall, spread up to 2m wide in parts. Consistent with an enclosure boundary depicted on the 1st edition OS map, but does not survive within the survey corridor beyond the extent recorded. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	540.2
Asset/Event Name	Building, Cnocanarve
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	N/A
Easting	246482
Northing	851738
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An un-roofed rectangular stone building measuring 12m by 5m over walls, which stand to 2.5m tall along the long elevations and 6m tall at the gable ends, all of which survive to full height. Fireplaces present at both gable ends. Entrance is in the SE elevation with a window flanking this either side, and an additional window in the N elevation. Forms the best preserved building of Asset group 540. While a small roofed structure is depicted in the vicinity on the 1st edition OS, this appears more likely to be the larger roofed building depicted on the 2nd edition OS map given its good level of preservation and size. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881. OS. 1907. Ross and Cromarty XCVIII. Survey date: 1902, Published: 1907.

Asset/Event Number	540.3
Asset/Event Name	Structure, Cnocanarve
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246485
Northing	851760
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small square structure measuring 4m by 4m over walls, which stand to 1.5m tall at NE end and are 0.25m wide but are collapsed on the SW side. Potentially an entrance in the SE side. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	540.4
Asset/Event Name	Dyke, Cnocanarve
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	246486
Northing	851765
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A section of drystone wall c5m long and 0.5m tall, forming a small revetment into the NE-facing slope adjacent to structure Asset 540.3. Not depicted on historic mapping.
Asset/Event Number	540.5
Asset/Event Name	Building, Cnocanarve
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246477
Northing	851755
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular building measuring 8.5m by 4m over walls which stand between 0.25 and 1.5m in height, with the SE end standing to 2m tall. Conjoins building Asset 540.6 to the NW, but this portion of the structure appears to be in much poorer condition and likely represents an older building. Entrances not readily discernible but considered to be in the SW elevation based on the presence of the entrance in Asset 540.6 being in this elevation. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	540.6
Asset/Event Name	Building, Cnocanarve
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246470
Northing	851759
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular stone and mortared building measuring c 8.5m by 4.5m over walls, conjoined with building Asset 540.5 on the SE gable end. This building is in better condition than 540.5, with walls measuring up to 1.5m tall and 0.5m wide, with an entrance c1m wide visible in the SW elevation. Possibly built as a later replacement for 540.6. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	540.7
Asset/Event Name	Structure, Cnocanarve
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	246472
Northing	851720
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular structure measuring 9m by 5m over walls, which stand between 0.3 and 1.5m tall and 0.4m wide. The two walls are constructed differently, with the E comprising large boulders at base and neater stacked stone atop and the W a more uniform construction of smaller stone. Entrance was possibly in the SE corner. Consistent with a roofed building depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	540.8
Asset/Event Name	Structure, Cnocanarve
Type of Asset/Event	Structure
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	246470
Northing	851711
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A U-shaped section of drystone walling likely representing the remains of a structure or building attached to the S side of building Asset 540.7, but substantially robbed so that only the three walls (E, S and W) survive, encompassing an area c5m by 4m over walls. Walls stand c0.4m tall and spread up to 2m wide as tumble. Building Asset 540.7 is depicted on the 1st edition OS map but this asset does not appear to be so.

Asset/Event Number	541
Asset/Event Name	Clearance cairn, Cnocanarve
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	E1.1
Easting	246413
Northing	851700
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn partially under grass, measuring 6m in diameter and standing 1m tall.

Asset/Event Number	542
Asset/Event Name	Dyke, Cnocanarve
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	E1.1
Easting	246540
Northing	851627
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke under grass. Very diminished, represented mostly by intermittent boulders that stand less than 0.5m tall and spread 0.5m wide, c75m long. Consistent with a field boundary on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	543
Asset/Event Name	Dyke, Allt na Criche
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	241497
Northing	854584
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone dyke partly under bracken, measure c50m long and stands up to 1.2m tall and 1m wide and bridges a low gap between two hills to the NE and SW. Consistent with an isolated length of a boundary on the 1st edition OS map, to the N of the Allt na Criche burn which forms the parish boundary between Urray to the S and Contin to the N. Asset 543 appears to be a continuation of dyke Asset 544 to the NE, but the visible extents of each have been recorded separately. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.
Asset/Event Number	544
Asset/Event Name	Dyke, Allt na Criche
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	N/A
Easting	241598
Northing	854630
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone wall under bracken and grass, measures c50m long and stands c0.5-1m tall, partly revetted against hill. Consistent with an isolated length of a boundary on the 1st edition OS map, to the N of the Allt na Criche burn which forms the parish boundary between Urray to the S and Contin to the N. Asset 544 appears to be a continuation of dyke Asset 543 to the SW, but the visible extents of each have been recorded separately. OS. 1881. Ross-shire & Cromartyshire (Mainland) XCVIII. Survey date: 1876, Published: 1881.

Asset/Event Number	545
Asset/Event Name	Clearance cairn, Allt na Fainich
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	241695
Northing	854377
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn, c4m in diameter and 1m high, moss covered large stones.

Asset/Event Number	546.1
Asset/Event Name	Footings, Comrie
Type of Asset/Event	Footing
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	MHG57259
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241457

Appendix 1: Gazetteer of Heritage Assets and Events

Northing	855787
Council	Highland
Condition:	Fair
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular concrete or packed gravel footing measuring 26m by 8.5m in the middle of an improved field near to extant farmstead. Although overgrown with grass this is still clearly visible as a feature. Surrounded on SW and NW side by a bank Asset 546.2. Not depicted on historic mapping.
Asset/Event Number	546.2
Asset/Event Name	Bank, Comrie
Type of Asset/Event	Bank
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG57259
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241456
Northing	855797
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A curving stone and turf bank under grass, measuring 1m tall and spread up to 1m wide, around the N side of structure Asset 546.1. Some visible stone particularly at the SE end, with some modern detritus sticking out of this section, suggesting this may be fairly recent. Uncertain function. Not depicted on historic mapping.
Asset/Event Number	546.3
Asset/Event Name	Clearance cairn, Comrie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG57259
Status	Non-designated Heritage Asset
Section:	N/A
Easting	241450
Northing	855759
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Fair
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Irregular spread of clearance material under grass measuring c9m by 7m and 1m tall, and forming a triangular clearance cairn.

Asset/Event Number	547
Asset/Event Name	Flood defence, River Conon
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	240429
Northing	856064
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large flood embankment under grass and gorse on the S side of the River Conon. Stands between 1-2m tall and c1m wide, possibly augmenting a natural terrace above the river. Recorded extent c1.25km, but it extends beyond the survey corridor to the NW and E. Depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXXXVII. Survey date: 1876, Published: 1881

Asset/Event Number	550
Asset/Event Name	Borrow pit, Fannyfield Wood
Type of Asset/Event	Borrow pit
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255237
Northing	866264
Council	Highland
Condition:	Degraded
Alignment:	NE/SW

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A borrow pit measuring 5m by 5m and 1m deep, under moss and forestry. Likely related to the construction of the modern adjacent forestry track.
Asset/Event Number	551
Asset/Event Name	Dyke, Fannyfield Forest
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255252
Northing	866251
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A length of drystone dyke that stands c1m tall and 0.5m wide. Terminates at NE end where the modern forestry track runs, but continues beyond the survey corridor to the SE. Recorded extent c40m long. Consistent with a boundary depicted on the 1st edition OS map. OS. 1880. Ross-shire & Cromartyshire (Mainland) LXXVI. Survey date: 1875-6, Published: 1880
Asset/Event Number	552
Asset/Event Name	Borrow pit, Fannyfield Wood
Type of Asset/Event	Borrow pit
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255203
Northing	866263
Council	Highland
Condition:	Fair
Alignment:	ENE/WSW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A long borrow pit measuring 22m by 4m and 1m deep. Excavated along the existing forestry track and likely as part of the

Appendix 1: Gazetteer of Heritage Assets and Events

track construction or drainage management.

Asset/Event Number	553
Asset/Event Name	Borrow pit, Fannyfield Wood
Type of Asset/Event	Borrow pit
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255144
Northing	866258
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A long borrow pit measuring 65m by 4m and 1m deep. Excavated along the existing forestry track and likely as part of the track construction or drainage management.

Asset/Event Number	556.1
Asset/Event Name	Structure, Eilean Na Cabhaig
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 29.00
HER Number	MHG20792
Status	Non-designated Heritage Asset
Section:	D1.2 (in access track corridor to section)
Easting	256011
Northing	869207
Council	Highland
Condition:	Fair
Alignment:	NNE/SSW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular structure largely surviving as a low turf covered linear mound with some visible stone, c13m by 6m. The long NNW elevation wall incorporates a section of a larger field boundary/enclosure wall (Asset 556.3). No evidence for an entry or internal divisions. An unroofed structure or pen is depicted in the vicinity of this asset on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV. Survey date: 1875, Published: 1881

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	556.2
Asset/Event Name	Dyke, Eilean Na Cabhaig
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 29.00
HER Number	MHG20792
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256029
Northing	869222
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Length of drystone dyke c200m long under moss, grass and trees. Composed of boulders and degraded, stands 0.4m tall and spread up to 2m wide. Consistent with field boundary on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV. Survey date: 1875, Published: 1881

Asset/Event Number	556.3
Asset/Event Name	Dyke, Eilean Na Cabhaig
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 29.00
HER Number	MHG20792
Status	Non-designated Heritage Asset
Section:	D1.2 (in access track corridor to section)
Easting	256011
Northing	869210
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under moss and gorse, standing c0.7 tall and spread up to 2m wide. Composed of fairly large boulders. Partially consistent with field boundaries depicted on the 1st edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV. Survey date: 1875, Published: 1881

Asset/Event Number	556.4
Asset/Event Name	Clearance cairn, Eilean Na Cabhaig

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	NH56NE 29.00
HER Number	MHG20792
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256041
Northing	869209
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under moss measuring 6m by 2m and standing 0.5m tall.

Asset/Event Number	560
Asset/Event Name	Dyke, Cnoc an Fhasgnaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255975
Northing	868734
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small remnants of a drystone revetted dyke c25m long under moss, c0.5m tall, on the SW side of the existing track. May continue further than the extent surveyed but vegetation limited certainty. Consistent with a boundary depicted on the 1st edition OS map, so this may be contemporary. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV. Survey date: 1875, Published: 1881

Asset/Event Number	561
Asset/Event Name	Clearance cairn, Cnoc an Fhasgnaidh
Type of Asset/Event	Other
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255995
Northing	868828
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Spread of field clearance partially under grass, measuring 13m by 7m and up to 0.2m tall. Situated along the fence line of the improved fields. Part of the field clearance has been reworked into foundations for a water trough.
Asset/Event Number	562.1
Asset/Event Name	Enclosure, Cnoc an Fhasgnaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256003
Northing	868799
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A curving portion of stone and turf dyke measuring c40m long, spread between 1-3m wide and standing up to 1m tall. This represented the partial remains of a N/S field boundary depicted on the 2nd edition OS map that has since mostly been removed. OS. 1907. Ross and Cromarty LXIV. Survey date: 1902, Published: 1907
Asset/Event Number	562.2
Asset/Event Name	Pen, Cnoc an Fhasgnaidh
Type of Asset/Event	Pen
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	256022
Northing	868791
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Roughly rectangular drystone pen c13m by 7m, which juts out at SE end of dyke Asset 562.1, to the W. Made up of drystone boulder dyke standing 0.5m tall and 0.25m wide, open to the N. Not depicted on historic mapping.

Asset/Event Number	565
Asset/Event Name	Ditch, Eilean Na Cabhaig
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256037
Northing	869145
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drainage ditch under grass measuring c140m long and 1-2m wide, depth varying from 0.8-1.5m. The NW extent is consistent with field boundaries depicted on the 1st and 2nd edition OS map. OS. 1881. Ross-shire & Cromartyshire (Mainland) LXIV. Survey date: 1875, Published: 1881 OS. 1907. Ross and Cromarty LXIV. Survey date: 1902, Published: 1907

Asset/Event Number	567
Asset/Event Name	Clearance cairn, Eilean na Cabhaig
Type of Asset/Event	Clearance cairn
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	256075
Northing	869134

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small clearance cairn, c0.25m high, 0.5m across. Some visible stone, turf covered.

Asset/Event Number	568
Asset/Event Name	Rock shelter, Hill of the Cave
Type of Asset/Event	Other
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D1.2
Easting	255709
Northing	868110
Council	Highland
Condition:	Good
Alignment:	NW
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rock shelter, a natural cave formation that aligns NE/SW and is situated above two waterfalls and a gorge to the SW, accessible through a dried river bed to the NE. The shelter has a large NE entry point 5 to 7m in width, the shelter is about 4m in interior depth, and a smaller entry is visible at the SW end. It is likely the cave referred to with the placename 'Tòrr na h-Uamhaig' (hill/knoll of the cave) on the 1st edition OS map. Some modern detritus was visible, but further/older remains may be concealed at a sub-surface level. The OS name book describes it as: 'A very small knoll situated between River Glass and Allt nan Caorach where both streams nearly meet a distance of about 1/4 mile from where they form a junction. It has derived its name from a little cave on the South side of it. Name means The Knoll of the little cave.' OS. 1881. Ross-shire & Cromartysire (Mainland) LXIV. Survey date: 1875, Published: 1881 OS Name Book. Ross and Cromarty OS Name Books, 1848-1876. Volume 1. p24. OS1/28/1/24.

Asset/Event Number	569
Asset/Event Name	Bridge, Eas a' Chonaisg
Type of Asset/Event	Bridge
Date and/or Period	Post-medieval/Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	D1.2
Easting	255634
Northing	868332
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Former site of bridge over deep gorge with waterfalls along the River Glass. Possible stone footings for the bridge observed from the NE side of the gorge from the opposite bank, with a drystone dyke (outwith track survey corridor) visible extending beyond to the NW. No structural remains visible on the SW bank side. A bridge pier, possibly natural or augmented rock formation, or constructed in stone and mortar but overgrown and obscured by vegetation, stands in the middle of the crossing point. A large wooden beam currently straddles the gap between the SW side of the watercourse and the pier. The bridge has fully collapsed, but would have measured c20m by 7.5m. No bridges are depicted on historic mapping.

Asset/Event Number	570
Asset/Event Name	Clearance cairn, Eas a' Chonaisg
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	D2.1 (within access
Easting	255566
Northing	868320
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small spread of clearance material within area of mature trees. Irregularly shaped, c0.1-0.25m in height, around 1m across. Largely visible stone but is overgrown with turf and moss.

Asset/Event Number	573
Asset/Event Name	Ditch, Luachair Bhan
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval/modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	C1.2
Easting	255974
Northing	893798
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch c1m wide and 0.5m deep, evidence of some banking to either side, but hard to identify due to felled forestry. Not depicted on historic mapping.

Asset/Event Number	575
Asset/Event Name	Clearance cairn, Coir' an t-Seilich Mor
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	259507
Northing	896949
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An irregular spread of stones under grass and moss, measures 7m by 5m and 0.2m tall.

Asset/Event Number	576
Asset/Event Name	Dyke, Coir' an t-Seilich Mor
Type of Asset/Event	Dyke
Date and/or Period	Modern
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	259532
Northing	896948
Council	Highland
Condition:	Fair

Appendix 1: Gazetteer of Heritage Assets and Events



Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large stone and turf dyke c1-1.5m tall and spread up to 5m wide, under moss and grass. Likely related to forestry operations as appears to be at the edge of a former laydown area/turning circle.

Asset/Event Number	577
Asset/Event Name	Dam, Balblair Wood
Type of Asset/Event	Dam
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Section:	
Easting	258619
Northing	896457
Council	Highland
Condition:	Fair
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Possible ford, dam or weir along an un-named burn that forms a tributary of the Allt a' Choir'-uisge. Visible as a line of stones c0.5m wide running from jutting dry ground on N side across to the S side, c4-5m long. Not depicted on historic mapping.

Asset/Event Number	578.1
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset

Section:	N/A
Easting	258252
Northing	896412
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large spread of field clearance under moss with indeterminate edges, measuring's 20m by 15m and stands up to

Appendix 1: Gazetteer of Heritage Assets and Events

0.3m tall.

<https://her.highland.gov.uk/Monument/MHG12918>

Centred on NH 582 964 is a field system of a type usually associated with hut circle settlement. It is best seen as an open to scattered density of stone clearance mounds interspersed with sporadic linear clearance; occasional lynchets are also in evidence. One or two cultivation plots of approximately 20.0m by 25.0m are discernible. The situation is in rising moorland open to the W.

Visited by OS (J M) 4 November 1976.

(NH 5806 9640) A possible hut circle, 5m in diameter and 0.5m high.
R J Mercer 1980.

There is no hut circle at this map reference or in the vicinity. The feature was not positively identified but there are one or two configurations of stone clearance which could fit the description.

This field-system has largely been destroyed by the creation of a forestry plantation.

Visited by RCAHMS (JRS) October 1989.

--- SHG2510 Text/Report/Fieldwork Report: Mercer, R. J. & Howell, J.M.. 1980.

Archaeological field survey in northern Scotland, 1976-1979. University of Edinburgh.
30/01/1980. Paper and Digital. 44-5, 130, BAL No. 9.

Asset/Event Number	578.2
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257976
Northing	896407
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.3
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset
Section:	
Easting	258018
Northing	896375
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.4
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset
Section:	
Easting	258025
Northing	896357
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.5
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	MHG12918
Status	Non-designated Heritage Asset
Section:	
Easting	258039
Northing	896343
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.6
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset
Section:	
Easting	258042
Northing	896334
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.7
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	
Easting	258057
Northing	896336
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.8
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset
Section:	
Easting	258050
Northing	896348
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.9
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	
Easting	258055
Northing	896370
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	578.10
Asset/Event Name	Clearance cairn, Henman's Burn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	NH59NE 24
HER Number	MHG12918
Status	Non-designated Heritage Asset

Section:	
Easting	258040
Northing	896372
Council	Highland
Condition:	Unknown
Alignment:	Unknown
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn forming part of the wider field system that comprises MHG12918. The clearance cairns are visible on Scotland (Phase 2) LiDAR imagery but could not be confidently identified during the walkover survey due to dense bracken and heather vegetation. For HER asset description see Asset 578.1.

Asset/Event Number	580
Asset/Event Name	Dyke, Invershin Castle
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	C1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	257543
Northing	896240
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Low linear earth mound confirming to modern fenced field boundary. Variable height, but up to 1m tall, and measures 0.5 across. Fully turf, no visible stone. Recorded extent c150m long, but continued outwith survey corridor to the NW and SE. Depicted on the 2nd edition OS map. OS. 1907. Ross and Cromarty XVIII, Surveyed: 1903, Published: 1907.

Asset/Event Number	581.1
Asset/Event Name	Possible earthwork, Invershin
Type of Asset/Event	Earthwork
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257638
Northing	896216
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A mound under grass measuring 80m by 20m and standing c10m tall, forming an irregular-shaped earthwork set on the edge of a hill. Possibly natural, or accumulated bunds related to modern farming. Not depicted on historic mapping.

Asset/Event Number	581.2
Asset/Event Name	Earthwork, Invershin
Type of Asset/Event	Earthwork
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257731
Northing	896198

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible/Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An arcing mound under grass measuring c45m long by 10m wide and c5m tall, situated atop a W facing slope. Possibly natural, or accumulated bunds related to modern farming. Not depicted on historic mapping.

Asset/Event Number	581.3
Asset/Event Name	Borrow pit or hollow, Invershin
Type of Asset/Event	Hollow
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257732
Northing	896211
Council	Highland
Condition:	Very degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hollow under grass, measuring c5m in diameter and 1m deep. Closely situated to similar hollow Asset 581.4. Possibly mechanically excavated.

Asset/Event Number	581.4
Asset/Event Name	Borrow pit or hollow, Invershin
Type of Asset/Event	Hollow
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	N/A
Easting	257734
Northing	896207
Council	Highland
Condition:	Very degraded
Alignment:	N/A
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hollow under grass, measuring c5m in diameter and 1m deep. Closely situated to similar hollow Asset 581.3. Possibly mechanically excavated.
Asset/Event Number	582
Asset/Event Name	Dyke, Salachaidh
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63032
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264657
Northing	897532
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under heather, standing up to 0.5m tall and spread 1.5m wide, c570m long. Not depicted on historic mapping. https://her.highland.gov.uk/Monument/MHG63032 A stretch of dyke was recorded near Loch Bhuidhe by CFA Archaeology in 2006 in advance of the Beaully to Dounreay 275kV overhead transmission line. Field survey identified the remains of a stone and turf bank aligned E-W and measuring approximately 50m in length near the location for Tower 277. The bank was 1-1.2m wide and 0.5m high, and covered in heather. <1> The feature can be clearly seen on vertical aerial photographs extending for a considerable distance eastwards and south-southeastwards and may have been an enclosure or head dyke for a farmstead the remains of which remain to be identified - they may lie under the conifer plantation to the east. The dyke is not shown on any historic OS mapping. <2> <1> SHG24982 Text/Report/Fieldwork Report: CFA Archaeology Ltd. 2008-2010. Beaully-Dounreay 275kV Overhead Transmission Line: Second Circuit Environmental Statement. Chapter 10: Cultural Heritage. CFA Archaeology Ltd. Digital. Site 277.1. <2> SHG27491 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 1999-2001. Get Mapping colour vertical aerial photography 1999-2001 (The Millennium Map). XY
Asset/Event Number	583
Asset/Event Name	Peat cutting, Salachaidh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	C1.1
Easting	264451
Northing	897598
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An arcing area of peat cutting under grass, measuring c30m long and 2-5m wide.

Asset/Event Number	584
Asset/Event Name	Clearance cairn, Salachaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264401
Northing	897587
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Oval shaped spread of clearance material under moss and turf measures 4.8m by 2m and stands 0.2m tall.

Asset/Event Number	585.1
Asset/Event Name	Farmstead, Salachaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264277
Northing	897635
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	ENE/WSW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous farmstead under grass and moss measuring 27m by 4m over walls constructed from rubble that delineate three compartments over raised undulating ground, suggesting possible three terraced buildings. Walls stand 0.6m tall and 0.7m wide and entrances appear to be in the S elevation due to visible depressions in the walls. The W compartment measures 5m by 4m internally, the middle compartment measures 11m by 4m internally, and the E compartment measures 5m by 4m internally. Consistent with a roofed building depicted on the 1st edition OS map associated with the Salachaidh farmstead. The building is shown as unroofed by the time of the 2nd edition OS map. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879 OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907 https://her.highland.gov.uk/Monument/MHG63032 A ruined farmstead at Sallachy near Loch Bhuidhe. The remains of a multi-roomed building orientated approximately east-west and enclosure dykes are visible on vertical aerial photographs taken in 1999-2001. <1> <1> SHG27491 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 1999-2001. Get Mapping colour vertical aerial photography 1999-2001 (The Millennium Map). XY
Asset/Event Number	585.2
Asset/Event Name	Building, Salachaidh
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264271
Northing	897622
Council	Highland
Condition:	Very Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small building under grass and moss measuring 6.5m by 4m over walls, which stand 0.6m wide and 0.4m tall. Two possible compartments but rubble is obscuring. Situated on low terrace of E-facing slope. Possibly the roofed building depicted on the 1st edition OS map associated with the Salachaidh farmstead. This building is shown as unroofed by the time of the 2nd edition OS map. For HER asset description see Asset 585.1. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879 OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907
Asset/Event Number	585.3
Asset/Event Name	Agricultural landscape, Salachaidh

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Field system
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264367
Northing	897614
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Improved grassy field c55m by 22m, associated with the Salachaidh farmstead Asset 585/MHG63030. For HER asset description see Asset 585.1.

Asset/Event Number	585.4
Asset/Event Name	Agricultural landscape, Salachaidh
Type of Asset/Event	Field system
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264293
Northing	897594
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Improved grassy field c140m by 60m, associated with the Salachaidh farmstead Asset 585/MHG63030. For HER asset description see Asset 585.1.

Asset/Event Number	585.5
Asset/Event Name	Storage pit, Salachaidh
Type of Asset/Event	Hollow
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264320
Northing	897602
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small rectangular shaped hollow under grass measuring 4m by 1.8m and 0.2-0.4m deep with a rounded profile, one of four (Assets 585.6-585.8) situated along a raised ridge from the surrounding area. Some stone is felt underfoot along the base. Likely a series of storage pits for vegetables. Not depicted on historic mapping. For HER asset description see Asset 585.1.

Asset/Event Number	585.6
Asset/Event Name	Storage pit, Salachaidh
Type of Asset/Event	Hollow
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264322
Northing	897606
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small rectangular shaped hollow under grass measuring 4m by 1.8m and 0.2-0.4m deep with a rounded profile, one of four (Assets 585.6-585.8) situated along a raised ridge from the surrounding area. Some stone is felt underfoot along the base. Likely a series of storage pits for vegetables. Not depicted on historic mapping. For HER asset description see Asset 585.1.

Asset/Event Number	585.7
Asset/Event Name	Storage pit, Salachaidh
Type of Asset/Event	Hollow
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	C1.1
Easting	264325
Northing	897610
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small rectangular shaped hollow under grass measuring 4m by 1.8m and 0.2-0.4m deep with a rounded profile, one of four (Assets 585.6-585.8) situated along a raised ridge from the surrounding area. Some stone is felt underfoot along the base. Likely a series of storage pits for vegetables. Not depicted on historic mapping. For HER asset description see Asset 585.1.

Asset/Event Number	585.8
Asset/Event Name	Storage pit, Salachaidh
Type of Asset/Event	Hollow
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264327
Northing	897614
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small rectangular shaped hollow under grass measuring 4m by 1.8m and 0.2-0.4m deep with a rounded profile, one of four (Assets 585.6-585.8) situated along a raised ridge from the surrounding area. Some stone is felt underfoot along the base. Likely a series of storage pits for vegetables. Not depicted on historic mapping. For HER asset description see Asset 585.1.

Asset/Event Number	585.9
Asset/Event Name	Agricultural landscape, Salachaidh
Type of Asset/Event	Field system
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	264246
Northing	897600
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Improved grassy field c70m by 22m, associated with the Salachaidh farmstead Asset 585/MHG63030. For HER asset description see Asset 585.1.
Asset/Event Number	585.10
Asset/Event Name	Corn drying kiln, Salachaidh
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264245
Northing	897616
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A corn-drying kiln under grass, measuring c6m in diameter over the walls/banks, constructed against and partially revetted into a SE-facing slope. Stands 0.7m tall with a slightly dished interior, very infilled. The flue is visible extending to the SSW. A roofed rectangular structure in the vicinity is shown on the 1st edition OS map and may be meant to indicate this. This building is shown as unroofed by the time of the 2nd edition OS map. For HER asset description see Asset 585.1. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879 OS. 1907. Sutherland CVIII, Surveyed: 1903, Published: 1907
Asset/Event Number	585.11
Asset/Event Name	Enclosure, Salachaidh
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264276

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	897639
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Remnants of a yard attached to the N side of the farmstead building Asset 585.11. Drystone dyke under moss and grass, measuring 18m by 11m over walls. Depicted on the 1st edition OS map. For HER asset description see Asset 585.1. OS. 1879. Sutherland CVIII, Surveyed: 1874, Published: 1879

Asset/Event Number	585.12
Asset/Event Name	Corn drying kiln, Salachaidh
Type of Asset/Event	Kiln
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264238
Northings	897610
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A probable corn-drying kiln under reeds and grass, visible as a slight mound partially lying over the SE-facing hill slope. Similar situated as kiln Asset 585.13, but more poorly preserved. Mound stands less than 0.5m tall and has no visible flue. Perhaps robbed for the nearby kiln. Not depicted on historic mapping. For HER asset description see Asset 585.1.

Asset/Event Number	585.14
Asset/Event Name	Clearance cairn, Salachaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264237
Northings	897538

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn under grass measuring 0.m in diameter and c0.5m tall. For HER asset description see Asset 585.1.

Asset/Event Number	585.15
Asset/Event Name	Clearance cairn, Salachaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264226
Northing	897554
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn under grass, measuring 4.5m by 3m and stands 1m tall. For HER asset description see Asset 585.1.

Asset/Event Number	585.16
Asset/Event Name	Clearance cairn, Salachaidh
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG63030
Status	Non-designated Heritage Asset
Section:	C1.1
Easting	264217
Northing	897593
Council	Highland
Condition:	Fair
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn under grass, measuring 4m by 3m and stands 0.25m tall. For HER asset description see Asset 585.1.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	600.1
Asset/Event Name	Clearance cairn, Bridge of Horn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279768
Northing	904714
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small mound under bracken and grass measuring c5m in diameter and standing 0.7m tall. No stone visible. https://her.hIGHLAND.gov.uk/monument/MHG10597 At NC 795 045, at the base of a steepening south-facing slope, is a close group of three similar hut circles (A-C), now overgrown with heather. They measure from 13m by 11.5m to 12.5m by 10.5m within tumbled walls spread from 2.5m-3.5m, and up to 0.6m high. The entrance in each case is in the south or south-south-east on the line of the longer axis. There is no definite evidence of cultivation around the huts, but some 200m to the NE are several stone clearance heaps and cleared ground, which are probably contemporary with the huts. Surveyed at 1:10,000. Visited by OS (N K B) 15 May 1981. NGR adjusted based on 2020 vertical aerial photographs. <1> --- SHG1568 Text/Publication/Article: Harden, J. 1990. 'Survey Dunrobin Glen (Golspie parish)', Discovery and Excavation in Scotland 1990, p.28. Discovery and Excavation in Scotland. 28. 28. <1> SHG28725 Image/Photograph(s)/Aerial Photograph/Vertical: Get Mapping. 2020. Getmapping aerial photography 2020. XY
Asset/Event Number	600.2
Asset/Event Name	Clearance cairn, Bridge of Horn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279759
Northing	904710

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible clearance cairn under bracken and moss. Stands 1.2m tall and spread up to 4m in diameter. For HER asset description see Asset 600.1.

Asset/Event Number	600.3
Asset/Event Name	Clearance cairn, Bridge of Horn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279737
Northing	904720
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass, stands 0.9m tall and spread 6m by 4m. For HER asset description see Asset 600.1.

Asset/Event Number	600.4
Asset/Event Name	Clearance cairn, Bridge of Horn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279727
Northing	904710
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Measures 0.6m tall and diameter of 6m. For HER asset description see Asset 600.1.
Asset/Event Number	600.5
Asset/Event Name	Lynchet, Bridge of Horn
Type of Asset/Event	Lynchet
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279771
Northing	904684
Council	Highland
Condition:	Very degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf bank under bracken, partly revetted and spread to c2m wide and up to 0.5m tall, forming a lynchet c8m long. Large stones visible under vegetation. For HER asset description see Asset 600.1.
Asset/Event Number	600.6
Asset/Event Name	Clearance cairn, Bridge of Horn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279710
Northing	904717
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Stands 0.8m tall and spread 6m by 3.5m. For HER asset description see Asset 600.1.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	600.7
Asset/Event Name	Clearance cairn, Bridge of Horn
Type of Asset/Event	Clearance cairn
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	MHG10597
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279709
Northing	904696
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A prehistoric clearance cairn under heather and grass. Stands 0.6m tall and spread 5m by 3.5m. For HER asset description see Asset 600.1.

Asset/Event Number	601
Asset/Event Name	Structure, Allt nan Sgeith
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279564
Northing	904448
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular stone and turf structure measuring 9m by 5m, situated within a large circular hollow next to hut circle settlement (Asset 115 group) to the NE. Banks are spread up to 2m wide with large boulder visible that stand 0.5m tall, and a possible partition is somewhat discernible. May be contemporary with the nearby prehistoric settlement (MHG10597; For HER asset description see Asset 600.1), but its regular form is more in keeping with a post-medieval structure.

Asset/Event Number	602

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Dyke, Allt Cnoc na Gamhna
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279574
Northing	904371
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A series of turf and stone dykes under grass and heather, running intermittently alongside the stream and enclosing small meanders. The dyke stands 0.3m tall and 0.5m wide and 0.3m tall and partly revetted. Uncertain function, possibly related to water course augmentation. Not depicted on historic mapping.
Asset/Event Number	603
Asset/Event Name	Dyke, Allt nan Sgeith
Type of Asset/Event	Dyke
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279458
Northing	904463
Council	Highland
Condition:	Very degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A very degraded dyke, likely stone and turf but now only intermittent stones survive, with some spread up to 2m wide and c40m long, but marked only by occasional stone rather than a true spread. Possibly related to Asset 602 but did not clearly cross the burn to join. Possibly of a later date than the nearby hut circle settlement. Not depicted on historic mapping.
Asset/Event Number	604
Asset/Event Name	Dyke, Allt Cnoc na Gamhna

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	279156
Northing	904028
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke under dense bracken, spread to 0.8m wide and up to 0.5m tall. C40m long. Not depicted on historic mapping. Likely associated with nearby farmstead Asset 139/MHG10398, but falls outwith the HER asset extent. For HER asset description see Asset 139.
Asset/Event Number	605.1
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278524
Northing	903448
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, c150m long with an associated tussocky bank beside it up to c1m wide and c0.2m tall representing the excavation upcast. The peat grip has been excavated into a slight NW-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. The peat grip is contained within the survey corridor. Not depicted on historic mapping.
Asset/Event Number	605.2
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278495
Northing	903383
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, recorded extent measures c210m with an associated tussocky bank beside it up to c1m wide and c0.2-3m tall representing the excavation upcast long but continues outwith survey corridor to the SE. The peat grip has been excavated into a slight NW-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.

Asset/Event Number	605.3
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278475
Northing	903323
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, recorded extent measures c140m long with an associated tussocky bank beside it up to c0.8m wide and c0.2m tall representing the excavation upcast but continues outwith survey corridor to the SE. The peat grip has been excavated into a slight NW-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.

Asset/Event Number	605.4
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278448
Northing	903272
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, the recorded extent measures c85m long with an associated tussocky bank beside it up to c1m wide and c0.2m tall representing the excavation upcast but continues outwith survey corridor to the SE. The peat grip has been excavated into a slight NW-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.

Asset/Event Number	605.5
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278410
Northing	903235
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, recorded extent measures c75m long with an associated tussocky bank beside it up to c1m wide and c0.2m tall representing the excavation upcast, but continues outwith the survey corridor to the SE. The peat grip has been excavated into a slight NW-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.

Asset/Event Number	605.6
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Modern

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278386
Northing	903232
Council	Highland
Condition:	Fair
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A cut earth drain c65m long in the peat measuring 1.3m deep and c1m wide, with a clear bank of relict upcast material respecting the E side measuring c0.8m wide and 0.2m tall, itself visible as a series of turfy tussocks. Extends down to the stream to the N and extent contained within the survey corridor. Not depicted on historic mapping.

Asset/Event Number	605.7
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278298
Northing	903212
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, c100m long with an associated tussocky bank beside it up to c1m wide and c0.2m tall representing the excavation upcast. The peat grip has been excavated into a SE-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. The peat grip is contained within the survey corridor. Not depicted on historic mapping.

Asset/Event Number	605.8
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278254
Northing	903206
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring c0.75m wide and up to 1m deep, recorded extent measuring c190m long with an associated tussocky bank beside it up to c1m wide and c0.2m tall representing the excavation upcast, but continuing outwith survey corridor to the NW. The peat grip has been excavated into a SE-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.

Asset/Event Number	605.9
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278338
Northing	903042
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring up to 1m wide and up to 1m deep, with an associated tussocky bank beside it up to c0.8m wide and c0.2m tall representing the excavation upcast. The peat grip has been excavated into a gentle NE-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. The peat grip continues outwith the survey corridor to the S, c190m long. Not depicted on historic mapping.

Asset/Event Number	605.10
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events

HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278227
Northing	903038
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring up to 1m wide and up to 1m deep with an associated tussocky bank beside it up to c1m wide and c0.1m tall representing the excavation upcast. The peat grip has been excavated into a gentle NE-facing slope allowing drainage into the Allt Cnoc na Gamhna burn. Recorded extent measures c190m long, but the peat grip continues outwith the survey corridor to the S. Not depicted on historic mapping.

Asset/Event Number	605.11
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1 (in access track corridor to section)
Easting	278203
Northing	902976
Council	Highland
Condition:	Degraded
Alignment:	WSW/ENE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring up to 1m wide and up to 1m deep, measuring c80m long with an associated tussocky bank beside it up to c0.7m wide and c0.2m tall representing the excavation upcast. The peat grip has been excavated into a gentle E-facing slope allowing drainage into a larger drain (Asset 605.10) that drains into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.

Asset/Event Number	605.12
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	278174
Northing	903051
Council	Highland
Condition:	Degraded
Alignment:	WSW/ENE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring up to 1m wide and up to 1m deep, measuring c120m long with an associated tussocky bank beside it up to c0.8m wide and c0.2m tall representing the excavation upcast. The peat grip has been excavated into a gentle E-facing slope allowing drainage into a larger drain (Asset 605.10) that drains into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.
Asset/Event Number	605.13
Asset/Event Name	Drainage ditch and upcast bank, Allt Cnoc na Gamhna
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	B1.1
Easting	277955
Northing	902882
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat grip (drainage ditch) measuring up to 1m wide and up to 1m deep, recorded extent measuring c220m long with an associated tussocky bank beside it up to c0.7m wide and c0.1m tall representing the excavation upcast, but continues outwith the survey corridor to the E. The peat grip has been excavated into a gentle E-facing slope allowing drainage into a larger drain (Asset 605.10) that drains into the Allt Cnoc na Gamhna burn. Not depicted on historic mapping.
Asset/Event Number	606
Asset/Event Name	Peat bank, Feithe Ruadh
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	277661
Northing	904551
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A peat bank under grass and heather, very narrow cut c1m wide extending in an L-shape 20m by 20m.

Asset/Event Number	607
Asset/Event Name	Quarry, Halsary
Type of Asset/Event	Quarry
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53515
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318173
Northing	948978
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An old stone quarry under grass, visible as the cut in remnants to the SE face of a small rocky knoll. Some bare stone visible in parts. C25m by 6m. Within larger peat cutting area Asset 608.1. Not depicted on historic mapping.

Asset/Event Number	608.1
Asset/Event Name	Farmstead, Halsary
Type of Asset/Event	Farmstead
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53513
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318096

Appendix 1: Gazetteer of Heritage Assets and Events

Northing	949051
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Part of the Halsary farmstead (MHG53513), the polygon represents the asset extent from the HER, which in turn appears to be drawn from the 1st edition OS map. The farmstead buildings are included within this, surrounded by improved ground. OS. 1877. Caithness XXIII, Surveyed: 1871, Published: 1877. https://her.highland.gov.uk/monument/MHG53513 Desk-based assessment in July 2008 identified "Helvry" Farmstead, depicted on Roy's Military Survey map (1747-55) as a cluster of buildings either side of a watercourse and surrounded by unenclosed fields. The main survey settlement appears to be on the west bank of the watercourse. Thomson's map (1822) depicts the farmstead, named there as 'Halzary'. The Ordnance Survey 1st Edition map (1877) shows 'Halsary' as a group of four roofed structures, including one long building, and two enclosed fields at the north end of an area of unenclosed improved ground. There are also two wells depicted. Field survey recorded one harled roofed farmhouse and three associated outbuildings. One of these is built of wood, one of concrete blocks and the third is a large metal shed. It was not possible to determine the date of the present farmhouse. Two short sections of field bank (amounting to no more than 75m in total length) were recorded at the extreme southern corner of the clearing around the farmstead. The existing field boundaries are all post and wire fences. An area of remnant rig and furrow is present at the southern end of the clearing. <1>Sources/Archives (1)<1> SHG24678 Text/Report/Environmental Statement: CFA Archaeology Ltd. 2009. Halsary Windfarm Environmental Statement: Archaeology and Cultural Heritage. CFA Archaeology Ltd. 11/2009. Digital (scanned as PDF). Site 6.
Asset/Event Number	608.2
Asset/Event Name	Farmstead, Halsary
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53513
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318330
Northing	949114
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Part of the Halsary farmstead (MHG53513), the polygon represents the asset extent from the HER, which in turn appears to be drawn from the 1st edition OS map. Depicted as a small area of improved ground on the 1st edition OS map, at the time of the survey this area was under cleared forestry. For HER description see Asset 608.1. OS. 1877. Caithness XXIII, Surveyed: 1871, Published: 1877.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	608.3
Asset/Event Name	Farmstead, Halsary
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53513
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318174
Northing	948809
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Part of the Halsary farmstead (MHG53513), the polygon represents the asset extent from the HER, which in turn appears to be drawn from the 1st edition OS map. Depicted as a small area of improved ground on the 1st edition OS map, at the time of the survey this appeared as an area of felled forestry. For HER description see Asset 608.1. OS. 1877. Caithness XXIII, Surveyed: 1871, Published: 1877.

Asset/Event Number	608.4
Asset/Event Name	Farmstead, Halsary
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG53513
Status	Non-designated Heritage Asset
Section:	N/A
Easting	318050
Northing	949235
Council	Highland
Condition:	Unknown
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Part of the Halsary farmstead (MHG53513), the polygon represents the asset extent from the HER, which in turn appears to be drawn from the 1st edition OS map. Depicted as an enclosure surrounding improved land, this was not visited during the walkover survey as outwith the survey corridor. For HER description see Asset 608.1. OS. 1877. Caithness XXIII, Surveyed: 1871, Published: 1877.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	609
Asset/Event Name	Ditch, Halsary Burn
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318880
Northing	949576
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch (peat grip) under heather and moss, measuring 1.5m wide and 0.4m deep, the recorded extent measures c210m long but extends outwith the survey corridor to the SE. It is depicted on the 1st edition OS map, leading NW from a boggy area annotated as 'The Flows', draining it into the Halsary Burn to the NW. OS. 1877. Caithness XXIII Surveyed: 1871, Published: 1877.

Asset/Event Number	610
Asset/Event Name	Mound, Black Hillocks
Type of Asset/Event	Mound
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	319265
Northing	950216
Council	Highland
Condition:	Fair
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large mound under grass, measuring c20m long and 11m wide and standing 2m tall. Situated to the immediate W of the Halsary burn. The vegetation does not appear long-established and so the asset is potentially modern, possibly related to the adjacent wind farm construction.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	611
Asset/Event Name	Peat cutting, Achavanich
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318142
Northing	942456
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An L-shaped peat cutting under grass and moss, c27m by 7m with banks 0.3m deep. Dis-used.
Asset/Event Number	612
Asset/Event Name	Track, Achavanich
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318326
Northing	942136
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track under grass, possibly augmented/widened by peat cutting at edges. Measures as much as 6m wide and leads through the large enclosure Asset 612, along the N side of the Burn of Aultachlevan Burn. It extends beyond the survey corridor to the NE and SW, c650m long, linking the Achavanich road to the NE with the A9 to the SW. It is depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXVIII. Surveyed: 1905, Published: 1907.
Asset/Event Number	613

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Enclosure, Achavanich
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318269
Northing	941914
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large irregular-shaped enclosure under grass, measuring c340m by 300m and terminating at the A9 road to the W. It has been constructed around the Burn of Aultachlevan, and is composed of a large turf dyke that stands up to 1.1m tall and spread up to 6m wide, constructed from the upcast material of the ditch that runs externally to this, visible under grass and c1m wide at the base, 2.5m wide at the top, and c0.7-1m deep. A broad track (Asset 612) bisects the enclosure from the NE to the SW, leading from the Achavanich road to the NE to the A9 to the SW. Three possible structures (Assets 6144-616) are situated within the enclosure. It is depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXVIII. Surveyed: 1905, Published: 1907.
Asset/Event Number	614
Asset/Event Name	Mound, Achavanich
Type of Asset/Event	Mound
Date and/or Period	Unknown/Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318193
Northing	942090
Council	Highland
Condition:	Very Degraded
Alignment:	NNW/SSE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub-rectangular mound under grass, measuring c10m by 4m and up to 1m tall, possibly the very degraded remains of a structure or a house platform. Not depicted on historic mapping.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	615
Asset/Event Name	Mound, Achavanich
Type of Asset/Event	Mound
Date and/or Period	Unknown/Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318218
Northing	942041
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An irregularly shaped mound under grass measuring c8m in diameter and standing up to 1m tall and may be the very degraded remains of a structure or a house platform. Not depicted on historic mapping.

Asset/Event Number	616
Asset/Event Name	Building, Achavanich
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318319
Northing	942081
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Very ephemeral possible footings for a rectangular building under grass and moss. Very difficult to see in somewhat tall vegetation but can be felt underfoot. Measures 12m by c. 4.5m over banks, which are 0.3m tall and spread up to 1.2m wide. Very boggy surrounds. Not depicted on historic mapping.

Asset/Event Number	617
Asset/Event Name	Dyke, Achavanich
Type of Asset/Event	Dyke

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318372
Northing	942079
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke running parallel with burn on the W side, under grass. Stands 0.3m tall and spread 1m wide for c16m, but possibly revetted partially into stream bank to serve as a flood guard or augmentation of stream. Not depicted on historic mapping.

Asset/Event Number	618
Asset/Event Name	Ditch, Achavanich
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318319
Northing	941866
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A narrow c0.3m wide earth cut drainage ditch (peat grip) under grass, L-shaped in plan and measures c75m long with the associated upcast forming a degraded turf bank c0.3m tall and spread 1.5m wide under grass. Extends outwith the survey corridor to the W. Not depicted on historic mapping.

Asset/Event Number	619
Asset/Event Name	Ditch, Achavanich
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318420
Northing	941657
Council	Highland
Condition:	Degraded
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A narrow c0.3m wide earth cut drainage ditch (peat grip) under grass, L-shaped in plan, measures c140m long, with the associated upcast forming a degraded turf bank c0.2m tall, spread 1.5m.wide and either side of the cut, under grass. Extends outwith the survey corridor to the W. Not depicted on historic mapping.
Asset/Event Number	620
Asset/Event Name	Peat cutting, Lochend
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318359
Northing	941337
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather measuring 200m by 120m, but continuing outwith the survey corridor to the SW. Peat banks are up to 0.7m deep and dis-used.
Asset/Event Number	621
Asset/Event Name	Peat cutting, Lochend
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318356

Appendix 1: Gazetteer of Heritage Assets and Events



Northing	941188
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather measuring 80m by 18m, continues outwith survey corridor to the SW. Peat banks are up to 0.5m deep and dis-used.

Asset/Event Number	622
Asset/Event Name	Peat cutting, Lochend
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318405
Northing	940962
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large area of peat cutting under heather, measuring 200m by 80m and extending outwith the survey corridor to the W. Peat banks are up to 0.6m deep and dis-used.

Asset/Event Number	623
Asset/Event Name	Track, Lochend
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318530
Northing	940916
Council	Highland
Condition:	Degraded
Alignment:	NNW/SSE

Appendix 1: Gazetteer of Heritage Assets and Events



Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track partially under grass, c1.5-2m wide and c120m long, set at edge of slope but raised slightly from bog below to the W. Appears to lead around to an area of peat cutting (Asset 624) so likely the old peat track, potentially returning to Lochend farm to the W. Not depicted on historic mapping.
Asset/Event Number	624
Asset/Event Name	Peat cutting, Lochend
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318579
Northing	940896
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather measuring 36m by 30m. Peat banks are up to 0.5m deep and dis-used.
Asset/Event Number	625
Asset/Event Name	Possible shieling, Rinsary
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	311285
Northing	923998
Council	Highland
Condition:	Very Degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible circular shieling structure under heather and revetted into the hillside. Formed by a small hollow with a c3.5m diameter internally with turf banks standing c0.6m high around the edge. Not depicted on historic mapping.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	626
Asset/Event Name	Dyke, Rinsary
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	311099
Northing	923659
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone boundary dyke forming an enclosure c300m by 300m, stands up to 1.2 m tall and 0.8m wide at base, narrowing to top. Rough rubble construction and collapse in places. Depicted on the 1st edition OS map. OS. Caithness, Sheet XLII. Survey date: 1871, Publication date: 1877

Asset/Event Number	627
Asset/Event Name	Clearance cairn, Rinsary
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	310973
Northing	923770
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone clearance pile formed of small stones and covered by moss, measures c9.5m in diameter and 0.5m tall. Located at the edge of improved ground, with further cairns visible to the NW of varying sizes and low to the ground.

Asset/Event Number	628.1

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Building, Braehungie
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318403
Northing	937522
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous stone building with 2 rooms and a tag of stone dyke attached to the E end, c13.5m by 4m over walls. Had been converted into an animal pen. Two entrances on S side, one gated. One blocked window in W gable. W gable stands to wall head height c4m tall, but E gable partly collapsed. Elsewhere walls stand to c1.3m tall and 0.6m wide. Depicted as a roofed building on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.
Asset/Event Number	628.2
Asset/Event Name	Dyke, Braehungie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318401
Northing	937508
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A revetment dyke under grass, stands c0.6m tall and extending c10m in the slope of the hill adjacent to the under thick grass is a very degraded revetment dyke forming probable one side of an enclosure next to the building Asset 628.1 to the N. Built from rough rubble, much of which has collapsed. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	629
Asset/Event Name	Dyke, Braehungie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318376
Northing	937457
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone, L-shaped in plan and extending 230m long. Stands 0.6m tall and spread 0.5m wide. Some coping stones visible but collapsed across much of the length. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	630
Asset/Event Name	Dyke, Braehungie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318310
Northing	937478
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A revetment dyke under grass, two lengths visible of c30m length, and standing to 1.2m tall. Constructed from large boulders and rubble creating a distinct break of slope in the field. Extends outwith survey corridor to the S. Consistent with a field boundary depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	631
Asset/Event Name	Building, Braehungie

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318286
Northing	937459
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous stone building measuring c25m by 5m over walls. Constructed of stone though largely rubble remains. 3-4 rooms within building with a possible entrance on the S side. Walls survive to c0.6m tall and were likely c0.6m wide originally but spread up to 2m due to collapse. Evidence of later clearance cairns at both gable ends. Depicted as a roofed building on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.
Asset/Event Number	632.1
Asset/Event Name	Ditch and bank, Braehungie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	318099
Northing	937316
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An earth-cut ditch under grass with an accompanying bank of upcast material on the N side. The ditch measures c1m wide and 0.6m deep, the upcast bank measures c1m wide and 0.3m tall, recorded extent measuring c105m long but extends outwith survey corridor to the SE. One of several that drain down to the nearby Braehungie burn to the NW. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.
Asset/Event Number	632.2

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Ditch and bank, Braehungie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	318075
Northing	937307
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An earth-cut ditch under grass with an accompanying bank of upcast material on the N side. The ditch measures c1m wide and 0.6m deep, the upcast bank measures c1m wide and 0.3m tall, recorded extent measuring c60m long but extends outwith survey corridor to the SE. One of several that drain down to the nearby Braehungie burn to the NW. Not depicted on historic mapping.

Asset/Event Number	632.3
Asset/Event Name	Ditch and bank, Braehungie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	318067
Northing	937277
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An earth-cut ditch under grass with an accompanying bank of upcast material on the N side. The ditch measures c1m wide and 0.6m deep, the upcast bank measures c1m wide and 0.3m tall, recorded extent measuring c100m long but extends outwith survey corridor to the SE. One of several that drain down to the nearby Braehungie burn to the NW. Not depicted on historic mapping.

Asset/Event Number	632.4
Asset/Event Name	Ditch and bank, Braehungie

Appendix 1: Gazetteer of Heritage Assets and Events



Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	318056
Northing	937272
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An earth-cut ditch under grass with an accompanying bank of upcast material on the N side. The ditch measures c1m wide and 0.6m deep, the upcast bank measures c1m wide and 0.3m tall, recorded extent measuring c75m long but extends outwith survey corridor to the SE. One of several that drain down to the nearby Braehungie burn to the NW. Not depicted on historic mapping.

Asset/Event Number	632.5
Asset/Event Name	Ditch and bank, Braehungie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317998
Northing	937232
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An earth-cut ditch under grass with an accompanying bank of upcast material on the N side. The ditch measures c1m wide and 0.6m deep, the upcast bank measures c1m wide and 0.3m tall, measuring c65m long. One of several that drain down to the nearby Braehungie burn to the NW. Not depicted on historic mapping.

Asset/Event Number	633
Asset/Event Name	Dyke, Braehungie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events



Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	318030
Northing	937247
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke under grass, stands 0.8m tall and spread up to 1.5m wide, c65m long, extends outwith survey corridor to the S. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.
Asset/Event Number	634
Asset/Event Name	Hollow, Braehungie
Type of Asset/Event	Hollow
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	318004
Northing	937274
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Rectangular hollow aligned NE-SW. c10m long x 2.5m wide. Hollow c.0.6m deep. Some stone visible at SW end - may be collapsed wall. Appears to be cut into natural terrace above river. Function unknown. Possible robbed out building. Not depicted on historic mapping.
Asset/Event Number	635
Asset/Event Name	Shieling, Braehungie
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.4
Easting	317957
Northing	937241
Council	Highland
Condition:	Very degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible shieling under heather, visible only as a change in vegetation (grass surrounded by heather). Measures c4m in diameter. Situated on a SE-facing slope overlooking the Braehungie burn. Not depicted on historic mapping.

Asset/Event Number	636
Asset/Event Name	Clearance cairn, Braehungie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317992
Northing	937287
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under heather and moss, measuring 5m diameter and up to 1m high. One cracked boulder visible at one side.

Asset/Event Number	637.1
Asset/Event Name	Clearance cairn, Braehungie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317856
Northing	937056

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn of rubble stones under grass, measuring c7m in diameter and standing to 1.3m tall.
Asset/Event Number	637.2
Asset/Event Name	Clearance cairn, Braehungie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317862
Northing	937062
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn of rubble stones under grass, measuring c6m in diameter and standing to 1.1m tall, similar to adjacent clearance cairn Asset 637.1
Asset/Event Number	638
Asset/Event Name	Hollow, Braehungie
Type of Asset/Event	Hollow
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317866
Northing	937049
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small hollow under grass

Appendix 1: Gazetteer of Heritage Assets and Events



measuring c3m in diameter, cut into the hillside next to dyke Asset 639. May be the remains of a small structure or pen or borrow pit. Not depicted on historic mapping.

Asset/Event Number	639
Asset/Event Name	Dyke, Braehungie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317878
Northing	937044
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under grass, stands 0.5m tall and spread up to 1m wide. Extends for c45m but continues outwith survey corridor to the SE. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	640
Asset/Event Name	Quarry, Braehungie
Type of Asset/Event	Quarry
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317854
Northing	937101
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An area of possible stone quarrying formed by a hollow area partly under grass, c14m by 8m, with exposed bedrock visible and several small piles of stone in vicinity. Not depicted on historic mapping.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	641
Asset/Event Name	Ditch, Braehungie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317824
Northing	937226
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch under grass, 1m wide and 0.5m deep, c150m long and leading to the Braehungie Burn to the S. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	642
Asset/Event Name	Dyke, Braehungie
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317554
Northing	936692
Council	Highland
Condition:	Degraded
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A degraded stone and turf dyke under grass, L-shaped in plan, stands 0.4m tall and spread 2m wide. Recorded extent measures c150m long, but continues outwith survey corridor to N and W. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	643
Asset/Event Name	Dyke, Braehungie

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	317967
Northing	937419
Council	Highland
Condition:	Degraded
Alignment:	WNW/ESE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf and stone dyke standing 0.4m tall and spread 2m wide, measures c120m long but continues outwith survey corridor to the NW. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	644
Asset/Event Name	Clearance cairn, Braehungie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318263
Northing	937520
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under vegetation, measuring c5m in diameter and 0.6m tall.

Asset/Event Number	645
Asset/Event Name	Ditch, Braehungie
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318355
Northing	937548
Council	Highland
Condition:	Degraded
Alignment:	WNW/ESE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch under grass, measures c1.5m wide and 0.5m deep with slight turf bank of upcast material on the S side, recorded extent measures c160m long but continues outwith survey corridor to the Braehungie Burn to the W. Depicted on the 2nd edition OS map. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.
Asset/Event Number	646
Asset/Event Name	Clearance cairn, Braehungie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318326
Northing	937586
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn partly under grass, measuring c5m diameter and 0.4m tall. Composed of rubble.
Asset/Event Number	647
Asset/Event Name	Clearance cairn, Braehungie
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318326

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	937614
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn under some vegetation, measuring c3m in diameter.

Asset/Event Number	648
Asset/Event Name	Hut circle, Crofts of Benachielt
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318618
Northings	937613
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather, measuring c6m diameter internally. Banks are turf and spread to 2m wide and 0.5m tall internally, with a possible entrance visible as a depression in the S side.

Asset/Event Number	649
Asset/Event Name	Hut circle, Crofts of Benachielt
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318654
Northings	937642
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Low

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather, measuring c5m diameter internally. Banks are turf and spread to 1.5m wide and 0.5m tall internally, with a possible entrance visible as a depression in the SW side. Situated on a slight platform so W side is 1.3m tall externally.
Asset/Event Number	650.1
Asset/Event Name	Enclosure, Crofts of Benachielt
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318569
Northing	937811
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure formed by a drystone dyke, curving in an L-shape around the associated farmstead (Asset 650 group). Measures c110m in length, 1.2m tall and 0.5m wide, but continues somewhat outwith survey corridor to the W. Some smaller arms extend from it. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.
Asset/Event Number	650.2
Asset/Event Name	Building, Crofts of Benachielt
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318583
Northing	937849
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous stone building with 2 rooms, c20m by 5m over walls. Walls are stone and mortar 0.5m wide and up to 1.7m tall

Appendix 1: Gazetteer of Heritage Assets and Events

with gables standing taller at c4m. 3 entrances and 2 windows on SW side. One window on NE side. Possible cruck slot on NE side interior. Walls mostly randomly coursed. Depicted as a roofed building on the 1st and 2nd edition OS maps.

OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.

Asset/Event Number	650.3
Asset/Event Name	Enclosure, Crofts of Benachielt
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318574
Northing	937834
Council	Highland
Condition:	Ruinous
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone structure with 3 rooms, measuring c15m by 5m over walls. Walls are stone and mortar 0.6m wide and up to 1.3m tall. 3 entrances on SW side and one window on NE side. Fireplace in SE gable. Possible cruck slots in walls. Stone buttress on NW gable exterior. NW compartment may be a cart shed. Depicted as a roofed building on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.

Asset/Event Number	650.4
Asset/Event Name	Clearance cairn, Crofts of Benachielt
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318591
Northing	937854
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible

Appendix 1: Gazetteer of Heritage Assets and Events



Description	*Recorded by AOC Archaeology during 2024 walkover survey. Clearance cairn measuring c2m in diameter and 0.5m tall, to N of building Asset 650.2.
Asset/Event Number	650.5
Asset/Event Name	Dyke, Crofts of Benachielt
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318578
Northing	937844
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Revetments dyke between buildings standing to 1.2m tall and 0.5m wide, c15m long. Built with large rubble and covered mostly by grass. Depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.
Asset/Event Number	651
Asset/Event Name	Dyke, Crofts of Benachielt
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318693
Northing	937868
Council	Highland
Condition:	Ruinous
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone head dyke under heather, grass and bracken, spread to 1m wide and up to 0.7m tall, c210m. Asset 656 forms the continuation of this to the N. Depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	652
Asset/Event Name	Wall, Crofts of Benachielt
Type of Asset/Event	Wall
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318649
Northing	937757
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone wall under vegetation, measuring c5.5m long and standing 0.5m tall and 0.5m wide. Survives as an isolated length only, not depicted on historic mapping.

Asset/Event Number	653
Asset/Event Name	Hut circle, Crofts of Benachielt
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318722
Northing	937832
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An arc of turf bank under dense heather and bracken that may be the remains of a hut circle, c5m diameter internally. Banks stand to 0.4m tall and spread up to 1.5m wide. Situated on a flat terrace midway up the slope.

Asset/Event Number	654

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Dyke, Crofts of Benachielt
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318672
Northing	937890
Council	Highland
Condition:	Very degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke possibly for a small pen or enclosure, c11m length surviving and measures c0.5m tall and spread 0.8m wide. Not depicted on historic mapping.
Asset/Event Number	655
Asset/Event Name	Building, Crofts of Benachielt
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318720
Northing	937947
Council	Highland
Condition:	Ruinous
Alignment:	WNW/ESE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small stone building c6m by 5m under dense bracken is built into the slope. Comprises a single room with a window in the WNW gable and an entrance on the SSW side. Walls and gables stand to roof height with side walls around 1.4m tall and 0.6m wide. Depicted as unroofed building on the 1st edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.
Asset/Event Number	656
Asset/Event Name	Enclosure, Crofts of Benachielt
Type of Asset/Event	Enclosure

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318663
Northing	937953
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure c150m by 80m formed by a drystone dyke, c0.5-0.8m tall and c0.4m wide. Appears to be part of a continuation of the dyke Asset 651. Encloses farmstead Asset 661 group to the W. Under dense vegetation in some areas. Depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.
Asset/Event Number	657
Asset/Event Name	Enclosure, Crofts of Benachielt
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318756
Northing	937971
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. An enclosure under grass and heather, built on the high terrace of the hill. Walls are loose rubble built c0.7m wide and 0.4m tall. Measures c65m by 20m. Depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.
Asset/Event Number	658.1
Asset/Event Name	Dyke, Crofts of Benachielt
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval

Appendix 1: Gazetteer of Heritage Assets and Events

Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318704
Northing	938081
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Lengths of degraded drystone dyke that appear to be the robbed out remains of the enclosure wall that once stood in close proximity to the building Asset 658.2. Where better preserved the dyke stands up to 1m tall and 0.8m wide. Possibly partially depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877.
Asset/Event Number	658.2
Asset/Event Name	Building, Crofts of Benachielt
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318689
Northing	938097
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous croft building measuring c25m by 5m over walls, which stand to full height of 2m and c4m height at the SE gable, the NW gable less well-preserved. The NW wall is partially revetted into the W-facing slope. Contains two walled partitions internally that survive to full height and delineated three compartments. Three windows and two entrances into the building in the S elevation, with entrances c1.8m tall and 1.1m wide, windows 0.5m tall and 0.3m wide. Building walls constructed of coarsely shaped rubble with longer, flatter flagstone lintels above windows and doorways. One small outbuilding attached to the external E gable elevation. Fireplace present in E wall of W room, and in the central room there are fireplaces on both interior walls. Doorways lead through each room, and there is a small entrance to the outbuilding to lean-to on eastern end. The building is depicted as roofed on the 1st edition OS map, with two smaller roofed buildings to the SW, one of which includes Asset 658.3. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXXIII. Surveyed: 1905, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	658.3
Asset/Event Name	Building, Crofts of Benachielt
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318672
Northing	938093
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small stone building measuring c6m by 5m over walls, with entrance on E side. Walls are composed of randomly coursed stone 0.6m wide and up to 1.7m tall with the gable standing higher. Interior overgrown with nettles. It may have originally been open ended on E side and door added later. Consistent with one of two small roofed buildings depicted on the 1st edition OS map to the SW of the main farmstead building Asset 658.2, but not depicted at all on the 2nd edition OS map. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXXIII. Surveyed: 1905, Published: 1907.

Asset/Event Number	658.4
Asset/Event Name	Structure, Crofts of Benachielt
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318668
Northing	938096
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small open ended drystone structure measuring c5m by 4m over walls that stand 1.3m tall and 0.7m wide, attached the back of building Asset 658.3 with similar construction. Depicted as a roofed building on the 1st edition OS map but not depicted at all on the 2nd edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published: 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published: 1907.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	658.5
Asset/Event Name	Dyke, Crofts of Benachielt
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318704
Northing	938096
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Drystone revetment wall measuring 7m long and c2m wide and up to 1m tall, composed of randomly coursed stone, with some collapse and possible field clearance associated with the farmstead visible. Extends form the NW side of the building and is depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXXIII. Surveyed: 1905, Published: 1907.
Asset/Event Number	658.6
Asset/Event Name	Dyke, Crofts of Benachielt
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318700
Northing	938219
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A stone and turf dyke under heather, stands 0.7m tall and spread up to 1m wide, survives in a fairly short length of c105m, but is consistent with the head dyke shown on the 1st edition OS map associated with Asset 658.2. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	659
Asset/Event Name	Clearance cairn, Crofts of Benachielt
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318735
Northing	938045
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small clearance cairn under moss and bracken, measuring c5m in diameter and 0.7m high.

Asset/Event Number	660
Asset/Event Name	Structure, Crofts of Benachielt
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318736
Northing	938079
Council	Highland
Condition:	Ruinous
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A rectangular stone structure revetted along its E side into the W-facing hillside c7m long by 6m wide over walls, with a single entrance at the SW corner in the S elevation measuring 0.7m wide. Walls stand to a height of 1.3m and are 0.6m wide. First depicted on the 2nd edition OS map. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXXIII. Surveyed: 1905, Published: 1907.

Asset/Event Number	661.1

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Name	Structure, Crofts of Benachielt
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318622
Northing	937992
Council	Highland
Condition:	Ruinous
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Small open ended stone structure with walls 1m wide and up to 1.2m tall, c5m by 3m over walls and open to the E. Gable end at W survives to roof height, c3.5m tall. Depicted as a roofed building on the 1st edition OS map but not depicted at all on the 2nd edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.

Asset/Event Number	661.2
Asset/Event Name	Building, Crofts of Benachielt
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318633
Northing	937970
Council	Highland
Condition:	Ruinous
Alignment:	NNW/SSE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ruinous stone building with at least 5 rooms, measuring c30m by 5m over walls. Built with randomly coursed rubble with one internal partition of upright slabs. At least 3 entrances on W side but may be other windows and doors that have collapsed on W and E sides. Walls are 0.6m wide and survive to varying heights up to 1.7m high. Internal features include blocked door, blocked fireplace, small alcoves. One low door on the E side may be a sheep creep suggesting later reuse. Depicted as a roofed building on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published 1907.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	661.3
Asset/Event Name	Enclosure, Crofts of Benachielt
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318629
Northing	937970
Council	Highland
Condition:	Degraded
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone built enclosure next to buildings Assets 661.1 and 661.2, composed of double-faced loose rubble walls, partly collapsed. Measures c22m by 12m, with walls measuring 0.6m wide and up to 0.4m tall. Depicted on the 1st edition OS map. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published 1877.

Asset/Event Number	662
Asset/Event Name	Clearance cairn, Crofts of Benachielt
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.3
Easting	318592
Northing	937899
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under grass, measuring c3m by 2m and standing 0.7m tall.

Asset/Event Number	663
Asset/Event Name	Structure, Crofts of Benachielt
Type of Asset/Event	Structure

Appendix 1: Gazetteer of Heritage Assets and Events



Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318716
Northing	938682
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub-circular shaped mound under heather and vegetation, measuring c7m in diameter. There is a possible ditch surrounding the mound, up to 0.6m wide, where the heather does not grow. Possibly a shieling. Not depicted on historic mapping.

Asset/Event Number	664
Asset/Event Name	Shieling, Crofts of Benachielt
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318781
Northing	938681
Council	Highland
Condition:	Very degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Footings of a rectangular shieling measuring 5m by 1.5m internally. The walls are composed of low turf banks spread to 1m wide and 0.5m tall. Situated atop a natural ridge/terrace above boggy area. Not depicted on historic mapping.

Asset/Event Number	665
Asset/Event Name	Shieling, Crofts of Benachielt
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318674
Northing	938781
Council	Highland
Condition:	Very degraded
Alignment:	N/A
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small mound measuring c4m in diameter and standing 0.5m tall, and differentiated more by changes in vegetation appearance to its surrounds than by form of the asset itself. May be a very degraded shieling mound. Not depicted on historic mapping.

Asset/Event Number	666
Asset/Event Name	Mound, Crofts of Benachielt
Type of Asset/Event	Mound
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318759
Northing	938827
Council	Highland
Condition:	Very Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small mound measuring c4m by 3m, standing 0.5m tall, and differentiated more by changes in vegetation appearance to its surrounds than by form of the asset itself. May be a very degraded shieling mound. Not depicted on historic mapping.

Asset/Event Number	667
Asset/Event Name	Ditch and bank, Crofts of Benachielt
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318749

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	939186
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ditch and bank, under varied vegetation. The ditch measures c0.8m wide and between 0.3-0.7m deep, with the associated bank forming a stone and turf dyke 1.5m wide and up to 0.7m tall, situated along the downhill W side from the ditch, possibly to create a drainage structure or to act as the head dyke for the Crofts of Bennachie to the W, or both. Measures c650m long within the survey corridor, but continues outwith the survey corridor to the NW and SE. Depicted as a boundary on the 1st edition OS map. OS. 1877. Caithness XXXIII Surveyed: 1871, Published: 1877.

Asset/Event Number	668
Asset/Event Name	Dyke, Achavanich
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318205
Northings	942708
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf bank under grass and gorse with occasional stone, stands up to 1m tall and spread up to 3m wide, recorded extent measures c220m but extends outwith the survey corridor to the E and W. A ditch, the associated source of the bank material, extends parallel with this on the SE side. It is depicted as a field boundary on the 1st edition OS map. OS. 1877. Caithness XXVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	669
Asset/Event Name	Hollow, Achavanich
Type of Asset/Event	Hollow
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	318267
Northing	942832
Council	Highland
Condition:	Degraded
Alignment:	Curving
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A semi circular hollow cut into the top break of slope, under grass. Measures c6.5m across and 0.5m deep, open to the W. Function unknown

Asset/Event Number	670
Asset/Event Name	Hut circle, Sithean Mor
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318057
Northing	943158
Council	Highland
Condition:	Very Degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A hut circle under heather and grass, measuring c.9m in diameter. Banks are somewhat ephemeral but the NE portion is more easily discerned. Spread up to 1.5m wide and standing 0.6m tall. Entrance not discernible.

Asset/Event Number	671
Asset/Event Name	Shieling, Sithean Mor
Type of Asset/Event	Shieling
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318189
Northing	943152
Council	Highland

Appendix 1: Gazetteer of Heritage Assets and Events



Condition:	Very Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small subrectangular-shaped shieling under grass, measuring 5m by 4m over banks. Constructed in turf, the banks stand to a height of c0.3m and have spread so that only a small internal depression is visible. Not depicted on historic mapping.

Asset/Event Number	672
Asset/Event Name	Quarry, Sithean Mor
Type of Asset/Event	Quarry
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318000
Northing	943404
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A quarry pit measuring c10m by 8m, under heather and grass. Not depicted on historic mapping.

Asset/Event Number	673
Asset/Event Name	Dyke, Sithean Mor
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318099
Northing	943501
Council	Highland
Condition:	Very degraded
Alignment:	NNW/SSE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A short section of stone and

Appendix 1: Gazetteer of Heritage Assets and Events



turf dyke c20m long under grass, represented mostly by boulders following the ridge of a slope. The dyke measures 0.4m tall and spread up to 1m wide. Not depicted on historic mapping.

Asset/Event Number	674
Asset/Event Name	Ditch and dyke, Hill of Rangag
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	318003
Northing	943676
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ditch and bank, under grass. L-shaped in plan, with the N end turning downhill to the W. The ditch measures c1m wide and 0.6m deep and c 60m long. The 1st edition OS map shows that this is part of a much longer linear feature (c 1.7km), that extends broadly parallel with the A9 road to the W, and likely relates to drainage management/water collection from the hills to the E. OS. 1877. Caithness XXVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	675
Asset/Event Name	Clearance cairn, Hill of Rangag
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317987
Northing	943743
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn under heather and grass, measures 2.5m in diameter and stands 0.8m tall.

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Number	676
Asset/Event Name	Hut circle, Hill of Rangag
Type of Asset/Event	Hut circle
Date and/or Period	Prehistoric
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317986
Northing	944735
Council	Highland
Condition:	Degraded
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A possible hut circle under heather and reeds, measuring c15m in diameter over poorly-preserved banks that stands to a height of c0.4m tall and spread c1.5m wide. Some stone is visible in the bank. Entrance is not discernible.

Asset/Event Number	677
Asset/Event Name	Mound, Hill of Rangag
Type of Asset/Event	Mound
Date and/or Period	Unknown
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317886
Northing	944921
Council	Highland
Condition:	Very degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small mound under grass and reeds measuring 6m by 4m and standing 0.5m tall. Some stone is visible. Possibly a clearance cairn or the remnants of a small structure. Not depicted on historic mapping.

Asset/Event Number	678

Appendix 1: Gazetteer of Heritage Assets and Events



Asset/Event Name	Dyke, Burn of Badachraskach
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317999
Northing	945100
Council	Highland
Condition:	Degraded
Alignment:	NNW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Stone and turf dyke partially under grass, marking the W extend of an area of commercial forestry plough furrows. The dyke stands to 1m tall and spread up to 2m wide, c75m long, with an associated ditch running parallel on its E side. Not depicted on historic mapping and may be related to the commercial forestry plantation nearby.

Asset/Event Number	679
Asset/Event Name	Peat cutting, Leavad
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317814
Northing	946275
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Area of peat cutting under heather measuring 70m by 30m. Peat banks are up to 0.7m deep and dis-used.

Asset/Event Number	680
Asset/Event Name	Peat cutting, Leavad
Type of Asset/Event	Peat cutting
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A

Appendix 1: Gazetteer of Heritage Assets and Events



HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317894
Northing	946000
Council	Highland
Condition:	Degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A large area of peat cutting under heather, measuring 200m long within the corridor and extending beyond the 200m wide survey corridor to the E and W. Peat banks are up to 0.5m deep and dis-used.

Asset/Event Number	681
Asset/Event Name	Enclosure, Burn of Tacher
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.2
Easting	317789
Northing	946575
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Turf and stone bank under grass reeds and gorse, spread to 2m wide and 0.8m tall with a ditch on the S and E sides. Forms a large enclosure measuring c140m by 150m, straddling the Burn of Tacher. Depicted on the 1st and 2nd edition OS maps. OS. 1877. Caithness XXVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XXVIII. Surveyed: 1905, Published: 1907.

Asset/Event Number	682
Asset/Event Name	Structure, Burn of Tacher
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.2
Easting	317931
Northing	946541
Council	Highland
Condition:	Very Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A sub-circular structure under grass along a low terrace overlooking the burn to the S, c10m in diameter and defined by a raised bank standing 0.5m tall and spread 2m wide. The interior is under reeds and a hollow, possibly a sheep or deer trail, extends through it N/S. Function unknown. Not depicted on historic mapping.

Asset/Event Number	683.1
Asset/Event Name	Building, Langergill
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG49293
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318521
Northing	955165
Council	Highland
Condition:	Degraded
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Linear rectangular building measuring c30m by 5.5 over walls, with the WNW half comprising a roofed building and the ESE half comprising a ruinous building with no surviving ESE gable end. The roofed portion contains an entrance with flanking windows in the SSW elevation, and two chimneys and fireplaces at each gable end of this. Interior floor is earthen, and the building appears to have been used a livestock pen as of late. Three entrances into the ruinous ESE portion of the building also in the SSW elevation; this building appears to have had a single partition forming two compartments within. The building is depicted as a single linear roofed structure on the 1st and 2nd edition OS maps, forming a small farmstead with the ancillary building (Asset 683.2) to the S and an enclosure (Asset 683.3) to the N. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907. https://her.highland.gov.uk/Monument/MHG49293 No description.

Asset/Event Number	683.2
Asset/Event Name	Building, Langergill

Appendix 1: Gazetteer of Heritage Assets and Events

Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG49293
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318518
Northing	955159
Council	Highland
Condition:	Degraded
Alignment:	E/W
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A roofless rectangular drystone building measuring 10m by 5m over walls and within dense tall grass, forming an ancillary building to Asset 683.1 which stands to the immediate NE. Walls stand between 0.3 and 1.2m tall. Depicted as unroofed on both the 1st and 2nd edition OS maps. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907. https://her.highland.gov.uk/Monument/MHG49293 No description.
Asset/Event Number	683.3
Asset/Event Name	Enclosure, Langergill
Type of Asset/Event	Enclosure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG49293
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318524
Northing	955190
Council	Highland
Condition:	Very degraded
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Ditch and slight turf bank under thick grass, L-shaped and measuring c45m long, standing up to 0.3m tall, forming an enclosure to the N of the building (Asset 683.1). Depicted on the 1st edition OS map, with the 2nd edition appearing to show a pen within but this could not be discerned during the walkover. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907. https://her.highland.gov.uk/Monument/MHG49293 No description.

Appendix 1: Gazetteer of Heritage Assets and Events

Asset/Event Number	684.1
Asset/Event Name	Building, Crofts of Hillpark
Type of Asset/Event	Building
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG19758
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	318020
Northing	955430
Council	Highland
Condition:	Ruinous
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A ruinous rectangular building under dense grass and nettles, measuring c18m by 5m over walls, which stand up to 0.7m wide and at the W gable end up to 1.9m tall, but generally these are lower and collapsed. Walls composed of randomly coursed flagstone. One visible internal partition within (internal access was not sought), and two entrances and three windows present in the S elevation. The building is depicted as a single roofed complex with the structure Asset 684.2 to the N on both the 1st and 2nd edition OS maps, forming a small farmstead. A rectangular area of ground is depicted to the S; the kaleyard as described below. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907. https://her.highland.gov.uk/Monument/MHG19758 Longhouse farm (ND 1802 5544), comprising; A: Longhouse [Asset 684.1]. Tripartite rectangular structure, the central unit original and containing opposing fireplaces. The NW unit also containing opposing fireplaces and the SE unit containing two byre slots are later additions. Orientation NW-SE .B: Longhouse [Asset 684.1]. Bipartite structure built at right angles with and 3m NE of A. Orientation NE-SW.C: Kaleyard. Dimensions: 18 x 9m. Rectangular area lying 5m SW of A.R J Mercer, NMRS MS/828/19, 1995A roofed building is depicted on the first edition of the OS 6-inch map (Caithness 1877, sheet xviii) and is shown as unroofed on the current edition of the OS 1:10,560 map (1971).Information from RCAHMS (FO) 19 March 1996.
Asset/Event Number	684.2
Asset/Event Name	Structure, Crofts of Hillpark
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG19758
Status	Non-designated Heritage Asset
Section:	A1.1

Appendix 1: Gazetteer of Heritage Assets and Events



Easting	318018
Northing	955439
Council	Highland
Condition:	Ruinous
Alignment:	N/S
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A small stone-built structure to the N of the building (Asset 684.1), under dense grass and nettles, measuring 5m by 6m over walls, which stand to 0.7m tall and 0.6m wide, 3.5m by 5m internally. This is depicted as a single roofed complex with Asset 684.1 to the S on both the 1st and 2nd edition OS maps. For HER description see Asset 684.1. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	684.3
Asset/Event Name	Well, Lady's Moss
Type of Asset/Event	Well
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	MHG19758
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317982
Northing	955432
Council	Highland
Condition:	Unknown
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A well is marked on the 1st edition OS map immediately W of the building Asset 684.1; the area is under dense grass and the well could not be identified during the walkover survey. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	685
Asset/Event Name	Dyke, Crofts of Hillpark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317628

Appendix 1: Gazetteer of Heritage Assets and Events



Northing	955521
Council	Highland
Condition:	Fair
Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A flagstone dyke standing up to 1m tall and spread up to 1.5m wide, with preservation varying across the length, although generally it is fair along the E/W aligned segment. C400m of which falls within the survey corridor. The W extent is depicted on the 1st edition OS map, with the 2nd edition OS map depicting the boundary in full as it stands today. Forms part of the enclosure network associated with Crofts of Hillpark, and meets drystone dyke (Asset 689) to the NW. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	686
Asset/Event Name	Ditch and dyke, Crofts of Hillpark
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317484
Northing	955753
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Large drainage ditch under grass measuring c1-2m wide and 0.8m deep runs adjacent to the remnants of a drystone dyke c 0.6m tall and spread up to 1.5m wide, poorly preserved in sections and surmounted by a post-and-wire fence, forming an enclosure at its SE end. C1km long and forms part of the enclosure network associated with Crofts of Hillpark, and continues the NW/SE alignment of one of the branches of the drystone dyke (Asset 689), and is as depicted on the 1st edition OS map. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	687
Asset/Event Name	Clearance cairn, Crofts of Hillpark
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset

Appendix 1: Gazetteer of Heritage Assets and Events



Section:	A1.1
Easting	317730
Northing	955525
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn partially under heather, measures 2m in diameter and stands 0.4m tall.

Asset/Event Number	688
Asset/Event Name	Clearance cairn, Crofts of Hillpark
Type of Asset/Event	Clearance cairn
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317639
Northing	955547
Council	Highland
Condition:	Degraded
Alignment:	N/A
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A clearance cairn partially under grass, measures 1.5m in diameter and stands 0.5m tall.

Asset/Event Number	689
Asset/Event Name	Dyke, Crofts of Hillpark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317312
Northing	955888
Council	Highland
Condition:	Degraded

Appendix 1: Gazetteer of Heritage Assets and Events

Alignment:	Various
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drystone dyke standing between 0.8-1.m tall, 0.8m wide at the base and tapering to 0.3m at the top, the top capped with upright coping stones. Forms part of the enclosure network associated with Crofts of Hillpark and branches off in a Y-shape at the S side of the survey corridor, one branch continuing to the SE where it meets dykes Asset 685 and 686, while the W branch continues outwith the corridor itself to the SW. Recorded length c450m long, but continues outwith survey corridor to SW and N. This latter branch, and the N/S main element, are depicted on the 1st edition OS map as a parish boundary between Halkirk to the N and W, and Watten to the S and E. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	690
Asset/Event Name	Ditch, Crofts of Hillpark
Type of Asset/Event	Ditch
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317351
Northing	955849
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A drainage ditch under grass and heather, measuring 1m wide and 0.5m deep, with an associated upcast bank under grass and heather alongside it, recorded extent measures c110m but continues outwith survey corridor to NE. This meets a dyke (Asset 689) to the SW, and continues out of the survey corridor to the NE. It is first depicted on the 2nd edition OS map. OS. 1907. Caithness-shire XVIII. Surveyed: 1905, Published: 1907.

Asset/Event Number	691
Asset/Event Name	Dyke, Crofts of Hillpark
Type of Asset/Event	Dyke
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317212
Northing	955852

Appendix 1: Gazetteer of Heritage Assets and Events



Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A turf dyke under grass and heather, spread up to 3m wide and standing up to 0.7m tall. Recorded extent c250m long but continues outwith survey corridor to the NE and SW. Possibly a stone element too, but this was not readily visible. The dyke extends across the entirety of the survey corridor, continuing outwith it to the W. Forms part of the enclosure network associated with Crofts of Hillpark, and meets drystone dyke (Asset 689) at the NE side of the survey corridor. Depicted as a field boundary on the 1st edition OS map. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	692
Asset/Event Name	Track, Crofts of Hillpark
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317073
Northing	955936
Council	Highland
Condition:	Degraded
Alignment:	NE/SW
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A relict track under grass, depressed slightly and measuring 2.5m wide, extends beyond the survey corridor to the N and S and leads past the sheepfold (Asset 693) to the NE. Recorded extent measures c220m long. Some stone visible. Appears to follow the course of a field boundary depicted on the 1st edition OS map. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	693
Asset/Event Name	Sheepfold, Crofts of Hillpark
Type of Asset/Event	Sheepfold
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.1
Easting	317119

Appendix 1: Gazetteer of Heritage Assets and Events



Northings	956039
Council	Highland
Condition:	Ruinous
Alignment:	Circular
Importance:	Low
Description	*Recorded by AOC Archaeology during 2024 walkover survey. Circular drystone sheepfold measuring c20m in diameter, with coursed flagstone walls standing c0.7m wide and 0.6m tall; the top courses of stone have slumped into the interior. Entrance on S side. Named as a sheepfold and depicted on the 1st edition OS map. OS. 1877. Caithness XVIII Surveyed: 1871, Published: 1877.

Asset/Event Number	694
Asset/Event Name	Track, Cnoc Reile
Type of Asset/Event	Track
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	A1.4
Easting	316578
Northings	934486
Council	Highland
Condition:	Degraded
Alignment:	NW/SE
Importance:	Negligible
Description	*Recorded by AOC Archaeology during 2024 walkover survey. A track visible as a depression 2-3m wide across the moorland, extending parallel with the modern road and slightly banked at either side. Recorded extent measures c22m long but extends outwith survey corridor to the N and S. Visible as track on 1st and 2nd edition OS maps. OS. 1877. Caithness XXXIII. Surveyed: 1871, Published: 1877. OS. 1907. Caithness XXXIII. Surveyed: 1905, Published: 1907.

Asset/Event Number	695
Asset/Event Name	Structure. Buoltach
Type of Asset/Event	Structure
Date and/or Period	Post-medieval
Listing No./NRHE Number	N/A
HER Number	N/A
Status	Non-designated Heritage Asset
Section:	
Easting	317184
Northings	935234